

# Vehicle History

Search terms:

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3612	ECU	27/02/2026	27/02/2026	1,398,428	0	0		Blue Collar Diesel The diagnostic computer was connected to check overall kilometers / Hours as per the ECU reading, oil pressure was checked using the computer, a cylinder cut out test was carried out on all cylinders. the manometer A water manometer test was conducted on the Cummins EGR engine to check for excessive crankcase pressure and to confirm correct operation of the crankcase ventilation system. The manometer was connected to the crankcase breather port and the correct cummins oricface port was then connected, the engine was started and allowed to reach normal operating temperature. With the engine running at	\$0.00

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
								<p>operating speed, the manometer reading showed approximately 10 inches of travel on each side of , equating to a total differential movement of 20 inches . The reading was stable and consistent during the test period, indicating the crankcase pressure was being measured correctly. The result was recorded and compared against expected values for the Cummins EGR engine. No abnormal fluctuations were observed during the test. The manometer equipment was then disconnected and the breather system returned to its original configuration. The test confirmed the measured crankcase pressure at 20 inches of total manometer</p>	

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
								movement (10 inches per side) during engine operation. as per Cummins wear limit procedure 18 inches of travel on a water manometer test show signs of excessively worn engine we exceed these limits. Sent to Cummins Adelaide by N.J Ashton.	
R-3273	HEADLIGHTS	25/02/2026	25/02/2026			0	2871	Internal Workshop checked by mechanic	\$0.00
R-3272	blinker	25/02/2026	25/02/2026			0	2870	Internal Workshop checked by electrician	\$0.00
R-3271	windscreen washers	25/02/2026	25/02/2026			0	2869	Internal Workshop checked by mechanic	\$0.00
R-3188	HEADLIGHTS	18/02/2026	18/02/2026			0	2810		\$0.00
R-3186	engine brake	17/02/2026	17/02/2026			0	2807		\$0.00
R-3185	seat	17/02/2026	17/02/2026			0	2806		\$0.00
R-3180	fuel tank	16/02/2026	16/02/2026			0	2799		\$0.00
R-3173	lights	11/02/2026	11/02/2026			0	2780		\$0.00
R-3162	Tarp	10/02/2026	10/02/2026			0	2749		\$0.00
R-3161	windscreen wipers	09/02/2026	09/02/2026			0	2742		\$0.00

<b>Number</b>	<b>Type</b>	<b>Date Open</b>	<b>Date Closed</b>	<b>Kilometres Closed</b>	<b>HoursClosed</b>	<b>Fuel Usage Closed</b>	<b>Fault</b>	<b>Repairer / Notes</b>	<b>Cost / Invoice</b>
R-3156	lights	04/02/2026	06/02/2026	439,862		0	2725	Internal Workshop found broken wire, repaired and now working again	\$0.00

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3379	Air Conditioning, Brakes	22/12/2025	22/12/2025	431,108	0	0		Blue Collar Diesel Re-inspected HVAC system, minor leak found at O-rings to air-con compressor, pulled out evaporator system and found excessive dirt build up in box / evaporator, de-gas air-con - minimal gas left in system, remove worn O-rings at A/C compressor, install new O-rings and reinstalled pipes, removed and replaced evaporator behind dash, install new TX valve and connecting pipes, dye and installed new O-rings and applied sealant, applied air-con leak sealant as precaution, vac down HVAC system, re-inspect leaks using vacuum test, re-gas air-con as required, ensure correct air-con cycling and correct	\$4,534.95 1842

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
								temperature, ran system for extended period to ensure gas is not freezing. Removed and replaced both steer axle brake boosters, removed faulty boosters, cut new boosters to correct length, install new slack adjusters and grease and adjust brakes.	
S-1810	C - 100k	22/12/2025	22/12/2025	431,108 64,963	0	0		Blue Collar Diesel Completed "C" service per Blue Collar Diesel extensive service sheet adhering to NHVR compliance and ADR standards.	\$4,534.95 1842

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3378	Air Conditioning	15/11/2025	15/11/2025	422,525	0	0		Blue Collar Diesel Carry out diagnosis and inspection of vehicle HVAC, check for leaks using nitrogen, carried out air-con re-gas as gas was reading low, no evidence of any leaks. Ran vehicle ensure air-con was getting cold and cycling correctly. All tests successful.	\$4,534.95 1842
R-2862	windscreen washers	19/07/2025	19/07/2025			0	1732	Internal Workshop Checked Nozzles full of gunk all cleaned and ok	\$0.00
R-2643	TYRE	02/07/2025	02/07/2025			0	1647		\$0.00
R-2642	Coolant Top Up	02/07/2025	02/07/2025			0	1646		\$0.00
R-2505	Brake Booster	10/06/2025	10/06/2025			0	1499		\$0.00
R-2455	clearance lights	05/06/2025	05/06/2025	409,701	0	0	1491		\$0.00