



Cummins South Pacific Pty. Ltd.

ABN NO. 42006332949

Grafton
18 - 20 Induna Street
South Grafton NSW 2460
Ph: 02 6641 1000
Fax: 02 6641 1099

COPY

WORKSHOP TAX INVOICE

INVOICE NUMBER

9421794

INVOICE DATE

07/07/22

PAGE

1

Invoice To

Account Number 2102579
OOMA ENTERPRISES NSW PTY LTD
"OOMA"
HENRY LAWSON WAY
FORBES
NSW 2871

Customer

OOMA ENTERPRISES NSW PTY LTD
"OOMA"
HENRY LAWSON WAY
FORBES
NSW 2871

Engine Model:	SIGNATURE/ISX/QSX	Eng No:	79966508	Equip Make:	KENWORTH
FleetNo:		Reg No:	CM71QE	Cust Ord NO:	CM71QE
Date in Service:	17/08/17	KLMS:	1078433	HRS:	20099
Repair Date:	24/06/22	Chassis NO:	458704	Currency:	AUD
C.O.No.	6600393	Work ordNo.	2758663	Facility	211

Complaint:

Engine Replacement
Kenworth replacement Parts and labour
Not cover by install assistance

Cause:

Maintenace Parts replacement

Correction:

During Engine Change out , Parts and labour Extras changed
out with Engine replacement .

On removal of engine , modification had be made to turbo
Dump pipe , Welded to turbo flange and slip joints on Block
weld up . Extra time to remove welds from dump pipe to
disassemble for engine removal .
Drained Gearbox oil , unable to remove Clutch Actuator Motor
from Gearbox .
Removed PTO assemble from Transmission .remove clutch
Actuator and removed Clutch assemble .
Remove Clutch Brake assemble , fit Clutch install kit
kit .
Fit new Clutch and Clutch brake assemble.
Refit Clutch actuator .Refit pto with new Gaskets .
Replaced Gearbox oil .

With New engine Fitted , Replaced Dump pipe with new Unit ,
assemble with new Mounting Isolators , fit New Pyro sender
to exhaust . adjust to suit .
Replaced All coolant silicone hose in engine Bay .
Adjusted Powersteering Hoses to suit different fuel lines of
new engine .
Replaced Cab Gauge , light senders in engine for Oil
pressure , due to conrod failure.
Cleaned out air side of radiator , CAC excessive debri
Removed Siezed lower Mounts and bolt from Radiator, replaced
All mounting rubbers on Radiator and refit to chassis
Replaced Air cleaners , replaced Powersterring filter and
fluid .
Check AC gas pressure , no leaks after install . OK
Replaced Braid Vent line .
Refit Drive shaft and check air connection to returned to

Cummins South Pacific Pty. Ltd. WORKSHOP TAX INVOICE



Grafton
18 - 20 Induna Street
South Grafton NSW 2460
Ph: 02 6641 1000
Fax: 02 6641 1099

INVOICE NUMBER 9421794

INVOICE DATE 07/07/22

PAGE 2

Invoice To

Account Number 2102579

Customer OOMA ENTERPRISES NSW PTY LTD

Description	Operation	Unit price	Qty	Extension
service .				

Description	Operation	Unit price	Qty	Extension
Labour	3	147.00	25.25	3711.75
LABOUR TOTAL				3711.75

Material				
1382.20	20LTR SYNGARD E386	574.90	1	574.90
LF637	LUBE FILTER	35.97	1	35.97
1215.04	4LTR ATF TQ DEXRON III	30.92	1	30.92
HF6107	HYDRAULIC FILTER	22.56	1	22.56
12PK2380	BELT V RIBBED DAYCO POLY	47.64	1	47.64
MATERIAL TOTAL				711.99

Subcontract				
53929605	Hoses	107.20	1	107.20
5392959	OEM parts	9014.12	1	9014.12
5394262	AC Repairs	125.00	1	125.00
5394260	Exhaust Clamp	31.16	1	31.16
5393791	radiator Washers	9.25	1	9.25
SUBCONTRACT TOTAL				9286.73

Miscellaneous				
	Environmental Levy	25.00	1	25.00
	Consumables	28.34		28.34
MISC TOTAL				53.34

SUB-TOTAL 13763.81

G.S.T 1376.38
INVOICE TOTAL 15140.19