

	B Service	16.01.2025	MSC Mechanical	Carried out "B" service. Supplied and fitted new engine oil and filter. Supplied and fitted new primary and secondary fuel filters. Cleaned and inspected air filter. Carried out full chassis grease. Checked diff and gearbox oils. Checked all lights. Checked and adjusted brakes. Truck - 1st axle brakes have 9 mm remaining. 2nd axle brakes have 9 mm remaining. 3rd axle brakes have 9 mm remaining. Trailer - 4th axle brakes have 8 mm remaining. 5th axle brakes have 8 mm remaining. Repaired exhaust brake. Supplied and fitted new exhaust brake solenoid. Swapped fittings and tested. Supplied and fitted new tailshaft bolts to rear of gearbox. Supplied fuel tank rubbers for straps. NOTE - Rear B Trailer requires brake reline
	Repairs	14.02.2025	LVP Repairs	Repair various cracks under aluminium bin Grind and fully weld cracks
	Repairs	27.02.2025	Powertarps Pty Ltd	Tarp drawer fitted from to suit bow profile
	Repairs	24.03.2025	MSC Mechanical Repairs	Carried out "B" service. Supplied and fitted new engine oil and filter. Supplied and fitted new primary and secondary fuel filters. Cleaned and inspected air filters. Carried out full chassis grease. Checked diff and gearbox oils. Checked all lights. Checked body bolts. Checked and adjusted brakes. 1st axle brakes have 10 mm remaining. 2nd axle brakes have 9 mm remaining. 3rd axle brakes have 12 mm remaining. Swapped N/S Steer brake hose. Supplied and fitted new engine sump plug.
	Parts	10.04.2025	Multispares	Switch- Electric Window
	A Service	28.04.2025	MSC Mechanical Repairs	Carried out "A" service. Checked engine oil - topped up. Supplied and fitted new primary and secondary fuel filters. Cleaned and inspected air filter. Carried out full chassis grease. Checked diff and gearbox oils. Checked all lights. Checked brakes. 1st axle brakes have 10 mm remaining. 2nd axle brakes have 10 mm remaining. Inspected for noise from compressor. Removed left side guard and air filter. Removed engine breather box. Removed compressor assembly. Removed leaking power steering pump. Supplied and fitted new power steer/fuel pump assembly. Replaced all seals. Supplied and fitted new compressor assembly. Swapped over all fittings and pipes. Replace coolant hoses and discharge pipe at compressor.

				Replaced oil feed line at compressor. Replaced oil pressure switch. Resealed breather box. Replaced air dryer filter. Topped up coolant and engine oil. Replaced power steer oil. Reassembled air filter and guards. Road tested.
	Repairs	30.04.2025	DG Auto Electrics	MACK SUPERLINER KMS.: 1,170,529 - TRAVEL ROSSMORE YARD - CHECK FOR PARKING LIGHTS NOT WORKING ON TRAILERS - TRACE FAULT TO PLUG - REPLACE PLUG - FOUND WORKING OK - CHECK ALL LIGHTS ON TRUCK AND TRAILERS A-TRAILER - FOUND 1x NUMBER PLATE FAULTY - REPLACE 1x NUMBER PLATE LIGHT - TESTED OK B-TRAILER - FOUND 1x NUMBER PLATE LIGHT FAULTY - REPLACE 1x NUMBER PLATE LIGHT - CHECK FOR 1x SIDE MARKER NOT WORKING RHS - TRACE AND REPAIR BROKEN WIRING TO IT - CHECK FOR LHS REVERSE LIGHT INOPERATIVE - TRACE AND REPAIR BROKEN WIRING - RE-TEST ALL LIGHTS
	Tyres	12.05.2025	Sydney Tyre Service	2 x New Power 11R22.5 18PR Tyres
	Repairs	14.05.2025	DG Auto	MACK SUPERLINER PRIME MOVER KMS.: 1,174,364 - TRAVEL TO ROSSMORE YARD AFTER TRUCK CAME BACK FROM WORK - REPLACE 2x FAULTY ROOF LIGHTS - RE-TEST ROOF LIGHTS AFTER INSTALLATION
	Repairs	28.05.2025	LVP Repairs	Repair various cracks on A trailer Bin Plate cracks with 6mm aluminium plate Repair cracks on Chassi subframe Repair various cracks on b trailer Plate cracks with 6mm aluminium plate
	Repairs	30.05.2025	MSC Mechanical Repairs	Carried out "B" service. Supplied and fitted new engine oil and filter. Supplied and fitted new primary and secondary fuel filters. Cleaned and inspected air filter. Cleaned cabin pollen filter. Carried out full chassis grease. Checked diff and gearbox oils. Checked all lights. Checked body bolts. Checked and adjusted brakes. 1st axle brakes have 8 mm remaining. 2nd axle brakes have 7 mm remaining. 3rd axle brakes have 7 mm remaining. A Trailer - 1st axle P/S 9 mm D/S 9 mm. 2nd axle P/S new D/S new B Trailer 1st axle P/S 9 mm D/S 9 mm

				2nd axle P/S 9 mm D/S 9 mm 3rd P/S 10 mm D/S 10 mm 4th P/S 10 mm D/S 10 mm Carried out brake reline on A Trailer. Removed wheels. Supplied and fitted new brake shoes. Supplied and fitted new brake drums. Refitted and tension wheels. Adjusted brakes. Supplied and fitted new P/S front steer slack adjuster.
	Parts	10.07.2025	Nepean Bearing & Transport	110 x Nylon Tubing, Heat Tape & 7/8Hose
	Parts	14.07.2025	Nepean Bearing & Transport	1/4 Tee, 28 x Fittings, 25 x Nylon Tubing
	Parts	16.07.2025	Nepean Bearing & Transport	1x Hose & 2x Turbo Clamps
	B Service	18.07.2025	MSC Mechanical Repairs	Carried out "B" service. Checked and topped up engine oil. Cleaned and inspected air filter. Carried out full chassis grease. Checked diff and gearbox oils. Checked all lights. Checked and adjusted brakes. 1st axle brakes have 10 mm remaining. 2nd axle brakes at 8 mm remaining. 3rd axle brakes have 8 mm remaining. Repaired reverse lights. Supplied and fitted new LED reverse inserts.
	B Service	08.08.2025	MSC Mechanical Repairs	MACK SUPERLINER Carried out "B" service. Supplied and fitted new engine oil and filter. Supplied and fitted new primary and secondary fuel filters. Supplied and fitted new air filters. Cleaned cabin pollen filter. Carried out full chassis grease. Checked diff and gearbox oils. Checked all lights. Checked body bolts. Checked and adjusted brakes. 1st axle brakes have 8 mm remaining. 2nd axle brakes have 7 mm remaining. 3rd axle brakes have 7 mm remaining. A TRAILER - 1st axle brakes have 8 mm remaining. 2nd axle brakes have 8 mm remaining. B TRAILER - 1st axle brakes have 9 mm remaining. 2nd axle brakes have 9 mm remaining. 3rd axle brakes have 8 mm remaining. 4th axle brakes have 8 mm remaining. Serviced both A and B Trailers.
				Carried out "B" service. Supplied and fitted new engine oil and filter. Supplied and fitted new primary and secondary fuel filters. Cleaned and inspected air filter. Carried out full chassis grease. Checked diff and gearbox oils. Checked all lights. Checked body bolts.

	B Service	24.09.2025	MSC Mechanical Repairs	Checked and adjusted brakes. TRUCK - 1st axle brakes - 10 mm 2nd axle brakes - 8 mm 3rd axle brakes - 8 mm TRAILER 1 - 1st axle brakes - 9 mm 2nd axle brakes - 9 mm TRAILER 2 - 1st axle brakes - 8 mm 2nd axle brakes - 8 mm 3rd axle brakes - 8 mm 4th axle brakes - 7 mm Supplied and fitted new engine mounts to rear of engine. Supplied and fitted new exhaust brake solenoid. Supplied and fitted new rebound rubber springs to front of cab. Supplied and fitted new gearbox mount bolts. Carried out trailer service – Front trailer. Carried out trailer service – Rear trailer. SERVICE PARTS - \$ 830.00 + GST EXHAUST BRAKE SOLENOID ASSEMBLY - \$ 2160.00 + GST ENGINE MOUNTS -\$ 1848.00 + GST CAB REBOUND RUBBERS - \$ 342.00 + GST
	Repairs	10.10.2025	MSC Mechanical Repairs	MACK - Found 3rd axle diff housing to be leaking. Removed diff centre, scraped away old gasket. Applied new silicone. Refitted diff centre. Fitted new axle seals. Replaced 2nd axle diff. Found metal in front diff. Supplied and fitted new oil in both diffs. Supplied and fitted new pollen filter.
	Services	11.11.2025	MSC Mechanical Repairs	Carried out "A" service. Checked engine oil. Carried out full chassis grease. Checked all lights. Checked and adjusted brakes. 1st axle brakes have 10 mm remaining. 2nd axle brakes of 9 mm remaining. 3rd axle brakes have 9 mm remaining. Topped up coolant. Checked for air leaks. Found O/S drive airbags leaking. Supplied and fitted 2 x new airbags. Supplied and fitted new fittings.
	Repairs	18.11.2025	MSC Mechanical Repairs	Inspected for coolant around radiator area. Found transmission coolant cooler leaking. Supplied and fitted new cooler assembly and pipes. Filled up with coolant. Road tested.
	Repairs	01.12.2025	BITP Enterprises	Check & Report on Air System. after hrs 6am call out travel to 21 area BHP car park found blown air bag and ride height valve not working had to wait till spares parts opened collected parts returned to truck and carried out

	Repairs	01.12.2025	BITR Enterprises	replacement of ride height valve and LH fount air bag test operations all ok Drained Priamary & Secondary Air tanks & recorded findings. Customer Instructions: Build up Air & Checked Governor Cut Out.Leak testwith Park Brake released & Brake applied. Checked Guage Lights & Alarm Operation
	Tyres	10.12.2025	Sydney Tyre Service	4 x New Power 11R22.5 18PR ND870 Premium Drive, 4x Tyre disposal
	B Service	10.12.2025	MSC Mechanical Repairs	Carried out "B" service. Supplied and fitted new engine oil and filter. Supplied and fitted new primary and secondary fuel filters. Supplied and fitted new air filters. Cleaned cabin pollen filter. Carried out full chassis grease. Checked diff and gearbox oils. Checked all lights. Checked body bolts. Checked and adjusted brakes. 1st axle brakes have 8 mm remaining. 2nd axle brakes have 7 mm remaining. 3rd axle brakes have 7 mm remaining. Trailer brakes - 1st axle brakes have 7mm remaining. 2nd axle brakes have 8 mm remaining. Supplied and fitted D/S trailer brake light. Supplied and fitted air dryer filters.
	Repairs	17.12.2025	Nepean Bearing & Transport	Diff Repair
	Repairs	03.02.2026	Volvo Group Australia	FIT SERVICE STICKER NEXT SERVICE +40,000 6 MONTHD ENGINE OIL TYPE VDS 4.5 TRANNSMISSION TYPE MINERAL
	Repairs	25.02..2026	VCV volvo Group	Differential, rear driving axle, check Customer advises groaning noise coming from rear HAPPENS WHEN ENGINE BRAKEIS ON 30-80KM AS SOON HAS YOU TAKE OFF . Drained both diffs, checked and found something stuck in the first drive diff and the metal in the second drive diff, advised customer about fault found. Customer informed that he will get another workshop to do the job as it will be there rework. Refilled diff with old oil.
	Repairs	09.03.2026	BITR Enterprises	Carry Out Cooling System Repair Picked up new header tank and travelled to truck on Picton road. Removed and replaced header tank Topped up with water. all ok Travelled back to workshop
	Parts	10.03.2026	Multispares	HEADER TANK HOSE, PROPYLENE GLYCOL COOLANT PREMIX RED, HOSE CLAMP 27-51MM
	Repairs	23.03.2026	George's Canvas	STD PAD
	Parts	9.04.2026	A & D Partners	MF105D31R
	Tyres	15.04.2026	Sydney Tyre Service	YOKOHAMA 295/80R22.5 143/145M RY023
				Engine Hours -22070 - REPORT ON LOSING COOLANT NO VISIBLE LEAK take truck with trailer for road test as instructed. Found leakage on heater hose connector to oil cooler hosing. Replaced cracked heater

	Repairs	27.06.2026	Volvo Group Australia PTY LTD	hose connector. Drain/ refill coolant. Washed around engine. Pressure tested cooling system & couldn't find any leaks. Roadtested & found coolant temperature raising when going up hills (under load) & dropping down when going down hills (no load). Checked system for flow & found coolant not circulating correctly. Drained coolant & removed thermostat & checked. Found thermostat not opening until 95 degrees (should start to open around 75 degrees). Replaced thermostat & checked on road all ok. Customer to take vehicle & monitor. Temperature staying around 80 degrees. Checked for leaks after road test all ok. REPORT - IS OVERHEATING UNHILLS WHEN LOADED, DRIVER STATES CANT HEAR THE ENGINE FAN COME ON. REPORT - VEHICLE IS OVERHEATING WHILE GOING UP HILLS LOADED, ONGOING ISSUES DRIVER STATES CANT HEAR THE ENGINE FAN KICK IN.
	Repairs	#####	Volvo Group Australia PTY LTD	17Z072 VO 20550690 HOSE 17Z082 VO 85137462 MACK BOOST CLAMP