



Vehicle History Detail



Fleet #	PM53
Registration	XB73VE
Make	Mack
Model	Titan
VIN / Chassis #	6FMM22E43BVB04186

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
22/04/2026	1,070,957 kms	Mud Flaps R-2721 Replace worn mud flaps			\$128.79
27/03/2026		Registration O-352		1059389276	\$3,931.70
29/01/2026		Registration O-340	TMR		\$3,928.00
10/09/2025		Registration O-314	TMR	1052966719	\$3,833.50
17/07/2025	305,074 kms	INSPECTION R-2364 REPLACED FRT DRIVE AXLE SHOCKS REPLACED TAIL LIGHTS AND REPAIRED WIRING FABRICATED PLATES TO MOUNT HEADLAMP BUCKETS. FITTED HADALMPS AND REPAIRED WIRING. REPLACED HEADLAMP RELAY REPAIRED EXHAUST SYSTEM REPAIRED RHF STEP ASSY REMOVED AND REPAIRED LEAKING FUEL TANK CHECKED ALL DRIVELINE OILS AND COOLANT. CHECKED BELTS AND HOSES REPLACED LH BONNET STRAPS	Internal Workshop		\$1,248.70
16/06/2025	305,201 kms	Suspension R-2253 REMOVED AND DRIVE SHOCKS REMOVED AND REPAIRED FUEL TANKS.REPLACED FUEL TAPS REPAIRED BRAKE LIGHTS AND AIRLEAKS REPLACED TREADLE VALVE REMOVED AND REPLACED ALL DRIVE BRAKES FRT AXLE REPLACED RH SIDE WHEEL BEARINGS AND HUB SEALS	Internal Workshop		\$2,843.22
02/06/2025	296,602 kms	INSPECTION R-2215 REMOVE AND REPAIR SIDE STEP. REFIT STEP ASSY. REMOVED AND REPLACED 4X HEADLAMPS WITH LED REPLACEMENTS AND REPAIRED WIRING TO SUIT. REPAIRED ELECTRICAL AS REQUIRED REPAIRED AIR LEAKS REPAIRED BRAKE LIGHTS REPAIRED TAIL LIGHTS	Internal Workshop		\$2,022.67
22/05/2025	299,256 kms	COI I-259 CARRY OUT COI REPAIRS	KnK Vehicle Inspections & Mod Certificates		\$326.70
15/01/2025		Brakes , Electrical R-2143 REMOVED AND REPLACED FRONT DRIVE AXLE BRAKE SOUES.REPLACED WHEEL BEARINGS AND SEALS REPAIRED TAIL LAMP WIRING REPAIRED HEADLAMP WIRING REPLACED DRIVING LIGHTS REPAIRED BRAKE LIGHTS CALLOUT AT ETHRIDGE CHECK AIR LEAKS	Internal Workshop		\$1,435.68

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
10/01/2025	296,512 kms	A - 15000 S-889 CARRY OUT SERVICE			\$436.91
09/12/2024		Clutch R-2074	Just Diesel Truck and Trailer Repairs		\$3,293.23
01/10/2024	294,803 kms	Brakes R-1833 REPLACED REAR AXLE BRAKE SHOES AND DRUMS.REPLACED HUB SEALS REPLACED BATTERIES X4 REPLACED STEERING SHAFT UNI JOINTS	Internal Workshop		\$1,722.35
30/09/2024	294,432 kms	COI I-169			\$0.00
22/08/2024	294,409 kms	seat R-1521 SUPPLIED BOTTLE JACK REPAIRED SEAT AND TEST OPERATION OK	Internal Workshop		\$812.10
22/08/2024		Gearbox R-1535 REMOVED AND REPLACED BROKEN GEARBOX MOUNT ASSY	Internal Workshop		\$3,026.10
22/08/2024	294,409 kms 225,048 hrs	Electrical R-1522 REPAIRED SPEEDO REPLACED SPEED SENSOR	Internal Workshop		\$295.69
22/08/2024	294,409 kms 225,048 hrs	Electrical R-1521 REPAIRED ALL LIGHTS AND TEST OPERATION OK.	Internal Workshop		\$45.00
08/07/2024		Seat R-1522 SUPPLIED	Internal Workshop		\$0.00
11/06/2024		SUSPENSION R R-1423 REPLACED DRIVE SHOCKS	Internal Workshop		\$0.00
10/06/2024	293,723 kms 1,728 hrs	Air leaks , Exhaust System, Suspension R-1499 CARRIED OUT TEMPORARY REPAIR TO EXHAUST SYSTEM FLEX PIPE AND CLAMPS REPAIRED AIR LEAK AT GEARBOX TETENSIONED FRONT SPRING HANGER PINS AS REQUIRED	Internal Workshop		\$531.16
24/05/2024		Oil leak , Turbo R-1329 Inspected leak and found that the turbo drain pipe has a leak. Will need to replace gaskets and Orings on pipe and on further inspection found that the boost hoses going from Turbo to intercooler hoses need replacement as old hoses are badly cracked and ready to fail. parts to be ordered are: - Top gasket for oil inlet to turbo - Oring ontop of Turbo onto intake housing - Air intake hose right hand side coming off air filter box, its a 90* hose - 2x Red boost lines from turbo to intercooler.	Internal Workshop		\$82.00
22/05/2024		Electrical R-1468 REPLACED BATTERY ISOLATOR AND TEST OK REPAIRED WIRING TO ALTERNATOR AND TEST.REQUIRES NEW ALT. REPAIRED A/C.REPLACED HOSE AND REGAS.TEST OK. INSTALLED FAN PRESSURE CONTROL SWITCH AND TEST OK.	mooreys	4157	\$924.00
20/05/2024		Electrical, SUSPENSION R R-1423 REPLACED CAB SHOCKS AND AIRBAGS FRT AND REAR REPLACED REAR ENGINE MOUNTS REPLACED TURBO DRAIN AND FEED GASKETS ADJUSTED BRAKES AND GREASED AS REQUIRED. REPLACED INTAKE AIR HOSE REPLACED GEARBOX SPEED SENSOR REPLACED WIPER BLADES	Internal Workshop		\$5,987.13

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
15/05/2024	294,526 kms	B - 30000 S-928 CARRY OUT B SERVICE			\$336.91
16/04/2024		air filter R-1428 R&R AIR FILTERS SENT TO ETHERIDE FOR FITTMENT.	Internal Workshop		\$279.51
11/04/2024		Engine R-1345 Diagnose engine missing with laptop at Central Gulf Diesel and done an injector cutout test and found that injectors 2 and 3 are failing. Will need to replace 2 and 3 injectors asap.. New injectors fitted and no more missing. Replaced CAC hose. carried out engine tune-up inc Jake repaired wiring to Jake brake and test operation. removed throttle pedal and cleaned.	Internal Workshop		\$2,819.30
10/04/2024	247,018 kms 207,080 hrs	Electrical R-1321 Replace sensor	Internal Workshop		\$33.00
01/04/2024		Engine R-1348 Changed injector 2 and 3 and done a compression brake adjustment on the truck.	Central Gulf Diesel		\$0.00
01/04/2024		R&R engine R-1130 More than likely requires new engine			\$0.00
11/03/2024	218,709 kms	Breakdown R-1318 Order 5m of hydraulic hose plus 8 hose fittings. Quote has been sent waiting for purchase order number to be able to pick parts	Internal Workshop		\$0.00
01/03/2024	290,000 kms	B - 30000 S-758 B service	Internal Workshop		\$931.87
01/03/2024	289,996 kms	Engine tune up R-1317 Check and adjust valve clearances Adjust jake brake clearance Check injector spring height Fix engine retarder switch wiring	Internal Workshop		\$396.00
06/12/2023	280,000 kms	B - 30000 S-728 Reline both lhs drive axles	Internal Workshop		\$1,206.87
06/09/2023	266,037 kms	B - 30000 S-606 B service	Internal Workshop		\$200.37
04/04/2023	234,231 kms	oil seal, Welding R-1005 1. Remove Jack shaft and remove yoke. Pry out old seal and clean all surfaces and install new seal. Install yoke and Jack shaft. Test drive PASS. 2. Fabricate plates and weld into position across mudguards install stiff bar.	Internal Workshop		\$385.00
14/03/2023	233,984 kms	Brakes , Bushes, Exhaust System, horton fan, Hoses R-1002 1. Reline all drive brakes with new brake shoes. 2. Replace all drive slack adjusters 3. Fabricated brackets to mount oil coolers under truck and run new hoses to coolers. 4. Replace exhaust bends and clamps where needed 5.replace both front cab bushes 6. Install new road speed sensor in gearbox 7. Replace tail lights and install new reverse spot lights. 8. Replace fuel cap 9. Replace step tread 10. Replace air cleaner strap 11. Replace aircon selector panel 12. Replace drivers seat 13. Replace gearbox mount on Lhs 14. Replace rear Cab bushes 15. Replace rear cab sway bar bushes 16. Weld up exhaust mounts and replace bushes	TLC Maintenance and repairs		\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
14/03/2023	233,984 kms	C - 180000 S-442	Internal Workshop		\$1,902.07
13/03/2023	217,484 kms	Bushes, Hoses, rods R-564	Fabbro Diesel Services, RLH Diesel PTY LTD		\$0.00
13/03/2023	238,984 kms	Air leaks , Lights, Seat, tyres, Windscreen R-806 All repairs carried out	Internal Workshop		\$0.00
24/12/2022		Registration O-248 13.12.22: Rcvd renewal from Ro. No COI required as garaging address is in exemption zone. Will book for a COI anyway after christmas to ensure it has one.	TMR	48CE49	\$3,323.55
09/11/2022	224,828 kms	New T-183	Bridgestone Australia LTD	4810231554	\$3,001.52
09/11/2022		New T-181	Bridgestone Australia LTD	4810231753	\$76.00
11/10/2022	227,248 kms	Breakdown R-793 11/10/2022 RO#31816 1997 MACK TITAN PRIME MOVER VIN:6FMM22E43BVB04186 REGO:XQ38VG KMS:227,248 REPAIR JOB CARD R-793 NOT STARTING ISSUE TRAVEL TO PORT AND CHECK BATTERY LEVEL FOUND FAULTY BATTERIES HOOK UP JUMPER LEADS TO BATTERIES AND LETCHARGE START TRUCK AND GET OFF LOADING RAMP AND OUTOF PORT COLLECT REQUIRED BATTERIES TRAVEL BACK TO MACHINE REMOVE AND REPLACE 3 X BATTERIES START TRUCK AND TEST - FOUND NOISYALTERNATOR REMOVE AND REPLACE ALTERNATOR OLD ALTERNATOR IS MISSING SPACER ANDREQUIRED FOR NEW ALTERNATOR SPACED OUT WITH WASHERS TO GET TRUCKRUNNING (SPACER NEEDS TO BE SOURCED AND FITTED) FOUND WATER PUMP BELTS TO BE MISSALLIGNEDBADLY NEEDS TO BE FURTHER CHECKED	BDS Mechanical		\$2,031.63
11/10/2022	227,478 kms	Alternator R-787 checked out alternator no movement in pulley okay	BDS Mechanical, Just Diesel Truck and Trailer Repairs		\$593.90
03/10/2022	214,051 kms 197,856 hrs	Brakes , Engine, mounts, mudflaps, stack R-754 • Engine service • Replace all the rear shock absorbers • Plastic Mud guards at the rear to replace with the flex I guard • Brake booster • Fuel tank cap missing • Repair the stack pipes at the rear of the cab • Repair filler tank neck on radiator • Speed sensor • Rh Bonnet mount and cable broken • Centre cross bar missing between the tanks • fit new mudflaps • repair LH rear tail light wiring • Play in steering Uni's FNQ 4/10/22 rego XQ 38VG Mack repair to exhaust stack posts and battery box 4/10/22 remove floor in Mack tipper Consumables Wire/Gas/Gouging rods 5/10/22 remove floor Mack tipper 5/10/22 rego XQ 38VG Mack fabrication of mud guards 6/10/22 rego XQ 38VG Mack fabrication of mud guards 6/10/22 Mack tipper patch side wall and install rhs supports to chassis 7/10/22 Mack tipper chassis crack repairs and repair broken air air lines 7/10/22 Mack tipper pick up steel from Tully and install new floor 8/10/22 Mack tipper weld new floor and install mud guards Consumables Wire/Gas/Diesel Travel	FNQ Hot Worx, RLH Diesel PTY LTD		\$8,756.44
14/09/2022	221,228 kms 20,073 hrs	Air Lines, Mudguard, Radiator, Wheel R-688 1- Prep surfaces and solder in original filler neck. Fill coolant 2- Replace all wheel studs 3- Replace steer tyres with new 4- Reposition and tighten mudgaurd 5- Replace with new DOT brass fitting	Fabbro Diesel Services		\$570.00
12/09/2022		Registration O-182 registration renewal	TMR	102386631	\$3,324.10
21/08/2022	217,580 kms	Battery R-594 batteries dead jump started with ute needs new isolator	BDS Mechanical		\$104.50

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
11/08/2022		Radiator R-761 MULTI-PUL IMPACT DAMAGE TO CORE. SUPPLY REMANUFACTURED EXCHANGE RADIATOR TO SIT EXCHANGE RADIATOR CONSISTING OF A NEW AUS MANUFACTURED HEAVY DUTY CORE, ASSEMBLED USING ALL NEW KLINGER GASKETS AND HARDWARE, PRESSURE TESTED AND PAINTED. BEING A NOT OVERLY OLD RADIATOR CORE (RECENTLY RECORDED) AND DUE TO THE "MUDDY/DIRTY" DEPOIST'S FOUND INTERNALLY IT'S STRONGLY RECOMENDED THE COOLING SYSTEM/ENGINE BE THOROUGHLY AND POSSIBLY REPEATEDLY FLUSHED BEFORE INSTALATION	Bayswater Road Radiators		\$4,250.00
28/07/2022		New T-74	Bridgestone Australia LTD	16218654	\$52.00
26/07/2022	210,106 kms 19,679 hrs	Alternator, Battery R-505 positive cable loose in cable lug	Fabbro Diesel Services		\$104.50
23/07/2022	208,443 kms	Exhaust System, Fuel Leak, Welding R-477 1. Remove old Fuel hose and get LRF repairs to make new one, install hose and test PASS. 2. Install new muffler on LHS. Modify brackets to suit new muffler for exhaust shroud. 3. Heat up and cut and weld exhaust mounting system to straighten after being bent.	BDS Mechanical		\$731.50
21/07/2022	208,443 kms	B - 30000 S-140 completed as per e jobcard	BDS Mechanical, Internal Workshop		\$0.00
20/07/2022	208,443 kms	B - 30000 S-137 completed as per e jobcard	BDS Mechanical, Internal Workshop		\$485.85
07/07/2022	205,610 kms	Seat R-393 shocky mount in seat base broken out of frame. remove shocky and clean up frame weld piece back in and reinstall shocky weld up broken arm in seat base close up slides in seat base to make tighten on slides adjust all brakes	Internal Workshop		\$154.00
29/06/2022		hydraulic hoses , Parts Only R-423 parts invoice	LRF Repairs Pty Ltd		\$683.42
27/06/2022		Parts Only R-301 Fitter: Robbie Brammer Site: Silkwood Dates: 20/06/2022 - 26/06/2022 Labour - Date: 20/06/2022 Hours: 10.5 Labour - Date: 21/06/2022 Hours: 9.5 Labour - Date: 22/06/2022 Hours: 12.5 Labour - Date: 23/06/2022 Hours: 13.5 Labour - Date: 24/06/2022 Hours: 11.5 Labour - Date: 25/06/2022 Hours: 12.0 Labour - Date: 26/06/2022 Hours: 9	Fabbro Diesel Services		\$2,351.25
24/06/2022		Registration O-94 Paid 3mths rego 22.06.2022 with GCA card	TMR	5A216B	\$3,266.10
20/06/2022	195,505 kms	S-Cam R-178 Re Original job 23757 - 195505km (05/05/2022) Inspected front brakes dragging. Removed back slack adjusters and checked for s-cam movement. Both slack adjuster and s-cams worn out with excessive movement. Removed wheel and hub assembly. Remove old s-cams, slack adjusters and bushes. Cleaned all parts. Sourced new s-cam bushes and slack adjusters. Fit new bushings and s-cams. Refitted brake shoes and hub assembly. Set wheel bearing, preload and filled hubs with oil. S cams are still on order and will be fitted once they have arrived.	Fabbro Diesel Services		\$1,357.77
09/06/2022	201,101 kms	Driveline R-47 Remove and replace uni joint travelled to ravenshoe	BDS Mechanical Townsville		\$879.60

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
03/06/2022		<p>Air leaks , Cab, Gauges, Power Steering, Speed R-233</p> <p>1-Power steering fault: check power steering filter and reservoir for metal, check steering pressure, no pressure, remove pump, found drive splice on accessory drive and pump stripped, track down order pump and drive, fit second hand pump and accessory drive, fill fluid and bleed system, test operation, all ok. 2-RHS Muffler fell Off: RH muffler rusted and broke at weld on inlet, order 5" straight through stack, new stack arrived found 2" shorter than original, had to make plates, change clamp sizing, lengthen stack etc, to match other side. 3-Cab Shock top bushes worn: R&R x 4 rear cab shocks 4-Lower power/ high pyro temp: check wastegate operation ok, manufacture adapters to pressure test CAC system, found CAI cracked and boost hose @ turbo leaking, check outlet o-rings and clamp down to remove excess play 5-centre bearing worn: remove 1st driveshaft and center bearing, found spline for output yoke, send away for repair, converted 10 spline to 18 spline shaft and adopted center bearing 6- air leak when PTO engaged: track down air leak found hole in signal line to pto above gearbox, fit joiner 7- Rear mudguard bracket loose: tighten RH rear lelox truck mudguard bracket 8- Missing Bullbar Bolt; order 2x correct size bolts and weld on eyes and paint. fit to truck 9-No Tacho: adjust speed sensor, all ok 10- Vehicle speed not reading correctly: interview driver found reading 10km/h less than actual speed, call WTG for literature regarding calibrating speedo, carry out calculations and adjust binary switches at the back of speedo, road test and compare to GPS. 6kph difference - send to work 11- diff temp reading high: test drive bobtail but couldnt get hot enough, send to work under loaded conditions with driver using temp gun, found 20C difference with gauge reading higher, advised driver to monitor 12- Side step loose: drill hole through aluminum step and fit bolt 13- No heater: pressure test heater core as was bypassed, held @ 15psi, run new heater hose and fit new taps, secure and route to prevent premature failure, no valve installed to turn heater on/off from controls, informed driver heater has to be turned on via heater taps 14-Driver side low beam not working: clean relay holder and secure with cable ties 15- crossover fuel line leaking, reseal LH front tank fuel tap 16- crossover return line leaking top of gearbox, replace fuel return line 17- air leak, cut and reseal fan solenoid, replace cab ride heigh valve 18-hyd oil low, fill with 80L of 78w oil 19- drivers side shield (cab to bunk) fallen off, repair mount tab and re-install 20- passenger side flare broken off, remove, carry out fiberglass repair, paint, refit</p>	Brown & Hurley, Fabbro Diesel Services		\$944.63
30/05/2022		<p>Engine, Parts Only R-350</p> <p>Replace Engine. Just confirming Gulf Civil own the core as per the attached invoices/remittance and the explanation as laid out below. Invoice and quote attached for reference. C15 Ascet paid in full - \$37000 1) C 15 Ascet - \$33000 engine cost 2) Core charge - \$4000 Incorrect engine supplied initially (C15 Ascet) discuss and arrange engine swap (C15) with a refund to be applied for the difference in cost between C15 Ascet (\$33000) and the C15 (\$28000) C15 Ascet: \$33000 Less C15: \$28000 Refund issued: \$5000 In light of the above I have also instructed Simon at Fabros not to return our original engine due to the core charge been paid.</p>	Rocklea Truck Parts		\$30,800.00
25/05/2022	1,995,521 kms	<p>Engine R-166</p> <p>(25/05/2022) After fitting customer supplied engine upon start up it was found to have a chuffing noise from exhaust. Inspected and found it to be coming from number 6 exhaust port indicating a burnt or damaged valve. Proceed to remove rear rocker cover and check valve and engine brake adjustment. All ok. Remove rocker gear and inspect valve springs. Ok. Advise customer that the cylinder head would need to be removed for further inspection. Removed head and found burnt valve (see photos attached). Cleaned up all parts and checked liner protrusions. All okay. Obtain new cylinder head, camshaft and gasket kit (supplied) and fit to engine. Fill coolant and prime fuel system.Run up, all okay. Finalize ECM calibration and test drive. Found engine to be low on power and have an active fault for the intake temp sensor. Swap sensor with old engine and fault no inactive. Test drive again. No leaks present and engine operation ok. Kenny's Auto Electrical: (27/05/2022) - Work Note Carried out fault finding on check engine light, rough engine performance and no data link. Pinned out data link plug found it to be ok. Hooked up laptop checked codes. Found intake temp sensor low voltage. Tested sensor found it to be U/S needs replacement. Cleared all other codes, dropped truck back of at FDS.</p>	Fabbro Diesel Services		\$5,945.62

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
17/05/2022	195,519 kms 19,542 hrs	Engine R-356 Work requested: * Engine change out Hours: 19542.9 Kilometres: 195519.9 Vehicle was booked into FDS Townsville Workshop to have a worn engine replaced with a second hand unit purchased by the customer. Secured vehicle in w/shop and began to drain all fluids. Disconnected and removed bonnet and radiator. As per discussion with customer radiator was stripped and delivered to Bayswater radiators for a clean and prs test. Disconnected engine from gearbox and chassis and removed. Obtained replacement second hand engine supplied and swapped over necessary parts. Installed second hand engine and connected to gearbox and chassis reusing clutch and rear engine mounts. Installed new front engine mounts. Obtained o/hauled radiator and reassembled cooling package. Installed into chassis and connected to engine using all new hoses and clamps. Filled new engine oil and replaced all filters. Installed new belts and repaired some damaged wiring. Replaced fan belt tensioner bearings. Replaced all CAC hoses with new. Refilled coolant. Primed fuel system and started and ran engine. Upon start up it was found that the engine had a chuffing noise coming from the exhaust. Upon closer inspection it was found to be coming from #6 exhaust port. Proceeded to check valve and engine brake adjustment. all ok. Removed #6 rocker gear to check valve springs, all ok. Indicating a possible burnt valve on #6. Advised customer of findings so customer could chase warranty from the engine supplier. Included in job was the replacement of the front brakes. Jack front axle and removed wheels and hubs. Removed drums and brakes. Inspected S cams and found excessive wear and unserviceable. Installed new S cams, slack adjusters, bushes, drums and shoes. Reassembled wheels and hubs on a set bearing preload. Adjusted brakes. Job complete. Note: This job has been closed off here and a new job for the cylinder head repair has been opened.	Fabbro Diesel Services		\$15,121.31
30/03/2022		Parts Only R-201 Labour Hire Fitter: Robbie Brammer Site: Townsville Dates: 21/03/22 - 25/03/22 Labour - Date: 21/03/22 Hours: 9.5 Labour - Date: 22/03/22 Hours: 9.5	Fabbro Diesel Services		\$1,985.50
25/03/2022		Parts Only R-317 Fitter: Robbie Brammer Site: Townsville Dates: 21/03/22 - 25/03/22 Labour - Date: 21/03/22 Hours: 9.5 Labour - Date: 22/03/22 Hours: 9.5 Labour - Date: 23/03/22 Hours: 9.5 Labour - Date: 24/03/22 Hours: 9.5 Labour - Date: 25/03/22 Hours: 9.5	Fabbro Diesel Services		\$1,985.50
24/03/2022		Parts Only R-200 Labour Hire Fitter: Robbie Brammer Site: Townsville Dates: 14/03/22 - 17/03/22 Labour - Date: 14/03/22 Hours: 8 Labour - Date: 15/03/22 Hours: 8 Labour - Date: 16/03/22 Hours: 8 Labour - Date: 17/03/22 Hours: 7.5	Fabbro Diesel Services		\$3,291.75
24/03/2022		Parts Only R-313 Fitter: Robbie Brammer Site: Townsville Dates: 14/03/22 - 17/03/22 Labour - Date: 14/03/22 Hours: 8 Labour - Date: 15/03/22 Hours: 8 Labour - Date: 16/03/22 Hours: 8 Labour - Date: 17/03/22 Hours: 7.5	Fabbro Diesel Services		\$3,291.75
24/03/2022		Registration O-44 Due date 24.03.2022 Paid 24.03.22 new due date 24.06.2022	TMR	B589D6	\$3,265.84
24/03/2022		Truck Annual Inspection I-4 1) Rectify cause of low braking efficiency on axles 2 and 3 and make all brakes equal and efficient. 2) Ensure excessive movement in axle 1 Left hand wheel bearing is within manufacturer specifications. 3) Rectify cause of all air leaks in air braking system. 4) Replace worn Teflon pads on fifth wheel. 5)Rectify cause of all oil leaks and clean down all contaminates. Signed of by Simon at FDS in Tsv and sent directly to TMR. COI issued - new expiry 14.09.2022	TMR	1018655496	\$190.49

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
16/03/2022		Parts Only R-221 Labour Hire Fitter: Robbie Brammer Site: Townsville Dates: 07/03/22 - 13/03/22 Labour - Date: 07/03/22 Hours: 11.5- (pick up parts and sorting, cannot apply to vehicle) Labour - Date: 08/03/22 Hours: 6 Labour - Date: 09/03/22 Hours: 3.5 Labour - Date: 10/03/22 Hours: 11 Labour - Date: 11/03/22 Hours: 10.5 Labour - Date: 12/03/22 Hours: 8.5 Labour - Date: 13/03/22 Hours: 5.5	Fabbro Diesel Services		\$3,500.75
13/03/2022		Parts Only R-314 Fitter: Robbie Brammer Site: Townsville Dates: 07/03/22 - 13/03/22 Labour - Date: 07/03/22 Hours: 11.5 Labour - Date: 08/03/22 Hours: 6 Labour - Date: 09/03/22 Hours: 3.5 Labour - Date: 10/03/22 Hours: 11 Labour - Date: 11/03/22 Hours: 10.5 Labour - Date: 12/03/22 Hours: 8.5 Labour - Date: 13/03/22 Hours: 5.5	Fabbro Diesel Services		\$3,605.25
17/02/2022		Parts Only R-339 parts invoices feb	Truckzone		\$12,505.29
02/02/2022	195,505 kms	C - 180000 S-88 C Service drain axle bump stops perrished rear axle bump stops missing all rear suspension bushes havve excessive movement high metall filing content on the front diff excessive play in the output shaft gearbox pla in the front input shaft (front diff) RH steering rod box missing oil filter cap missing engine speed sensor wires broken at the plug coolant temp sensor coolant wire broken at the plug Work requested: C-service & defects Hours: 19535 Kilometres: 195,505 (21/02/2022) Removed pos 6 hub, disconnected airbags and shocks. Heated J beam collars to free up as fitter had great difficulty removing them. Split J beams, sorted parts and went parts run for bolts. Carried out appropriate cleaning and paperwork. (23/03/2022) Inspected defect list from machinery inspection. Inspected for air leaks on brake system, found loose air line on POS 5 brake booster. Refitted and tested for leak. Found POS 2 brake booster leaking under application. Removed and replaced pos 1 and 2 brake boosters. Tested operation and tested for leaks. Inspected and adjusted brakes on all axles. Inspected and adjusted pos 1 and 2 wheel bearings. Degreased and washed down engine of contaminants. Wiped down finger prints from bonnet and moved unit out of workshop. see document attached for further description	Fabbro Diesel Services		\$29,668.10
06/01/2022		Registration O-22	TMR		\$3,332.19
01/11/2021	195,505 kms 19,187 hrs	Diff, Thermostat R-94 RO#22165 02/11/2021 Mack Titan REG: XQ38VG KM'S: 195,505 HR'S: 19,187 REPAIRS Removed thermostat housing and thermostat's. Test - both failed. Found turbo exhaust leaking, pyro threads stripped, exhaust manifold loose, alternator adjuster broken, RHR airbag ride height broekn, rear diff switch broken, front diff airline broken, broken wires above front diff, front diff switch broken, fuel tank brace bushes preished and missing bolts, clutch cover missing, front and rear diff mudflaps torn/missing, both diff temp sensors broken, spot light wiring broken, RH side marker not working, front engine mount worn, cab shock bushes worn/perished, exhaust cross over pipes rusted/holes, LH stack broken and rear stack brace broken. Replaced air line at rear diff. Replaced fitting in front diff and reconnect air line. Cleaned thermostat housing and bolts. Fit new thermostats and gasket. Fill with water and test - all ok. Fit rear snorkles. Greased truck and adjusted all brakes. Tried to connect Cat ET - no power to connector box from truck side - smoke came out of box.	BDS Mechanical		\$2,728.67
76 Records				Total:	\$203,605.80