



# Vehicle History Detail



Fleet #	PM64
Registration	XQ88UP
Make	Kenworth
Model	T650
VIN / Chassis #	6F5000000XA419516

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
04/02/2026		<b>COI, General repairs</b> R-2526 Inspect and repair and required to COI standards. Hydraulic tank drained and cleaned. Refilled with new hydraulic oil. Connected to trailer and tested tipper. Tested good. A/C fan removed on red dot. New fan fitted .	Internal Workshop		\$1,237.70
19/12/2024	269,583 kms	<b>B - 30000</b> S-891 CARRY OUT SERVICE			\$714.56
11/12/2024		<b>Battery</b> R-2121 REPLACED BATTERIES AND TEST STARTING AND CHARGING SYSTEM OK TESTED BRAKES AND FOUND LEAKING BRAKE TREADLE VALVE. REMOVED AND REPLACED VALVE REMOVED AND REPLACED STARTER MOTOR AND CHECK STARTING OK	Internal Workshop		\$1,398.98
11/12/2024		<b>Electrical</b> R-2120 REPLACED INDICATOR SWITCH REPLACED TAIL LAMP ASSY BOTH AND TEST OK	Internal Workshop		\$1,441.90
10/11/2024		<b>Air Conditioner</b> R-1972	Central Gulf Diesel		\$599.50
22/10/2024		<b>Air Conditioner</b> R-1929	Internal Workshop		\$397.23
20/10/2024		<b>hub</b> R-1885 REPLACED HUBCAP PLUGS			\$16.40
14/10/2024		<b>Parts Only</b> R-1875	Internal Workshop		\$317.38
17/09/2024	260,101 kms	<b>A - 15000</b> S-890 CARRY OUT SERVICE			\$604.37
11/09/2024		<b>Electrical</b> R-1800 REPAIR AIR AND ELECTRICAL CIRCUIT FOR SIDE TIPPER OPERATION.TEST OK	LRF Repairs Pty Ltd		\$2,556.26
30/08/2024		<b>Electrical</b> R-1748 DIAGNOSE AND REPAIR ELECTRICAL SYSTEM REPAIRED SPEED SENSOR WIRING.TESTED WIRING OUTPUTS.NO SIGNAL FROM ECM. REPLACED ECM AND TEST OPERATION OK.	JAC Diesel Repairs		\$1,148.30
28/08/2024	258,569 kms	<b>COI</b> I-167			\$319.73

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
08/08/2024	255,042 kms	<b>R&amp;R engine</b> R-1424 REPLACED ENGINE S/HAND UNIT REPLACED CLUTCH	Internal Workshop		\$43,167.66
23/05/2024		<b>Fan belt</b> R-1363 Needs new fan belt installed. New belt is in the truck. New belt needs to be fitted.	Gulf Civil Field Service		\$44.00
10/04/2024	251,732 kms	<b>Breakdown</b> R-1320 Removed old jack shaft and rear pinion yoke into differential. Replaced front and rear universal joints, replaced rear pinion yoke, and replaced the jack shaft. Greased all drive line when completing jobs. Test drove machine and all worked correctly.	Internal Workshop		\$1,056.18
05/04/2024	252,837 kms	<b>Electrical, Fuel Pump</b> R-1369 Find and fix problem causing throttle to cut out. Fit new pick up fuel pump due to old one not making enough pressure. Test drive truck, engine ran shitty, rectify problem by finding earth wire loose. Test drive again, engine ran and drove fine no problems.	Internal Workshop		\$4,530.38
02/04/2024		<b>Engine</b> R-1332 Fan belt needs replacement before failure, because there are holes in the fan belt. ORDER NEW FAN BELT.	Internal Workshop		\$0.00
12/03/2024	251,732 kms	<b>Breakdown</b> R-1319 Need to get scan tool to connect up to the truck resolve the issue.	Internal Workshop		\$0.00
07/02/2024	251,000 kms	<b>Booster, Brakes</b> R-1300 •Re line rear RH Drive brakes •Replace rear front drive brake booster • Replace park brake valve •Fix problem with indicators not working •correct issue with low air light on dash	Internal Workshop		\$1,135.12
08/11/2023	250,699 kms	<b>Bearings, Engine tune up, King Pin</b> R-1256 1. Perform engine tune up as per Cummins specs test run PASS. 2. Remove left steer wheel and all brake components and tie rod end and remove old king pin and bushes. Clean all components and install new bush and pin and test movement PASS. 3. Replace bearings on left steer hub and install new seal and fill hub with oil. Check all work. 4. Remove bracket and weld cracks and broken pieces. Reinstall bracket.	Internal Workshop, TLC Maintenance and repairs		\$825.00
07/11/2023	250,699 kms	<b>B - 30000</b> S-696	Internal Workshop		\$1,123.12
04/08/2023	236,209 kms	<b>B - 30000</b> S-543	Internal Workshop		\$1,013.26
29/06/2023	218,000 kms 1 hrs	<b>B - 30000</b> S-502 B service Grease Adjust brakes Check over Fix front grill	Internal Workshop		\$809.70
08/06/2023	40 kms	<b>starting issue</b> R-1113 Found batteries not holding charge. Replace batteries and test. PASS	Internal Workshop		\$977.06
10/03/2023	185,000 kms	<b>C - 180000</b> S-441	Internal Workshop		\$1,432.75
31/12/2022		<b>Shockies</b> R-1110			\$0.00
09/11/2022		<b>Bushes</b> R-1111			\$0.00
20/10/2022	175,000 kms	<b>ecm, Engine, Safety Equip, wipers</b> R-883 Check codes and found it only had low battery at some point. Replace Jack Replace wiper blades	Internal Workshop		\$154.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
06/10/2022		<b>Registration</b> O-195 registration renewal received - emailed to tamara holly raised po 17/10 paid by bpay - brendan	TMR		\$13,212.50
05/10/2022	163,000 kms	<b>UHF Radio</b> R-745 Install antenna	Internal Workshop		\$38.50
04/10/2022		<b>Axles, Gauges, hub, Hydraulics, Lights, Mirror, Steering</b> R-760 All repairs carried out	Fabbro Diesel Services		\$0.00
06/09/2022	158,548 kms	<b>Brakes , hub</b> R-672 replace hub seal and brakes filled diff and hub adjusted brakes and bearings	BDS Mechanical		\$548.22
06/09/2022		<b>FIT TBR TYRE</b> T-144	Bridgestone Australia LTD	4810230962	\$583.23
18/08/2022	154,370 kms	<b>Air leaks</b> R-585 Repaired air leaks	Fabbro Diesel Services		\$209.00
10/08/2022	151,711 kms	<b>COI</b> I-38 COI PASSED VEHICLE INSPECTION SHEET	JAC Diesel Repairs	IE12154	\$156.65
10/08/2022		<b>Registration</b> O-167 NEW REGO	TMR		\$3,324.10
06/08/2022	150,835 kms 1 hrs	<b>B - 30000</b> S-179 changed trans oil and filter changed diff oil and filter a/c blower fan noisy cab mounts worn windscreen broken horn not working adjusted turn table and pivots, cleaned and feed up no reverse light	Fabbro Diesel Services		\$2,056.33
06/08/2022	151,711 kms	<b>Brakes , Electrical, Fuel Leak, Power Steering, Seat Belt, Shockies</b> R-524 1-remove and replace LH tank breathers 2-perform service and diff oil / filters and g/box oil / filter 3-support cab, ubolt top of shock and move, remove panhard rod bolt and turn around 4-trouble shoot and repair reverse lights not working, not connected, connect but found a/c system switches on when in reverse. trouble shoot but eventually found out its an OEM feature for cold climates 5-shock bottom bush pos 1 worn on sides, remove off studs and fit extra washer to take up play, refit - ok 6- sub-let windscreen repair 7-replace LH bonnet spigot 8-remove steering shaft, make up to remove seal, remove seal and install new seal, assemble shaft, top up aft and run - no leaks, ok 9-trouble shoot horn not working, missing horn, replace, broken electrical bush for steering column 10-retro fit seat belt latch as not installed 11-sub-let LRF to remanufacture suction hose for power steer pump. top up ATF after replacement 12-clean grease off turntable and inspect found gouge in locking pin. remove raised sections with grinder. clean old grease and dirt from jaws. regrease 13- reglue pedal fubber down 14-remove and replace all driver seals, brake linings, scams pos 3,4,5,6 and pos 1 wheel seal replaced	Fabbro Diesel Services		\$4,660.25
22/07/2022	150,835 kms	<b>Windscreen</b> R-686 supply and fit RHS & LHS windscreen	Mobile Windscreens & Tinting		\$500.02
22/07/2022		<b>New</b> T-78	Bridgestone Australia LTD	4810230045	\$1,246.90
10/07/2022		<b>Air Tank, Drop Bar</b> R-399 removed old air tank fit new air tank with new fittings test drove and pressure tested diagnosed rear drop bar issue waiting on parts incorrect km reading noted	BDS Mechanical		\$313.50

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
07/07/2022		<b>Electrical</b> R-392 7 pin plug found to be faulty replace plug and test pass adjust all brakes	Internal Workshop		\$93.98
17/05/2022		<b>Parts Only</b> R-328 Fitter: Robbie Brammer Site: Silkwood Dates: 09/05/22 - 15/05/22 Labour - Date: 09/05/22 Hours: 11.5 Labour - Date: 10/05/22 Hours: 7.5 Labour - Date: 11/05/22 Hours: 11.5 Labour - Date: 12/05/22 Hours: 12 Labour - Date: 13/05/22 Hours: 12.5 Labour - Date: 14/05/22 Hours: 9.5 Labour - Date: 15/05/22 Hours: 6.5	Fabbro Diesel Services		\$418.00
17/05/2022		<b>Parts Only</b> R-218 Labour Hire Fitter: Robbie Brammer Site: Silkwood Dates: 09/05/22 - 15/05/22 Labour - Date: 09/05/22 Hours: 11.5 Labour - Date: 10/05/22 Hours: 7.5 Labour - Date: 11/05/22 Hours: 11.5 Labour - Date: 12/05/22 Hours: 12 Labour - Date: 13/05/22 Hours: 12.5 Labour - Date: 14/05/22 Hours: 9.5 Labour - Date: 15/05/22 Hours: 6.5	Fabbro Diesel Services		\$418.00
16/05/2022		<b>Registration</b> O-70 Paid 3 mths rego with GCA card	TMR	90B233	\$3,334.10
28/04/2022		<b>New</b> T-14	Internal Workshop		\$0.00
10/04/2022	112,506 kms	<b>B - 30000</b> S-96 RO#25816 XQ88UP 112,506 km SERVICE Carried out service, greased & inspected as per B Service. Topped up diff oils, Topped up hub oil (front). Cleaned diff breathers. Adjusted brakes. Test drove. Ok	BDS Mechanical		\$594.00
05/04/2022		<b>Parts Only</b> R-352 parts invoice non inventory items	MaxiParts		\$1,652.95
30/03/2022		<b>Alignment, Rotate</b> T-17 all work sublet to Big Wheels Truck Alignment	Fabbro Diesel Services		\$1,156.69
26/03/2022	103,485 kms	<b>Fuel Leak, Oil leak</b> R-33 1.Damaged. Loose bolts/fittings. Drivers side front fuel tank leaking from pick up point only when fuel tank is full 2.Oil leak front diff 3. Needs a new windscreen drivers side 4.Diff temp sensors not working 5. Indicator works intermittently	Internal Workshop		\$308.00
16/03/2022		<b>Parts Only</b> R-222 Labour Hire Fitter: Robbie Brammer Site: Townsville Dates: 07/03/22 - 13/03/22 Labour - Date: 07/03/22 Hours: 11.5- (pick up parts and sorting, cannot apply to vehicle) Labour - Date: 08/03/22 Hours: 6 Labour - Date: 09/03/22 Hours: 3.5 Labour - Date: 10/03/22 Hours: 11 Labour - Date: 11/03/22 Hours: 10.5 Labour - Date: 12/03/22 Hours: 8.5 Labour - Date: 13/03/22 Hours: 5.5	Fabbro Diesel Services		\$574.75
13/03/2022		<b>Parts Only</b> R-316 Fitter: Robbie Brammer Site: Townsville Dates: 07/03/22 - 13/03/22 Labour - Date: 07/03/22 Hours: 11.5 Labour - Date: 08/03/22 Hours: 6 Labour - Date: 09/03/22 Hours: 3.5 Labour - Date: 10/03/22 Hours: 11 Labour - Date: 11/03/22 Hours: 10.5 Labour - Date: 12/03/22 Hours: 8.5 Labour - Date: 13/03/22 Hours: 5.5	Fabbro Diesel Services		\$679.25
13/03/2022	94,804 kms	<b>Brakes , Wheel bearings</b> R-117 RO#28543 Carry out repairs to trailer identified during the C service Replace broken spring packs Radius rod bushes to replace worn one	BDS Mechanical, Fabbro Diesel Services, Truckline		\$1,375.89

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
08/03/2022	93,728 kms	<b>Air leaks , Steering</b> R-105 RO#28360 RO#28538 removed old draflink, refit new with new split pins and turns on adjustment. diagnosed air leak front LH side air brake line jacked u front end, removed shackles on both sides. removed front guards and accessories. removed wheels, shockies and accessories. head up spring hanger and attempted to bush out pins and bushes. note - extreamly tight) removed springs and hangers, drove to silkwood yard to ress bushes and grind weld. note spring bushes welding in solid. reassembled front end. tensioned wheels.	BDS Mechanical		\$2,351.25
02/03/2022	91,380 kms	<b>New T-37</b> GEOFF AUTHORISED. TRAVEL TO FORCE CIVIL DEPOT, JACK UP TRUCK, REMOVE STEER TYRES & BRING BACK TO SHOP. FIT TWO NEW TYRES WITH BALANCE BAGS. RETURN TO DEPOT AND REFIT TO TRUCK. OLD TYRES TAKEN BY CUSTOMER.	Tully Tyre Service		\$1,155.00
28/02/2022		<b>Parts Only</b> R-361 parts - feb march	MaxiParts		\$2,066.83
16/02/2022		<b>Puncture</b> T-36 swapped 16 driver tyres over between 2 trucks	Tully Tyre Service		\$550.55
13/02/2022	84,651 kms	<b>C - 180000</b> S-16 RO#28501 15/02/2022 Kenworth T650 REG: XQ88UP LV: PM64 KM'S: 84,651 C SERVICE Carried out C service as per checklist. Sika rear diff housing as per driver's request. (Parts supplied by customer) NOTE: - All track and torque rod bushes cracking. - Front diff sensor and wire missing. - Rear diff housing needs resealing.	BDS Mechanical Townsville , Truckzone	00051906	\$126.52
31/01/2022	76,996 kms	<b>Driveline</b> R-10 Inspected over oil leaks. Found diff oil everywhere over the rear of the vehicle. Oil leak present at oil filter, through shaft seal and rear drive input seal. Possible oil leak from front drive head but would need to confirm after oil filter replaced and washed. Inspected breathers and found remote breathers fitted and looked rusty and blocked. Informed customer of findings, provided rough estimate of cost of repair but difficult to know until repairs actually started. Received authority to repair. \$1,500.00 Moved onto pit, removed old breathers and fitted new breathers, had to get an adaptor for one line as they were both different, secured with p clamps to previous location. Inspected oil filter and removed oil filter, wasn't tight but was firm, fitted new filter to diff. Removed jack shaft bolts and set up puller to remove uni caps, while removing caps found some caps have failed and broken into 2, both jack shaft unis needed to be replaced. Once shaft out, replaced both unis, had to tap out one hole as was damaged. Removed rear drive input nut and set up puller to remove yoke, removed yoke removed seal, cleaned housing, inspected, ok, installed new seal. Cleaned yoke surface, installed yoke and new nut, tensioned nut. Found excessive play at through shaft yoke. Nut tight, found bearings to have 3-4mm of play in them. Tried to remove through shaft nut but wouldn't budge, tried soaking it in CRC dispersant, still unable to loosen. Had to use oxy and heat up the nut. Removed nut, set up yoke puller, removed yoke and seal. Removed through shaft assembly, pressed out shaft and removed bearing from housing. Installed new bearings in housing, fitted shaft. Had to clean up threads on shaft as slightly damaged from removal due to heating and working nut off. Installed through shaft assembly, fitted new seal and fitted yoke and new yoke nut, tensioned nut. Fitted jack shaft and torqued all bolts to 40ftlb, greased uni's. Cleaned down vehicle, refitted walk plate and topped up both diffs. Test drove, checked over no leaks present, repair complete	Brown and Hurley Burpengary	2389345	\$2,505.47

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
22/11/2021	60,521 kms	<b>hydraulic hoses</b> R-61 RO#4 23/11/2021 replaced PTO pump and fit new hydraulic hose from hydraulic tank to pump, as original hose was starting to collapse internally 2.5hrs 24/11/2021 PTO airlines pulled out of fittings and broke them, replaced fittings and cut zipties on lines, to give them more length. 25/11/2021 drove to site, topped up tranny fluid 1.5hrs 26/11/2021 Hydraulic hose blew on PTO diverter valve, removed blown hose, didnt have pars in stock, went to work shop and they had correct fittings and hose. took fittings and hose to truck, marked positions, took back and crimped fittings on, fit hose, topped up hydraulic oil, tested systems, all ok drove truck and trailers back to camp.	Fabbros Diesel Services		\$627.00
21/11/2021		<b>CTP</b> O-4	TMR		\$309.55
21/11/2021		<b>Registration</b> O-3 PO 3 mths rego at MC3 level	TMR	GCA CCP 16.11.2021 TMR inv XQ88UP.1121	\$3,332.19
17/10/2021	59,409 kms	<b>Parts Only</b> R-194 RO#22043 labour hire invoice uploaded for pricing hydraulics	BDS Mechanical		\$365.75
25/08/2021		<b>B - 30000</b> S-86 RO#20268 Kenworth REG: XQ88UP KM'S: 36,490 REPAIRS Carried out service. Changed engine oil, oil/fuel/air filters. Changed gearbox oil & filter. Changed diff oils & filter. Changed coolant & filter. Greased. Checked over. Removed axle shafts. Removed tailshaft. Unbolt diff centre & pull out. Cleaned surfaces. Apply sealant & refit centre. Bolt in & refit tailshaft & axles. Removed old diverter valve & hosing. Design & fabricate bracket to mount diverter valve & fittings. Ran air lines from cab control to bracket. Plumb up all hydraulics for side tipper controls, pressure & return. Unbolt sleeper cab & jacked up. Prepped area & weld broken chunk of steel. Let cab back down. Replaced all mounting bolts. Replaced cab shocks. Removed & replaced fuel taps. Removed & replaced cross over fuel lines. Fit new batteries. Tidy up battery cables. Fit stereo & UHF. Removed all hubs. Replaced rear S cams & bushes. Fit new brake shoes & hardware kits to all axles . Clean hubs & bearings. Fit new seals & refit hubs. Fill with oil. Removed and replaced all engine mounts as required. Replaced mudflaps in front of first drive. Fit marker plates to rear mudflaps and cut to size. Removed and replaced LH and RH box latches. Replaced rear axle shafts. Removed and replaced turntable. Removed and replaced rear gearbox seal, yoke and uni. Fit spotlights and rotating beacon. Removed & replaced mattress. Replaced RHF fuel tank straps. Replaced power divider switch. Replaced 6x dash light bulbs. Removed & replaced radio. Fit new speakers. Removed & replaced fan belt & A/C belt. Replaced bearings in all tensioners. Replaced exhaust clamp behind turbo. Fit rear hook up. Fit new plate to rear and plumb up. Removed drive tyres and refit with new tyres. Checked all wheel nuts. Removed & replaced cabin A/C vents. Replaced head light surrounds. Removed & replaced horton fan pressure switch.	BDS Mechanical		\$30,185.96
<b>64 Records</b>				<b>Total:</b>	<b>\$148,051.42</b>