

Component Serial Number

VIN

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Vehicle Notes :

4/05/2021 12:00:00AM RO#: R54115 DATE: 04/05/2021 CUST: D & G QLD TRANSPORT PTY LTD ODOM: 0 TOTAL: \$37792.23 ADVISOR:
BRANCH: 417RZ SALE TYPE: |||||

OP_CODES

53MBZZZ|65MBZZZ13|67MBZZZ|69MBZZZ04|54MBZZZ02|69MBZZZ|69MBZZZ13|69MBZZZ03|65MBZZZ|7
0MBZZZ|70MBZZZ26|69MBZZZ48|69MBZZZ44|70MBZZZ10|69MBZZZ12|62MBZZZ|67MBZZZ09|60MBZZZ
08|67MBZZZ01|67MBZZZ02|65MBZZZ01|52MBZZZ02|99MBZZZ

OP_DESC

|||||

COMPLAINT

CARRY OUT PD||FULL WHEEL ALIGNMENT TO BE CARRIED OUT^D&L LASER|GME TX4500 UHF WITH
ANTENNAE^ON HIGHWAY SUPPLY AND FIT.|WINDOW TINT^TWEED TINTING^|FIRE EXTINGUISHER BETWEEN
GUARDS^DTGC SUPPLY AND FIT.|JOST JSK37 1270MM HIGH GREASELESS.^CARRABEAN CLIP AND C

CAUSE

|||||

CORRECTION

|||||BULLBAR YET TO BE SUPPLIED.|||||

1/07/2021 12:00:00AM RO#: R54563 DATE: 01/07/2021 CUST: D & G QLD TRANSPORT PTY LTD ODOM: 10 TOTAL: \$9140.58 ADVISOR:
BRANCH: 417RZ SALE TYPE: |||

OP_CODES

69MBZZZ12|67MBZZZ

OP_DESC

|

COMPLAINT

FIT UP BULLBAR GARNER HI TOP.^WIRE UP LIGHTS.|WIRE IN TRAILER LIGHT REDARC UNIT.

CAUSE

|

CORRECTION

FITTED ANDWIRED UP AS REQUIRED.|CARRIED OUT FITMENT AND WIRE UP OF REDARC AS REQUESTED.

2/07/2021 12:00:00AM RO#: R54570 DATE: 02/07/2021 CUST: D & G QLD TRANSPORT PTY LTD ODOM: 1652 TOTAL: \$840.00 ADVISOR:
BRANCH: 417RB SALE TYPE: W

OP_CODES

56MHZZZ

OP_DESC

COMPLAINT

INSPECT NOT USING ADBLUE^^Authority Number: PAA0502

CAUSE

DC - 21712G8^14000099 6.0 Time approved by Peter Armstrong for rectifying^Adblue line issues

CORRECTION

ATTENDED BREAKDOWN.^OUTBOUND: 78 KMS^INBOUND 78 KMS^FOUND CODE 161100.^WENT BACK TO
WORKSHOP TO SOURCE PROCEDURE.^FSM CONTACTED WHILE AT WORKSHOP AND ADVISED OF REPAIR
PROCEDURE.^REATTENDED BREAKDOWN.^OUTBOUND: 78 KMS^INBOUND: 78 KMS^FOUND ADBLUE SENDER
U

Component Serial Number

VIN

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

3/09/2021 12:00:00AM RO#: R55045 DATE: 03/09/2021 CUST: D & G QLD TRANSPORT PTY LTD ODOM: 51554 TOTAL: \$905.00 ADVISOR:
BRANCH: 417RB SALE TYPE: W|M|I

OP_CODES

70MBZZZZ26|51MBZZZZ|69MBZZZZ

OP_DESC

||

COMPLAINT

DRIVERS SEAT GOES UP ON ITS OWN|CARRY OUT 40K INSPECTION SERVICE|CHECK LOSING AIR IN 1 HOUR

CAUSE

||

CORRECTION

CHECKED AND FOUND DRIVERS SEAT VALVE BYPASSING AIR INTERNALLY.^REPLACED SEAT VALVE AS
REQUIRED.^RECHECKED - ALL OK.|CARRIED OUT INSPECTION SERVICE.|BUILT UP AIR AND LET VEHICLE SIT
FOR 1 HOUR.^FOUND TO BE HOLDING AIR OK.^NO FAULT FOUND.^ADJUSTED HIGH BEAM

10/09/2021 12:00:00AM RO#: R55111 DATE: 10/09/2021 CUST: D & G QLD TRANSPORT PTY LTD ODOM: 51554 TOTAL: \$0.00 ADVISOR:
BRANCH: 417RB SALE TYPE: I

OP_CODES

69MBZZZZ

OP_DESC

COMPLAINT

LH TOOL BOX DOOR DAMAGED

CAUSE

CORRECTION

REPLACED AS REQUIRED.

20/10/2021 12:00:00AM RO#: R55421 DATE: 20/10/2021 CUST: D & G QLD TRANSPORT PTY LTD ODOM: 87594 TOTAL: \$1886.24 ADVISOR:
BRANCH: 417RB SALE TYPE: M

OP_CODES

51MBZZZZ

OP_DESC

COMPLAINT

CARRY OUT 80K SERVICE.;

CAUSE

DC - 21120SV^00530602 1.5 Perform Annual Inspection^00532001 0.7 Perform Telligent periodic maintenance safety
related^00500002 0.7 Engine filter change Perform^00504101 0.5 Fuel filter^00525801 0.2 Fuel filter element water
separator^00503501 0.2 General

CORRECTION

REPLACED.^ENGINE OIL AND FILTER^FUEL FILTERS^VENT FILTERS^AIR FILTER^AIR DRYER FILTER^POLLEN
FILTER^CARRIED OUT TOP TUNE

9/12/2021 12:00:00AM RO#: R55836 DATE: 09/12/2021 CUST: D & G QLD TRANSPORT PTY LTD ODOM: 134053 TOTAL: \$132.30 ADVISOR:
BRANCH: 417RB SALE TYPE: M

OP_CODES

51MBZZZZ

OP_DESC

COMPLAINT

CARRY OUT INSPECTION SERVICE (120K)

CAUSE

DC - 21118SV^00530602 1.0 Telligent time-based maintenance - annual Perform

CORRECTION

CARRIED OUT INSPECTION SERVICE.

Component Serial Number

VIN

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

18/01/2022 12:00:00AM RO#: R56084 DATE: 18/01/2022 CUST: D & G QLD TRANSPORT PTY LTD ODOM: 165151 TOTAL: \$2265.99
ADVISOR: BRANCH: 417RB SALE TYPE: M

OP_CODES
51MBZZZZ

OP_DESC

COMPLAINT
CARRY OUT TELLIGENT SERVICE (160K)

CAUSE
DC 21119SV^00500002 0.8^00504101 0.5 Fuel filter^00525801 0.2 Fuel filter element water separator^00504401 0.2
Adblue filter replace^00509101 0.3 Air drier filter replace^00532001 0.7 Telligent periodic maintenance safety
related^00507701 0.2 Air filter r

CORRECTION
CARRIED OUT TELLIGENT SERVICE.^CHANGE ENGINE OIL AND FILTER^FUEL AND WATER SEPARATOR FILTER,
ADBLUEFILTER, AIR DRIER, 2X MESH^FILTER IN FUEL TANK, GREASE.^RETENSIONED FUEL TANK STRAP AND
REPLACED RETAINING CLIP.^REPLACED RH INDICATOR LIGHT GLOBE.

Component Serial Number

VIN

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Repair Order History

AmtPrice

Extended

SlId : RA960030485:02 Total : \$1,474.80 Date Invoice : 11/04/2024 OdomIn: 805,662 OdomOut: 805,662

Sold Operations

OpsId : 3 Job : 99 NOX SENSOR TO BE COVERED BY GOODWILL
 Cause : NOX outlet sensor to have failed due to an internal electrical failure;;
 Correction : CHECK AND REPORT ON VEHICLE DERATING;;

1.00	NOX SENSOR	1,580.14	1,580.14
-1.00	Adjust Parts Price [[Warranty Only]]	105.34	-105.34

Rejected Operations

OpsId : 2 Job : 54 QUOTE REPLACEMENT NOX SENSOR AND REGENERATION
 Cause :
 Correction :

1.00	NOX SENSOR	1,696.01	1,696.01
------	------------	----------	----------

SlId : RA960030485:01 Total : \$760.00 Date Invoice : 10/17/2024 OdomIn: 805,662 OdomOut: 805,662

Sold Operations

OpsId : 1 Job : 54 CHECK AND REPORT ON VEHICLE DERATING
 Cause : OUTLET NOX SENSOR FAILED, ACM SOFTWARE UPDATE REQUIRED AND DPF IN ZONE 2 -
 Correction : INSPECTED AND CONFIRMED CUSTOMER CONCERN

0.00	Sam J.	0.00	0.00
------	--------	------	------

SlId : RA960029125:02 Total : \$0.00 Date Invoice : 08/30/2024 OdomIn: 780,881 OdomOut: 780,881

SlId : RA960029125:01 Total : \$1,445.54 Date Invoice : 07/27/2024 OdomIn: 780,881 OdomOut: 780,881

Sold Operations

OpsId : 1 Job : 49 CHECK AND REPORT ON CUST CONCERN OF VEHICLE DERATING A
 Cause : ADBLUE TANK STRAINER BLOCKED, ADBLUE PUMP REPAIR REQUIRED
 Correction : INSPECTED AND CONFIRMED CUSTOMER CONCERN

1.00	KIT ADBLUE FILTER	31.61	31.61
1.00	REPAIR KIT PUMP UNIT	480.92	480.92
0.00	bay 6	0.00	0.00
-1.00	Adjust Parts Price [[Warranty Only]]	46.48	-46.48

OpsId : 2 Job : 79 CARRY OUT WORK AS PER CAMPAIGN BULLETIN SM3311
 Cause : RECALL
 Correction : CARRIED OUT WORK AS PER CAMPAIGN BULLETIN SM3311

1.00	THERMOSTAT	213.63	213.63
1.00	SEAL	16.31	16.31
1.00	ONE EAR CLAMP	21.50	21.50
0.00	BACK COUNTER	0.00	0.00
-1.00	Adjust Parts Price [[Warranty Only]]	12.83	-12.83

SlId : RA960008029:01 Total : \$590.52 Date Invoice : 10/12/2022 OdomIn: 382,577 OdomOut: 382,577

Component Serial Number

VIN

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Sold Operations

OpsId : 1 Job : EA EXPRESS ASSESSMENT -
 Cause : Found coolant hose from header tank to thermostat split;
 Correction : Carried out check on coolant leak

1.00	FILLING PIPE	286.02	286.02
6.00	COOLANT - ALLIANCE PRIMECOOL GP P-40	4.58	27.48
1.00	Adjust Parts Cost [[Warranty Only]]	0.01	0.01

SlId : RA940026112:01 Total : \$844.54 Date Invoice : 03/12/2024 OdomIn: 701,536 OdomOut: 701,536

Sold Operations

OpsId : 1 Job : BD ATTEND BREAKDOWN - COOLANT LEAK FROM HOSE
 Cause : LHF HEATER HOSE SPLIT & LEAKING;
 Correction : TRAVEL TO BREAKDOWN LOCATION. FOUND HEATER HOSE LHF SPLIT. SUPPLIED & FIT NI

3.00	COOLANT - ALLIANCE PRIMECOOL GP P-40 (20L) - QABP AFM4604020	7.20	21.60
1.00	MOLDED HOSE	62.94	62.94

SlId : RA940026111:01 Total : -\$781.60 Date Invoice : 03/12/2024 OdomIn: 701,536 OdomOut: 701,536

Sold Operations

OpsId : 1 Job : BD ATTEND BREAKDOWN - COOLANT LEAK FROM HOSE
 Cause : LHF HEATER HOSE SPLIT & LEAKING;
 Correction : TRAVEL TO BREAKDOWN LOCATION. FOUND HEATER HOSE LHF SPLIT. SUPPLIED & FIT NI

-3.00	COOLANT - ALLIANCE PRIMECOOL GP P-40 (20L) - QABP AFM4604020	7.20	-21.60
-------	--	------	--------

SlId : RA940025735:02 Total : \$781.60 Date Invoice : 03/07/2024 OdomIn: 701,536 OdomOut: 701,536

Sold Operations

OpsId : 1 Job : BD ATTEND BREAKDOWN - COOLANT LEAK FROM HOSE
 Cause : LHF HEATER HOSE SPLIT & LEAKING;
 Correction : TRAVEL TO BREAKDOWN LOCATION. FOUND HEATER HOSE LHF SPLIT. SUPPLIED & FIT NI

3.00	COOLANT - ALLIANCE PRIMECOOL GP P-40 (20L) - QABP AFM4604020	7.20	21.60
------	--	------	-------

SlId : RA940025735:01 Total : \$353.15 Date Invoice : 03/07/2024 OdomIn: 701,536 OdomOut: 701,536

Sold Operations

OpsId : 2 Job : BD NTI COVERAGE - SERVICE CALL OUT & KMS;
 Cause :
 Correction :

1.00	A/HOURS CALL OUT	250.00	250.00
41.00	KMS TRAVELLED	2.15	88.15
1.00	FUEL CHARGE	15.00	15.00

SlId : RA931005614:01 Total : \$3,721.07 Date Invoice : 01/05/2023 OdomIn: 461,460 OdomOut: 461,472

Component Serial Number

VIN

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Sold Operations

OpsId : 1 Job : EA CHECK AND REPORT EGR ACTUATOR

Cause :

Correction : REPLACE EGR ACTUATOR AND VALVE

1.00	SERVOMOTOR	976.05	976.05
1.00	RECIRCULATION VALVE	903.24	903.24
1.00	METAL SEAL	39.32	39.32
1.00	PIPE CLAMP	85.71	85.71
1.00	WORKSHOP SUNDRIES	0.01	0.01

OpsId : 2 Job : EA CHECK AND REPORT NOISE FROM FRONT OF ENGINE

Cause :

Correction : REPLACE BELT, TENSIONER AND LOWER GUIDE PULLEY

1.00	BELT TENSIONER	687.26	687.26
1.00	V-RIBBED BELT 2642MM	121.82	121.82
1.00	GUIDE PULLEY	106.10	106.10
1.00	SCREW	8.07	8.07
1.00	WORKSHOP SUNDRIES	0.24	0.24

SIsId : RA930009078:01 Total : \$0.00

Date Invoice : 02/23/2024

OdomIn: 592,000

OdomOut: 592,000

Sold Operations

OpsId : 1 Job : 20 LOSING COOLANT

Cause :

Correction :

SIsId : RA921005786:02 Total : \$2,694.99

Date Invoice : 09/16/2023

OdomIn: 591,593

OdomOut: 591,593

Sold Operations

OpsId : 3 Job : 60 CAB PUMP INOP

Cause :

Correction : COMPLAINT-

1.00	HYDRAULIC PUMP(B/NECK Q4)	2,417.49	2,417.49
------	----------------------------------	----------	----------

SIsId : RA921005786:01 Total : \$4,305.43

Date Invoice : 09/14/2023

OdomIn: 591,593

OdomOut: 591,593

Component Serial Number

VIN

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Sold Operations

OpsId : 1 Job : 18 OIL LEAK

Cause :

Correction : COMPLAINT-

4.00 GASKET 17.13 68.52

1.00 HIGH-PRESSURE LINE (1-2-3) 174.38 174.38

4.00 GASKET 17.13 68.52

1.00 HIGH-PRESSURE LINE (1-2-3) 174.38 174.38

3.00 HIGH-PRESSURE LINE (4-5-6) 286.89 860.67

OpsId : 2 Job : 54 WARNING ON DASH FOR GENERATOR OPEN CIRCUIT

Cause :

Correction : COMPLAINT-

1.00 ALTERNATOR 2,225.43 2,225.43

SIsId : RA921005785:01 Total : -\$6,633.55 Date Invoice : 09/14/2023 OdomIn: 591,593 OdomOut: 591,593

Sold Operations

OpsId : 1 Job : 18 OIL LEAK

Cause :

Correction : COMPLAINT-

-4.00 GASKET 17.13 -68.52

-1.00 HIGH-PRESSURE LINE (1-2-3) 174.38 -174.38

-4.00 GASKET 17.13 -68.52

-1.00 HIGH-PRESSURE LINE (1-2-3) 174.38 -174.38

-3.00 HIGH-PRESSURE LINE (4-5-6) 286.89 -860.67

OpsId : 2 Job : 54 WARNING ON DASH FOR GENERATOR OPEN CIRCUIT

Cause :

Correction : COMPLAINT-

-1.00 ALTERNATOR 2,225.43 -2,225.43

OpsId : 3 Job : 60 CAB PUMP INOP

Cause :

Correction : COMPLAINT-

-1.00 HYDRAULIC PUMP(B/NECK Q4) 1,968.84 -1,968.84

SIsId : RA921005154:01 Total : \$6,633.55 Date Invoice : 07/18/2023 OdomIn: 591,593 OdomOut: 591,593

Component Serial Number

VIN

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Sold Operations

OpsId : 1 Job : 18 OIL LEAK

Cause :

Correction : COMPLAINT-

4.00	GASKET	17.13	68.52
1.00	HIGH-PRESSURE LINE (1-2-3)	174.38	174.38
4.00	GASKET	17.13	68.52
1.00	HIGH-PRESSURE LINE (1-2-3)	174.38	174.38
3.00	HIGH-PRESSURE LINE (4-5-6)	286.89	860.67

OpsId : 2 Job : 54 WARNING ON DASH FOR GENERATOR OPEN CIRCUIT

Cause :

Correction : COMPLAINT-

1.00	ALTERNATOR	2,225.43	2,225.43
------	------------	----------	----------

OpsId : 3 Job : 60 CAB PUMP INOP

Cause :

Correction : COMPLAINT-

1.00	HYDRAULIC PUMP(B/NECK Q4)	1,968.84	1,968.84
------	---------------------------	----------	----------

SlId : RA921004392:02 Total : \$1,794.96

Date Invoice : 06/29/2023

OdomIn: 545,531

OdomOut: 545,531

Sold Operations

OpsId : 2 Job : 00 TELLIGENT SERVICE

Cause :

Correction : Carried out Telligent service. (Inspection).

1.00	SCREW CAP	13.39	13.39
1.00	9KG FIRE EXT BAG	5.58	5.58
12.00	GEAR OIL - ALLIANCE PRIME TRANS PLUS MB 75W90	30.00	360.00
35.00	GEAR OIL - ALLIANCE PRIME AXLE PLUS 235.8 75W90	22.50	787.50
1.00	GREASE - COMPLEX - A001989405109	60.99	60.99
7.00	ENGINE - ALLIANCE PRIME ENGINE GLOBAL 10W40	15.00	105.00

SlId : RA921004392:01 Total : \$694.11

Date Invoice : 05/03/2023

OdomIn: 545,531

OdomOut: 545,531

Sold Operations

OpsId : 1 Job : 35 DIFF SEAL LEAKING AGAIN

Cause :

Correction : Complaint: DIFF SEAL LEAKING.

1.00	NUT FLANGE	47.79	47.79
1.00	SEAL RING	167.28	167.28

SlId : RA921004049:02 Total : \$1,503.58

Date Invoice : 03/31/2023

OdomIn: 520,264

OdomOut: 520,264

Component Serial Number

VIN

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Sold Operations

OpsId : 1 Job : 35 OIL LEAK FROM REAR DIFF

Cause :

Correction : COMPLAINT:

1.00 TAPPET SWITCH

117.02

117.02

OpsId : 2 Job : 01 ENGINE SURGING / HUNTING WHILE DRIVING

Cause :

Correction : COMPLAINT:

1.00 FUEL METERING UNIT

937.47

937.47

-1.00 Adjust Parts Cost [[Warranty Only]]

0.01

-0.01

OpsId : 3 Job : 79 SM3272 Update software release in motor control module (MCM)

Cause :

Correction : Carried out recall sm3272 as per manufacture guidelines

SIsId : RA921004049:01 Total : \$17.50

Date Invoice : 03/24/2023

OdomIn: 520,264

OdomOut: 520,264

Sold Operations

OpsId : 4 Job : 54 TRAILER LIGHT FAULT ON DASH FOR L/H TURN SIGNAL - CURRENT I

Cause :

Correction : COMPLAINT:

1.00 24V 21W LOAD RESISTOR BL

17.50

17.50

SIsId : RA921002759:02 Total : \$389.48

Date Invoice : 12/08/2022

OdomIn: 435,074

OdomOut: 435,074

Sold Operations

OpsId : 4 Job : 47 Replace missing fuel tank rubbers

Cause :

Correction :

2.00 ISOLATOR BRACKET FUEL TNK

55.99

111.98

SIsId : RA921002759:01 Total : \$3,117.64

Date Invoice : 11/30/2022

OdomIn: 435,074

OdomOut: 435,074

Component Serial Number

VIN

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Sold Operations

OpsId : 1 Job : BDA BREAKDOWN AFTERHOURS

Cause :

Correction : CARRIED OUT CALL OUT FOR BELT NOISE.

66.00 KMS TRAVELLED 0.75 49.50

1.00 A/HOURS CALL OUT 150.00 150.00

OpsId : 2 Job : 01 BATTERY SENSOR LIGHT ON.

Cause :

Correction : Battery sensor light on;;

1.00 BATTERY SENSOR 480.87 480.87

OpsId : 3 Job : 20 Replace water pump, drive belt and idler pulley

Cause :

Correction : Drained Coolant

1.00 COOLANT PUMP 782.49 782.49

1.00 V-RIBBED BELT 2642MM 121.82 121.82

1.00 GUIDE PULLEY 106.10 106.10

2.00 PROFILE BASE 81.25 162.50

1.00 SPACER RING 14.08 14.08

-1.00 Adjust Parts Cost [[Warranty Only]] 158.34 -158.34

SIsId : RA921002255:02 Total : \$59.88

Date Invoice : 10/11/2022

OdomIn: 384,389

OdomOut: 384,389

Sold Operations

OpsId : 2 Job : 54 CALIBRATE SPEEDO - TRUCK DOES 97KM/H

Cause :

Correction : CARRIED OUT CALIBRATION

SIsId : RA921002255:01 Total : \$668.62

Date Invoice : 10/11/2022

OdomIn: 384,389

OdomOut: 384,389

Sold Operations

OpsId : 1 Job : 00 CARRY OUT TELLIGENT SERVICE.

Cause :

Correction : * Completed Inspection service Telligent check list as required,

1.00 AIR FILTER INSERT 321.86 321.86

5.00 ENGINE - ALLIANCE PRIME ENGINE GLOBAL 10W40 (205L) - QABP AFM4982: 8.03 40.15

1.00 HAZ WASTE & ENVIRO DISPOSAL 2.00 2.00

1.00 MISC SHOP SUPPLIES 14.50 14.50

1.00 Adjust Parts Cost [[Warranty Only]] 0.11 0.11

SIsId : RA921001720:02 Total : \$464.91

Date Invoice : 08/23/2022

OdomIn: 342,121

OdomOut: 342,121

Component Serial Number

VIN

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Sold Operations

OpsId : 3 Job : 54 FOG LAMP REPLACEMENT.

Cause :

Correction : Attend to front RHS fog light broken (Glass)

1.00 FOG LAMP RH 294.99 294.99

1.00 AU Surcharge | RA921001720 3.42 3.42

SlId : RA921001720:01 Total : \$2,300.35

Date Invoice : 08/19/2022

OdomIn: 342,121

OdomOut: 342,121

Sold Operations

OpsId : 1 Job : 00 C/O TELLIGENT SERVICE

Cause : SERVICE DUE

Correction : Carried out Telligent service/Engine service as per checklist.

1.00 FILTER PACKAGE 64.65 64.65

1.00 SCREW PLUG 34.61 34.61

1.00 TS FUEL FILTER (MAHLE) 189.91 189.91

1.00 ROCKER COVER SEAL DD13/15 92.11 92.11

2.00 AIR FILTER 57.83 115.66

1.00 FILTER CARTRIDGE 150.77 150.77

1.00 AIR FILTER ELEMENT 130.54 130.54

1.00 DUST FILTER 86.55 86.55

1.00 TS WIPER BLADE 59.97 59.97

45.00 ENGINE - ALLIANCE PRIME ENGINE GLOBAL 10W40 (205L) - QABP AFM4982 8.03 361.35

0.40 GREASE- COMPLEX A0019894051 09 33.65 13.46

45.00 HAZ WASTE & ENVIRO DISPOSAL 0.40 18.00

6.90 CONSUMABLES 6.78 46.78

SlId : RA921001160:02 Total : \$244.00

Date Invoice : 07/16/2022

OdomIn: 304,509

OdomOut: 304,509

Sold Operations

OpsId : 1 Job : 00 INSPECT AND CARRY OUT TELLIGENT SERVICE

Cause : Service due

Correction : Carried out inspection service as per telligent schedule.

0.40 COMPLEX GREASE - A001989405109 33.47 13.39

SlId : RA921001160:01 Total : \$588.20

Date Invoice : 07/05/2022

OdomIn: 0

OdomOut: 304,509

Component Serial Number

VIN

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Sold Operations

OpsId : 2 Job : 54 INSPECT RHS INDICATOR INOP.

Cause :

Correction : Confirmed customer concern.

1.00 24V 21/5W BAY15D BULB 10 8.99 8.99

1.00 AU Surcharge | RA921001160 4.22 4.22

OpsId : 3 Job : 99 TURNTABLE PADS WORN, REPLACE

Cause :

Correction : Found turn table pads very worn.

1.00 GREASELESS INSERT KIT CW 492.49 492.49

SlsId : RA921000584:03 Total : \$0.00 Date Invoice : 05/26/2022 OdomIn: 259,470 OdomOut: 259,470

SlsId : RA921000584:02 Total : \$1,164.06 Date Invoice : 05/24/2022 OdomIn: 259,470 OdomOut: 259,470

Sold Operations

OpsId : 3 Job : 00 TENSIONER LOST TENSION, REPLACE BELTS AND TENSIONER

Cause :

Correction : FOUND TENSIONER SPRING LOST TENSION CAUSING BELTS TO WALK OFF PULLEYS AND

1.00 V-RIBBED BELT 62.84 62.84

1.00 V-RIBBED BELT 2642MM 119.43 119.43

1.00 BELT TENSIONER 673.78 673.78

1.00 MISC SHOP SUPPLIES 0.01 0.01

SlsId : RA921000584:01 Total : \$1,613.43 Date Invoice : 05/24/2022 OdomIn: 259,470 OdomOut: 259,470

Sold Operations

OpsId : 1 Job : 00 CARRY OUT 240K SERVICE

Cause :

Correction : CARRY OUT 240K SERVICE AS PER SCHEDULE.

1.00 FILTER PACKAGE 63.39 63.39

1.00 TS FUEL FILTER 176.26 176.26

1.00 FILTER CARTRIDGE 147.83 147.83

1.00 DUST FILTER 84.81 84.81

1.00 AIR FILTER ELEMENT 127.90 127.90

2.00 AIR FILTER 54.97 109.94

1.00 SCREW PLUG 33.94 33.94

1.00 HAZ WASTE & ENVIRO DISPOSAL 16.00 16.00

40.00 Engine-ALLIANCE PRIME ENGINE GLOBAL 10W40-PUMP IN 6.45 258.00

1.00 MISC SHOP SUPPLIES 28.36 28.36

SlsId : RA921000101:01 Total : \$158.76 Date Invoice : 03/29/2022 OdomIn: 209,845 OdomOut: 209,845

Component Serial Number

VIN

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Sold Operations

OpsId : 1 Job : 00 CARRY OUT INSPECTION SERVICE (200K)

Cause : DONE

Correction : CARRIED OUT INSPECTION SERVICE.

1.00 WORKSHOP SUNDRIES

7.56

7.56

SIsId : RA920034538:01 Total : \$2,366.94

Date Invoice : 05/26/2025

OdomIn: 829,115

OdomOut: 829,115

Sold Operations

OpsId : 1 Job : 00 ROADWORTHY INSPECTION WITH LSIT/COST OF WORK REQUIRED

Cause :

Correction : C- ROADWORTHY INSPECTION WITH LSIT/COST OF WORK REQUIRED

OpsId : 2 Job : 00 BATTERIES NEED REPLACING

Cause :

Correction : COMPLAINT: BATTERIES NEED REPLACING

2.00 ELECTRICAL SYSTEM BATTERY

911.47

1,822.94

0.00 EX MELB

0.00

0.00

SIsId : RA920022753:01 Total : \$3,029.16

Date Invoice : 05/02/2024

OdomIn: 747,815

OdomOut: 747,815

Sold Operations

OpsId : 1 Job : 49 ADBLUE ISSUE, Not dosing AdBlue

Cause :

Correction : C: ADBLUE ISSUE - NOT DOSING ADBLUE

OpsId : 4 Job : ASR ADBLUE FILTER CLOGGED

Cause :

Correction : C: ADBLUE FILTER CLOGGED

1.00 DEF FILTER

327.11

327.11

0.00 FILTER ELEMENT

175.15

0.00

0.00 EX MELB

0.00

0.00

OpsId : 5 Job : ASR ADBLUE LINE METER UNIT TO PUMP FRACTURED - NEEDS TO BE RI

Cause :

Correction : C: ADBLUE LINE METER UNIT TO PUMP FRACTURED - NEEDS TO BE REPLACED

1.00 ADDITIVE LINE

992.05

992.05

0.00 ADDITIVE LINE

992.05

0.00

0.00 EX MELB

0.00

0.00

SIsId : ES920001172

Total : \$34,261.01

Date Invoice : IN SHOP

OdomIn: 0

OdomOut: 0

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Rejected Operations

OpsId : 3 Job : ASR IMPACT DAMAGE TO FRONT GRILL - REPLACE

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	COVER GRILL	606.34	606.34
0.00	in stock - needs painting	0.00	0.00
1.00	COVER GRILL	366.36	366.36
0.00	in stock - grill support bracket	0.00	0.00

OpsId : 4 Job : ASR BOTH SIDE MIRROR LOWER TRIM PIECES MISSING

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	COVER	42.71	42.71
0.00	in stock	0.00	0.00
1.00	COVER	39.89	39.89
0.00	in stock	0.00	0.00

OpsId : 5 Job : ASR FRONT BLIND SPOT MIRROR TOP TRIM COVER MISSING

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	COVER	42.79	42.79
0.00	in stock	0.00	0.00
1.00	COVER	51.13	51.13
0.00	in stock	0.00	0.00

OpsId : 6 Job : ASR BOTH BULL BAR LIGHTS ARE MISSING - TO BE REPLACED

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
2.00	INDERATOR LIGHT LED	38.94	77.88
0.00	in stock	0.00	0.00

OpsId : 7 Job : ASR P/S LOWER STEP CRACKED + STEP TREAD MISSING - REPLACE

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	ENTRANCE - painting required	567.47	567.47
0.00	in stock	0.00	0.00
1.00	STEP PLATE	34.69	34.69
0.00	in stock	0.00	0.00
1.00	STEP PLATE	34.69	34.69
0.00	in stock	0.00	0.00
1.00	STEP PLATE	41.99	41.99

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Rejected Operations (Cont.)

0.00	in stock	0.00	0.00
1.00	STEP PLATE	41.99	41.99
0.00	in stock	0.00	0.00
4.00	EXPANSION RIVET	5.52	22.08
0.00	in stock	0.00	0.00

OpsId : 8 Job : ASR ADBLUE CAP MISSING - POSSIBLE CONTAMINATION IN SYSTEM WIL

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	ADBLUE CAP NON-VENTED	76.42	76.42
0.00	in stock - suit hilton tank	0.00	0.00
1.00	NOX REDUCING AGENT	77.68	77.68
0.00	in stock	0.00	0.00

OpsId : 9 Job : ASR IMPACT DAMAGE TO FRONT BULLBAR - REQUIRES SUBLET TO ATTE

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
------	--	------	------

OpsId : 10 Job : ASR STEER TYRE TREAD HAS UNEVEN WEAR - REQUIRES WHEEL ALIGN

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
------	--	------	------

OpsId : 11 Job : ASR D/S STEP CRACKED - REPLACE STEP + STEP THREAD

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	ENTRANCE	567.47	567.47
0.00	ex melb - needs painting	0.00	0.00
2.00	STEP PLATE	34.69	69.38
0.00	ex melb	0.00	0.00
1.00	STEP PLATE	41.99	41.99
0.00	in stock	0.00	0.00
1.00	STEP PLATE	41.99	41.99
0.00	in stock	0.00	0.00
4.00	EXPANSION RIVET	5.52	22.08
0.00	in stock	0.00	0.00

OpsId : 12 Job : ASR DPF MARKER LIGHT IMPACTED - REQUIRES REPLACMENT

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	MARKER LAMP	64.26	64.26
0.00	ex melb	0.00	0.00

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Rejected Operations (Cont.)

2.00	HEXAGON NUT	3.41	6.82
0.00	in stock	0.00	0.00

OpsId : 13 Job : ASR FUEL TANK GRAB HANDLE IMPACTED - REQUIRES REPLACEMENT
Cause :
Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	HANDLE GRAB	135.49	135.49
0.00	in stock	0.00	0.00

OpsId : 14 Job : ASR D/S + P/S FUEL TANK MARKER LIGHTS INOP + 1 IS MISSING
Cause :
Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
2.00	MARKER LAMP	64.26	128.52
0.00	ex melb	0.00	0.00
4.00	HEXAGON NUT	3.41	13.64
0.00	ex melb	0.00	0.00

OpsId : 15 Job : ASR D/S TAIL LIGHT NOT SECURED CORRECTLY + WIRES DAMAGED
Cause :
Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	TAIL LIGHT BRACKET	45.04	45.04
0.00	in stock - black flat bar style	0.00	0.00

OpsId : 16 Job : ASR FRONT RADAR SENSOR IS MISSING
Cause :
Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	CU DISTANCE SENSOR	3,182.76	3,182.76
0.00	in stock 1 only	0.00	0.00

OpsId : 17 Job : ASR A/C LINES IMPACTED/ CRUSHED
Cause :
Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	REFRIGERANT LINE	209.54	209.54
0.00	in stock	0.00	0.00
1.00	SUCTION LINE	570.20	570.20
0.00	in stock	0.00	0.00

OpsId : 18 Job : ASR COOLANT LINES UNDER LINES GRILL ARE CRUSHED
Cause :
Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	MOLDED HOSE	50.25	50.25

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Rejected Operations (Cont.)

0.00	Drivers side	0.00	0.00
0.00	in stock	0.00	0.00
1.00	MOLDED HOSE	59.34	59.34
0.00	Passenger side	0.00	0.00
0.00	ex dealers	0.00	0.00

OpsId : 19 Job : ASR HEADER TANK FITTINGS CRACKED

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	EXPANSION RESVR COOLANT	868.59	868.59
0.00	ex melb	0.00	0.00

OpsId : 20 Job : ASR PGOG STICK RUSTED AND BENT - REQUIRES REPLACEMENT

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	POGO STICK HEAVY DUTY	70.27	70.27
0.00	in stock	0.00	0.00

OpsId : 21 Job : ASR FOG LIGHT IMPACTED - REQUIRES REPLACEMENT

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	FRONT FOG LAMP	225.26	225.26
0.00	LH - in stock	0.00	0.00
1.00	FRONT FOG LAMP	225.26	225.26
0.00	in stock	0.00	0.00
0.00	no mention if LH or RH is required	0.00	0.00

OpsId : 22 Job : ASR BOTH DOOR HINGE TRIM PANELS DAMAGED

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	COVER	92.29	92.29
0.00	LH - IN STOCK - NEEDS PAINT	0.00	0.00
1.00	COVER	130.47	130.47
0.00	RH - EX MELB - NEEDS PAINT	0.00	0.00

OpsId : 23 Job : ASR P/S J BRACKET ON FUEL TANK BRACKET IMPACTED

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	BRACKET L W ANGLE LH	197.01	197.01
0.00	IN STOCK	0.00	0.00

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Rejected Operations (Cont.)

OpsId : 24 Job : ASR A3 AIR BAGS PERISHED - REQUIRE REPLACEMENT

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
4.00	AIR SUSP BELLOWS RA	697.59	2,790.36
0.00	IN STOCK	0.00	0.00
4.00	SCREW PLUG	46.20	184.80
0.00	IN STOCK	0.00	0.00

OpsId : 25 Job : ASR REAR CAB MOUNTS PERISHED - REQUIRE REPLACEMENT

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
2.00	ELASTOMER BEARING	24.47	48.94
0.00	IN STOCK	0.00	0.00

OpsId : 26 Job : ASR PSF CONTAMINATED WITH ENGINE OIL

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
12.00	TRANSMISSION - ALLIANCE PRIME FLEX ATF III (205L) - QABP AFM4958205	14.44	173.28
1.00	POWER-STEERING PUMP	1,518.74	1,518.74
1.00	CORE - POWER STEERING PUMP	254.21	254.21
0.00	CORE MUST BE CLEANED AND RETURNED IN ORIGINAL PACKAGING	0.00	0.00
0.00	IN STOCK	0.00	0.00
1.00	PROFILE SEAL	27.84	27.84
0.00	IN STOCK	0.00	0.00
1.00	OIL FILTER	21.86	21.86
0.00	IN STOCK	0.00	0.00

OpsId : 27 Job : ASR DRIVE BELTS FRAYED - REQUIRES REPLACEMENT

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	POLY-V-BELT	134.11	134.11
0.00	IN STOCK	0.00	0.00
1.00	POLY-V-BELT	48.87	48.87
0.00	IN STOCK	0.00	0.00

OpsId : 28 Job : ASR MUD FLAP ON D/S MISSING

Cause :

Correction :

0.00	Choose appropriate Labour Guide for type of work to be performed	0.00	0.00
1.00	VTC M/FLAP AS 18X26	34.41	34.41
0.00	IN STOCK	0.00	0.00

212380

473909C0611304

W1T96342420498541

YEAR

MAKE

MODEL

IN SERVICE

2021

MB

2663 LS 6X4 F

01/07/2021

Rejected Operations (Cont.)

OpsId : 29 Job : ASR A4 MUD GUARD POLES LOOSE - REQUIRES TIGHTENING

Cause :

Correction :

0.00 Choose appropriate Labour Guide for type of work to be performed 0.00 0.00

OpsId : 30 Job : ASR ALL BRAKES LOW - REQUIRE REPLACEMENT

Cause :

Correction :

0.00 Choose appropriate Labour Guide for type of work to be performed 0.00 0.00

1.00 DISK BRAKE PAD 292.06 292.06

0.00 IN STOCK - STEER 0.00 0.00

2.00 DISK BRAKE PAD 284.98 569.96

0.00 IN STOCK - DRIVE 0.00 0.00

OpsId : 31 Job : ASR DPF FILTERS DUE FOR REPLACEMENT

Cause :

Correction :

0.00 Choose appropriate Labour Guide for type of work to be performed 0.00 0.00

1.00 DIESEL PARTICULATE FILTER 1,186.95 1,186.95

1.00 CORE - DIESEL PARTICLE FILTER 3,057.62 3,057.62

0.00 CORE MUST BE CLEANED AND RETURNED IN ORIGINAL PACKAGING 0.00 0.00

0.00 IN STOCK 0.00 0.00

1.00 PROFILE CLAMP EXH SYS 174.09 174.09

0.00 IN STOCK 0.00 0.00

1.00 FASTENING CLAMP 224.49 224.49

0.00 IN STOCK 0.00 0.00

1.00 METAL SEAL SINGLE LAYER 33.48 33.48

0.00 IN STOCK 0.00 0.00

1.00 ANTI-TAMPER SEAL 11.85 11.85

0.00 IN STOCK 0.00 0.00

OpsId : 32 Job : ASR MAJOR SERVICE DUE - C SERVICE

Cause :

Correction :

0.00 Choose appropriate Labour Guide for type of work to be performed 0.00 0.00

42.00 ENGINE - ALLIANCE PRIME ENGINE GLOBAL 10W40 (5L) - QABP AFM4982004 14.86 624.12

12.00 GEAR OIL - ALLIANCE PRIME TRANS PLUS MB 75W90 (20L) - QABP AFM4301 29.85 358.20

28.00 GEAR OIL - ALLIANCE PRIME AXLE PLUS 235.8 75W90 (205L) - QABP AFM461 25.36 710.08

40.00 COOLANT - ALLIANCE PRIMECOOL GP P-40 (5L) - QABP AFM4604005 9.89 395.60

1.00 GREASE - ALLIANCE AFX2 GREASE (180KG) - QABP AFM4215180 17.49 17.49

0.30 GREASE - COMPLEX (400G) - A001989405109 65.24 19.57