

| |
|--|
| Asset: RDT10 (R60C) |
| Serial Number: 76408 |
| Hours : 16,549 |
| Comment |
| 4/9/24 Densley Time sheet 20790 Hours - Remove head board and place in tipper body |
| 13/12/2023 - SOS Engine Oil Sample - 20788 Hours No Action Needed |
| 22/11/2023 - MCE Service Report 750 Hour service performed by Kevin Jones @ 20788 Hours Service Comments: Needs Auto electrical to look at reverse lights and squawker. Make decision on duo. Service complete |
| 11/08/2023 - SOS Engine Oil Sample No Action Required |
| Densleys Timesheet – 04/09/2023 EX05 – 4780 Hours Unload all waste oils and filters from weekend services. Order coolant level sensor for a ADT17. Fill out all oil samples. Fill out app and do service sheets. Ring and Discuss ADT17 coolant loose issue and level sensor. |
| 30/08/2023 - MCE Service Report 500 Hour service performed by Kevin Jones @ 20472 Hours Service Comments: Nil |
| Densley Time Sheet – RDT09 – 20356 Hours Make a list for cabin to be sealed Start to clean |
| 25/04/2023 - SOS Engine Oil Sample - 20249 Hours Result: No Action Required |
| 05/05/2023 - MCE Service Report 250 Hour service performed by Kevin Jones @ 20249 Hours Service Comments: Nil |
| 26/04/2023 - Densley Service Time Sheet - HMR 20159 Change out faulty trans temp sensor and test as fixed Noticed input yoke bolts on trans broken, found other suitable bolts Cut to correct length and fit, Refit shaft Add 10 Litres engine oil |
| 20/04/2023 - SOS Engine Oil Sample - 20091 Hours Result: No Action Required |
| 29/03/2023 - MC Earthmoving Service Report Service performed by Orland Mahamis @ 20091 Hours Service Comments: Oil leak around hydraulic pump (need new gasket) Worn out frame rubber plates. |
| Densley Service Time Sheet @ Engine hours 20051 Hours Check over truck with new operator Rod Top up engine and hydraulic oils is very low Cheque trans warning light as shift control fault Control lever is badly worn and replacement recommended Still OK to operate |
| Densley Service Time Sheet @ 19983 Hours Ball joint dropped off steering link at dump Straighten and re-join, drive to shed Start removing Change front struts back to 200mm Wash front steering components check component condition for damage or cracks, all ok Carry out steering wiggle test, all firm Top up trans oil as low Chelsea drive box shaft leak |
| 20/02/2023 - MC Earthmoving Service Report Service performed by Orland Mahamis @ 19867 Hours Service Comments: Oil leak on hydraulic pump. Rubber on LH side front suspension is damaged. |
| Densley Service Time Sheet @ 19788 Hours Pen has dropped into cabin fan, Remove fan and pen Fit new reo slat to fin so all speeds now work |
| 03/01/2023 - MCE Service 500 Hour service performed by Wayne Jeffreys at 19551 Hours Service Comments: Replaced seat belt at this service. Use sealant to seal chelsea drive shaft leak. R/h rear strut bush collapsing and will need attention soon . Replace r/h blown headlight globe. |
| 19/12/2022 - Densley Service Time Sheet @ 19516 Hours Truck not starting, carry out test to find start relay fuse blown. Replace Start Relay, now has power but will not switch Organise HT Auto for repairs |
| 03/01/2023 - Densley Service Time Sheet @ 19551 Hours Carry out full 500 Hour Service Replace lower front headlight globe Replace broken seat belt with bell seat Chelsea drive has oil leak, leaking around shaft, clean and fill with Silastic RH Rear lower strutt bush starting to collapse, will need replacing Truck wouldnt crank, Test to find power at starter but nothing happening, Organise HT Auto for Monday |
| 12/10/22 - Densley Service Time Sheet Machine Hours: 19446 Hours Pick up computer at Densleys Refit to truck Ready for trans to be fitted next week |
| 23/07/22 Densley Service Report Machine Hrs: 19,446 Recover truck from rock stock pile Hook up manitou to charge steer accumulator and walk truck to yard with dozer and ZX850 |
| 22/07/22 Densley Service Report Machine Hrs: 19,446 Sort out how to charge accumulator so we can get steering on truck when towing Get Enzed to make up hose from manitou to charge with shut off tap |
| 21/07/22 Densley Service Report Machine Hrs: 19,446 Engine failure Check Start to recover with dozer & excavator on rock stock pile |
| 01/06/22 Densley Service Report Machine Hrs: 19,165 - Carry out 500hr service - Tap and remount cab filter cover - Refit LH rear wheel mud flap - Adjust alternator belt and fit broad spacer under adjustment screw as its boring a hole into timing case cover - Trans oil changed, traces or clutch plate in trans screen, will monitor. |
| 02/05/22 - RDT09 - Service Report 1000 and 250 Hr combined at engine hours 19165 by Kevin Jones Next Service will be 500hr. . Water pump has oil leak. Pos 2 front tyre needs change out. |
| 09/12/2021 - MCE maintenance report: 250 hr service |
| 17/11/21 - Densley service timesheet: "-Replace broken 'T' piece, enzed supplied -top up hyd oil + engine oil." |
| 27/10/21 - Densley service timesheet: Help kevin finish off 1000hr service. -change trans oil and suction screen clean. -grease all shafts and park brakes -check front wish bose for crackers. -check belts and general check. |
| 27/10/21 - MCE maintenance report: 1000 hours service |
| 07/10/21 - Densley service timesheet: Operator complaint of LH side struts feel down. check front and rears gas pressures ok, just added a bit extra to increase that side height. |
| 14/09/21 - Densley service timesheet: Carry out 250hr service, full check over and grease |
| 15/09/21 - MCE 250 hours service maintenance report |
| 03/02/21 - MCE: 250 hours service |
| 04/06/21 - Kevin Jones: 500 hours service |