

MAINTENANCE
Unit #708 - 2018 JD 850K Dozer
S#XVJF327143

Date	Hours	Work Performed
Aug 16/18	324	Service - 15w40 oil , O. air [Amos]
Oct 10/18	648	Service - 0w40 oil , both fuel , both air [Levi]
Nov 23/18	1076	Service - 0w40 oil , both fuel , O. air , replace short left angle cyl hose [Amos]
Nov 18/19	2250	Service - 5w40 oil [Levi]
Nov 27/19		Change angle hose , change hose under cab [DJ]
Jan 14/19	2,637	Service - 5w40 oil , both fuel , O. air , check lites , perform check list [Amos]
Jan 24/20		Change both left angle hoses [Amos]
Mar 10/20	3011	Service - 5w40 oil , both fuel , both air [Amos]
April 1, 2020	3181	Brandt - Install new motor
Aug 21/20	3396	Service - 5w40 oil , both fuel , O. air , SOS motor # 30478274 [Amos]
Sept 25/20		Replace A/C compressor & belt [Levi]
Oct 5/20		Replace coolant valve for DEF - DEF overheating [Levi]
Oct 28/20	3782	Service - 5w40 oil , both air [Levi]
Dec 11/20	3832	Replace LH rear angle hose , tighten both tracks , test run Espar [Levi]
May 18/21		Service - 5w40 oil , install new sprocket segments [Levi]
Nov 10/21	4633	Service - 5w40 oil , both fuel , both air [Levi]
Jan 8/22	4974	Service - 5w40 oil , both fuel , O. air [Curtis]
April 21/22	5258	Changed out faulty wiper motor RH [Clayton]
May 20/22	5374	Installed new cab mount bolts. [Levi]
August 19/22	5800	Service - 5W40, Both fuel, Both air filters. [Clayton]
Sept 30/22	5964	Replaced segments + installed Rails. Flipped edges. [Clayton]

MAINTENANCE
Unit #708 - 2018 JD 850K Dozer
S#XVJF327143

Oct 17/22	6000	New rails installed. Track shoe transfer -Finning
Nov 03/22	6159	Replace joystick base for blade control. [Chris]
Dec 08/22	6275	Service- 5W40, Water seperator, Outer Air. [Braylan]
Feb 02/23	3604	Install new DEF tank header sensor and new DEF tank. [Brandt Tractor @ wuthridge Pit]
Feb 24/23	6484	Replace blown hose near fan, replace o-rings and new hose. [Chris]
April 06/23	6521	Replace edges and corner bits. [Chris]
May 17/23	6650	Service - 5W40, Both fuel, Both air, cab filter. Replace fuses for condensor fans 1 and 2. fuse also blown for compressor clutch. Find short in clutch. Replace compressor, belt, charge AC 3.75 lbs. [Chris]
August 03/23	6727	Limp mode, warning alarm. SCR temp invalid. Replace aftertreatment sensor harness, run service regen. Codes clear but come back after operation for an hour. Reprogram (delete) performed by Northline Equipment . Pull SCR, DOC, and DPf and gut filters. Test. OK. [Chris]
Feb 07/24	7110	Service- 5W40, both fuel, both air. [Chris]
Feb 26/24	7196	Coolant leak under cab. Espar hoses, cut and splice new union. Replace EGR return pipe elbow and clamps. Repair hydraulic leak. [Chris]
March 05/24	7298	Could not change ripper cylinder due to wrong parts. Re-place o-ring on leaking ripper lines at rear of cab. [Chris]
Mar 06/24	7300	New ripper cylinder installed. [Jason]
June 21/24	7542	Service - 5W40, both fuel, air, Trans service. Hydraulic filter changed. Hard bar machined + new pins/bushings. RH pivot shaft bushing. New Espar heater installed. Pump hose to valve hydraulic replaced. Front hydrostatic pump swash plate side cover resealed. [Jason]
Oct 30/24	7828	Flip edge and corner bits. [Chris]
Feb 24/25	7895	Service- 5W40, both fuel, both air. Removed GPS [Jack]
June 01/25	8096	Check over machine. Top up fluids, grease machine. Install GPS, fix GPS. Diagnose trans malfunction was calibrated while requiring motor speed sensor. Change sensor . Would slip calibration, possible update. Help Brandt, adjust manually so would accept calibration. They got to pass, test was good. [Shannon]

Unit #708 - 2018 JD 850K Dozer
S#XVJF327143

Unit #708 - 2018 JD 850K Dozer
S#XVJF327143

[illegible]