

Red-Line Power Craft Ltd.
12806 100 St.
Grande Prairie, AB T8V 4H9
Phone: 780-532-4313

Repair Order Invoice

Doc Number: 11085
Service Writer: Travis O'Shea
Date Printed: 11/04/2024
Date Promised: 01/08/2020
Cashier: Trevor Thacker
Cashier Date: 01/31/2020

Customer Information

Home Phone: 780-827-1492
Cell Phone: 780-827-1492
Email: dave.mcammond@tourmalineoil.com

Unit 2019 Polaris S19EHM8RS 850 PRO-RMK 174 Color: Keyboard:
3" SC-SELECT
VIN/Serial No: SN1EHM8R0KC333094 Plate: Odom/Hrs In: 1,178 Out: 1,178

788121-14295A248 - CHECK FOR MOTOR QUIT RUNNING

Description:

Resolution:

TOOK PICS OF ALL 4 FOUR CORNERS OF THE SLED
-FOUND BOTTOM CRANK CASE BROKE FROM CONNECTING ROD BREAKING
-REMOVED ENGINE FROM UNIT AND TORE DOWN ENGINE
-FOUND LOSS OF OIL TO PTO SIDE OF CRANK AND SEIZED PTO SIDE AND BROKE CONNECTING ROD
-QUOTED A LONG BLOCK
-PTO SIDE REED IS BROKE, QUOTED
-EXHAUST VALVE WAS HITTING SIDES OF ENGINE AND MARKED VALVES, QUOTED NEW EXHAUST VALVES AND GASKETS
-QUOTED EXHAUST GASKET, 2 SPARK PLUGS, COOLANT
-ALSO FOUND FRONT LEFT ENGINE MOUNT BROKE AND ALSO CAUSED LEFT SIDE BRACE WHERE ENGINE MOUNT BOLTS TO DOWEL PIN HOLE IS OBLONGED AND THREADS ARE MARKED UP, QUOTED LEFT SIDE BRACE, MOUNT, AND ADHESIVE
-ALSO FOUND THROTTLE BODY BOOT BENT, QUOTED
-QUOTED WHAT IS NEEDED HOURS AND KMS ARE ON THE WORK ORDER

-RECIEVED NEW ENGINE, INSTALLED STATOR, FLYWHEEL AND TORQUED ALL TO SPEC
INSTALLED NEW REED VALVE ASSEMBLY ON PTO SIDE AND INSTALLED ORIGINAL MAG SIDE BACK IN
-INSTALLED THROTTLE BODY
-INSTALLED FUEL RAIL WITH NEW GREEN INJECTOR O-RINGS
-INSTALLED NEW Y-PIPE GASKET AND INSTALLED Y-PIPE
-INSTALLED NEW EXHAUST VALVE ASSEMBLY
-INSTALLED OIL PUMP AND INSTALLED LINES IN PROPER LOCATIONS ACCORDING TO SERVICE MANUAL
-REMOVED OLD COOLANT BOTTLE AND INSTALLED NEW COOLANT BOTTLE AND INSTALLED COOLANT LINES
-REMOVED LEFT SIDE PLASTIC PANEL TO ACCESS SIDE ENGINE MOUNT
-REMOVED LEFT SIDE ENGINE MOUNT BRACE AND CLEANED ALL SEALANT OFF
-I REMOVED FRONT BUMPER AND SKID PLATE TO REMOVE SIDE MOUNT FOR ENGINE
-INSTALLED NEW ENGINE SIDE MOUNT WITH SEALANT AND TORQUED ALL FASTENERS TO SPEC
-INSTALLED SKID PLATE AND FRONT BUMPER
-INSTALLED SIDE PLASTIC WITH NEW RIVETS AND PUSH DART
-INSTALLED ENGINE AND TORQED TO SPEC 40FT LBS
-INSTALLED ALL WIRES AND COOLANT LINES, ZIP TIED ALL WIRES AND ROUTED IN PROPER LOCATIONS
-INSTALLED 2 NEW SPARK PLUGS
-INSTALLED EXHAUST SYSTEM AND CONNECTED TEMP SENSORS
-INSTALLED INTAKE SYSTEM
-INSTALLED CLUTCHES AND TORQUED TO SPEC
-CONNECTED OIL TANK AND ADDED COOLANT TO UNIT
-RESET FUEL AND OIL CALIBRATION FOR NEW ENGINE, ITS IN BREAK IN MODE
-I DID A EXHAUST VALVE RELEARN
-I PRIMED FUEL SYSTEM AND ALSO OIL SYSTEM AND VERIFIED OIL IS IN ALL LINES WHICH THEY WERE
-WHEN I WAS TRYING TO PUT HOOD ON I FOUND FRONT CLIPS THAT CLICK IN ARE BENT AND WILL NOT CLICK AND STAY, WITH SIDE PANELS ON HOOD WILL BE FINE BUT JUST WANTED TO MAKE NOTE OF THAT SO CUSTOMER KNOWS

Resolution:-STARTED UNIT AND BLEED COOLANT SYSTEM AND INSTALLED RAD CAP

-TOOK UNIT FOR A QUICK DRIVE AND UNIT DRIVES AND RUNS GOOD COOLING SYSTEM IS OPERATING PROPERLY
-PARKED UNIT BY BAMA BUILDING

Recommend:1178 KMS
732 MILES
55.7 HOURS

Parts

Part #	Qty	Description	Price	Discount	Total
2208234	1.00	K-LONG BLOCK 850 SNOW	WARRANTY	WARRANTY	WARRANTY
5416669	1.00	SEAL- WATERPUMP,	WARRANTY	WARRANTY	WARRANTY
1241176	1.00	WELD-COOLANT BOTTLE SINGLE	WARRANTY	WARRANTY	WARRANTY
2207894	1.00	K-EXHAUST VALVE ASM 850	WARRANTY	WARRANTY	WARRANTY
5814505	1.00	GASKET-EXH MANIFOLD	WARRANTY	WARRANTY	WARRANTY
1205639	1.00	ASM-REED VALVE,VFORCE,TG	WARRANTY	WARRANTY	WARRANTY
1205609	1.00	ADAPTER-THROTTLE BODY	WARRANTY	WARRANTY	WARRANTY
2204171	1.00	KIT-LORD 406 REPAIR KIT 50ML	WARRANTY	WARRANTY	WARRANTY
3023534	1.00	MOUNT-ENGINE,FRONT,PTO	WARRANTY	WARRANTY	WARRANTY
5142413	1.00	BRKT-ENGINE,FRONT,PTO	WARRANTY	WARRANTY	WARRANTY
7520894	1.00	SCR-HXFL-M10X1.5X40 DG PT P80	WARRANTY	WARRANTY	WARRANTY
7556733	1.00	WSHR-10.5X20.0X2.0 ZY3	WARRANTY	WARRANTY	WARRANTY
7547332	1.00	NUT-M8X1.25,FLG,NYLOC-OLIVE D	WARRANTY	WARRANTY	WARRANTY
1023784	1.00	ASM-BRACE LOWER LH	WARRANTY	WARRANTY	WARRANTY
5436287	2.00	INJECTOR BUSHING ELASTOMER	WARRANTY	WARRANTY	WARRANTY
5132835	1.00	PIN-DOWEL,M6X10	WARRANTY	WARRANTY	WARRANTY
7080603	2.00	CLAMP	WARRANTY	WARRANTY	WARRANTY

Parts Subtotal **WARRANTY**

Labor

Description	Hours	Total
	WARRANTY	WARRANTY
Labor Subtotal		WARRANTY
Warranty Deductible		\$52.50

Job Subtotal **\$52.50**

Approve: ☒ **Decline:** ☐

NON WARRANTABLE PARTS

Description:

Parts

Part #	Qty	Description	Price	Discount	Total
XX-BPR9ES	2.00	SPARK PLUG BPR9ES SOLID	\$5.99	\$0.00	\$11.98
GD-PREHDMF-3.78	1.00	ANTIFREEZE 50/50 HD	\$17.99	\$0.00	\$17.99

Parts Subtotal **\$29.97**

Job Subtotal **\$29.97**

Approve: ☒ **Decline:** ☐

All Jobs Subtotal: **\$82.47**

GST - 5.00%: **\$1.50**

Taxable - 5.00%: **\$375.42**

Total: **\$83.97**

Less Deposits: **(\$83.97)**

Total Due: **\$0.00**

GST # 104441357RT0001
NO RETURNS ON ELECTRICAL PARTS!

I AUTHORIZE THE OPENING AND KEEPING OF A MAINTENANCE AND REPAIR FILE FOR THIS VEHICLE AS WELL AS COMMUNICATING NECESSARY INFORMATION WITH THIRD PARTIES FOR THE REPAIR OF THE ABOVE VEHICLE. I ALSO GIVE YOU AND YOUR EMPLOYEES PERMISSION TO OPERATE THE VEHICLE HEREIN DESCRIBED ON STREETS, HIGHWAYS, OR ELSEWHERE FOR THE PURPOSE OF TESTING OR INSPECTION. I UNDERSTAND ANY ITEMS MAY REQUIRE DIAGNOSTIC TIME AND I AM RESPONSIBLE FOR THAT CHARGE (IF NOT COVERED BY WARRANTY). RED-LINE POWER CRAFT IS NOT RESPONSIBLE FOR LOSS OR DAMAGE TO THE VEHICLE OR ARTICLES LEFT IN VEHICLE IN CASE OF FIRE, THEFT, OR ANY OTHER CAUSE BEYOND RED-LINE'S CONTROL, OR FOR ANY DELAYS CAUSED BY THE UNAVAILABILITY OF PARTS OR DELAYS IN SHIPMENT OF PARTS BY THE SUPPLIER OR TRANSPORTER.

***ANY UNITS LEFT OVER 7 DAYS AFTER PICK-UP CALL HAS BEEN MADE ARE SUBJECT TO \$15.00/DAY STORAGE
***WASH CHARGES WILL APPLY AT OUR DISCRETION

Signature: _____