



Vehicle Standards and Inspection

Semi-Trailer Inspection Certificate

This Certificate is issued under the authority of the Province of Saskatchewan

Decal # A237584

Station #: 71141

Station Name: Tremcar West Inc.

Technician #: 88937

Technician Name: Kenn Daley

Signing Officer #: 82627

Signing Officer Name: Paul Bacik

Customer Details:

Name: Wayne MegLi

Address: BOX 607, CARROT RIVER, Saskatchewan, S0E0L0

Inspection Completed Date: 15Oct2025

Inspection Expiry Date: 31Oct2026

Vehicle Details:

VIN: 2H9DFDHG6ET002434

Hubometer Reading:

Year: 2014

Vehicle Make/Model: TREMCAR TRAILER/TRAILER

Plate:

Jurisdiction:

Unit:

Message(s): VIN has been validated.

This certificate does not warranty or guarantee the condition of this vehicle's components and systems for any period of time.

Ad-5



Vehicle Standards and Inspection

Semi-Trailer Record of Inspection

The Record of Inspection must be given to the customer regardless of whether the vehicle passes or fails.

Station #: 71141

Station Name: Tremcar West Inc.

Technician #: 88937

Technician Name: Kenn Daley

Signing Officer #: 82627

Signing Officer Name: Paul Bacik

Customer Details:

Name: Wayne MegLi

Address: BOX 607, CARROT RIVER, Saskatchewan, S0E0L0

Vehicle Details:

VIN: 2H9DFDHG6ET002434

Hubometer Reading:

Year: 2014

Vehicle Make/Model: TREMCAR TRAILER TRAILER

Inspection Details:

Pass	Rejected	Corrected	Req Attn	DRIVERS COMPARTMENT	Comments
x				Vehicle Identification (5)	
x				Fire Extinguisher (5)	
x				Auxiliary Controls/Equip (5)	

Pass	Rejected	Corrected	Req Attn	BODY EXTERIOR	Comments
		x		Lamps (6)	RF MARKER LIGHT OS. RH SIDE SIGNAL NOT WORKING WIRING AND LIGHTING REPAIRED
		x		Reflex Reflectors (6)	MISSING ON REAR IMPACT GUARD NEW REFLECTIVE TAPE INSTALLED
x				Retro Reflective Markings (6)	
x				Trailer Hitch (10)	
x				Attached Equipment (8)	
x				Cargo Bodies/Vessels (8)	
x				Mud Flaps/Fenders (8)	
x				Landing Gear (8)	
x				Rear Impact Guard (8)	
x				Trailer Power Cord (7)	

Pass	Rejected	Corrected	Req Attn	ENGINE COMPARTMENT	Comments
x				Fuel System (1)	

x				Battery/Wiring Condition (7)	
---	--	--	--	------------------------------	--

Pass	Rejected	Corrected	Req Attn	CHASSIS	Comments
x				Hyd Brake System/Components (3.1)	
		x		Air Brake System/Components (3.2)	RC CALIPER SEIZED LOWER PIN. LR, RF, RR, CALIPERS NEED TO BE ADJUSTED. RC NEW CALIPER INSTALLED ALL OTHERS CHECKED AND SET ABS LIGHT ON CODE 3. CAGING BOLTS MISSING; RR,LC,RC.
x				Elec Brake System/Components (3.1)	
		x		Wheel Bearings (9)	LF HUB OIL LOW. TOPPED UP
x				Tires/Wheels (9)	
x				Self-Steering Axle (2&4)	
x				Frame/Crossmembers/Mounts (8)	
		x		Suspension/Axles (2)	LF SHOCK BLOWN RR AIR BAG BASE CRACKED. AIR RIDE DUMP VALVE SEIZED. LF SHOCK REPLACED, RR AIR BAG REPLACED, AIR RIDE CONTROL VALVE REPLACED.
x				Exhaust/Emission System (1)	
x				Sliding Axle Assembly (if equipped) (8)	

Brake/Tire Measurements

axle 1-Pass

Wheel1 : Tire Tread Depth: 22 in

Brake(1): No Brake

I/A

Wheel2-Off : Tire Tread Depth: 22 in

Brake(1): Disc Brake

Min Brake Lining/Pad: 22 mm • Brake Drum/Rotor: 42 mm

Wheel3-Off : Tire Tread Depth: 22 in

Brake(1): Disc Brake

Min Brake Lining/Pad: 22 mm • Brake Drum/Rotor: 41 mm

Wheel4 : Tire Tread Depth: 22 in

Brake(1): No Brake

I/A

axle 2-Pass

Wheel1 : Tire Tread Depth: 20 in

Brake(1): No Brake

I/A

Wheel2-Off : Tire Tread Depth: 20 in

Brake(1): Disc Brake

Min Brake Lining/Pad: 14 mm • Brake Drum/Rotor: 42 mm

Wheel3-Off : Tire Tread Depth: 19 in

Brake(1): Disc Brake

/heel4 : Tire Tread Depth: 17 in

rake(1): No Brake

/A

3-Pass

/heel1 : Tire Tread Depth: 17 in

rake(1): No Brake

/A

/heel2-Off : Tire Tread Depth: 17 in

rake(1): Disc Brake

Min Brake Lining/Pad: 22 mm • Brake Drum/Rotor: 43 mm

/heel3-Off : Tire Tread Depth: 20 in

rake(1): Disc Brake

Min Brake Lining/Pad: 21 mm • Brake Drum/Rotor: 42 mm

/heel4 : Tire Tread Depth: 18 in

rake(1): No Brake

/A

PASS - vehicle passes inspection

Decal # A237584

Inspection Completed Date: 15Oct2025

One or more wheels were removed for inspection. Warning: Wheel nuts **MUST** be **RE-TORQUED** within 100-150 km.
Failure to do so may result in damage or serious injury.