

# ADAPT-A-LIFT GROUP PTY LTD

## Service History Listing Active Units

Date: 24/06/2026

Time: 3:08:54PM

For Equipment Code From: H12909 To: H12909

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1652280	F2 - Decomission and Removal of F2 (Demob and Relocation)	CMILLAR	12/09/2024	External	24250.0	\$26,132.90	<p>Carry out Demob of Hyster H52XM</p> <p>Carry out PTW and safe work establishment Prep machine for strip down in readiness for Crane Carry out PTW with crane operator and High Risk Work JSA Set up crane and prep for lift</p> <p>Remove Mast, Carriage and Spreader - Load Straight onto Semi Trailers Lower Cabin into transport position and prep machine for Heavy Haulage Removal</p> <p>Remove PN Stickers and local site aux items installed to machine Sign off crane and PTW's Clean Work Area</p> <p>Sign off Works</p>
1651861	F2 - Get unit operational in preparation for dismantle	SRomano	28/08/2024	Internal	24250.0	\$0.00	<p>Crane unload components at stoage facility Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Returned cab wiring connections. Refit covers. Start up unit. Prep unit for dismantle.</p> <p>Refitted back the wire harnesses. And put back the covers. All good.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1650632	F2 - return cabin harness to original connection	APATRIMONIO	22/08/2024	Internal	24250.0	\$0.00	Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  Returned cab wiring harnesses to original connections. Refit cab covers. Start up unit and moved out of wash bay. Tagged machine out of service.
1648396	Booking of oils	211 Planning F	14/08/2024	Internal	24250.0	\$0.00	
1641331	F2 - Drive Tyre Rotation	BIG TRUCKS NSW	17/07/2024	External	24230.0	\$1,545.60	
1627431	24250hr II 250hr Service	SRomano	16/07/2024	Internal	24230.0	\$0.00	250hr Service  Cartied out 250 hours srvice and inspection. Replaced engine oil and oil filter. Checking attachment for possible cracks. Found loose bolts of the wear pad bracket and retightng it. Greasing. screen lost settings reset tested ok
1636642	bottom lift camera not working	AMABBOTT	1/07/2024	Internal	24139.0	\$0.00	
1607170	F2 - 3G Sunset Device Swap (FM1 to VAM)	BIG TRUCKS NSW	30/06/2024	Internal	23914.0	\$0.00	
1631410	All lights & gauges are not showing on the dash. Ptk 777002	AMABBOTT	11/06/2024	Internal	24135.0	\$0.00	Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  confirmed instruments not working at all. checked fuse blown wire rubbed thru on dash, repaired ok Travel to site,
1631138	Spreader stuck at 20' won't extend to 40' POTkt 775830	AMABBOTT	11/06/2024	Internal	24134.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  traveled to site inspected spreader 30ft stop enguaged, deactivated all ok pick up parts. aattend site. sign in and fill out permit to work. head down to workshop. top coolent. start unit and found trans oil leaking from cooler line. remove cooler line and head to pirtek. once hose was made head back to pn and fit hose. ffill up trans with oil. 25L
1626775	F2 - overheating	CMILLAR	23/05/2024	Internal	24111.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1626305	F2 - bottom lift camera not working, fuel cap has been cracked	AMABBOTT	22/05/2024	Internal	24105.0	\$0.00	tech online crashed wouldnt let me in after completing job. traveled to site replaced cracked fuel cap. camera on reverse input while not in reverse. adjusted camera settings now when rev selected rev camera comes up and able to select leg camras while in fwd and neutral.
1623819	F2 - oil leak from underneath	APATRIMONIO	15/05/2024	Internal	24057.0	\$0.00	Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,  Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,  Inspect oil leak underneath the machine. Found main valve filter head leaking oil. Removed filter head and replaced blown O-ring. Start up machine and tested functions. Sent unit back in service.
1623190	Unit overheating. Showing codes E2646, E2659 & E0146. Tagged out. Ptkk 748892	AMABBOTT	14/05/2024	Internal	24043.0	\$0.00	Check/Inspect/Diagnose Cylinder Remove and Replace Coolant Hose/s  coolant leak loss of coolant and overheated repaired leak topped up coolant
1621006	Replace batteries x 4	CMILLAR	6/05/2024	Internal	23976.0	\$0.00	Travel to site,  Replace Battery,  collect batterys and head to site. sign into site. travel down to unit. remove and replace batterys. (batterys taken out where bigger but we could not get the same battery as there was no stock and a 2 week wait time) (batterys taken out DC31ASMF and batterys fitted DCN120-7LSMF) travel to workshop and unlock container. grab swipe pass. head back to unit. check starting system all ok. check batterys and check alternator all ok and working at time of inspection. take swipe pass back to workshop container and lock container. travel up to office and sign out.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1616298	F2 - Impact damage to hose roller on top of mast	AMABBOTT	1/05/2024	External	23967.0	\$4,885.92	Hose reel on top of mast broken/ bent removed all hoses removed and assessed damage, took to fab shop for repair as parts not in stock. pickup hose roller from repairer ewp from kennards refit to unit, adjust hoses test all ok
1596592	24000hr II 6000hr Service	AMABBOTT	1/05/2024	Internal	23803.0	\$0.00	Labour Travel to site, 2000hr Service picked up sherwin travelled to branch and collected parts. returned hyd suction filters and oil and crank case breather filter as hyd oil not getting replced and crank case breather not fitted as excessive blowby 5000hr Service Replaced engine oil&filter, trans oil&filters&breather, fuel filters, air filters inner&outer brake filters, control valve filter&o-ring, hydraulic filters&o-ring, hydraulic breather filters, diff oil, a/c filter, greasing.  Note: Remaining jobs, Mast inspection and wheel hubs gear oil change. Drain and refill differential oil, Attend site.Drained and refilled the diff centre . carry out mast inspection. lubricate chains refit park brake coil charge up/ jump start unit as down for 2 weeks batteries low voltage.  return ewp kennards
1618934	F2 - broken seat adjuster	211 Planning F	26/04/2024	Internal	23866.0	\$0.00	hub oil front and back is all that remains.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1604339	F2 - trans overheating - fit dipstick tube	211 Planning A	18/04/2024	Internal	23866.0	\$0.00	<p>Blow out radiator core,</p> <p>Top up Engine Oil as required,</p> <p>trans overheating cooler blocked, steam cleaned cooler. topped up eng oil dipstick tube split spraying eng oil over side of motor. washed down ordered new dip stick tube</p> <p>Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items,</p>
1613415	F2 - wiper system failure	AMABBOTT	8/04/2024	Internal	23966.0	\$0.00	<p>replaced dip stick tube. Replace Windscreen Wiper,</p> <p>wiper blades off screen, removed and refitted arm in correct location, replaced wiper blades.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1613366	F2 - oil leak from spreader, error codes LE300, E0556 & overload warning	AMABBOTT	8/04/2024	Internal	23966.0	\$0.00	<p>Labour</p> <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>picked up parts and travelled to site code e0556 not present, sensor ordered incorrect, removed and cleaned out current sensor.</p> <p>overload warning present on mdt screen, checked LMI screen and in red with incorrect values. plugged in tablet and confirmed readings incorrect. checked all wiring to mast sensor. found broken wire at connector on mast. cleaned area, trimmed some cable and reinstalled connector. retested unit now reding as normal.</p> <p>Replace Switch/es</p> <p>picked up sensor from cummins installed additional crank case sensor outside of valve cover as error intermittently coming up due to excessive blowby</p>
1612406	Engine fault light, batteries are flat	AMABBOTT	3/04/2024	Internal	23959.0	\$0.00	<p>Carry out Inspection and Diagnosis of Electrical System</p> <p>checked fluid levels, ok batteries low wouldnt start hooked up truck fot half hour to charge them up then jump started. ran unit crank case breather codes no longer showing up. to be monitored.</p>
1611170	F2 - in limp mode error code E0556	211 Planning F	27/03/2024	Internal	23957.0	\$0.00	
1615796	Scheduled Service - Fire Suppression System Service - 12 Months	BIG TRUCKS NSW	21/03/2024	Internal	23966.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1608547	Error Code E0556	SPREMACHANDRA	18/03/2024	Internal	23941.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  Locate the unit , Carry out troubleshooting of error code E0556. crank case pressure above normal operating range, Checked crank case pressure sensor harness and connector , Remove and clean the sensor , Remove and clean breather assembly , Started and tested , Blow out radiator core,
1607957	Located workshop. Check engine light on. Error codes E300 & E4308. In limp mode. Ptk 692297	SRomano	14/03/2024	Internal	23925.0	\$0.00	Washing the radiator (was so dusty). Did the engine run atleast 30 minutes, the temperature is on normal with no error codes. Washing the engine compartment due to oil spillage coming from the dipstick tube.(parts already ordered). REMOVE AND REPLACE KEY PAD WITH NEW. Opened the whole keypad and checked then cleaned. Fixed back.
1606543	F2 - full stop button not working on the MDT	SRomano	12/03/2024	External	23914.0	\$344.21	
1606219	EGR Cooler Components Cost	BIG TRUCKS NSW	7/03/2024	Internal	23904.0	\$0.00	
1599979	F2 - Replacement Steer Rims	BIG TRUCKS NSW	27/02/2024	External	23959.0	\$7,119.66	
1603279	F2 - exhaust fumes smell inside cabin	SPREMACHANDRA	23/02/2024	Internal	23833.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Locate the unit , Set up safe work area , Check the unit for exhaust smell inside the cabin, Remove covers and inspect, Found open passage under the cabin could cause enter exhaust fumes in to the cabin, Door (RH). not sealing properly, Cover the passage with sponge, Adjust the door latch, Tested the unit,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1585475	F2 - bottom lift camera not working	AMABBOTT	20/02/2024	Internal	23823.0	\$0.00	<p>Carry out Inspection and Diagnosis of Attachment Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Both drop down leg cameras weren't working. Reset screen. Right hand leg camera back online. Inspect left camera for fault, found pinched cable at leg knuckle. Repaired cable and test camera, camera still nit working. Unit requires a new camera and harness.</p> <p>Labour</p> <p>Removed the camera from M4 and send it to NSW.</p> <p>Fit Full Camera Kit,</p> <p>Changed bottom lift camera at right hand side. Checked engine oil level and transmission oil level.</p> <p>Note: I filled 17 liters of engine oil and 19 liters of transmission oil.</p> <p>Travel to site,</p> <p>removed and replaced camera cabke that runs through drop down leg and up over spreader with new cable from rvs. soldered new cannon connector onto cable tested now working. reprogrammed screen to show both leg cameras in normal mode then rear camera in reverse. Repair Air Conditioner as necessary ,</p>
1596351	F2 - broken AC compressor bracket/extract broken AC compressor mounting bolts	APATRIMONIO	7/02/2024	Internal	23803.0	\$0.00	<p>Removed and welded broken compressor bracket. Extract broken mounting bolts. Refit bracket and ACU compressor. Note: compressor belt for replacement, machine tagged out of service.</p>
1596268	F2 - bottom lift arms not working	CMILLAR	29/01/2024	Internal	23803.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>carry out inspection of unit for drop down legs. test drop down legs and could not fault at time of inspection. park unit back in parking bay.</p>
1596054	F2 - ERG cooler replacement cost conducted 30/10/23 - 1575250	211 Planning F	25/01/2024	Internal	23790.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1592371	Machine in limp mode - fault coded TE300 & TE101	DMCDONALD	12/01/2024	Internal	23723.0	\$0.00	<p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Unit parked up with reports of reduced speed whilst locked to container and TE300 and TE100 on dash.. Checked proxy adjustment, checked connections.. found some old repairs with rough solder joints, re connected, cleaned all plugs as residual oil found on external of 4 pin plugs, tested continuity all ok with 0.3 ohms between harness.</p> <p>Downloaded and installed Hyd User Intreface prog on tablet. Checked intenal parameters all signal recieved from proximity switches.</p> <p>waited for operator and went for a run to move a few boxes, found on one occasion the attachment did not have sufficient slew back causing speed limiting , explained to operator and he ammended. all ok at time of test.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1591566	Truck going into limp mode	DMCDONALD	9/01/2024	Internal	23719.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  Replace Exhaust Manifold,  Labour  Repair Exhaust Manifold as required,  Carry out Inspection and Diagnosis of Mast/Carriage  Repair Mast as necessary,  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  Unit constantly showin t300. Carry out diagnosis for cause of fault, found mast proxy wiring had bad circuit. Repaired mast and proxy harnesses. Test unit, tested ok.  Machine Parked up, reports of DTCs and reduced speed.. Confirmed DTCs in history showing E01866, E3741, E4863.. Codes not active at initial time of test.. Concern did reappear the following day and I was able to capture fault, DTCs relating to EGR manifold pressure mismatch.. Removed EGR, cleaned ports, re assembled, tested and found DTCs cleared, returned to service.. Machine returned with same Complaints, found sensor to have internal fault plus sensor plug worn and not properly retaining plug, replaced sensor, tested, all ok after repair. 250hr Service
1588978	23750hr II 250hr Service	BIG TRUCKS NSW	5/01/2024	Internal	23470.0	\$0.00	250hr Service
1590254	RUNNING SLOW	TARTHUR	2/01/2024	Internal	23701.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Electrical System  Repair Exhaust pipe as required,  Repair Switch/es  Cleaned out blocked sensors. Test Idle engine for 5 minutes to confirm codes are cleared, codes are cleared.
1589853	3X ERRORS CODED - UNIT IN LIMBO	BIG TRUCKS NSW	27/12/2023	Internal	23470.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1589632	F2 - Telemetry Not Reporting	BIG TRUCKS NSW	22/12/2023	Internal	23470.0	\$0.00	Carry out Inspection and Diagnosis of Telemetry System  Repair Fleet Management System as required,  Inspect telematics, as I was not given any indication to the fault extra time was taken to check all aspects of the reporting system, Confirmed gsm/gps connection, checked reports are being recieved.. Found hour meters not current and no engine RPM being recieved.. Suspecting CAN BUS connection failure I tested signal at the FM1 module and found a break in connection, traced all connection and harness, found broken wires causing loss in comms.  repaired connection, tested and found display to have rpm and current hour meters.
1589441	F2 code e1866	AMABBOTT	21/12/2023	Internal	23570.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  code e1866 egr pressure sensor checked connections, wiring no faults found at time of testing code intermittant fault to be monitored
1587741	F2 - error codes 0556 and E300	DMCDONALD	15/12/2023	Internal	2574.0	\$0.00	Check/Inspect/Diagnose Cylinder  Travel to site, inspect unit for error codes.. Discovered codes illuminated are H0401 and H0412.. These codes were joystick calibration codes.  Completed joystick calibration and tested.. all ok after repair.
1586944	F2 - reported burning smell	SPREMACHANDRA	12/12/2023	Internal	23574.0	\$0.00	The codes listed on the breakdown were not active at time of diagnosis. Repair Air Conditioner as necessary ,  Operetor complain abnormal smell from the ac system and error code on display (E0556)intermittantly Check and cleand ac filters, found out air circulation switch off position , E0556 crank case pressure abnormal operatin range,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1586229	F2 - overheating, waterpump failure	WJONES	11/12/2023	Internal	23574.0	\$0.00	BRING UNIT INTO WORKSHOP AND SET UP SAGE WORK AREA REMOVE ENGINE COVER PLATE WASH DOWN TIMING GEAR AREA OF ENGINE REMOVE MAIN BELT SET UP DRAIN TRAY UNDER WATER PUMP AREA OF ENGINE REMOVE FAILED WATER PUMP CLEAN UP SURFACES MAKE GUIDE BOLT INSTALL NEW WATER PUMP AND ORING TOP UP COOLANT RUN ENGINE UP TO TEMP TO ENSURE NO LEAKS AND LEVEL IS CORRECT Carry out Inspection and Diagnosis of Wheel
1582827	tyre pressure monitor has stopped working	WJONES	27/11/2023	Internal	23517.0	\$0.00	INSPECT TPMS SYSTEM OK
1581335	Missed crane invoice for F2 job 1576259	211 Planning F	22/11/2023	Internal	23470.0	\$0.00	
1580413	F2 - Cummins to attend replace harness and sensor	AMABBOTT	17/11/2023	Internal	23480.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  Labour  Travel to site,  Repair Exhaust Manifold as required,  Repair Turbo as necessary,  unit had e2554 exhaust gas sensor 1 erratic, intermittant  cummins replaced sensor unit no start after service assisted cummins to get unit started found fuel leak as larger fuel filter binding up on thread and not fully seating. installed another filter, now running  code e2554 still occurring removed sensor, fitted in end of pipe, filled pipe, liquid not draining pipe blocked had pirtek make new pipe cleared port in exhaust manifold customer ran machine fault to be monitorred so far code no longer present.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1569059	F2 - 23500hr II 500hr Service	WJONES	13/11/2023	Internal	23471.0	\$0.00	Travel to site,  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Bleed Fuel System to remove air,  CARRY OUT 500HR SERVICE REPLACE ENGINE OIL AND FILTER REPLACE FUEL FILTERS REPLACE ENGINE AIR FILTERS  ENGINE CRANKING BUT NOT FIRING FUEL RELATED ISSUE
1578470	service kit Hyster J117_0500Hr SrvKit_DSL_H40-52XM-16CH_T4. 0500 Hour Service	211 Planning F	9/11/2023	Internal	23470.0	\$0.00	
1577650	F2 - E0556 error code & stopped functions	RLE	7/11/2023	Internal	23469.0	\$0.00	
1577990	F2 - air con not working	211 Planning F	3/11/2023	Internal	23469.0	\$0.00	
1576259	F2 - replace bearings on RH chain sheave	AMABBOTT	31/10/2023	Internal	23439.0	\$0.00	Replace Chain Sheave,  unit down for repair did walk around/ inspection rh chain sheave on lean collapsed bearing. unloaded chain confirmed movement in bearing  Remove ancillary items and Chain Sheave, Strip, Inspect and report,  Labour  removed chain removed overmast hose rollers to gain access removed damaged pin removed roller caught just in time roller ok cleaned all components replaced bearings and seals installed and adjusted preload filled with grease refitted hose rollers and chain
1575619	Unit Checks of the TPMS	CMILLAR	27/10/2023	Internal	23432.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1575250	F2- Cummins to replace EGR Cooler	AMABBOTT	26/10/2023	Internal	23439.0	\$0.00	<p>Overhaul Engine assembly as required,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>attend site and carry out inspection of unit. found that alternator is seized and belt has broken. order new parts. escort cummins down to workshop for egr replacement cummins have done their part. once parts have arrived at wp in the morning i will contact tech on job.</p> <p>Labour</p> <p>Replace alternator,</p> <p>Replace Fan Belt,</p> <p>pickup alt plus belt wp travel to site fit alt belt too small went truckline to get bekt nil stock wp fit belt run engine check for leaks all ok</p> <p>replaced the alternator and drive belt, carry out inspection of attachment, started and tested charging system. Top up cooling system,</p>
1574616	F2 - stalling after coolant top up	CMILLAR	24/10/2023	Internal	23429.0	\$0.00	<p>attend site and sign in. fill out permit to work. inspect unit and found coolant level was low. (added 5l) check engine oil level. OK at time of inspection. start unit and check operation. all working at time of inspection park unit ready for operation.</p>
1573824	F2 - overheating	CMILLAR	20/10/2023	Internal	23419.0	\$0.00	<p>unit has some oil leaks but nothing to effect unit. Travel to site,</p> <p>Top up cooling system,</p> <p>Top up Engine Oil as required,</p> <p>coolant took 15L and engine took 5l of oil</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1572591	F2 - cummins to attend check coolant consumption, oil sample, engine blow by, injector testing, general condition and remaining life of engine	WJONES	17/10/2023	Internal	23390.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>SIGN INTO SITE AND FILL OUT PTW SET UP SAFE WORK AREA REMOVE ENGINE COMPARTMENT COVERS AND WASH DOWN ENGINE BAY ASSIST CUMMINS TECH WITH ACCESSING SITE AND INFORM HIM OF HOW TO GET THE UNIT OPERATIONAL FOR TESTING PURPOSES</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Top up cooling system,</p> <p>Attended Cummins to perform emgine evaluatio on the excessive coolant lose.</p> <p>cleaned and washed down the machine.</p>
1571847	F2 - Code E0197, Cutting out/stalling after start up.	CMILLAR	12/10/2023	Internal	23388.0	\$0.00	<p>Topped up 10 liters of engine coolant.</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>inspected machine fluid levels and leaks.</p>
1571854	F2 - Drive Tyre Rotation on Existing Rims	BIG TRUCKS NSW	11/10/2023	External	23313.0	\$1,651.00	<p>Topped up engine coolant.</p> <p>Carry out drive tyre rotation on existing rims on unit F2 at SFT</p>
1571325	F2 - horn issue	APATRIMONIO	11/10/2023	Internal	23316.0	\$0.00	<p>Travel to site,</p> <p>Repair Switch/es</p> <p>Travel to site.</p> <p>Checked up horn issue, found out horn switch was broken.</p> <p>Replaced horn switch and tested function.</p> <p>Adjust Attachment to correct specification,</p>
1569997	F2 - no power to MDT spreader stuck open	AMABBOTT	5/10/2023	Internal	23256.0	\$0.00	<p>Carry out Inspection and Diagnosis of Electrical System</p> <p>suspect 30 ft stop engaged stopping arm. reset mdt looked for faults all ok</p> <p>Travel to site,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1568455	F2 - spreader wont extend past 20ft	WJONES	28/09/2023	Internal	23202.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Attachment  Repair Attachment as necessary,  TRAVEL TO SITE SIGN IN AND FILL OUT PTW TEST UNIT FOR FUNCTION FOUND UNIT ONLY OPENING LHS OF SPREADER INSPECT SPREADER - FOUND RHS SOLENOID WIRING CORRODED NEAR PLUG REMOVE PLUG AND REPAIR WIRING REFIT AND TEST FUNCTION - OK BOTH EXTENSION BEAMS FULLY FUNCTIONAL
1568184	F2 - AC Service	211 Planning F	27/09/2023	Internal	23202.0	\$0.00	
1556347	F2 - 23250hr II 250hr Service	WJONES	27/09/2023	Internal	23201.0	\$0.00	250hr Service  Travel to site,  TRAVEL TO SITE SIGN IN AND FILL OUT PTW SET UP SAFE WORK AREA CARRY OUT 250HR SERVICE REFILL GREASE POTS AND INSPECT GREASE SYSTEM JACK UP AND CHECK STEER AXLE COMPONENTS - OK CARRY OUT MAST INSPECTION - CHAIN WEAR AT 0.75% INSPECT TWIST LOCK CONDITION - OK TEST ALL TRUCK AND SPREADER FUNCTIONS - OK REMOVE AND BLOW OUT ENGINE AIR FILTER CHECK ALL WORK LIGHTS - OK Repair Attachment as necessary,
1567954	F2 - drop legs inop	DMCDONALD	26/09/2023	Internal	23202.0	\$0.00	Drop Legs stuck open.. Tested operation, found left rear leg not operating... cycled ignition and re tetsted, found legs to retract.. Lowered spreader, cleaned and tested all proxy switches relating to the intermodal leg system..  tested opening and retracting of legs, found all ok at time of test.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1566605	F-2 requires swapping back the MDT unit which is currently in F-4.	DMCDONALD	21/09/2023	Internal	23175.0	\$0.00	Travel to site,  Fit Fleet Management System as required,  Swap MDT between F2 and F4.. Tested operation, all ok at time of inspection
1566111	F2 - park brake adjustment	WJONES	20/09/2023	Internal	23156.0	\$0.00	Block up unit, Adjust brakes and handbrake,  SET UP SAFE WORK AREA ADVISE AND ASSIST SANATH WITH PROPER PARK BRAKE ADJUSTMENT PROCEEDURE TEST PARK BRAKE FUNCTION - OK
1566023	AFTER HOURS CALLOUT - Breakdown machine overheated	APATRIMONIO	19/09/2023	External	23154.0	\$370.75	Unit has been reported having transmission error code t4308. Attend to site, signed in and locate unit. Set up work area. Rectify transmission fault code t4308 - torque converter out temperature above normal. Checked transmission oil level. Checked transmission oil cooler and found out it was clogged. Pressure wash cooler pack. Test run unit and performed stall test. Machine ready to go. Hand over unit to customer. Travel back home.
1564793	F2 - bottom lift cameras not working	WJONES	15/09/2023	Internal	23105.0	\$0.00	Carry out Inspection and Diagnosis of Attachment  Repair Attachment as necessary,  WAIT FOR OPERATOR TO HAND OVER UNIT INSPECT CAMERA SYSTEM FOUND CAMERA HARNESS HANGING FROM BRACKETS UNSECURED ALSO CONNECTOR LOOSE CHECK CONNECTOR AND HARNESS CONDITION - OK NO INDICATION OF DAMAGE REJOIN CONNECTOR AND SECURE HARNESS - CAMERA SYSTEM NOW OPERATING CORRECTLY
1564340	F2 - engine error codes	DMCDONALD	13/09/2023	Internal	23098.0	\$0.00	Carry out Inspection and Diagnosis of Transmission  Carry out Inspection and Diagnosis of Electrical System

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1562812	F2 - Top up coolant	AMABBOTT	7/09/2023	Internal	23450.0	\$0.00	<p>Labour</p> <p>Travel to site,</p> <p>Carry out equipment condition assessment</p> <p>Top up cooling system,</p> <p>Collect coolant from W.P stores.</p> <p>Travel to site.</p> <p>Sign into site and obtain PTW.</p> <p>Locate unit and move to workshop.</p> <p>Check and top up coolant.</p> <p>Unit required 8 litres.</p> <p>Unit hours at time of top up 23071.</p> <p>Return unit to service.</p> <p>ADDITIONAL COOLANT ADDED - APPROX 9L</p> <p>Collect parts at WP and travel to site.</p> <p>Top-up coolant.</p> <p>WAIT FOR UNIT TO BE BROUGHT OVER TO WORK SHED</p> <p>SET UP SAFE WORK AREA</p> <p>CHECK COOLANT LEVEL - LEVEL NOT LOW</p> <p>ORGANISE AND ORDER OIL SAMPLING KIT</p> <p>TAKE OIL SAMPLE FROM THE ENGINE,</p> <p>SCOTT MILLARD CONTACT INFO PUT ON SAMPLE PAPERWORK</p> <p>Top up Engine Oil as required,</p> <p>moved unit to workshop</p> <p>checked and adjusted levels</p> <p>3 october, 10L coolant 5L engine oil</p> <p>refilled 8L 9-10</p> <p>Top-up coolant 10ltrs.</p> <p>Carry out machine condition assessment.</p> <p>top up cooling system. 10l</p> <p>TRAVEL TO SITE</p> <p>SIGN IN AND FILL OUT PTW</p> <p>4L OF COOLANT ADDED TO SYSTEM</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
							attend site and top up coolant
1562045	F2 - Coolant Flush and Replacement	DMCDONALD	5/09/2023	Internal	23047.0	\$0.00	top up coolant as needed. Labour  Travel to site,
1561526	F2 - cutting out and shutting down with error codes E0197 and E0235 he also noted there was possibly a coolant light showing	AMABBOTT	5/09/2023	Internal	23041.0	\$0.00	Flush and Replace Cooling System Coolant Bleed cooling system and remove air locks  confirmed low coolant codes topped up coolant 10L checked no leaks present engine rattly/ excessive noise. possibly liner leak/ walk
1558816	F2 - 6 Monthly Fire Suppression Service	BIG TRUCKS NSW	5/09/2023	Internal	23022.0	\$0.00	
1560170	F2 - repair wearpads	RLE	30/08/2023	Internal	23023.0	\$0.00	
1556615	F2 - Replace Spreader Wearpads and Reshim, Replace Broken 20/40 Mounting Bolts, Replace Air Cleaner Vacuum Switch	RLE	30/08/2023	Internal	23567.0	\$0.00	Travel to site,  Repair Attachment as necessary,  Attend site to fit new spreader wearpads. Replaced and removed old wearpads and install in four new one. Top LHS wearpad had a broken bolt. Drill and tap bolt hole out and refitted new bolts. Replace Fuel Line,  Removed fuel lines.  Labour  Travel to site,  Check/Inspect/Diagnose Fuel system, bleed Fuel system to remove air,  Carry out Inspection and Diagnosis of Electrical System  Travel to Pirtek to get the fuel hose done. Travel to site, signed in and set up work area. Refit fuel hose and bleed air in fuel system. Replaced crankcase pressure sensor. Start up unit and test run. Unit sent back to service.
1558453	F2 - Fuel pump return tube leaking, Crankcase pressure sensor leaking.	APATRIMONIO	23/08/2023	Internal	23023.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1554676	F2 - Error Code E1866	APATRIMONIO	22/08/2023	Internal	23014.0	\$0.00	<p>Carry out Inspection and Diagnosis of Electrical System Rectify engine error code E1866 EGR pressure sensor data incorrect. Checked up wiring connections from EGR pressure sensor socket to ECU. Found connections are intact and no broken or damage wire. Recommend cummins tech to attend. Assist Cummins tech to rectify E1866 error code. Travel to site, Travel to site. Continue rectify E1866 error code. Removed ECM, fit to F4 machine and tseted. Found out error code carroed over and constant corfirming that F2 ECM is faulty amd needs to be replaced.</p> <p>Rectify engine error code E1866. Checked electrical harness from EGR valve to ECU and EGR pressure sensor to ECU. Removed EGR valve and serviced. Removed/check EGR manifold and found out EGR pressure sensor cross drilling was blocked. Removed blockage and clean manifold. Clean grid heater. Refit manifold, sensor and EGR valve. Connect sensor connection. Run the engine and fault was gone. Send machine back in service. Travel to site,</p>
1557647	F2 - air filter restriction light is on also dash lights around steering wheel, Transmision oil leak, attachment oil leak, error code e1866 is back	APATRIMONIO	21/08/2023	Internal	23014.0	\$0.00	<p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>Checked air filter restriction lights on. Found out air filter clogging sensor faulty. Replaced sensor and tested. Repair hydraulic oil on spreader manifold. Repair oil leak on transmission filter head.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1554330	F2 - Error Codes	APATRIMONIO	7/08/2023	Internal	23007.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  Labour  Travel to site,  Top up cooling system,  Replace Radiator cap,  Rectify error code E0235 and E0197. Found out engine coolant low level. Performed coolant leak test and found system no leak. Checked radiator cap and found out it was cracked. Organized and collect parts at WP. Travel back to site. Top-up coolant and replaced radiator cap. Test run engine and reset fault codes. Machine ready to use. Travel to site,
1553689	F2 - Bottom Leg Camera Fault	DMCDONALD	3/08/2023	Internal	22971.0	\$0.00	Repair Visual display unit as necessary, Travel to site,
1547992	F2 - 23000hr II 3000hr Service	APATRIMONIO	28/07/2023	Internal	23008.0	\$0.00	Remove ancillary items and Remove Drive Shaft Assembly from unit,
1552928	F2 - Replacement steer tyres on existing rims	211 Planning A	27/07/2023	External	22929.0	\$16,653.00	3000hr Service Replace steer tyres on existing rims. 1800-25 Goodyear tyres 2,819hrs achieved.
1552136	F2 - Error Codes	APATRIMONIO	27/07/2023	Internal	22936.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  Inspect engine fault code E1866. Clean EGE Valve and replaced pressure sensor. Test run engine but still error occurred. Recommend Cummins tech to attend to further check on engine issue.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1550340	F2 - Unit has no power & all dash lights on.	APATRIMONIO	19/07/2023	Internal	22916.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Electrical System  code E1866 efr pressure mismatch checked egr pipes, connections need cummins to plug into ecu.  Rectify E1866 and E4863 engine fault code. Fixed loosed EGR pressure sensor socket connector. Test run unit. Wash unit.
1549597	F2 - no slew and error code E0235	APATRIMONIO	17/07/2023	Internal	22897.0	\$0.00	Travel to site,  Carry out equipment condition assessment  Carry out Inspection and Diagnosis of Electrical System  Carry out Inspection and Diagnosis of Attachment  Travel to site, signed in and locate unit. Checked up error code E0235, found out coolant low level. Top-up coolant to correct level. Checked up attachment no slew function / H0416 fault code. Carry out joystick recalibration and tested attachment function. Send unit back to service.
1548778	F2 - Misfiring	TARTHUR	12/07/2023	Internal	22876.0	\$0.00	Travel to site,  Carry out equipment condition assessment  Change Engine Oil as required,  Found engine oil was over filled. Drained excess engine oil down to correct level. Run unit and check for smoke, ran ok. Return unit to service.
1548276	Reverse and Leg Camera Faults	DMCDONALD	11/07/2023	Internal	22876.0	\$0.00	Fit Full Camera Kit,
1551887	F2 - Not Starting	BIG TRUCKS NSW	10/07/2023	Internal	22927.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1547842	F2 - MDT Not Powering Up	CMILLAR	10/07/2023	Internal	22867.0	\$0.00	Travel to site,  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  attend site and had unit brake down in middle of yard. unit lost power but then got power back to dash. unit would not start after power loss. remove cover and inspect wiring to try and fault find issue but could not work it out. had to top up cooling system with water. 10l unit will need a coolent flush. jump starter relay to get unit run. once unit was in work shop had a auto elec come and fix problem.
1541390	22750hr II 250hr Service	CMILLAR	10/07/2023	Internal	22867.0	\$0.00	Labour  Travel to site,  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  250hr Service
1543607	F2 - Headlight Switch Broken	BIG TRUCKS NSW	22/06/2023	Internal	22648.0	\$0.00	
1543692	F2 - Replace 4 x drive tyres onto existing rims	211 Planning C	20/06/2023	External	22667.0	\$32,190.20	Replace 4 x 1800.25 Drive tyres on exsting rims Brand - Goodyear Hours achieved - 2,316hrs
1541550	There is no power to the MDT	AMABBOTT	14/06/2023	Internal	22600.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System
1531694	F2 - 22500 II 500hr Service	APATRIMONIO	13/06/2023	Internal	22590.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Performed machine 500 hours service. Replaced engine oil and filter. Replaced fuel filters. Replaced aor filters. Top-up transmission oil. Checked lift chain and lubricate. Top-up grease tabs and lubricate greasing points. Checked steer pins and bushes. Wash unit.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1540519	F2 - Oil leak and tyre ppressure monitor fault	WJONES	8/06/2023	Internal	22556.0	\$0.00	<p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Travel to site,</p> <p>Steam clean equipment as necessary.</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>Labour</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>22556HRS</p>
1536397	F2 - Check Heater & A/C	APATRIMONIO	22/05/2023	Internal	22339.0	\$0.00	<p>Repair Air Conditioner as necessary,</p> <p>Disconnet ac compressor to prevent fuse from blowing. Ac still able to run off heater on its own. Until futhur repairs can be made.</p> <p>Repair Carriage as necessary,</p> <p>Repair Attachment as necessary,</p> <p>4 x Drive Rims Replaced.</p>
1534088	F2 - Replace Drive Rims* 4	211 Planning A	11/05/2023	External	22183.0	\$11,306.36	
1532655	F2 - Turbo Supply Line Leaking Oil	BIG TRUCKS NSW	5/05/2023	Internal	22164.0	\$0.00	
1531612	F2 - Weight Scale Inspection	AMABBOTT	2/05/2023	Internal	22164.0	\$0.00	<p>Repair Main Electrical Control Panel as necessary,</p> <p>tested weight scale,</p> <p>confirmed screen reading container weight</p>
1519067	F2 - 22000 II 2000hr service	AMABBOTT	2/05/2023	Internal	22164.0	\$0.00	<p>Labour</p> <p>2000hr Service</p> <p>Travel to site,</p> <p>have only replaced engine and trans oil and filters while unit down for ad blue issue</p> <p>carried out service</p> <p>chains at 1.5%</p> <p>hub oil needs replacing next service as service completed while machine down not able to drive f/r to drain/fill hub.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1530743	F2 - Oil Leak	AMABBOTT	28/04/2023	Internal	22164.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Carry out equipment condition assessment</p> <p>2000hr Service</p> <p>Labour</p> <p>Carry out the rest of the 2000HR servc.Changed the brake filter,air cleaner, and fuel. Checked the chain wear and serviced the diff. Chain&gt;1.5%.</p> <p>Replace alternator,</p> <p>Replace Fan Belt,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Repair Air Conditioner as necessary,</p> <p>Overhaul Fan Assembly as required,</p> <p>Attend site and carry out removing fan pump off f2 to remove the beraing inside the pump.</p> <p>Repair fan assembly as required.</p> <p>remove ancillary items and Fan assembly from unit and Replace. Refit Fan assembly to unit, refit ancillary items,</p> <p>Attend site and reiffted fan belt and ac ban along with the pump.</p> <p>Repair Turbo as necessary,</p> <p>fan belt too small. ordered correct belt. fit belt, fan hub bearing also noisy. ordered bearing, removed hub, pressed out old bearing pressed in new bearing refit to machine ran unit, oil leak onto manifold from turbo feed hose. smoking while operating.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1526641	F2 - Oil Leak	TARTHUR	11/04/2023	Internal	21995.0	\$0.00	<p>ordered new hose. replaced hose, cleaned down oil leak ran unit all ok Travel to site,</p> <p>Carry out equipment condition assessment</p> <p>Labour</p> <p>Replace Battery,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>Adjust Mast to correct specification,</p>
1525167	F2 - Leg Issue	AMABBOTT	31/03/2023	Internal	21905.0	\$0.00	<p>Replaced batteries. Replaced over mast hoses. Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>legs not operating. friday unit needed over weekend for bottom lift. followed wiring, checked all sensors found sensor out of range stopping operation adjusted sensor tested legs all ok</p>
1524521	Spare Kit	BIG TRUCKS NSW	29/03/2023	Internal	21870.0	\$0.00	
1521242	F2 - Replace Adblue Filter/Strainer	BIG TRUCKS NSW	16/03/2023	Internal	21862.0	\$0.00	
1520039	DEF error code	AMABBOTT	10/03/2023	Internal	21905.0	\$0.00	<p>Travel to site, Carry out Inspection and Diagnosis of Electrical System cummins replaced blocked ad blue doser. replaced ad blue tank filters as blocked filters causing ad blue issue. machine now running 3 days no further codes.</p>
1519964	F2 - Losing Power	WJONES	10/03/2023	Internal	21852.0	\$0.00	
1518847	AH-Error code EE003 limited speed on the unit, bottom lift function not working at all. Tagged Out. URGENT. PTKT-352025	DMCDONALD	6/03/2023	Internal	21803.0	\$0.00	Carry out Inspection and Diagnosis of Attachment

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1517541	F2 - Transmission Overheating	AMABBOTT	1/03/2023	Internal	21733.0	\$0.00	Blow out radiator core,  dennis brought machine over. fan noisy anf t4308 trans overheating code. washed out dirty radiator retested guage now dropped
1542475	F2 - Annual Fire Suppression	211 Planning A	22/02/2023	Internal	22600.0	\$0.00	
1515936	Afterhours Callout - F2 - Stuck On A Box - 22.02.23	WJONES	22/02/2023	External	21675.0	\$789.41	Travel to site, sign in and fill out PTW Head down to machine and inspect Unit has RHS amber flashing when spreader on a box Found that mechanically the landing pins were functioning correctly Set up work platform from work shed and inspect spreader proxy adjustments RHS front landing proxy faulty - not lighting up Remove and replace proxy with 2nd hand from truck stock - test operation-ok Cable tie connection and excess wire Pack up platform and clean up work area Sign off PTW and sign out Drive rotation – 1255hrs achieved
1508197	F2 - DRIVE ROTATION	211 Planning A	15/02/2023	External	21532.0	\$2,061.30	Remove ancillary items and Hydraulic Hose/s, inspect and report,  Removed leaking pilot pump discharge hose.  Reseal Hydraulic Pump as necessary,  Refit Hydraulic Hose/s and ancillary items,  Top up Hydraulic Oil to correct level,  Removed and resealed hydraulic pump. Refit pump and hoses. Top-up hydraulic oil. Tested unit function.
1511685	F2 - Repair Oil Leaks	APATRIMONIO	3/02/2023	Internal	21670.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Travel to site,  Performed machine 500hr servicing.
1507486	F2 - 21500 II 500hr service	APATRIMONIO	3/02/2023	Internal	21670.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1510067	F2 - Fuel Leak	APATRIMONIO	30/01/2023	Internal	21670.0	\$0.00	Travel to site, Repair Diesel injectors as required, Repair Fuel Pump, Labour Replace Fuel Pump, Replaced fuel pump. Bleed fuel system. Start-up and tested unit. Assist BFI tech to check fire suppression system. Wash unit.
1508850	F2 - Light Switch Broken	APATRIMONIO	23/01/2023	Internal	21670.0	\$0.00	Travel to site, Repair Light/s  Replace Switch/es  Replaced light switch.
1508786	F2 - A/C Repairs	BIG TRUCKS NSW	20/01/2023	Internal	21566.0	\$0.00	
1507829	F2 - Broken Light Switch and Panel	DMCDONALD	17/01/2023	Internal	21514.0	\$0.00	Repair Switch/es
1505466	F2 - Fault With Seatbelt	RLE	9/01/2023	Internal	22459.0	\$0.00	Repair Seat as necessary,  Fiited and removed seat belt
1504254	HYDRAULIC LEAK	APATRIMONIO	29/12/2022	Internal	21340.0	\$0.00	Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,  Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,  Steam clean equipment as necessary.  Repaired hydraulic oil leaks on spreader control valve and 20/40 cylinder both side. Wash unit.
1504158	NO SLEW - UNIT PARKED IN THE SHED	APATRIMONIO	28/12/2022	Internal	21328.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Attachment  Load software as required to calibrate the unit,  Attend to site. Rectify no slew issue, H0416 fault code. Cleaned and fixed loosed joystic socket connector. Performed joystick calibration.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1503871	F2 - Spreader Oil Leak	TARTHUR	23/12/2022	Internal	21282.0	\$0.00	Travel to site,  Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,  Remove ancillary items and Hydraulic Hose/s, inspect and report,  Labour  Replace Hydraulic Hose/s and ancillary items,
1497779	F2 - 21250 II 250hr service	APATRIMONIO	22/12/2022	Internal	21276.0	\$0.00	Top up Hydraulic Oil to correct level, 250hr Service  Performed machine 250hrs service. Wash machine. Repair Wheel Nut Indicators,
1502541	F2 - Broken Wheel Nut Indicators	APATRIMONIO	19/12/2022	External	21244.0	\$233.96	Checked right hand steer wheel nut indicators. Replaced damage indicators. Travel to site,  Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,  Remove ancillary items and Hydraulic Hose/s, inspect and report,  Replace Hydraulic Hose/s and ancillary items,  Steam clean equipment as necessary.
1501026	Afterhours Callout - F2 Oil Leak - 13.12.22	WJONES	13/12/2022	External	21161.0	\$837.15	Top up Hydraulic Oil to correct level, Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items,  Top up Engine Oil as required,  Repaired engine oil leak. Top-up engine oil. Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,
1500885	F2 - Engine Oil Leak	APATRIMONIO	12/12/2022	Internal	21157.0	\$0.00	confirmed no slew out rhs traced wiring to loose terminal on R9. corrected and now operational.
1500342	Slew Fault	AMABBOTT	9/12/2022	Internal	21123.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1499892	F2 - Oil Leak	AMABBOTT	8/12/2022	Internal	21128.0	\$0.00	Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,
1499076	F2 - No Slew	APATRIMONIO	5/12/2022	Internal	21091.0	\$0.00	minor leak sweating from 1x hose at steer orbital with orange cable tie and 4x orings to hose manifold. Carry out Inspection and Diagnosis of Attachment  Repair Attachment as necessary,  Rectify no slew issue. Found out left slew proximity switch not working. Replaced proximity switch and tested attachment functions several times.
1498699	F2 - Overmast Hose Leaking	APATRIMONIO	2/12/2022	Internal	21070.0	\$0.00	
1496710	F2 - Tyre Pressure Sensor Missing On Steer	APATRIMONIO	25/11/2022	Internal	20992.0	\$0.00	Carry out Inspection and Diagnosis of Telemetry System  Replace Fleet Management System as required,  Checked up TPMS and found out rear left pressure sensor missing. Replaced and programmed tyre pressure sensor.
1490356	21000 II 1000hr service	APATRIMONIO	24/11/2022	Internal	20992.0	\$0.00	Travel to site, 1000hr Service  Performed machine 1000hrs servicing.
1495174	Engine Oil Low	APATRIMONIO	18/11/2022	Internal	20939.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Electrical System  Top up Engine Oil as required,  Rectify engine fault code. Found out engine oil low level. Top-up engine oil.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1493823	Brake Issue	APATRIMONIO	15/11/2022	Internal	21070.0	\$0.00	Carry out Inspection and Diagnosis of Brake System  Block up unit, Adjust brakes and handbrake,  Checked brake issue. Found out brake valve and roller worn out. Adjust brake pedal. Parts on order. Machine good to go, temporary fixed provided.  Labour  Collect parts at DP.  Replace Brake master cylinder,  Bleed Brake System  Replaced brake valve, roller and pin. Bleed brake system.
1493177	Smell of oil in the cab of F2 and the brake pedal needs adjusting,	APATRIMONIO	14/11/2022	Internal	20939.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Inspect cab for smell of burnt oil. Checked exhaust pipes and tightened the clamps. Clean cab interior.
1492391	NCC Callout 9.11.22 - Operator error caused the front drop down legs to get stuck on a flat rack.	TARTHUR	9/11/2022	External	20847.0	\$529.40	Callout 8.11.22 Operator error caused the front drop down legs to get stuck on a flat rack. Carry out equipment condition assessment Supplied operator with override key and assist and monitor to free legs from flat rack.
1492139	Check unit for damage due to operator error which caused the front drop down legs to get stuck on a flat rack.	211 Planning A	9/11/2022	Internal	20847.0	\$0.00	
1488241	F2 - 20750 II 250hr service 0250 Hour Service	211 Planning A	7/11/2022	Internal	20514.0	\$0.00	
1490361	F2 - Damaged Mast Hose Guide	APATRIMONIO	2/11/2022	External	20992.0	\$755.03	Replace damaged overmast hose bracket as required Check operation - ok

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b>		<b>Model:</b>		<b>Serial No.:</b>			
1487316	SEEN SYSTEM UPGRADE	WHILL	1/11/2022	Internal	20992.0	\$0.00	Fit Fleet Management System as required,  Travel to site,  Travelled to site and located unit. Fitted up 2 rear sensor and ran wiring through to the cab. Wires up pwer source and signal wires. Fitted up cab module and checked opertaion. Confirmed system working correctly. Unplugged cab module as per Micheal Rileys instruction. Returned unit to service
1489906	F2 - Not Starting	APATRIMONIO	31/10/2022	Internal	20767.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  Attend to site and locate machine. Set up work area. Checked up battery. Jump start unit and check charging system 27.9vdc.
1488143	A/C Service	211 Planning A	24/10/2022	Internal	20514.0	\$0.00	
1487989	The instrument panel display lights aren't working in F2.	APATRIMONIO	24/10/2022	Internal	20699.0	\$0.00	Repair Visual display unit as necessary,  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  Troubleshoot instrument panel not working. Checked wiring connections and found a loose connection on pin #2 of diagnostic switch. Fixed connection and tested panel.
1480314	F2 - 20500 II 500hr service Hyster H117_0500Hr Service Kit_Dsl_STG4. 0500 Hour Service	211 Planning A	13/10/2022	Internal	20361.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1483461	F2 - Replaced POS 2 due to customer damage	211 Planning B	6/10/2022	External	20514.0	\$7,924.95	
1482897	Operator reported this morning that the seatbelt in F2 isn't retracting & presents as a safety issue, please see attached photos.	DMCDONALD	4/10/2022	Internal	20505.0	\$0.00	Labour  Travel to site,
1481569	F2 - Intermittent function on the windscreen wipers does not work.	DMCDONALD	29/09/2022	Internal	20547.0	\$0.00	Repair Seat as necessary, Repair Windscreen Wiper as necessary,  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  Labour

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1477612	Transmission Failure	APATRIMONIO	23/09/2022	Internal	20341.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Transmission</p> <p>Attend to site and set-up work area. Rectify transmission cutting out issue, T2100 and T6204 error codes. Removed and clean proportional solenoids. Removed and clean 2nd/4th clutch solenoid and spool. Replaced transmission oil and filters.</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p> <p>Remove ancillary items and Remove Drive Shaft Assembly from unit,</p> <p>Removed hydraulic and transmission hoses. Disconnect transmission wiring harness. Removed drive shaft.</p> <p>Replace Transmission,</p> <p>Pulled out transmission.</p> <p>Remove ancillary items and Transmission, Strip, Inspect and report,</p> <p>Labour</p> <p>Refit Hydraulic Hose/s and ancillary items,</p> <p>Top up Hydraulic Oil to correct level,</p> <p>Replace Transmission Hose/s,</p> <p>Top up Transmission Oil to correct level,,</p> <p>Load software as required to calibrate the unit,</p> <p>Steam clean equipment as necessary.</p> <p>Travel to collect old hoses from Randy's place and travel to Pirtek Milperra to source new one. Travel to site. Refit hydraulic hoses. Top-up hydraulic oil 615 litres. Travel to Pirtek to collect new hoses and back to site.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1480492	Operator has reported F2 spreader arm to be leaking hydraulic fluid, F2 has been parked in the shed.	APATRIMONIO	20/09/2022	Internal	20368.0	\$0.00	<p>Installed transmission hoses.  Top-up transmission oil 64 litres.  Refit drive shaft.  Calibrate new gearbox.  Test run machine.  Wash unit.  Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>Inspect hydraulic oil leaking on attachment.  Replaced blown hoses.  Tested attachment functions.  Machine good to go.</p>
1475932	F2 - Replace 4* Drive tyres on existing rims (2218hrs achieved)	211 Planning A	13/09/2022	External	20277.0	\$30,187.60	
1467427	F2 - 20000 II 5000hr service Hyster H117_5000Hr Service Kit_Dsl_STG4. 5000 Hour Service	211 Planning A	13/09/2022	Internal	19819.0	\$0.00	<p>Labour</p> <p>Travel to site,</p> <p>5000hr Service</p> <p>Collect parts at DP and travel to site.  Performed machine 5000hrs service.</p> <p>Continue machine 5000 hrs servicing.  Performed wheel hub bearing retension.  Replaced gear oil.  Replaced engine coolant.</p>
1477233	Horn issues - volume low	APATRIMONIO	6/09/2022	Internal	20322.0	\$0.00	<p>Equipment Transport,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1476653	Operator in it tonight reported it losing power & going into neutral, it has thrown the following fault codes- E4205, E6104, EE300 and EE101	211 Planning A	2/09/2022	Internal	20310.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>Carry out Inspection and Diagnosis of Transmission</p> <p>Adjust Inching Valve to correct specification ,</p> <p>Top up Transmission Oil to correct level,,</p> <p>set up perimeter for work isolate unit steam clean unit top up transmission oil diagnostic fault code adjust inching pedal sensor found out clutch slip at 4th gear advise Michael Riley unit ok to back for service at max 3rd gear</p>
1461754	F2 - Replace 2* Steer Rims & 2* Steer tyres (1984hrs achived)	211 Planning A	30/08/2022	External	19525.0	\$19,687.42	
1451179	12 Monthly Fire Suppression Service. Fire Suppression System Service - 12 Months	211 Planning A	24/08/2022	Internal	19093.0	\$0.00	
1472173	Hydraulic oil leaking on attachment	APATRIMONIO	16/08/2022	Internal	20105.0	\$0.00	<p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>Steam clean equipment as necessary.</p> <p>Inspect hydraulic oil leak. Replaced blown attachment hoses. Tested attachment functions. Wash unit.</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p> <p>Labour</p> <p>Travel to site,</p> <p>Refit Hydraulic Hose/s and ancillary items,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1471454	Part #4021862 Ordered 12.8.22 Further works - Cracked Grease Tub	211 Planning A	16/08/2022	Internal	20105.0	\$0.00	Labour  Collect parts at WP.  Grease All Points on Unit,  Steam clean equipment as necessary.  Replaced cracked grease tab. Fixed grease line and tested. Wash unit.  Top up Engine Oil as required,  remove and replace grease tub steam clean topup engine oil Carry out Inspection and Diagnosis of Transmission
1471455	Gear's not working and transmission cuts out Error code: T23002758F	APATRIMONIO	12/08/2022	Internal	20073.0	\$0.00	Carry out Inspection and Diagnosis of Transmission  Adjust Transmission Control Valve to correct specification ,  Carry out equipment condition assessment  Repair Transmission Control Valve as necessary ,  Attend to site and carry-out equipment condition assessment. Rectify transmission fault code T2300 (Supply pressure on sensor 3 to transmission too low. Proportional solenoid stuck) & T2100 (Supply pressure on sensor 1 to transmission too low. Proportional solenoid stuck). Removed and clean 1/3 proportional solenoid valve. Refit solenoid valve and tested transmission. Reset fault codes and test run machine. Tyre pressure issues and sub contractors works.
1471289	Tyre pressure issues	211 Planning A	11/08/2022	External	20073.0	\$478.75	Tyre pressure issues and sub contractors works.
1471145	NCC Blown tyre - TFI to attend	211 Planning A	11/08/2022	External	20073.0	\$0.00	
1465964	F2 - 19750 II 250hr service 0250 Hour Service	211 Planning A	11/08/2022	Internal	20073.0	\$0.00	250hr Service  Performed machine 250 hrs servicing. Repair damaged steer pin grease line. Retight wearpad retainer bolts. Note: attachment grease tab crack, parts on order.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1469107	Parts on Back order as at 5.8.22 - F2 - Engine light issue + transmission error codes	CMILLAR	3/08/2022	Internal	20115.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  Labour  Travel to site,  attend site and sing in. find unit and tag out. set up safety zone. remove and replace engine air filters. pack up and remove tags Travel to site,
1467866	Operator advised that the clutch brake has not been working correctly could we please have somebody have a look at it / may only need an inching peddle adjustment	WJONES	27/07/2022	Internal	19839.0	\$0.00	Carry out Inspection and Diagnosis of Attachment
1464620	Parking brake lining worn out / Engine oil leak	APATRIMONIO	12/07/2022	Internal	19680.0	\$0.00	Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items,  Replace Brake Shoe/s,  Diagnosed engine oil leak. Repaired oil leak on engine oil filter head. Replaced worn out parking brake lining.
1459490	19500 II 500hr service. Hyster H117_0500Hr Service Kit_Dsl_STG4. 0500 Hour Service	211 Planning A	12/07/2022	Internal	19680.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Labour  Travel to site,  Collect parts at drop point and travel to site. Performed machine 500hrs service. Replaced engine oil and filter. Replaced air cleaner element. Replaced fuel filters. Top-up grease tabs and lubricate greasing points. Checked lift chain and lubricate. Checked steer pin and bushes. Retight wear pad retainers. Wash unit.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1464215	Tyre pressure sensor missing	APATRIMONIO	11/07/2022	Internal	19668.0	\$0.00	Carry out equipment condition assessment  Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Diagnosed buzzer sound coming from the cabin. Found out tyre pressure sensor missing causing buzzer sound come up. Replaced missing tyre pressure sensor. Add front left outer sensor on the monitor.
1462711	Reported tonight F2 has a cab water leak, leaking from above the 2 way radio onto the observer seat.	DMCDONALD	11/07/2022	Internal	19571.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Inspect and repaired water leaking from above the 2 way radio onto the observer seat. Cleaned and dry surface and applied sealant on cabin top glass.
1458866	heater/air con dial knob is missing in F2.	APATRIMONIO	11/07/2022	Internal	19668.0	\$0.00	Replace Switch/es  Replaced ACU heater knob with toggle switch.
1458053	No forward / no reverse	APATRIMONIO	11/07/2022	Internal	19668.0	\$0.00	Carry out Inspection and Diagnosis of Brake System  Rescued unit no forward/reverse. Checked park brake solenoid and found out solenoid was burnt. Replaced solenoid fixed connection. Replaced blown fuse and tested park brake function. note: temporary fixed provided, machine good to go.
1458726	Wheel nut indicator replacement	211 Planning F	15/06/2022	External	19342.0	\$297.64	Remove ancillary items and Solenoid from unit. Replace Solenoid and Refit to unit. Refit ancillary items,  Replaced park brake solenoid and spool. Wheel nut indicator replacement

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1458242	Multiple error codes, leaking fluid from underneath the carriage / no wipers / unit keeps stalling	APATRIMONIO	15/06/2022	Internal	19342.0	\$0.00	Remove and Replace Coolant Hose/s  Carry out Inspection and Diagnosis of Electrical System  Top up cooling system,  Checked multiple errors. EO235/E0197- coolant low level. Repaired leaking coolant hoses and top-up coolant. Checked front wiper, insulate grounded wire and replaced blown fuse.  Labour  Travel to site,  Replaced ACU heater coolant hoses. 250hr Service
1456597	19250 II 250hr service. 0250 Hour Service	211 Planning A	15/06/2022	Internal	19299.0	\$0.00	
1456187	New Tyre Sensor Kit Installed tyre pressure sensor missing - Part needed SEN-220	DMCDONALD	10/06/2022	Internal	19341.0	\$0.00	Travel to site,  Replace Visual display unit,  Load software as required to calibrate the unit,  Replace Fleet Management System as required,
1453201	Customer Damage F2 - Impact Damage To Spreader	211 Planning A	10/06/2022	External	19187.0	\$2,618.35	Replaced tyre pressure monitoring kit. Customer Damage F2 - Impact Damage To Spreader Call came through while on site about F2 spreader drop down legs not closing up on LHS Spoke to operator and was informed that tree debris was found around the LHS of spreader and on engine covers Inspected LHS area of spreader and found that the plug on the solenoid had been broken off. Remove and inspect solenoid terminals - all bent. Clean up tooling  Collect parts at WP and travel to site. Replaced attachment solenoid valve assembly and fixed hydraulic connection. Test unit and return to service

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1456948	Unit stuck on box	APATRIMONIO	8/06/2022	Internal	19310.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Rescued unit stops in middle of driveway. Used F4 to jumped start unit and moved to safe working area. Checked up battery and charging system and found out alternator not charging. Machine tagged out - needs alternator replacement.</p> <p>Labour</p> <p>Travel to site,</p> <p>Replace alternator,</p> <p>Collected parts at branch and travel to site. Replaced alternator assembly and fixed connections. Refit alternator belt. Jumped start unit and checked charging system. (28.1Vdc) Repair Air Conditioner as necessary,</p>
1456815	Heater not working	211 Planning A	8/06/2022	Internal	19310.0	\$0.00	<p>Assisted ACU Tech to rectify heater not working. Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>Inspect oil leaking and found out leaks coming from transmission. Repair oil leak and top-up oil.</p>
1456900	The unit has a leak. They don;t know where it's from and they want to know if it's safe on use. Tagged Out. PTKT-147907	APATRIMONIO	7/06/2022	Internal	19310.0	\$0.00	<p>Labour</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Rectify TE300/E0556 fault code. Replaced engine oil and filter. Replaced air cleaner element inner and outer.</p> <p>Rectify fault code E0556. Checked wiring connections. Checked blowby pressure. Machine down, for further troubleshooting.</p>
1455094	Error Codes - EE300 / EO556 and steering reported to be heavy	APATRIMONIO	3/06/2022	Internal	19300.0	\$0.00	<p>Labour</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Rectify TE300/E0556 fault code. Replaced engine oil and filter. Replaced air cleaner element inner and outer.</p> <p>Rectify fault code E0556. Checked wiring connections. Checked blowby pressure. Machine down, for further troubleshooting.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1455913	Failed Engine (dust through filters into engine)	211 Planning A	2/06/2022	Internal	19293.0	\$0.00	Replace Radiator, Repair Radiator as required, Carry out Inspection and Diagnosis of Electrical System
1448615	19000 II 1000hr service. Hyster H117_1000Hr Service Kit_Dsl_STG4. 1000 Hour Service	211 Planning A	1/06/2022	Internal	18969.0	\$0.00	Repair Cylinder head as required Labour Travel to site, 1000hr Service Organized parts at WP and travel to site. Performed machine 1000hrs service part 1. Replaced engine oil and filters. Replaced fuel filters. Replaced transmission oil and filters. Wash unit. Continue performed 1000hrs servicing. Checked lift chain wear (0.8%) and lubricate. Checked steer pin and bushes. Lubricate greasing points. Top-up grease tank. Checked up attachment. Carry out Inspection and Diagnosis of Electrical System
1454234	F2 is showing fault (E 0556 ) can this please be looked at. Cummins needed to diagnose	WJONES	26/05/2022	Internal	19229.0	\$0.00	Assisted Cummins tech in troubleshooting engine E0556 issue. Carry out Inspection and Diagnosis of Brake System
1453889	Handbrake issues- not working to full capacity	DMCDONALD	26/05/2022	Internal	19213.0	\$0.00	Block up unit, Adjust brakes and handbrake, Diagnosed handbrake not working to full capacity.. Inspect park brake pads and adjust. Tested handbrake function.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1452562	Joystick not responsive, will complete movement with approx. 2-3 second delay. Buttons sticking, all of them.	APATRIMONIO	20/05/2022	Internal	19147.0	\$0.00	Travel to site,  Carry out equipment condition assessment  Carry out Inspection and Diagnosis of Electrical System  Repair Switch/es  Attend to site and carry-out equipment condition assessment. Rectify joystick not responsive. Removed joystick and clean contacts. Refit joystick and tested functions several times. Machine good to go.
1451530	F2 is showing faults (TE 300 and E 0556 ) can this please be looked at.	APATRIMONIO	17/05/2022	Internal	19103.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Electrical System  e0556 and e1942 codes present. high crank case pressure, Arjay previously ordered sensor/ filter. needs scan tool plugged in to check ecu operation/ sensor read out.  Carry out equipment condition assessment  Change Engine Oil as required,  Travel to site and carry-out equipment condition assessment. Rectify E1942 and E0556 engine fault code.(Crankcase pressure too high). Replaced cylinder head element. Replaced engine oil. Reset fault codes. Tested run machine and fault doesn't come up again. Machine good to go.
1451193	F2 - H12909 - Flat tyre	BIG TRUCKS NSW	16/05/2022	External	19093.0	\$362.50	
1450428	F2 was reported by operator that spreader light not working	APATRIMONIO	12/05/2022	Internal	19070.0	\$0.00	Repair Light/s  Check-up attachment lights. Repaired broken wire connection. Replaced blown fuse.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1441003	The hand brake is operational but can we get it inspected because it not working to its full compacity / Engine issue.	CMILLAR	12/05/2022	Internal	18750.0	\$0.00	<p>Carry out Inspection and Diagnosis of Electrical System</p> <p>inspect unit for park brake issue. found that unit did not have a brake issue but had a enginr crank case pressure problem. found crank case sensor was full of oil. this is a problem when the crank case filter s not change at 2500hours. remove filter and clean it best i could. remove sensor and clean it out. refit filter and sensor. test unit but still have crank case pressure problem coming up on dash. e0556 e1942 parts have been ordered.</p> <p>Labour</p> <p>Travel to site,</p> <p>Pick-up parts at Cummins WP and travel to site. Replaced engine breather element. Fixed shorted alternator supply line.</p> <p>Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items,</p> <p>Collect parts at branch and travel to site. Replaced engine breather element and seal. Wash unit. Replace Light/s</p> <p>Replaccec spreader light and fixed connections.</p>
1449199	F-2 inspected for the Spreader lights issue - spreader lights are not working too, which made it hard when he is getting a container from 3 high.	APATRIMONIO	6/05/2022	Internal	19004.0	\$0.00	<p>Replace Light/s</p> <p>Replaccec spreader light and fixed connections.</p>
1447998	Check out air conditioning blowing hot air	APATRIMONIO	6/05/2022	Internal	19004.0	\$0.00	<p>Repair Air Conditioner as necessary ,</p> <p>Rectify ACU blowing hot air. Fixed grounded electrical connection.</p> <p>Travel to site,</p> <p>Travel to site. Inspect aircon no cool, A/C switch was turned off thats the reason why its not getting cool. Clean air filter. Tested ACU, okay.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1446556	Machine non start - may be a battery issue	APATRIMONIO	6/05/2022	Internal	19004.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>voltage 9v. hooked up to truck and charged up/ jump started. voltage 22v engine running alternator not charging. checked fuse/ wiring. connector on alt not all tgh e way home and broken. resecured as best as possible, unit now charging. needs powertrain harness replaced to prevent future breakdowns.</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p>
1446674	Oil filter adapter on engine leaking oil, only minor but will require parts/ reseal.	APATRIMONIO	3/05/2022	Internal	18968.0	\$0.00	<p>Replaced engine and transmission harness. Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items,</p> <p>Inspect engine oil leaking. Resealed oil filter adapter. Top-up engine oil. Wash unit.</p>
1443135	Scheduled Service - 18750 II 250hr service .0250 Hour Service	211 Planning A	3/05/2022	Internal	18886.0	\$0.00	
1447437	Unit failing to start - continually stalling	APATRIMONIO	28/04/2022	Internal	18908.0	\$0.00	<p>Travel to site,</p> <p>Carry out equipment condition assessment</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Top up Hydraulic Oil to correct level ,</p> <p>Travel to site from Port Kembla branch. Carry-out machine condition assessment. Checked machine failing to starts. Checked starting and charging system. Replaced buckle and seat relay. Top-up hydraulic oil. Tested unit function with load. Machine good to go.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1434074	Waiting on Part as at 6.4.22 - Reported by D Olla that F2 has no slew left due to spreader hydraulic ram faulty, also no bottom lift due to same hydraulic ram not extending fully, windscreen wipers need attention and aircon still n	DMCDONALD	11/04/2022	Internal	18765.0	\$0.00	<p>Carry out Inspection and Diagnosis of Attachment</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Repair Windscreen Wiper as necessary,</p> <p>Repair Attachment as necessary,</p> <p>Repaired wiper blade. Rectify no slew and bottom lift issue. Checked electrical connections. Repaired slew left relay and connections- needs new relay. Tested attachment function several times. Machine good to go. Note: needs new slew relay and brake pressure switch (leaking).</p> <p>Replace Windscreen Wiper,</p> <p>Strip and Replace Contactor, Reassemble,</p> <p>Replaced slew relay and tested unit function. Machine good to go. Replace Windscreen Wiper,</p>
1437040	New wiper motor and blade	APATRIMONIO	31/03/2022	Internal	18750.0	\$0.00	<p>Repair Windscreen Wiper as necessary,</p> <p>Install new wiper blades. Rectify wiper no intermittent speed, found out wiper timer relay was damaged. Parts on order.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1434709	Further works: steer pin and bushes replacement on both sides	APATRIMONIO	31/03/2022	Internal	18887.0	\$0.00	Carry out Inspection and Diagnosis of Steering System  Ordered parts needed for the job.  Labour  Repair Steering as necessary,  Replace Steering Cylinder,  Replaced steering cylinder assy. Replaced steer pin and bushes both sides. Refit tie rod and greasing connection. Tested steering function.  Travel to site,  Grease All Points on Unit,  Pick-up greasing fitting at Pirtek Blacktown and travel to site.
1434251	New seat covers	DMCDONALD	31/03/2022	Internal	18189.0	\$0.00	Install grease fittings to steering pins. Repair Seat as necessary,  Replaced seat cover.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1430391	New Sim Card Ordered 24.3.22 - F2: FM1/ Telemetry not reporting, please investigate further.	DMCDONALD	31/03/2022	Internal	18765.0	\$0.00	<p>Carry out Inspection and Diagnosis of Telemetry System</p> <p>Inspect/Diagnose telemetry not reporting. Found out FM1 module faulty. Needs part replacement.</p> <p>Travel to site,</p> <p>Replace Fleet Management System as required,</p> <p>FM1 not reporting, after initial diagnosis found that there was an internal modem problem on the FM1 module, a replacement was ordered.. at time of replacement it was discovered that the FM1 (GPS-GSM) antenna was very brittle and broke at the connector, a replacement was ordered.. at time of antenna and FM1 replacement I had engaged soeedshield to send through the file for H12909 as per the previous FM1 parameters.. this file never came through, a serial cable from tablet to FM1 required for Mike to do a remote login.. After a serial port connector had been lent I had mike remote into my tablet to access internal parameters and he discovered that the SIM card was not being recognised, a replacement was ordered.. machine put back together and we discovered no start, I ch</p>
1442105	Camera Issue	DMCDONALD	14/03/2022	Internal	18765.0	\$0.00	<p>Fit Full Camera Kit,</p> <p>Monitor stuck on reverse camera and not selecting drop leg cameras.. this monitor was from a previous F1 failure and was put onto F2 as it was out of service as a way to make F1 frontline ready for intermodal...</p> <p>Call was placed with Rod from RVS and he got back to me with a way to access internal parameters to try rectify fault... after a look inside the setting it was found that there was a parameter which had glitched and selected a wrong setting, this was then rectified, tested and found to be all ok after modification.</p> <p>No new monitor required at this stage.</p>
1436826	Parked up warning light on, steering column lights flashing and error code 556 driver was not sure if it was he-556 or ht-556	APATRIMONIO	7/03/2022	Internal	18750.0	\$0.00	<p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Top up Engine Oil as required,</p> <p>Repair Windscreen Wiper as necessary,</p> <p>Rectify fault code EO556- crankcase pressure issue. Found out engine oil low level, top-up engine oil 5ltrs. Test run unit, fault code doesn't come up again. Adjusted wiper arm position.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1436420	F2 - H12909 had to be parked up as it was shutting down constantly. It was showing faults E_ SHT and T6105	DMCDONALD	4/03/2022	Internal	18190.0	\$0.00	Carry out Inspection and Diagnosis of Transmission  Repair Transmission Control Valve as necessary,  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Travel to site,
1435459	H12909 / F2 - Fork is parked up out of service due to reeving high at idle while only crawling with a LPN error code and transmission light showing	DMCDONALD	28/02/2022	Internal	18676.0	\$0.00	Carry out Inspection and Diagnosis of Transmission  Repair Switch/es Labour
1421540	Scheduled Service - 18,500hr service. .0500 Hour Service	APATRIMONIO	23/02/2022	Internal	18676.0	\$0.00	Travel to pick up parts at branch.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Performed machine 500hr service. Replaced engine oil and filter. Replaced fuel filters. Checked lift chain wear. Checked steer pin and bushes. Wash unit.
1418411	F2: Replace tyre pressure sensors.	DMCDONALD	23/02/2022	External	18117.0	\$1,565.40	F2: Replace tyre pressure sensors.
1433146	F2 is not operational parked up because the air conditioning doesn't blow cold air while truck is idling.	211 Planning F	21/02/2022	Internal	18189.0	\$0.00	
1432748	H12909 - Driver reported Hyster 2 won't slew to the right can it be looked at on day work	WJONES	18/02/2022	Internal	18644.0	\$0.00	Travel to site,  Carry out equipment condition assessment Travel to site,
1431776	Just reported that F-2 (H12909) has the lights flashing on the steering wheel and the STOP light on the dash on. Unit parked up in shed.	WJONES	14/02/2022	Internal	18605.0	\$0.00	Carry out equipment condition assessment
1430986	Air con Issues - Unit blowing cold air for 15-20 mins then cuts out and blows hot air then cuts out and blows cold air again	APATRIMONIO	11/02/2022	Internal	18195.0	\$0.00	Repair Air Conditioner as necessary,  ACU issue being reported. Assisted ACU tech Sal on the issue.
1430357	Further charges to Job #1417188 - Blown Turbo - Cummins Invoice to investigate and report issues	211 Planning F	8/02/2022	Internal	18117.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1429526	F2 last night and found the hydraulic ram that controls the swivel and pushes the head out was only working On the right side. Can we get this looked at today please.	WJONES	4/02/2022	Internal	18117.0	\$0.00	Travel to site,  Check/Inspect/Diagnose Cylinder
1429053	Take Turbo from PN to Cummins - Please see Justin Walker	DMCDONALD	2/02/2022	Internal	18117.0	\$0.00	Labour
1428690	Air Con Issues	APATRIMONIO	1/02/2022	Internal	18190.0	\$0.00	Travel to site,  Repair Air Conditioner as necessary,  ACU issue. Travel to site. Checked ACU system and found out loose connection on ACU compressor clutch. Fixed loose connection and test ACU.
1425773	F2: Call out to site on 17/1/21 to inspect damage to Position 4 tyre.	211 Planning B	17/01/2022	External	18189.0	\$374.13	
1424801	Fork 2 parked up due to cut tyre photos taken need to be checked - Please see attached the quote for the work. Can you please send through the PO when you can. We can hold this at our warehouse as a P	211 Planning F	12/01/2022	External	18189.0	\$917.40	
1423775	A/C Not Working	DMCDONALD	5/01/2022	Internal	18762.0	\$0.00	Travel to site,  Repair Air Conditioner as necessary,
1423466	F2 is having error codes E0235 E0197 E0235 And the back tyre has a slit running through it	DMCDONALD	4/01/2022	Internal	18762.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Electrical System  Top up cooling system,  Repair Air Conditioner as necessary,  Replace Fan Belt,
1420350	F2: Replace Steer Tyres * 2 & Steer Rims * 2 (new rims) - 1274 Hours Achieved on Steer Tyres & Rims.	211 Planning B	22/12/2021	External	18149.0	\$18,138.12	Labour

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1421954	F2 - H12909 - The air conditioner not working blowing hot air	APATRIMONIO	20/12/2021	Internal	18185.0	\$0.00	Repair Air Conditioner as necessary,  Check up ACU not working. Check system and found out ACU gas low pressure, recommend Austral tech to recharge gas.
1413350	Scheduled Service - 18,000hr service II 3000hr type. Hyster H117_3000Hr Service Kit_Dsl_STG4. 3000 Hour Service	211 Planning B	15/12/2021	Internal	18178.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Travel to site,  3000hr Service  Travel to site. Performed machine 3000hr service. Carry out equipment condition assessment
1421008	Tyre Sensor issues	APATRIMONIO	14/12/2021	Internal	18176.0	\$0.00	Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  Inspect warning buzzer issue. Check mast and ultrasonic sensor wiring connection. Repair cut off ultrasonic supply wire. Tested unit function several times. Machine good to go.
1413278	F2: Replace Fire Suppressin Expellant Cartridge & bracket and replace C5 Electric actuator.	211 Planning B	14/12/2021	Internal	17846.0	\$0.00	
1420423	Fork 2 parked up due to cut tyre photos taken need to be checked	211 Planning F	13/12/2021	External	18165.0	\$7,521.95	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1417188	F2 is now parked as well due to hydraulic problem photos attached - Blown Turbo	PUMINYAD	26/11/2021	Internal	18124.0	\$0.00	<p>Travel to site,</p> <p>Check/Inspect/Diagnose Cylinder</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Repair Attachment Cylinder as necessary ,</p> <p>Repair Turbo as necessary ,</p> <p>Assist Cummins technician in checking engine turbo charger issue.</p> <p>Labour</p> <p>Replace Turbo,</p> <p>Top up cooling system,</p> <p>Travel to site.. Sign in, PTW was open from previous tech was lost so the supervisor would not open a new PTW so extra time spent to locate previous PTW.. set up safe work area..</p> <p>Remove ancilliery items fixed to failed turbo, there was alot of trouble trying to loosen exhaust flange nuts as they were very tight, extra time needed to remove turbo..</p> <p>After removing turbo i noticed that the dowdy seals for the oil and coolant supply were heavily deteriorated.. travel to Pirtek to replace dowdy seals.. return to site.. fit new turbo and refit ancilliery items to turbo.. tested and found coolant leak from VGT actuator flange.. removed seals and re sealed and tested.. all ok after repair</p>
1416776	F2 has blown the beading by the looks, were cant see a hole in the tyre but there may be? This happened while traveling with a 28 T container. It is currently parked on the concrete near the shed. Can	DMCDONALD	24/11/2021	External	18094.0	\$7,703.30	
1412117	F2: Replace Drive Tyres * 4 & Drive Rims (new rims) * 4 - 1611 Hours Achieved on drive tyres & 3408 Hours Achieved on drive rims. Tyres & rims changed out early because site wanted no tyre work carried out in December.	211 Planning B	24/11/2021	External	17995.0	\$34,765.64	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1411031	Soft Brakes	APATRIMONIO	22/11/2021	Internal	17793.0	\$0.00	Travel to site,  Carry out equipment condition assessment  Carry out Inspection and Diagnosis of Brake System  Replace Brake Shoe/s,  Travel to site and carry-out equipment condition assessment. Check brake and accumulator pressure. Replaced foot brake valve taken from H3. Recalibrate inching pedal. Tested brake and wash unit. Machine good to go.
1415605	F2 -Crank Case Pressue Issue	WJONES	18/11/2021	Internal	18005.0	\$0.00	
1414413	F2 has done a hydraulic hose and is parked in the shed.	APATRIMONIO	15/11/2021	Internal	18005.0	\$0.00	Remove ancillary items and Hydraulic Hose/s, inspect and report,  Labour  Travel to site,  Refit Hydraulic Hose/s and ancillary items,  Top up Hydraulic Oil to correct level,  Removed hydraulic hose and travel Pirtek to source new one. Travel back to site and refit hoses. Top-up hydraulic oil and test attachment functions. Machine good to go.
1414179	Change wipers to Genuine and report on the wipers being removed.	APATRIMONIO	12/11/2021	Internal	18005.0	\$0.00	Labour  Pick-up parts at branch.  Replace Windscreen Wiper,  Replaced wiper blades with genuine one.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
---------	-------------	----------	------	----------	----------	--------	-------

Owner: RITC000

Equip. Code: H12909

Description: HYSTER H52.00XM-16CH - Tier 4 Engine

Make: HYSTER

Model: H52.00XM-16CH

Serial No.: H117E01600P

1401603	Scheduled Service - 17,500hr service II 500hr type. .0500 Hour Service	PUMINYAD	2/11/2021	Internal	17843.0	\$0.00	<p>250hr Service</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Performed machine 500hr service. Check steer pin and bushes. Check lift chain wera (0.75%) and lubricate.</p> <p>Performed machine 500hr service. Replace engine oil and filters.</p> <p>Remove ancillary items and Fuel Filter and Replace, Refit Fuel Filter and ancillary items,</p> <p>Replace Fire Extinguisher,</p> <p>replace fuel filter. conboy fire suppression guy. assist fire suppression guy in removing the covers of unit on f2 and f1 while he do the 6monthly inspection.</p> <p>Continue machine 500 hours servicing. Performed safety checks. Wash unit.</p>
1400383	F2: 12 Monthly Fire Suppression Service .Fire Suppression System Service - 12 Months	PUMINYAD	2/11/2021	Internal	17300.0	\$0.00	
1411542	the MDT not signing in and swipe cards not reading on VM1 system F2 – H12909	PUMINYAD	1/11/2021	Internal	17831.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Carry out Inspection and Diagnosis of Telemetry System</p> <p>travel to site. check f2 not working. forktrack system is lock. call speedshield to reset system. start up unit ans test run unit all good.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1410108	F2 bottom lift camera right rear needs adjusting, may have taken a knock?	PUMINYAD	25/10/2021	Internal	17757.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Fit Full Camera Kit,  check camera bracket is hit. repair bracket and mounting. refit bracket and camera. adjust camera. test run unit all good.
1409900	Transmisson Calibration Fault	PUMINYAD	22/10/2021	Internal	17802.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  Repair Transmission as necessary,  check error code TE501 calibrate trans. error code fix.
1409806	F2 fog lights are not working can we please have somebody take a look for us before night shifts kicks in tonight would be greatly appreciated .	PUMINYAD	22/10/2021	Internal	17757.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Electrical System  Repair Light/s  check unit light not working. check electrical. repair light. test run light all good working.
1409573	Check air conditioning of unit and report any issues	PUMINYAD	21/10/2021	Internal	17702.0	\$0.00	Labour  Replace Light/s  travel to ashdown to pick up new work light. travel to pn. fit new work light. Carry out equipment condition assessment  check ac unit all good working.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1409311	Swap out cracked Drop down leg cylinder with spare	PUMINYAD	20/10/2021	Internal	17684.0	\$0.00	Remove ancillary items and Attachment Cylinder, Strip, Inspect and report,  Repair Attachment Cylinder as necessary,  Refit Attachment Cylinder and ancillary items,  Removed drop down leg cylinder and repair. Refit and connect hoses. Test unit function. Machine good to go.  pull out drop down cylinder. weld the crack fitting. Carry out Inspection and Diagnosis of Electrical System
1408826	Air Conditioner not working	PUMINYAD	19/10/2021	Internal	17684.0	\$0.00	Repair Air Conditioner as necessary,  check ac not working. check electrical found that compressor is not activating. found that supply wire is broken. repair wiring. test ac now iys cooling good.
1407149	New Wiper Blades (2 needed in total)	PUMINYAD	11/10/2021	Internal	17429.0	\$0.00	Labour  Travel to site,  Replace Windscreen Wiper,  travel to burson to pick up wiper blade. travel ro pn. installed wiper blade.
1403562	Check Tyre Pressure	DMCDONALD	22/09/2021	Internal	17420.0	\$0.00	Repair Drive Tyre/s as necessary,  Tyre pressure alarm going off... Checked drive tyre pressures and checked calibration of sensors.. found drive tyre pressures were ranging between 155 PSI and 186 PSI on my tyre guage which matches pressure reading on monitor, the discrepency between pressures is greater than 10% and will cause an alarm.. TFI called in to adjust pressures.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1399626	A/C blower fan not working	APATRIMONIO	16/09/2021	Internal	17303.0	\$0.00	Repair Air Conditioner as necessary,  Labour  Travel to site,  Steam clean equipment as necessary.  A/C blower not working. Pick-up parts at WP and travel to site. Replaced blower assy and tested. Pressure washed machine. Labour
1396252	F2: Scheduled Service - 17,250hr service II 250hr type.	DMCDONALD	16/09/2021	Internal	17356.0	\$0.00	Labour  250hr Service  Carried out 250 hr service.. Lift chain stretch measured at 0.75% at time of inspection. Topped up engine oil
1400038	as at 20.09.2021 waiting on a part 1530hrs F2 had an oil leak from the RHS of the spreader when the bottom lefts legs were in the down position. Machine has been parked up out of service.	DMCDONALD	3/09/2021	Internal	17300.0	\$0.00	Note: 1.5 hours taken to travel to and from Botany to pick up Niftylift Cherry Picker.. Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,  Travel to site,  Remove ancillary items and Hydraulic Hose/s, inspect and report,  Labour  Replace Hydraulic Hose/s and ancillary items,  Inspect oil leak, found leak on top of spreader, unable to close drop legs due to broken hose so repair must be done with attachment elevated.. Travel to Botany to pick up cherr picker.. return to site, remove hoses and travel to pirtex for replacement hoses.. replaced hoses and affected o-rings.. cleaned area and steam cleaned unit.
1399696	Operator complaint that the AC was not blowing any air in the cab. Removed panel under cab to access blower fan gave it a nudge and it fired up ok.	WJONES	2/09/2021	Internal	17215.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1396219	Fork will tilt by its self when a container is attached	APATRIMONIO	17/08/2021	Internal	17022.0	\$0.00	Carry out equipment condition assessment  Check/Inspect/Diagnose Cylinder  Reseal Hydraulic Control Valve as necessary,  Fork will tilt by its self when a container is attached. Carry-out equipment condition assessment. Check up tilting function. Reseal tilting solenoid valve and test tilting function. Machine good to go.
1395761	Sunday service 15/8 - labour only	BIG TRUCKS NSW	15/08/2021	External	16988.0	\$4,163.76	Sunday service - labour only approved by Mike Riley
1391367	Scheduled Service - 17,000hr service II 2000hr type. .2000 Hour Service	APATRIMONIO	15/08/2021	Internal	17000.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Collect EWP at Port Botany and send to PN to be use for F2 servicing on Sunday.  Labour  Travel to site,  2000hr Service  Reseal Transmission as necessary,  performed 2000hrs service. reseal trans outputshaft. reseal attachment thats leaking. wash unit.  Performed machine 2000hr servicing. Repair transmission oil leaking. Repair hydraulic main valve and 20/40 cylinder oil leaking. Check steer pin and bushes. Check chain wear (0.70%) and lubricate. Wash unit.
1361943	F2: Replace Steer Tyres * 2 & Steer Rims * 2 (new rims) - 1863 Hours Achieved on Steer Tyres & 2296 Hours Achieved on Steer Rims	211 Planning B	10/08/2021	External	16955.0	\$17,659.72	
1394132	Loose fan belt	APATRIMONIO	8/08/2021	Internal	16943.0	\$0.00	Adjust fan belt as required  Loose ACU belt. Adjust loose ACU belt. Machine good to go.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1393957	Inspect radio for intermittant issue	APATRIMONIO	4/08/2021	Internal	16906.0	\$0.00	Carry out Inspection and Diagnosis of Telemetry System
1391593	A/C not working	APATRIMONIO	27/07/2021	Internal	16809.0	\$0.00	Inspect radio for intermittent signal issue. Check electrical and antenna connections. Repair Air Conditioner as necessary,  A/C not working. Rectify A/C not working. Repair damage electrical connection. Unit good to go.
1390051	Tyre pressure guage	DMCDONALD	20/07/2021	Internal	16710.0	\$0.00	Repair Drive Tyre/s as necessary,
1385596	Scheduled Service - 16,,750hr service II 250hr type. .0250 Hour Service	DMCDONALD	20/07/2021	Internal	16745.0	\$0.00	250hr Service  Carried out 250hr service, topped up engine oil with 3 litres of surplus oil.. Chain stretch measured at 0.75%.
1389170	F2 - Oil Leak	WJONES	14/07/2021	Internal	16665.0	\$0.00	Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,  inspect unit unable to detect oil leak location suspect leak coming from tranmisson forward area wash down suspected area, blow down with compressed air and brake clean to dry operate all functions park up to inspect again unable to locate leak, operator and AALG techs to monitor situation call shift supervisor to inform them of situation, unit ok to return to work

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1386928	Inspect engine transmission & hydraulic leaks	AMABBOTT	5/07/2021	Internal	16600.0	\$0.00	<p>Check/Inspect/Diagnose Cylinder</p> <p>ran machine and inspected leaks leaking front oil filter adapter on engine, transmission control valve, centre hydraulic manifold rebooked next day for repairs</p> <p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>Carry out Inspection and Diagnosis of Transmission</p> <p>Top up Transmission Oil to correct level,,</p> <p>Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items,</p> <p>Top up Engine Oil as required,</p> <p>Inspect engine, transmission &amp; hydraulic oil leaks. Repair oil leak at hydraulic control valve. Check transmission oil leak. Pressure sensor leaking - for replacement. Top-up transmission oil. Check engine oil leak. Engine filter head leaking - for resealing. Top-up engine oil. Wash unit and test functions. Machine good to go.</p> <p>Travel to site,</p> <p>Travel to site and carry-out equipment condition assessment. Inspect oil leaks. Oil leaks at engine oil filter head and transmission pressure sensor - waiting for parts.</p> <p>Labour</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>Repair Transmission as necessary,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1385062	Blown hose	APATRIMONIO	25/06/2021	Internal	16486.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>Source out part for engine filter head. Travel to site and reseal filter head. Replace engine oil filter hoses. Replace transmission pressure senso x2. Tested machine and wash. Unit good to go. Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>Rectify hydraulic oil leaking. Remove blown attachment hose. Travel to Pirtek to make new one and back to site. Fit new hose and wash unit. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p>
1378592	Scheduled Service - 16,500hr service II 500hr type. .0500 Hour Service	APATRIMONIO	24/06/2021	Internal	16484.0	\$0.00	<p>Performed machine 500hr servicing. Check steer pin and bushes. Check lift chain wear. (0.2%) Wash unit.</p>
1383746	F2: Replace Drive Tyres * 4 (on existing rims) - 1797 Hours Achieved	211 Planning B	16/06/2021	External	16384.0	\$26,627.80	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1379614	Error codes E143 & E415 - unit for cutting out with load on	PUMINYAD	2/06/2021	Internal	15661.0	\$0.00	<p>Change Engine Oil as required,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Troubleshoot engine fault codes. Check engine oil pressure by gauge. Replace engine oil. Check sensor and wiring connection.</p> <p>Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items,</p> <p>Travel to site,</p> <p>Labour</p> <p>Replace Engine Oil Filter,</p> <p>travel to parts. travel to site. replaced oil filter test run unit for 2hrs no more error codes, wait for cummins to test engine oil pressure. checked pressure at 700rpm oil pressure is 192kpa at 2000rpm its 410kpa which is good. returned all cover and accessories. unit is back in service.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1378334	F2 - Codes on Dash E0235, E0197	PUMINYAD	24/05/2021	Internal	16223.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Top up cooling system,</p> <p>Top up Engine Oil as required,</p> <p>Fault code reported, E0235 and E0197.</p> <p>Travel to site and carry-out equipment condition assessment.</p> <p>Check-up fault code and found out coolant level was low.</p> <p>Top-up coolant 20ltrs.</p> <p>Top-up engine oil.</p> <p>Check/Inspect/Diagnose Engine compression and perform compression test and report.</p> <p>travel to site.</p> <p>check unit coolant low level.</p> <p>performed coolant leak test.</p> <p>pull out EGR output to intake manifold and found that coolant is coming out from the egr cooler goin to intake manifold.</p> <p>tag oit unit.</p>
1377959	TECHNICIAN INITIATED JOB	PUMINYAD	21/05/2021	Internal	16210.0	\$0.00	<p>Replace Muffler,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Top up cooling system,</p> <p>Complaint; Unit keeps on cutting out error codes E0235 and E0196.</p> <p>Cause; Low coolant level.</p> <p>Correction; top up coolant and reset error code. test run unit and now no more error codes</p> <p>.unit is back in service.</p>
1377663	Heater repair	BIG TRUCKS NSW SUB	19/05/2021	Internal	16175.0	\$0.00	
1377471	Clear fault codes, DEF N0x sensors malfunction, DEF injector malfunction	BIG TRUCKS NSW SUB	19/05/2021	Internal	16175.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1376835	Ongoing error codes E0235, E0197	PUMINYAD	17/05/2021	Internal	16156.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Electrical System  Top up cooling system,  travel to site from wp. check error code. found that low coolant. top up coolant and reset error codes. test run unit and no more error.
1376014	Engine filter housing leak & transmission output shaft leak	PUMINYAD	12/05/2021	Internal	16132.0	\$0.00	Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items,  Repair Transmission as necessary,  Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, 250hr Service
1370957	Scheduled Service - 16,250hr service II 250hr type	PUMINYAD	12/05/2021	Internal	16134.0	\$0.00	performed 250 hrs service. grease unit tubs and greasing point. replaced trans speed sensors oring because its leaking. check chain and lube. still good. jack unit steer pin and bushing check. all good. trans output shaft and engine filter bypass is both leaking and need to order parts and replaced.  Performed machine 250 hrs servicing. Check steer pins and bushing. Check lift chain wear. Lubricate unit. Replace transmission speed sensor O-rings(x4). Note: Waiting for engine parts.
1358903	F2: Replace Tyre Pressure Sensor	APATRIMONIO	12/05/2021	Internal	16132.0	\$0.00	Adjust Fleet Management System as required,  Check-up tyre pressure monitoring system. Front right inner sensor not working. Recalibrate pressure sensor.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1375519	DAF error code on dash	APATRIMONIO	10/05/2021	Internal	16132.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  Assist cummins tech to check engine fault code. DEF injector solenoid and NOX sensor faulty-for replacement. Waiting for parts (Cummins will provide).  Assist Cummins tech to replace Nox sensor and DEF solenoid. Tested machine and monitor whilst in operation. Machine is up. Carry out Inspection and Diagnosis of Electrical System
1372739	F2 - Error Code	APATRIMONIO	28/04/2021	Internal	16131.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  Repair Switch/es  check error code DEF. faulty diesel exhaust fluid level sensor. check electrical. all good. pull out sensor from the def tanks for visual check. refit sensor and tank accessories. test run unit. unit is safe to use just have error code def and engine derate.  Travel to site,  Clean Diesel Tank as required,  Labour  Engine fault code reported. E3714/E4863/DEF-faulty Diesel Exhaust Fluid sensor. Pick-up parts at WP and travel to site. Replaced DEF tank assembly and fixed fluid and coolant hose connection. Clean wiring sockect connectors. Call cummins tech to reset fault codes stored in ECU. Test run machine and its good to go.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1371432	Engine stopped, Warning lights coming up.	PUMINYAD	21/04/2021	Internal	16058.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Electrical System  Top up cooling system,  Adjust Inching Valve to correct specification ,  Travel to site. check error code stop engine. found coolant low level. top up coolant. also found that inching pedal has some play. adjusted inching pedal and calibrate. 2000hr Service
1364128	Scheduled Service - 16,000hr service II 2000hr type	PUMINYAD	13/04/2021	Internal	15959.0	\$0.00	Performed machine 2000hr servicing. Chain wear : 0.2%  Labour  Travel to site,  performed 2000hrs service. weld crack wear pad bracker. Bleed cooling system and remove air locks
1368934	F2 - E0235 code on dash	PUMINYAD	8/04/2021	Internal	15949.0	\$0.00	Labour  Travel to site,  Top up cooling system,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1368739	GREEN LIGHT ISSUE	PUMINYAD	7/04/2021	Internal	15950.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>check attachment green light issue. test unit function at 3 stock hight. check attachment wiring found some water corrotion on the connector. open and clean connector. refit connectors. test unit in 3 stock high green light is ok its not playing up. unit is back in service.</p> <p>Carry out equipment condition assessment</p> <p>Troubleshoot green light indicator issue. Repair corroded wiring harness connector. Tested machine function.</p> <p>Repair Attachment as necessary,</p> <p>ride with the operator to see the green light issue. recreate the problem. found that green light proxy is playing up when unit is loaded. adjust left side proxy. test unit allgood no more green light issue. unit back in service. Repair Attachment as necessary,</p> <p>Rectify green indicator light not working. Check-up reverse buzzer.</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>check reverse buzzer all working. check and repair green light. test run unit operate attachment. all good unit is back in service.</p>
1368215	Green light not working on high stacks and reverse buzzer reported inop	PUMINYAD	6/04/2021	Internal	15937.0	\$0.00	<p>Repair Attachment as necessary,</p> <p>Rectify green indicator light not working. Check-up reverse buzzer.</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>check reverse buzzer all working. check and repair green light. test run unit operate attachment. all good unit is back in service.</p>
1367218	Auto Elec Cost Ref # 1362536	BIG TRUCKS NSW	29/03/2021	Internal	15840.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1365524	Engine light is coming up - Possibly water on the filter	PUMINYAD	22/03/2021	Internal	15840.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Top up cooling system,</p> <p>travel to site.</p> <p>sign in to site.</p> <p>set up safe work area.</p> <p>check error codes E0197 and E0235 low coolant.</p> <p>top up coolant using pxg from the container.</p> <p>test run unit and check for coolant leak.</p> <p>all good no more leak.</p> <p>I ordered new cup for expansion tank.</p> <p>Replace Radiator cap,</p> <p>replaced radiator cap.</p>
1365360	F2 - Attachment lights playing up	BIG TRUCKS NSW	19/03/2021	Internal	15801.0	\$0.00	
1364466	F2- Replace fire extinguisher	AMABBOTT	16/03/2021	Internal	15800.0	\$0.00	Replace Fire Extinguisher,
1364156	Scheduled Service - 6 Monthly Fire Suppression Service.	211 Planning B	16/03/2021	Internal	15753.0	\$0.00	
1364148	F2 - Fuell smell	PUMINYAD	15/03/2021	Internal	15757.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>Steam clean equipment as necessary.</p> <p>check fuel smell on the cabbिन.</p> <p>replaced ac filter take spare from pn container.</p> <p>clean the cabbिन and seat sorounding.</p> <p>put rubbish to the bin.</p> <p>blow it with air.</p> <p>test run unit no more fuel smell.</p> <p>Carry out equipment condition assessment</p>
1363914	AFTERHOURS- Operator heard a big bang come from the unit, possibly a blown tyre.	TARTHUR	12/03/2021	External	15740.0	\$462.50	<p>Travel to site. Sign into site. Obtain PTW. Locate unit and setup safe work area. Inspect all tyres for damage, tyres are in hood condition. Inspect unit for signs of impact or loose componets that may cause 'big bang' sounds, unit has no signs of recent impact or loose components. Request operator to test drive while observing from training seat, unit operating without fault or banging sounds. Return unit to service. Report findings to shift supervisor. Sign off PTW. Sign out from site.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1359760	Scheduled Service - 15,500hr service II 500hr type	PUMINYAD	10/03/2021	Internal	15710.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Performed machine 500hrs servicing. Chain wear : 0.1% both side. Steer pin and bushes still good.
1362536	A/C not working	AMABBOTT	8/03/2021	Internal	15699.0	\$0.00	Repair Air Conditioner as necessary,
1362260	F2 - Repair Seatbelt	AMABBOTT	5/03/2021	Internal	15678.0	\$0.00	Repair Seat as necessary,  seat belt jaming, replaced belt section retested ok
1359421	F2 Spreader issue	APATRIMONIO	19/02/2021	Internal	15541.0	\$0.00	Travel to site,  Carry out equipment condition assessment  Repair Attachment as necessary,  Travel to site from Simblast. Carry-out equipment condition assessment. Check up twistlock issue, adjust twistlock rods. Test attachment function.
1359100	F2 attachment issues	CMILLAR	18/02/2021	Internal	15522.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1358813	F2 Stuck on box	PUMINYAD	17/02/2021	Internal	15549.0	\$0.00	<p>Top up cooling system,</p> <p>Remove and Replace Coolant Hose/s</p> <p>Check coolant leak. top up coolant. start unit and check leak coming from. found that its coming from the head bleeding hose to radiator header . pull out hose and replaced using van stock hose. top up coolant. test run unit. unit is now back in service.</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Repair Attachment as necessary,</p> <p>Grease All Points on Unit,</p> <p>Unstock unit from the box. bring unit to the workshop. check attachment. adjust proxy braket. greased twistlock. fill grease tubs. tension ac compressor belt. test run unit twiatlock. unit is back in service.</p>
1357564	Sticky Brakes	TARTHUR	11/02/2021	Internal	15364.0	\$0.00	<p>installed washer bushing for twistlock rod. Carry out equipment condition assessment</p> <p>Carry out Inspection and Diagnosis of Brake System</p>
1356665	Check Attachment - Part Dislodged	PUMINYAD	8/02/2021	Internal	15451.0	\$0.00	<p>Test brakes, test ok. Check brale pressures, pressures to spec. Return to operator to test, operating correctly. Repair Attachment as necessary,</p> <p>Remove and repair overmast hose guide pole.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1341845	F2 - Scheduled Service - 15,000hr service II 5000hr type	PUMINYAD	27/01/2021	Internal	15497.0	\$0.00	5000hr Service  Continue machine 5000hrs servicing. Performed hub retension. Replaced gear oil.  Labour  Travel to site,  Replaced twistlocks.  Replacement of twistlocks. Carry out Inspection and Diagnosis of Attachment  performed safety check attachment wearpads.
1353003	Check Attachment wear pads	PUMINYAD	21/01/2021	Internal	15296.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1353005	Attachment functions slow and engine stalling	PUMINYAD	19/01/2021	Internal	15300.0	\$0.00	<p>Check/Inspect/Diagnose Hydraulic Tilt Valve Section and test operation,</p> <p>Repair Hydraulic Control Valve as necessary,</p> <p>Adjust Hydraulic Pressure Settings to correct specification,</p> <p>Troubleshoot attachment low pressure. Check main manifold accumulator charge valve and pressure transducer. Remove and clean check valves. Check hydraulic pressure.</p> <p>Check/Inspect/Diagnose Cylinder</p> <p>Labour</p> <p>Travel to site,</p> <p>Collect parts from Prestons. Drop part to Pac Nat SFT</p> <p>Replace Hydraulic Valve Section,</p> <p>pick up parts. clean main manifold. installed papet spool accu charge valve. test run nuit and check MP port pressure its 0-210bar which is ok. check MACC pressure 210bar cut out. 165 cut in ok. adjust MSB1 to 165bar. clean unit and reapiir oil leak in the main valve. returneb attachment valve block on H3 used for testing. test run unit and now its back in service.</p> <p>Andrew - pressure on main manifold macc 4000psi charge valve fault and relief valve on main manifold hitting relief, charge valve replaced.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1352014	Unit Driving Slowly, No codes on dash	APATRIMONIO	15/01/2021	Internal	15296.0	\$0.00	<p>Travel to site,</p> <p>Carry out equipment condition assessment</p> <p>Carry out Inspection and Diagnosis of Transmission</p> <p>Check/Inspect/Diagnose Cylinder</p> <p>Travel to site and carry out equipment condition assessment.</p> <p>Check-up machine driving slow.</p> <p>Adjust and calibrate inching pedal.</p> <p>Check-up hydraulic oil pressures.</p> <p>Note: machine tagged out. Engine stalls when hydraulic oil gets hot. For further troubleshooting.</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Adjust Hydraulic Pressure Settings to correct specification,</p> <p>Repair Attachment as necessary,</p> <p>Continue troubleshooting engine stalling during steering and tilting.</p> <p>Attachment movement getting slow after few minute of operation.</p> <p>Check hydraulic pressures, check main valve and manifold spool and solenoids.</p> <p>Adjust pilot pressure.</p> <p>Check attachment hydraulic pressure. Pressure Intermittent, for further check.</p> <p>Check/Inspect/Diagnose Hydraulic Pump and test operation,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Adjust Hydraulic Control Valve to correct specification ,</p> <p>Continue troubleshooting on hydraulic low pressure.</p> <p>Carry attachment cylinder leak test.</p> <p>Check main manifold pressures.</p> <p>Check/Inspect/Diagnose Hydraulic Tilt Valve Section and test operation,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1351878	F2 -Low coolant.	PUMINYAD	15/01/2021	Internal	15295.0	\$0.00	Continue troubleshoot on dropping hydraulic pressure on attachment. Travel to site,  Carry out Inspection and Diagnosis of Electrical System  Top up cooling system,  check error code low coolant E0235 top up coolant and test run unit. all working. Travel to site,
1351707	Spreader / Tbeam fault - inoperable	PUMINYAD	14/01/2021	Internal	15289.0	\$0.00	Travel to site,  Carry out equipment condition assessment  Repair Attachment as necessary,  Travel to site and carry out equipment condition assessment. Check up spreader function.
1351568	Spreader fault .	PUMINYAD	13/01/2021	Internal	15279.0	\$0.00	Carry out Inspection and Diagnosis of Attachment Travel to site,  Check/Inspect/Diagnose Cylinder  Adjust Hydraulic Pressure Settings to correct specification,  Adjust Hydraulic Control Valve to correct specification ,  travel to site. sign in to pn. set up safe work area. test unit issue. check electrical all working. check hydraulic pressure. low open relief valve and clean inside parts. refit valve and test run unit. no 20/40 function. check 20/40 found that the lock pin is activated causing the 20/40 not to move. deactivate function and problem fix. test run unit all function is now working unit back in service.
1345135	Scheduled Service - 15,250hr service II 250hr type	211 Planning B	8/01/2021	Internal	14929.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1349922	F2 - Joystick rubber & fire extinguisher bracket needs to be replaced	APATRIMONIO	5/01/2021	Internal	15296.0	\$0.00	<p>Replace Fire Extinguisher,</p> <p>Repair Switch/es</p> <p>Check-up joystick rubber and fire extinguisher bracket.</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Check up joystick rubber boot, worn-out for replacement.</p> <p>Labour</p> <p>Travel to site,</p> <p>Pick-up parts and travel to site.</p> <p>Replace joystic rubber boot.</p> <p>Carry out Inspection and Diagnosis of Electrical System</p>
1349895	F2 - E0556 fault code coming up	APATRIMONIO	5/01/2021	Internal	15185.0	\$0.00	<p>Rectify engine fault code.</p> <p>Check engine harness and connections.</p> <p>Clean socket connector of crankcase pressure sensor.</p> <p>Carry out equipment condition assessment</p>
1348952	Repair A/C fault	AMABBOTT	31/12/2020	Internal	15159.0	\$0.00	<p>Repair Air Conditioner as necessary,</p> <p>Labour</p> <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Carry out equipment condition assessment.</p> <p>Check ACU not working.</p> <p>Travel to branch to pick-up parts and back to site.</p> <p>Install new ACU belt.</p> <p>Test ACU.</p> <p>Check engine error code E1942.</p> <p>Repair Windscreen Wiper as necessary,</p>
1348671	F2 - Replace wiper blades	PUMINYAD	29/12/2020	Internal	15126.0	\$0.00	<p>Repair wiper blade.</p>
1347816	F2: Replace Steer Tyres * 2 (on existing rims)	211 Planning B	22/12/2020	External	15092.0	\$10,497.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1346043	F2 - Unit has a hydraulic leak from around the spreader. Tagged out.	APATRIMONIO	11/12/2020	Internal	14976.0	\$0.00	<p>Travel to site,</p> <p>Carry out equipment condition assessment</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Travel to site. Site sign in procedure. Obtain permit to work. Locate unit and set up safe work area. Inspect unit for leaks, found hose from the brake filter housing to brake pump on trans has fouled against a steer hose going to the pressure valve above drive axle. Informed D.M of findings and that I was close to 14hr working limit. Locked out unit for another tech to attend 1st thing in the morning.</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p> <p>Refit Hydraulic Hose/s and ancillary items,</p> <p>Steam clean equipment as necessary.</p> <p>Carry out machine condition assessment. Remove damage hydraulic hoses. Fit new hydraulic hoses. Wash machine.</p>
1343623	Check F2 for leaks, leaks have been reported in the driver pre-starts	ASTOKES	1/12/2020	Internal	14868.0	\$0.00	<p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>INSPECTED UNIT FOR ANY/ALL FLUID LEAKS, NO SIGNIFICANT LEAKS NOTED, ALL OK.</p>
1339752	F2 - Replace 3 X transmission hoses, 4 X main control valve hoses.	211 Planning B	1/12/2020	Internal	14866.0	\$0.00	<p>Replace Transmission Hose/s,</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>Replace transmission and hydraulic hoses.</p>
1343361	F2 - something lodged in tyre	AMABBOTT	30/11/2020	External	14835.0	\$182.10	<p>Remove ancillary items and Hydraulic Hose/s, inspect and report, Repair Puncture as necessary,</p> <p>consulted sean from tyre company sent through pictures gave ok to pull out ratchet strap end. tyre ok no air leak.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1338833	F2 - Scheduled Service - 14,750hr service II 250hr type	PUMINYAD	26/11/2020	Internal	14785.0	\$0.00	250hr Service
1338243	F2 - Mast mounting check	PUMINYAD	26/11/2020	Internal	14786.0	\$0.00	travel to branch pick up ewp. travel to site. check lube mast chains. do safety iinspection. Repair Mast as necessary, checked ans tensioned pins to 320nm
1339640	F2: Replace Drive Tyres * 4 & Drive Rims * 4 (new rims)	211 Planning B	25/11/2020	External	14602.0	\$0.00	clean mast pins and bolts. pull out and replaced pin bolt.
1339349	F2 - Trans fault code T20100	AMABBOTT	24/11/2020	Internal	14764.0	\$0.00	Carry out Inspection and Diagnosis of Transmission
							code t2100 coming up when engine idling. tested unit. all gears 19bar causing fault ordered new regulator spring
							replaved trans spring. checked trans pressure now 23 bar recalibrated trans. tesst drove and cleared codes.
1341582	F2 - Cannot get the 4th gear the unit - Tagged out.	APATRIMONIO	20/11/2020	Internal	14602.0	\$0.00	
1342751	F2: Call out of site on 19/11/20 to inspect steer tyre after impact damage.	211 Planning B	19/11/2020	External	14782.0	\$454.50	
1339398	F2: Replace Steer Rims (new) * 2 & Fitout 2 Runouts tyres (drive tyres removed from F1)	211 Planning B	17/11/2020	External	14659.0	\$5,619.32	
1339748	F2 - End of ratchet strap embedded in tyre	AMABBOTT	12/11/2020	Internal	14521.0	\$0.00	
1339580	F2 - losing the spreader lights	AMABBOTT	12/11/2020	Internal	14602.0	\$0.00	Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,
							loosing red/ unlock light, found broken wire at sensor plug, repaired
							Carry out Inspection and Diagnosis of Transmission
							Check up transmission error 2100. Rectify spreader losing red indicator light. Fixed cut-off wire of left side twistlock sensor.
1337693	F2: Replace Drive Tyres * 4 & Drive Rims * 4	211 Planning B	12/11/2020	External	14587.0	\$33,219.44	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1333227	F2 - Scheduled Service - 14,500hr service II 500hr type. Level B Service	AMABBOTT	12/11/2020	Internal	14602.0	\$0.00	Labour  Travel to site,  Carry out equipment condition assessment  Pick up parts at branch and travel to site. Servicing rescheduled, workshop unsafe to use.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Performed machine 500hr servicing. Retight handrails mounting bolts. Carry out equipment condition assessment inspected unit, leaking at fitting on nitrogen tank. tightened recommend fire guys check system pressure etc after fluid leaked out.  recon replaced main fire tank
1324952	Major repairs to fire suppression system	AMABBOTT	12/11/2020	Internal	14602.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1338743	F2 - Overheating	CMILLAR	9/11/2020	Internal	14587.0	\$0.00	<p>Remove and Replace Coolant Hose/s Labour Travel to site, Carry out Inspection and Diagnosis of Electrical System</p> <p>Replace Temperature Sender,</p> <p>Replace Switch/es</p> <p>attend site and sign in. carry out inspection with Adam to find out why unit was over heating. found that unit had a coolant leak from fitting on the side of engine block. using temp gun found the engine cylinder head was at 145 degreese. wait for unit to cool down to a temp that we could work on it. remove hose and fit new hose. top up coolant and found coolant leaking from back of cylinder head from heater hoses. titan hosesand recheck all ok. steam clean engine and found warring lights would not go off. tag out unit for the night. pick up parts from cummins and hyster. attend site and sign in. remove and replace coolant. went to remove and replace coolant level switch and found that the switch was the wrong part. double check parts and get the right level switch.</p>
1338652	F2 - Hydraulic oil leak	211 Planning B	9/11/2020	Internal	14589.0	\$0.00	<p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Labour</p> <p>Travel to site,</p> <p>Refit Battery to unit, Refit ancillary items,</p> <p>Carry out equipment condition assessment</p> <p>INSPECTED UNIT FOR HYDRAULIC OIL LEAK, FOUND DIESEL TANK CAP UNSECURE AND NOT AFFIXED TO TANK SPOUT, FOUND DIESEL UNDERNEATH UNIT, REFITTED FUEL CAP TO UNIT, REFITTED BATTERIES TO UNIT IN ABSENCE OF BATTERIES FOR F1, RAN AND TESTED UNIT, UNIT OPERATED OK THEN FOUND SEVER COOLANT LEAK FROM EGR COOLER LINE ON ENGINE BLOCK SIDE. UNIT TAGGED OUT FOR FURTHER REPAIRS. Repair Water Pump</p>
1336437	F2 - Coolant leak	DMCDONALD	28/10/2020	Internal	14323.0	\$0.00	<p>Repair Water Pump</p> <p>Top up cooling system,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1336062	F2 - mast strike alarm going off when tilted back and loaded with a container (heal strike issue)	DMCDONALD	28/10/2020	Internal	14230.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Electrical System  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Carry out equipment condition assessment
1334437	F2 - check undercarriage hoses for degredation / leaks	PUMINYAD	21/10/2020	Internal	14359.0	\$0.00	we need pirtek to chance 5 hoses from mmai control valve to lift valve. need to replace 2x broken hose clamps.  Check undercarrage hoses for degration and leaks.  250hr Service  Remove ancillary items and Hydraulic Hose/s, inspect and report,  Replace Hydraulic Hose/s and ancillary items,  performed 250hrs service. repair 20/40 cylinder bolt. replaced overmast hoses. replaced aux hoses. replaced auto greasing hose. top up coolant. 250hr Service
1330267	F2 - Scheduled Service - 14,250hr service II 250hr type	APATRIMONIO	21/10/2020	Internal	15704.0	\$0.00	250hr Service  Performed machine 250hr servicing. Top-up grease tank. Check machine condition assessment.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1333320	F2 - Overheating and low coolant light	DMCDONALD	13/10/2020	Internal	14239.0	\$0.00	<p>Travel to site,            Replace Water Pump,            Checked for coolant leak, confirmed leak on turbo coolant turbo drain fitting, as fitting is situated above the DPF the coolant leaking from fitting instantly evaporated making diagnosis difficult.. tightened fitting and pressure tested system to ensure no further leaks, no evidence of further leaks at time of inspection.            As the engine fitted to the unit is a tier 4 the coolant requirements only allow cummins genuine coolant to be added to system, no coolant was instock at time of breakdown so unit will have to stay down over night and coolant sourced tomorrow morning.</p> <p>Labour</p>
1331611	CALLOUT - operator went to go refuel now cant start it up	CMILLAR	3/10/2020	External	14132.0	\$523.00	<p>Flush and Replace Cooling System Coolant            Travel to site,            Carry out Inspection and Diagnosis of Attachment</p> <p>*attend and sign into site.            *carry out inspection of forktrack system for swipe card reader fault.            *could not fault card reader.            *carry out function test of unit while on site and everything seems to be operational.            *send unit back to work.</p> <p>*attend and sign into site.            *carry out inspection of forktrack system for swipe card reader fault.            *could not fault card reader.            *carry out function test of unit while on site and everything seems to be operational.            *send unit back to work.</p>
1327500	F2 - Air Con Servicing	ASTOKES	23/09/2020	Internal	13988.0	\$0.00	<p>Repair Air Conditioner as necessary,            ASSISTED SAL IN A/C SERVICE.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1328326	Hydraulic leak on the spreader, parked up	DMCDONALD	22/09/2020	Internal	13981.0	\$0.00	Travel to site,  Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,  Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,  Approx half hour to sign in, Inspected oil leak.. found large oil leak evident from r/h/s of spreader.. cleaned area for diagnosis and tested spreader function at diagnose source of leak, unable to properly diagnose due to intense spray of hydraulic oil coating all hoses and valves in 20-40 cylinder valve bank.. requested operator to test function while I look for leak from spreader, found leak evident from control valve area.. stripped control valve, replaced all brittle orings and re tested.. no signs of leak after repair, commenced clean up of large oil spill Labour
1323880	F2 - Scheduled Service - 14,000hr service II 2000hr type. Level D Service	ASTOKES	17/09/2020	Internal	13934.0	\$0.00	Travel to site,  2000hr Service  CARRIED OUT 2000HR SERVICE AS PER SCHEDULE
1326178	F2 - Inspect chain length	DMCDONALD	11/09/2020	Internal	13774.0	\$0.00	Performed machine 2000hrs service. Carry out Inspection and Diagnosis of Mast/Carriage Travel to site,
1325951	F2 - Alarm going off, unable to reset (E1885)	ASTOKES	9/09/2020	Internal	13883.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Electrical System Travel to site. check unit alarm error code e1885. check electRical. found intake nox sensor defective. Labour Repair Exhaust pipe as required, Carry out Inspection and Diagnosis of Telemetry System Repair Fleet Management System as required, ARRIVED TO SITE AND SPENT SOMETIME RUNNING THROUGH PN SOPS WITH MIKE RILEY. CHECKED EXHAUST NOX SENSOR ON F2, CHECKED TO CLEAR CODES, CODE REMAINED, BYPASSED FORKTRACK SYSTEM, RAN UNIT AND TESTED THROUGH THD YARD, FOUND CODE EVENTUALLY CLEARED, CONNECTED FORKTRACK SYSTEM AND TESTED HONEYWELL SYSTEM AND FOUND ALL OK.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1314872	F2 - Scheduled Service - 13,500hr service II 500hr type. Level B Service	AMABBOTT	27/08/2020	Internal	13732.0	\$0.00	Travel to site,  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1323249	F2: Rotation of Drive Tyres & Re-Torque of drive tyres.	211 Planning D	26/08/2020	External	13721.0	\$2,659.25	
1311939	F2 - 12 Monthly Fire Suppression Service.	DMCDONALD	20/08/2020	Internal	13096.0	\$0.00	Install Fire Extinguisher,
1312047	F2 - Hydraulic fan running full speed al lthe time (loud) - Hydraulic pump replacement	DMCDONALD	23/07/2020	Internal	13280.0	\$0.00	Assist Recon for servicing of fire suppression. Carry out equipment condition assessment  Replace Hydraulic Pump,  Travel to site,  Check/Inspect/Diagnose Hydraulic Pump and test operation,
1313439	F2 - A/C Not Working	BIG TRUCKS NSW SUB	22/07/2020	Internal	13268.0	\$0.00	Labour Carry out Inspection and Diagnosis of Electrical System  Inspect unit for A/C fault. Power is getting to A/C switch but not to A/C compressor. Only had time for a quick check, further diagnosis required.  Repair Air Conditioner as necessary,
1312977	F2 - prestart not coming up, no card required to start fork	DMCDONALD	21/07/2020	Internal	13238.0	\$0.00	assist austral, electrical fault in ac harness. Carry out Inspection and Diagnosis of Telemetry System
1311937	F2- Scheduled Service - 13,250hr service II 250hr type- Change out engine oil and oil filter after engine re-build.	DMCDONALD	21/07/2020	Internal	13238.0	\$0.00	250hr Service  Travel to site,
1311323	F2 - Complete service from J 1297064 - 1000h	DMCDONALD	21/07/2020	Internal	13238.0	\$0.00	3000hr Service
1314679	F2 - Having trouble starting	AMABBOTT	20/07/2020	Internal	13201.0	\$0.00	1000hr Service Carry out Inspection and Diagnosis of Telemetry System  screen frozen/ not turning on. removed and checked/ cleaned connection. reset/ restarted all ok
1305203	F2 - Scheduled Service - 13,250hr service II 250hr type	211 Planning B	7/07/2020	Internal	13073.0	\$0.00	
1311286	F2 - EGR Valve	211 Planning B	2/07/2020	Internal	13075.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1297064	ON HOLD, F2 ENGINE ISSUES, TRUCK DOWN - PARTS AT PN - F2 - Scheduled Service - 13,000hr service II 1000hr type. Level C Service	DMCDONALD	24/06/2020	Internal	12780.0	\$0.00	Travel to site, 1000hr Service Remove ancillary items and remove Radiator from unit, Inspect and report, Steam clean equipment as necessary. Labour Removed Radiator ass'y. Cleaned/Washed parts. Delivered radiator ass'y to JJ Radiator repair. Travel back to pacific national. 3000hr Service Performed machine servicing. Drain transmission oil. Replaced brake and transmission filter.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1305448	F2 - Error codeds E0197 and E0235 - losing coolant - ENGINE REBLOCK	ASTOKES	22/06/2020	Internal	13075.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>topped up coolant and engine oil 9-6-20. while wheels off for repair.</p> <p>wheels refitted 10-6-20, unit not drivin and coolant low warning on again.</p> <p>checked engine. blowing steam out exhaust, coolant resior bubbling, engine oil contaminated with coolant. called out cummins to assis.</p> <p>with sump removed coolant leaking past one piston. cummins to remove head and find fault.</p> <p>Change Engine Oil as required,</p> <p>Carry out equipment condition assessment</p> <p>Remove and Replace Cylinder Head</p> <p>Remove ancillary items and remove engine from unit.</p> <p>Labour</p> <p>Remove ancillary items and remove Radiator from unit, Inspect and report,</p> <p>Steam clean equipment as necessary.</p> <p>Removed radiator assemble. Wash radiator and machine.</p> <p>Refit Radiator to unit, Refit ancillary items,</p> <p>Refit Hydraulic Hose/s and ancillary items,</p> <p>Replace Transmission Oil as Required</p> <p>Refit radiator assembly. Refit hydraulic and transmission hoses. Refill transmission oil.</p> <p>Refit engine to unit, refit ancillary items,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p>
1305815	F2: Drive tyre rotation & re-torque of drive tyres.	211 Planning B	9/06/2020	External	13075.0	\$2,674.75	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1305270	F2 - reapiir fork track	AMABBOTT	9/06/2020	Internal	13075.0	\$0.00	Carry out Inspection and Diagnosis of Telemetry System  reconnected and worked thru torktrack faults. system now working.
1302749	F2: Replace Steer Tyres * 2	211 Planning B	9/06/2020	External	13022.0	\$10,493.00	
1296642	F2: Replace Wheel Studs & Nuts	AMABBOTT	9/06/2020	External	13075.0	\$3,578.62	Labour  Repair Wheel/s as necessary,  wheel studs streched and threads damaged on studs and nuts. removed and replaced studs. had to weld nuts onto some studs to remove.
1293920	F2: Replace Steer Rims * 2	211 Planning B	9/06/2020	External	13022.0	\$4,084.32	Carry out equipment condition assessment
1305064	CALLOUT - F2 - Honeywell swipe system. None of the card readers are working. No one can log in.	211 Planning B	6/06/2020	External	13073.0	\$519.00	
1304677	F2 - Blown hose on top of spreader	AMABBOTT	5/06/2020	Internal	13057.0	\$0.00	Replace Hydraulic Hose/s and ancillary items,  blown spreader hose. replaced hose washed down 20/40 arm.
1303416	F2: Re-torque Pos 5 & 6 Tyres	211 Planning B	4/06/2020	External	13051.0	\$752.75	
1293237	F2 - Replace vales on lock cylinders	AMABBOTT	27/05/2020	Internal	12850.0	\$0.00	Remove ancillary items and Hydraulic Control Valve , Strip, Inspect and report,  Performed machine walk around inspection. Removed valve and inspect. The new valve are thinner than the original one so it makes the bolts longer. Replace bolts.
1296390	F2: Re- Torque drive tyres	BIG TRUCKS NSW SUB	19/05/2020	External	12765.0	\$752.75	Carry out equipment condition assessment
1295186	F2 - PA isn't working	AMABBOTT	14/05/2020	External	12841.0	\$350.80	Carry out Inspection and Diagnosis of Electrical System  Checked 2 way radio microphone. its broken causing it not to work.  Repair Radio,  obtained hanset, 5 pin plug fitted old plug has 3 pin plug. swapped plugs. dropped hoodlining and installed, tested ok

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1293176	F2 - Wiring modifications as per Scott Baker	AMABBOTT	14/05/2020	Internal	12841.0	\$0.00	Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  Repair Fleet Management System as required,  carried out fm1 upgtades as per instructions on speedsheild drive.  Repair Attachment as necessary,  Performed wiring modifications and replaced relays. Test machine performance. Moved spreader attachment parts.
1296379	F2: Replace Drive Tyres * 4	BIG TRUCKS NSW SUB	5/05/2020	External	12742.0	\$20,954.00	
1294135	F2 - Auto greaser on chasis not working	GGUERRERO	5/05/2020	Internal	12741.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  INSPECTED OPERATION OF CHASSIS GREASE PUMP, NO FAULTS FOUND AT TIME OF TEST, ADJUSTED SETTINGS, GOING TO MONITOR OPERATION IN FUTURE. 250hr Service
1293612	F2: Scheduled Service- 12,750hr service II 250hr type.	GGUERRERO	5/05/2020	Internal	12741.0	\$0.00	CARRIED OUT 250 HR SERVICE AS PER SCHEDULE. CHAINS AT 0.5% WEAR. ALL OK

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1287756	F2 - Scheduled Service - 12,500hr service II 500hr type. Level B Service	ASTOKES	17/04/2020	Internal	12337.0	\$0.00	<p>Labour</p> <p>Travel to site,</p> <p>Pickup parts at wetherill park and travel to site pacific national.</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Greased machine.            Changed oil engine oil.            Note: No available parts of engine oil filter in the service kit. Needs to be replaced.</p> <p>COMMENCED 500HR SERVICE ON UNIT, GREASED AND INSECTED CHAINS, 0.5% WEAR. REPLACED ENGINE OIL, FILTER WAS MISSING FROM KIT. HALTED SERVICE DUE TO CUSTOMER REQUIRING UNIT, REST OF SERVICE TO BE CARRIED OUT.</p> <p>Repair Attachment as necessary,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Service machine 500hr.            Tighten loose wear pad bolts.            Tighten loose radiator fan cover bolts.</p> <p>Travel to site,</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p> <p>Refit Hydraulic Hose/s and ancillary items,</p> <p>Replaced hose from main pump to steering main control valve.            Test machine performance.</p> <p>REMOVE AND REPLACE HYDRAULIC OVERMAST HOSES, TESTED ALL OK.</p>
1290012	F2 - Hydraulic Hoses	GGUERRERO	14/04/2020	Internal	12471.0	\$0.00	<p>Travel to site,</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p> <p>Refit Hydraulic Hose/s and ancillary items,</p> <p>Replaced hose from main pump to steering main control valve.            Test machine performance.</p> <p>REMOVE AND REPLACE HYDRAULIC OVERMAST HOSES, TESTED ALL OK.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1289981	F2 - Hydraulic Hose	GGUERRERO	8/04/2020	Internal	12463.0	\$0.00	<p>Check/Inspect/Diagnose Cylinder</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p> <p>Refit Hydraulic Hose/s and ancillary items,</p> <p>Inspect hoses that needs to be replaced.  Replaced damaged hoses 2x  A. From pump to pilot valve.  B. From pilot valve to cab.  Top-up engine oil and hydraulic oil.  Test machine performance.  Needs to replace 2 more hoses.</p>
1286357	F2 - R/H spreader is becoming stuck intermittently - P&A on 6996120 x2 requested - only 1 available - work carried over in to J 1293237	AMABBOTT	31/03/2020	Internal	12273.0	\$0.00	<p>Travel to site,  Carry out Inspection and Diagnosis of Attachment  Carry out equipment condition assessment  Repair Attachment as necessary,  Carry out inspection of attachment.  Repair Hydraulic Control Valve as necessary,  retested lock cylinder system  found rhs locking intermittantly  removed hoses and found oil flow incorrect.  checked diagrams and 858 elme spreader does not list using one way check valve block as 818 spreader uses.  contacted nacco to confirm kit fitted is for unit, kits only made for 818 spreader.  removed check valve block. tested working in and out but needs singular check valve to stop cylinder creep.  hyster looking into avaiability of valve.</p>
1283807	F2 - Install high vis tape on mast and attachment	ASTOKES	25/03/2020	External	12186.0	\$864.30	<p>Clean attachment and mast .  Install hi-vis tape on mast and attachment.</p>
1280777	F2 - Scheduled Service - 12,250hr service II 250hr type	ASTOKES	24/03/2020	Internal	12052.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>250hr Service</p> <p>Grease All Points on Unit,</p> <p>Top up Hydraulic Oil to correct level,</p> <p>Top up Engine Oil as required,</p> <p>Carry out machine condition assessment.  Service machine 250hr.  Top up grease tank on both machine and attachment.  Top up hydraulic oil 50Ltrs from spare oil in container van.  Top up engine oil 2ltrs.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1285767	After Hours Callout - Broken wear pad bracket	CMILLAR	23/03/2020	External	12259.0	\$324.20	After Hours Call Out. Repair Attachment as necessary, inspect unnit for wear pad bracket broken.
1284785	F2 - Arm rest broken + Fault light coming up	AMABBOTT	18/03/2020	Internal	12280.0	\$0.00	Repair Seat as necessary,  Carry out Inspection and Diagnosis of Electrical System  Replace Switch/es
1284434	No power. (TMC SF email)	DMCDONALD	17/03/2020	Internal	12215.0	\$0.00	fitted new air filter sensor light, light no longer on dash Travel to site,
1283430	F2 - Wiper blades	DMCDONALD	12/03/2020	Internal	12169.0	\$0.00	Carry out Inspection and Diagnosis of Transmission Replace Windscreen Wiper,
1282247	After Hours Callout - Unit in limp mode, turns on and does not rev.	TARTHUR	7/03/2020	External	12123.0	\$421.60	Travel to site,  Carry out equipment condition assessment  Carry out Inspection and Diagnosis of Electrical System  CUSTOMER COMPLAINT UNIT IN LIMP MODE Travel to site. Site sign in procedure. Locate unit and carry out function test, found DEF warning active on dash and engine in limp mode. Check DEF tank found level is low. Arrange for operator to fill DEF and bring unit to work shop. Carry out checks to DEF system and check fluid levels. Clear fault codes caused by low DEF. Inform customer of findings. Return unit to service. Obtain customers signature.
1279948	F2 - Smoke/Hydraulic fluid pouring from the spreader arm on the RH side.	PUMINYAD	26/02/2020	Internal	12030.0	\$0.00	Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,
1279012	F2 - Air filter light flashing	CMILLAR	24/02/2020	Internal	12023.0	\$0.00	Remove, clean and refit Air filter,  Remove ancillary items and Hydraulic Filter and Replace, Refit Hydraulic Filter and ancillary items,  Replace Ignition Switch as required,  Carry out Inspection and Diagnosis of Electrical System
1274034	Scheduled Service - 12,000hr service II 3000hr type. Level E Service	DMCDONALD	20/02/2020	Internal	12215.0	\$0.00	Labour Labour  Travel to site,  1000hr Service

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1277715	F2 - stuck in limp mode. Parked up.	DMCDONALD	18/02/2020	Internal	12002.0	\$0.00	Carry out Inspection and Diagnosis of Attachment Carry out Inspection and Diagnosis of Transmission Repair Transmission as necessary, Repair Attachment as necessary, Travel to site, Replace Transmission Oil as Required Remove ancillary items and Solenoid from unit. Replace Solenoid and Refit to unit. Refit ancillary items,
1254873	F2 - Tre pressure alarm going off but prssures reported as fine in cab controls. Possible sensor issue.	AMABBOTT	17/02/2020	Internal	11971.0	\$0.00	Load software as required to calibrate the unit, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, LHR sensor not reading as tyre valve to short. needs new valve. then need to reprogram. Repair Tube Valve as necessary, Repair Main Electrical Control Panel as necessary,
1277126	F2 - Bottom lift arms have issues opening.	AMABBOTT	14/02/2020	Internal	11971.0	\$0.00	reset LHR sensor and tested system all ok Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, drop down legs cutting out. traced to electrical fault on spreader repaired, tested ok
1276231	F2 - Overheating	DMCDONALD	11/02/2020	Internal	11900.0	\$0.00	Travel to site, Bleed cooling system and remove air locks
1270654	F2: Scheduled Service - 11,750hr service II 250hr type	ASTOKES	3/02/2020	Internal	11664.0	\$0.00	Blow out radiator core, 250hr Service Unable to check chain stretch as i dont have a chain stretch gauge.. mast inspections still pending. Extra time taken to fill grease tubs as they had airlocks and required system bleeding..

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1271842	Replace seat belt	CMILLAR	23/01/2020	Internal	11709.0	\$0.00	Fit Seat Belt,  Repair Seat as necessary,  inspect seat belt fault. replace seat belt. fault still had issues. found rubbish behind seat was causing plug to pull apart. fit new plug and clean out rubbish.  Travel to site,  Carry out Inspection and Diagnosis of Electrical System  Top up cooling system,  Top up Transmission Oil to correct level,,  Steam clean equipment as necessary.
1271712	F2: Re-Torque Drive Tyres	211 Planning B	22/01/2020	External	11702.0	\$752.75	
1271710	F2: Drive Tyre Rotation	211 Planning B	22/01/2020	External	11702.0	\$2,209.75	
1270228	Replace right camera on mast	DMCDONALD	22/01/2020	External	11900.0	\$1,067.80	Labour  Fit Full Camera Kit,
1269225	F2 - lock cylinder is not working at 30 position, cylinder bypassing. Bypassing cylinder to be removed. needs to be either replaced or overhauled.	AMABBOTT	14/01/2020	Internal	11971.0	\$0.00	Repair Visual display unit as necessary, Remove ancillary items and Attachment Cylinder, Strip, Inspect and report,  Removed both lock cylinders and hosing and blocked hydraulic function to locks  Travel to site,  Repair Attachment Cylinder as necessary,  Labour  Refit Attachment Cylinder and ancillary items,  reinstalled lock cylinders to unit. tested operation all ok  Repair Attachment as necessary,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1262309	Scheduled Service - 11,500hr service II 500hr type. Level B Service	DMCDONALD	7/01/2020	Internal	11589.0	\$0.00	Labour  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Carried out scheduled maintenance.. Carried out mast inspection, unable to properly check chain stretch as I do not have a chain stretch gauge. chains lubricsted and visually inspection.
1260092	F2 - coolant issues and the engine light has been coming on. Parked up.	DMCDONALD	6/01/2020	Internal	11623.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Electrical System  loosing coolant with no external leaks. possible egr cooler or engine fault. ben suggested we start with replacing the egr cooler as due every 5000h.  Carry out equipment condition assessment  Repair Exhaust Manifold as required,  Site sign in procedure. Locate unit and setup work area. Replaced EGR cooler. Found U/S coolant hose while replacing EGR cooler. Source new hose ans seals. Return to site. Replace coolant hose. Finish installing EGR cooler and cooler plumbing. Top up radiator with water. Pressure test cooling system, found heater hoses and plug at back of cylinder head leaking coolant. Unit needs water drained and leaks at back of cylinder head rectified and then refill radiator with correct specification coolant. Unit is tagged out. Pack up tools and equipment. Site sign out procedure.  Labour  Flush and Replace Cooling System Coolant  Top up cooling system,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1266845	Side shift is not working. Tagged out.	JINGLIS	3/01/2020	Internal	11457.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Attachment  arrive onsite and go to machine, test operate and work out what issue is. found spreader intermittently locking on 30 position. check switch and electrical side, no problem there. remove lock cylinders and found one to be bypassing causing tongue to be dragging on boom section and sliding into lock position. secured cylinder inside boom section and put operator in machine to test. machine back in service. Repair Visual display unit as necessary,
1266692	F2 - Right camera not working on hte mast	BIG TRUCKS NSW	2/01/2020	Internal	11440.0	\$0.00	
1266341	Callout - Leaking hydraulic oil	CMILLAR	29/12/2019	External	11626.0	\$587.63	Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,  Travel to site,  Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Carry out Inspection and Diagnosis of Transmission
1265915	Callout - F2 overheating	CMILLAR	21/12/2019	External	11642.0	\$364.50	Travel to site,  Repair Light/s  Labour  Replace Light/s  Repair Light Circuit as required,
1260495	2 headlights on the front and light underneath the cab that points towards container are not working.	DMCDONALD	11/12/2019	Internal	11283.0	\$0.00	Load software as required to calibrate the unit,  Completed by Dan M.  11283

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1246280	Scheduled Service - 11,000hr service II 1000hr type. Level C Service	DMCDONALD	11/12/2019	Internal	11150.0	\$0.00	Labour  1000hr Service  oils, filters complete, grease tubs filled. requires front wiper blades x2 transmission calibration mast lube plus inspection.  Replace Windscreen Wiper,  Replaced Front wiper blades.. Pierre performed mast inspection, unit safety check and fitted F2 number to back of mast.. Calibrated Transmission and inching pedal Travel to site,
1259829	F2 - Travelling a low speed even when at full throttle. The right side spreader is also jamming when in the 40" slot setting.	AMABBOTT	29/11/2019	Internal	11111.0	\$0.00	Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  rh rear drop down leg hit mast while lowering. split overmast harness. repaired harness, tested, ok Travel to site,
1259659	Callout - loss of power - no hoist facilities, moving very slowly	TARTHUR	28/11/2019	External	11110.0	\$260.00	Carry out equipment condition assessment Carry out Inspection and Diagnosis of Mast/Carriage Repair Main Electrical Control Panel as necessary, Carry out Inspection and Diagnosis of Transmission Top up Transmission Oil to correct level,, Travel to site. Carry out site sign in procedure. Locate unit and setup safe work area. Inspect unit for mast fault, found no safety lights active. Check fuses found mast supply fuse blown. Replaced fuse and test mast functions, tested ok. Fault code te300 showing on dash. Checked trans oil, found trans oil below add mark. Topped up oil 10L with oil from site container. Spoke to operator about faults and he mentioned the right rear drop down leg swung out and back while raising the carriage, the leg contacted the over mast cables half way up the mast. The operator tested the unit and mast and carriage functions are working but the unit is in limp mode. The over mast cable needs checking and the right rear drop down leg needs inspecting to find why it swung out by itself

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1259586	F2 - Overheating	DMCDONALD	28/11/2019	Internal	11008.0	\$0.00	Travel to site,  Bleed cooling system and remove air locks  checked overheating, observed temperature high when arrived on site.. found coolant level low in header tank.. added 15L coolant and ran to operating temp.. found temp to be steady at normal operating temp.. checked for signs of leaks.. all ok at time of test. Spoke with Andrew who had done work to cooling system the day before and we have ascertained that low coolant level is most likely due to an airlock in cooling system.. Sent machine back into operation and checked unit before completion of job, all ok at time of inspection however i recommend unit coolant level be monitored by one of our techs every couple of days to ensure unit isnt using water. Steam clean equipment as necessary.
1250826	F2- Replace filter housing fittings washer seal and 5X speed sensors 0-ring	AMABBOTT	28/11/2019	Internal	11099.0	\$0.00	Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items,  Remove and Replace Coolant Hose/s  steam cleaned engine bay and blocked radiator. replaced 4 transmission speed sensor orings. replaced engine oil filter seals. replaced engine coolant hose. topped up cooling system. Travel to site,
1258016	CALLOUT - shutting down. error codes EO197 and EO235	CMILLAR	23/11/2019	External	11070.0	\$412.00	attend site and carry out inspection of unit. found 2x error codes. both relating to low coolant level. top up coolant level and remove covers to check for leaks. could not find any leak. (hard to find leak due to raining on unit). fit covers and start unit. fault code went away. Replace Switch/es
1256366	F2 - Replace ignition swithc	DMCDONALD	20/11/2019	Internal	11017.0	\$0.00	Travel to site,  put new ign switch in f2. f2 switch back in h3.
1249957	F2: Replace 12 Wheel Nuts.	BIG TRUCKS NSW	18/11/2019	External	10802.0	\$95.61	
1256253	CALLOUT - IGNITION NOT WORKING	PUMINYAD	16/11/2019	External	11014.0	\$412.00	Carry out Inspection and Diagnosis of Electrical System Replace Ignition Switch as required,
1239554	Scheduled Service - 10,750hr service II 250hr type	BIG TRUCKS NSW	15/11/2019	Internal	10406.0	\$0.00	
1261470	F2: Crack Testing of 6 Rims.	211 Planning B	13/11/2019	External	11157.0	\$3,129.02	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1244081	Check the bottom lift leg engagement lights and leg CCTV cameras are operational	AMABBOTT	12/11/2019	External	10968.0	\$2,081.75	<p>Travel to site,</p> <p>Fit Full Camera Kit,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Order new cameras for drop down legs to replace damaged ones, repair proxy sensor bracket and re adjust proxy switch for rear left drop down leg unit tested ok</p> <p>Replaced R/H/F drop leg camera.. bracket smashed and bolts rusted and snapped in mounting points.. extracted bolts and replaced bracket and camera.. adjusted camera angle and tested... all ok after repair..</p> <p>Note: unable to test drop leg landing lights due to no spare operators and no flat racks onsite at time of inspection, engagement lights must be tested ok before job can be sigfned off..</p> <p>Repair Attachment as necessary,</p> <p>CHecked engagement lights.. found R/H/S landing lights working only.. removed plates of bottom lift legs to reveal proxy switch adjustment.. found both proxy switch adjustments within spec and both proxy switches to light up registering landing signal however landing light still not illuminated on light bar.. further diagnosis needed..</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>repaired drop down leg wiring adjusted landing sensors. tested on box all ok</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1253438	Alternator not charging, starter motor solenoid playing up, check flywheel ring gear	DMCDONALD	7/11/2019	Internal	10934.0	\$0.00	<p>Repair Charging Circuit as required,</p> <p>Checked Alternator concern.. checked charge rate and recieved 27.9v at battery at idle. Shutdown engine and tested voltage drop and charge rate after starting.. Battery reading 26.5v when unit switched off, Started unit and observed voltage drop 24.1v on cranking and immediately raised to 25.9v when engine started to idle before reaching 27.9v after 5 seconds of idle.. Charging system functioning correctly at time of test...</p> <p>Checked Starter motor operation, noticed starter motor free spin before eventually starting, removed starter and inspected operation and flywheel ring gear.. ring gear appears to be ok.. recommend new starter motor.</p>
1253395	CALLOUT - STARTOR MOTOR ISSUE AND AIRCON NOT WORKING	SBHAN	6/11/2019	External	10931.0	\$79.50	<p>Travel to site, Carry out equipment condition assessment Call out - Unit wont start and A/C Faults as reported multiple of times . Start unit found starter motor to be free spinning. Possible cause starter motor will require replacement or Ring Gear on flywheel . Will require further diagnostics. A/C system possible blower motor faulty - parts required.</p>
1252906	F2 Aircon not working	DMCDONALD	5/11/2019	Internal	10298.0	\$0.00	<p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Repair Air Conditioner as necessary,</p> <p>Checked A/C operation.. found no blower fan operation, checked for power and checked fuses and relays... all ok. Checked for power all the way to the fan motors, found no power at motors... traced connections and discovered bad connection before fan.. re connected and still no fan operation. cleaned out fans from heavy build up of dust and fans started working.. Fans operational after repair however there may still be an internal fault in fan assy and in the instance of fan failure I recommend fans be ordered and replaced..</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1246620	Gears seem to be slipping in and out + tighten drivers arm rest	DMCDONALD	5/11/2019	Internal	10928.0	\$0.00	Checked Transmission operation.. found no evidence of trans slipping and no code history logged. found Inching pedal in need of adjustment.. re adjusted, all ok after repair. recommend trans recalibration when trans oil changed. Checked Arm rest complaint, found arm rest loose and adjusment functions seized.. tightened arm rest, lubricated adjustment components and checked operation... all ok after repair
1245066	F2: REPLACE DRIVE RIMS * 4	211 Planning B	5/11/2019	External	10590.0	\$7,576.90	
1245064	F2: REPLACE STEER RIMS * 2	211 Planning B	5/11/2019	External	10590.0	\$4,003.00	
1250716	Callout - stopping in middle of yard (ongoing issue this day) further works J 1250826	PUMINYAD	26/10/2019	Internal	10837.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Top up Engine Oil as required, Top up Transmission Oil to correct level,, Top up cooling system, Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items, Unit turn off by itself. Check electrical. Check engine oil level, trans ol level, coolant level and found its low. Top up engine oil 15lit, trans oil 10 lit. coolant 8lit. Check oil leak found that ther is oil leak on the engine oil filter hoses oring. Replace oring available on my van but to order filter housing fitting seal for replacement. Trans speed sensors oring need to replace . Travel to site,
1250707	Error code T200 - tagged out	PUMINYAD	25/10/2019	Internal	10833.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  Carry out Inspection and Diagnosis of Transmission  Travel to site. Check error code t200 as per operator. no error code coming only TE201 and TE101 for over rev while shifting gears forward and reverse or shifting forward while the machine is moving reverse and vise versa. Check electrical all good. Call shift manager to send the operator and test the unit and as per operator unit is good no issue at all. unit back in service.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1250494	Keeps shutting mid operation - no error codes - Parked Up	AMABBOTT	25/10/2019	Internal	10831.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Transmission  t5403 coming up adjusted and calibrated iching pedal. calibrated transmission
1250378	F2: Replace Drive Tyres * 4.	211 Planning B	23/10/2019	External	10813.0	\$20,954.00	
1250376	F2: Replace Steer Tyres * 2	211 Planning B	23/10/2019	External	10813.0	\$10,493.00	
1250279	F2: Re-Torque tyres & Replace 6 wheel nuts.	211 Planning B	23/10/2019	External	10813.0	\$752.75	
1249122	F2 for seatbelt has been reported as faulty/ not working	AMABBOTT	21/10/2019	Internal	10780.0	\$0.00	Travel to site,  Repair Seat Switch Wiring,  Labour  Repair Seat as necessary, Travel to site,  Adjust fan belt as required  retensioned belts Repair Air Conditioner as necessary,
1248532	Loose fan belt	AMABBOTT	17/10/2019	Internal	10745.0	\$0.00	checked a/c operation, confirmed getting cold thru vents, compressor kicking in/ out as normal and low pressure pipe cold. could not fault system, to be monitored.
1248500	aircon not getting cold	AMABBOTT	17/10/2019	Internal	10745.0	\$0.00	
1247877	F2 - Tyre worn - Metro Tyres to attend	BIG TRUCKS NSW SUB	15/10/2019	External	10707.0	\$0.00	
1246364	Intermittent LE3000 + LE211 alarms being set off + oil leak	DMCDONALD	10/10/2019	Internal	10667.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Electrical System Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items, Top up Engine Oil as required, Check error code TE2021 and tE101 description as per photo. Check all oil found that engine oil is low due to leaking on the filling cup. top up 8liters engine oil. Clean and retight engine filling cup to be check this coming thursday  Checked engine oil and for re occurrence of forementioned codes.. oil level just on full mark and no active codes listed.. no sign of leaks from oil filler cap.. all ok after inspection

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1243414	F2: Callout to site 24/9/19. Position 2 tyre damaged (customer damage). Replace position 2 tyre with second hand tyre and re-torque position 1 & 2 tyres.	211 Planning B	24/09/2019	External	10507.0	\$2,589.50	
1242124	smoke + fumes from the exhaust. Hole in exhaust pipe, parked up in maintenance shed.	AMABBOTT	19/09/2019	Internal	10470.0	\$0.00	Repair Exhaust pipe as required,  Labour  Replace Exhaust pipe,  dump pipe off turbo split. replaced with previously ordered part. Carry out Inspection and Diagnosis of Electrical System
1241917	Inside door handle is sticking when opening/closing, acceleration appears quite sluggish.	DMCDONALD	19/09/2019	Internal	10677.0	\$0.00	adjusted door handle, requires new lever, ordered parts. has boost leak from turbo pipe oring. ordered new oring, unit still operational.  Labour  Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Replaced door latch, adjusted striker and tested... all ok after repair.. 10667h
1240802	Sublet return invoice. Job ref 1177219	BIG TRUCKS NSW	16/09/2019	Internal	10440.0	\$0.00	
1232055	Scheduled Service - 10500hr service II 500hr type. Level B Service	AMABBOTT	11/09/2019	Internal	10416.0	\$0.00	Labour  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  picked up parts and again a tier 3 kit was issued. ordered correct parts. Travel to site,  Carry out Inspection and Diagnosis of Electrical System  low oil level throwing codes. replaced oil part of service all ok
1239359	Shut down completely, possibly due to dirt in air filter or low oil levels	AMABBOTT	10/09/2019	Internal	10416.0	\$0.00	
1221770	Field Service Bulletin - FPI 18-807	PUMINYAD	3/09/2019	External	9705.0	\$664.68	
1233321	F2 - 40/20 jamming up.	DMCDONALD	16/08/2019	Internal	10149.0	\$0.00	Repair Attachment as necessary,
1228518	Scheduled Service - 10250hr service II 250hr type	DMCDONALD	16/08/2019	Internal	10152.0	\$0.00	250hr Service

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1232794	Error Codes - Crawl Speed	DMCDONALD	15/08/2019	Internal	10135.0	\$0.00	<p>Travel to site,</p> <p>Adjust Switch/es</p> <p>Checked codes and crawl speed.. found code TE300 - relating to reduced vehicle speed due to identified error. found mast functions reduced and no lift or tilt function... found blue light active..</p> <p>checked and found proxy switches not in range of twistlock bar due to poor adjustment..</p> <p>re adjusted and tested.. all ok</p> <p>Truck hours - 10135h</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1229789	F2 - Drivier side door handle leaking, ignition issue - possibly a battery + Oil leaks + trans cooler leak	AMABBOTT	5/08/2019	Internal	10153.0	\$0.00	<p>Check/Inspect/Diagnose Cylinder</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Labour</p> <p>Travel to site,</p> <p>Replace Battery,</p> <p>Steam clean equipment as necessary.</p> <p>diagnose loose bolt on door handle latch adjuster readjust and tighten tested ok, diagnose transmission oil cooler leak possible crack or loose fitting, diagnose unit struggles to start/sometimes wont start and batteries drop from 25v to 17v when cranking remove and replace batteries unit tested ok, steam clean unit to be able to try and find where multiple leaks are coming from. Carry out warrenty campaign fit fire blanket to unit</p> <p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Carry out equipment condition assessment</p> <p>Assist to replace batteries on unit . Wash unit as to diagnose oil leaks . Engine oil filter housing return hose o-ring to be replaced, trans cooler still to be identified could possibly be fitting on cooler. Transmission hose leaks , O-rings .</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>trans cooler fitting leaking fixed on different job .</p> <p>wasnt the tech to finish off repairing the oil leaks therefore cannot get job signed off Carry out Inspection and Diagnosis of Telemetry System</p>
1228995	F2 - Wont start, starter motor issue + MDT screen froze	AMABBOTT	31/07/2019	Internal	9800.0	\$0.00	
1222064	Scheduled Service - Fire Suppresion Service ; DAFO type; Level 1 - 12 monthly. Fire Suppression System Service	211 Planning B	24/07/2019	Internal	9705.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1218741	Scheduled Service - 10000hr service II 5000hr type. Level F Service	AMABBOTT	24/07/2019	Internal	9578.0	\$0.00	5000hr Service  5000hr service, replace engine oil and filter, replace transmission oil and filters, grease unit, check and lube lift chains  Labour  remove and replace twist locks , change gear oil  Travel to site,  5000hr service, hub retension and hydraulic oil replacement and filters. Travel to site,
1223544	Replace alternator	CSTAM	10/07/2019	Internal	9580.0	\$0.00	diagnose alternator has totally stopped charging now causing flat batteries and unit to shut down, charge batteries with other unit for a short period to start and move to safe area for alternator replacement asap  diagnose alternator has totally stopped charging now causing flat batteries and unit to shut down, charge batteries with other unit for a short period to start and move to safe area for alternator replacement asap  diagnose alternator has totally stopped charging now causing flat batteries and unit to shut down, charge batteries with other unit for a short period to start and move to safe area for alternator replacement asap  Replace alternator,  Repair Charging Circuit as required,  remove and replace alternator, found belt tensioner to be getting stuck remove and lube free up and refit, jump start unit and test, transmission calibration fault code appearing calibrated transmission tested unit for 30min to be sure charging perfect now running without shutting off and fault codes. Clean work area

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1223310	Unit is Overheating - Fork has been parked up at the Maintenance shed	CSTAM	10/07/2019	Internal	9580.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Electrical System  Steam clean equipment as necessary.  Repair Charging Circuit as required,  attend site for overheating issue ran unit at full rpm and load for 30min no fault, checked radiator appeared to be partially blocked with dirt pressure washed radiator and engine bay. Found alternator not charging past 22 volts causing error codes alternator requires replacing in near future
1212513	Scheduled Service - 9750hr service II 250hr type	AMABBOTT	21/06/2019	Internal	9578.0	\$0.00	Scheduled Service - 9750hr service II 250hr type  Travel to site,  250hr Service
1212658	F2: RE-TORQUE DRIVE TYRES	211 Planning B	29/05/2019	External	9404.0	\$752.75	F2: RE-TORQUE DRIVE TYRES
1211796	F2 - Exhaust leak + repair wheel stud	AMABBOTT	29/05/2019	Internal	9376.0	\$0.00	F2 - Exhaust leak + repair wheel stud  Repair Exhaust Manifold as required,  repaired exhaust leak replaced wheel stud checked spreader 30ft stop engaged. unlocked stop all ok
1211735	F2: ROTATE DRIVE TYRES	211 Planning B	29/05/2019	External	9366.0	\$2,209.75	F2: ROTATE DRIVE TYRES
1201333	Scheduled Service - 9500hr service II 500hr type. Level B Service	AMABBOTT	29/05/2019	Internal	9366.0	\$0.00	Scheduled Service - 9500hr service II 500hr type. Level B Service  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1210861	F2 - 4 loose bolts on the spreader	CSTAM	27/05/2019	Internal	9001.0	\$0.00	genie broken down mast needs inspection at next 250h service F2 - 4 loose bolts on the spreader  Carry out Inspection and Diagnosis of Mast/Carriage  Travel to site,  Adjust Mast Wear Strips to correct specification,  diagnose loose carriage wear pad bracket bolts remove clean apply locktite and refit all bolts tested ok

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1209556	Inspect F2 - It won't unlatch off a container last night + leaking coolant	DMCDONALD	21/05/2019	Internal	9337.0	\$0.00	<p>Inspect F2 - It won't unlatch off a container last night + leaking coolant</p> <p>Bleed cooling system and remove air locks</p> <p>Labour</p> <p>Remove ancillary items and remove Radiator from unit, Inspect and report,</p> <p>Assist Daniel removing panels, covers and other components remove turbo intercooler pipes and radiator hoses</p> <p>Replace Radiator,</p> <p>Refit Radiator to unit, Refit ancillary items,</p> <p>Adjust Attachment to correct specification,</p> <p>Coolant leak, inspected coolant leak and confirmed leak from core of radiator...</p> <p>Ordered parts and removed cooling system to swap out radiator... Due to accessories surrounding Radiator extra time taken to remove, removed intercooler, trans cooler and hydraulic cooler just to access radiator..</p> <p>after system re fitted and coolant added to system leak came from radiator hose clamp, re seated clamp and hose and re filled system.. bled cooling system and checked for leaks.. no signs of leaks at time of inspection after repair.. checked twistlock adjustment, all ok at time of inspection.. complaint of twistlocks getting stuck may have been due to overheating engine causing DTC and shutting down functions.</p>
1195442	Scheduled Service - INTERIM SAFETY CHECK- 9250hrs	DMCDONALD	15/05/2019	Internal	9272.0	\$0.00	<p>Repair Attachment as necessary,</p> <p>Scheduled Service - INTERIM SAFETY CHECK- 9250hrs</p> <p>250hr Service</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1207930	F2 - Oil leak on the spreader + coolant leak	DMCDONALD	14/05/2019	Internal	9337.0	\$0.00	<p>F2 - Oil leak on the spreader</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>Flush and Replace Cooling System Coolant</p> <p>Remove and Replace Coolant Hose/s</p> <p>Repair Attachment Cylinder as necessary,</p> <p>Repair Attachment as necessary,</p> <p>Labour</p> <p>Top radiator hose blown. Hose has been ordered through spare parts . ETA 10 DAYS. Hose has been modified for time being , presure test radiator system and inspect for further leaks. Top up coolant and test unit.</p>
1206746	F2 - Coolant leak, poss radiator issues.	NWeerasekara	10/05/2019	Internal	9222.0	\$0.00	<p>F2 - Coolant leak, poss radiator issues.</p> <p>Remove and Replace Coolant Hose/s</p> <p>Breakdown. Blown main coolant hose from radiator to engine block , order parts as per required to get unit back into service. Main hose required is ex-europe , parts have been ordered. Customise previous blown radiator hose as per temporary repair to get unit back into service. Top up coolant 40L. Unit back in servcice. Once hose arrives from Europe, it must be replaced asap.</p> <p>Labour</p> <p>Travel to site,</p>
1204098	F2 - check over and clean up radiator	GSTARK	30/04/2019	Internal	9087.0	\$0.00	<p>Top up cooling system, F2 - check over and clean up radiator</p> <p>Travel to site,</p> <p>Blow out radiator core,</p> <p>checked and found the radiator is blocked and topped up coolant tested all ok.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1203874	Coolant leak	CSTAM	29/04/2019	Internal	9087.0	\$0.00	TECHNICIAN INITIATED JOB  Travel to site,  Top up cooling system,  Blow out radiator core,  Repair Radiator as required,  diagnose low coolant, top up run unit found radiator block with dirt gerni radiator also found engine coolant hose gone hard normal clamp not providing enough clamping force so i fit a hose clamp as temporary fix to stop leaking unit tested ok
1203853	F2 - Unit overheating	CSTAM	29/04/2019	Internal	9087.0	\$0.00	F2 - Unit overheating
1203040	F2 - Blown coolant hose	NWeerasekara	24/04/2019	Internal	9050.0	\$0.00	raised job as current job 1203847 didnt appear on tablet F2 - Blown coolant hose
1202581	After Hours call out	PUMINYAD	19/04/2019	External	9028.0	\$269.50	Remove and Replace Coolant Hose/s TECHNICIAN INITIATED AFTER HOURS JOB  Coolant leak on the engine side. Check machine found that heater supply hose on the engine is blown. Repair hose cut the blown side of the hose and refit the coolant hose.
1200814	F2 - Unit wont start	NWeerasekara	12/04/2019	Internal	8952.0	\$0.00	Top up coolant to the level. F2 - Unit wont start  Carry out Inspection and Diagnosis of Electrical System  Check F2 and start

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1192024	Scheduled Service - 9000hr service II 3000hr type. Level E Service	DMCDONALD	11/04/2019	Internal	9852.0	\$0.00	<p>Scheduled Service - 9000hr service II 3000hr type. Level E Service</p> <p>THIS IS A TEIR 4 MOTOR</p> <p>3000hr Service</p> <p>Labour</p> <p>Travel to site,</p> <p>traveled and picked up parts. completed 3000hr service.</p> <p>Steam clean equipment as necessary.</p> <p>9000 service, chains 0.25% wear... steam cleaned and washed unit.</p> <p>Hyd oil low</p> <p>note: air filter not changed due to no stock...</p> <p>TECHNICIAN INITIATED JOB</p>
1199685	After Hours Call Out	PUMINYAD	9/04/2019	External	8915.0	\$317.00	<p>Arrived on site at 5am.</p> <p>Carry out Inspection and Diagnosis of Attachment, Repair Attachment as necessary,</p> <p>Check unit no 40 function. found that brake lock is engage on the 20 function. Disengage the brake lock and test 40 function now working.</p> <p>Tighten bolts on the spreader cattruck .</p> <p>no 20/40 operation</p> <p>found 30 ft stop locks locked in at 20ft position.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1195210	F2 - Err code E5177	GSTARK	3/04/2019	Internal	8887.0	\$0.00	<p>F2 - Err code E5177</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Check error codes Cummins to attend</p> <p>checked a d found codes for turbo actuator. checked all plugs and connections. got cummins out. found actuator is fualty. 2 weeks from the us \$2650+.</p> <p>Labour</p> <p>Travel to site,</p> <p>Repair Turbo as necessary,</p> <p>fitted actuator requires programming</p> <p>attended site removed actuator. programed with cummins. reftted actuator and programed. tested all ok. refilled coolant and cleaned down unit.</p>
1188685	F2: STEER TYRE REPLACEMENT * 2.	211 Planning B	27/03/2019	External	8709.0	\$10,119.00	F2: STEER TYRE REPLACEMENT * 2.
1188681	F2: REPLACE DRIVE TYRES * 4.	211 Planning B	27/03/2019	External	8709.0	\$20,206.00	F2: REPLACE DRIVE TYRES * 4.
1195187	After hours call out charge. error code E5177	SEDEN	25/03/2019	External	8885.0	\$174.50	<p>After hours call out,</p> <p>Technicain attened site at 5:30am for the below.</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Attend callout to check error code E5177 inspect and found possible turbo communication issue</p>
1194931	F2 - No spreader function	GSTARK	22/03/2019	Internal	8851.0	\$0.00	<p>Cummins to attend</p> <p>F2 - No spreader function</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Repair Attachment as necessary,</p>
1186174	INTERIM SAFETY CHECK- 8750hrs + change diff oil	GSTARK	20/03/2019	Internal	88762.0	\$0.00	<p>checked and found to be stuckat 20. freed up and regreased 40/20. tested all ok.</p> <p>INTERIM SAFETY CHECK- 8750hrs</p> <p>250hr Service</p> <p>carried out safety inspection and changed diff oil .</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1193148	F2 - Labour to replace step	211 Planning B	15/03/2019	Internal	8759.0	\$0.00	F2 - Replace damaged step
1192674	F2: Re- Torque Tyres	211 Planning B	14/03/2019	External	8741.0	\$752.75	15/03 - Parts charged on JN 1191839. F2: Re- Torque Tyres
1191839	F2 - Fuel cap missing + inspect damaged step	DMCDONALD	12/03/2019	External	8709.0	\$222.00	F2 - Fuel cap missing  Clean Diesel Tank as required,  Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  replace fuel cap, inspected tyres and inspected step damage F2 - oil leak and lots of warning light coming up.
1190018	F2 - oil leak and lots of warning light coming up.	PUMINYAD	5/03/2019	Internal	8632.0	\$0.00	Travel to site,  Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items,  Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,  Check machine oil leaking found transmission output shaft leaking, engine oil filter hose leaking and suction hose on the tank leaking. Pull out drive shaft clean and retighten outputshaft big bolt. Clean and retighten the hose and fitting. Clean and retighten 3 suction hoses clamp tank side.
1188941	F2 - Chain roller bearing collapsed	AMABBOTT	28/02/2019	Internal	8621.0	\$0.00	F2 - Chain roller bearing collapsed  Remove ancillary items and Chain Sheave, Strip, Inspect and report,  Replace Chain Sheave,  Labour  LH chain roller bearing collapsed replaced

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1176436	Scheduled Service - 8000hr service II 2000hr type. Level D Service	GSTARK	27/02/2019	Internal	8479.0	\$0.00	Scheduled Service - 8000hr service II 2000hr type. Level D Service  Labour  2000hr Service  carried out part of 2000hr service.  Adjust Clutch to correct specification,  carried out part of 200 hr service  07/03 MM -Trans oil change pending - to be carried out in the next interim safety check, next week. F2 - Bearing noise in the spreader
1188516	F2 - Bearing noise in the spreader	DMCDONALD	26/02/2019	Internal	8615.0	\$0.00	Labour F2 - Brake pedal shakes when the spreader is raised
1188394	F2 - Brake pedal shakes when the spreader is raised	DMCDONALD	26/02/2019	Internal	8615.0	\$0.00	Check/Inspect/Diagnose Cylinder  checked operation of unit, tested for fault... unable to replicate at time of test... checked trans oil level and hyd oil level, checked error log found no relating codes. will reinspect unit tomorrow during maintenance... supervisor told to moniteer closely for clearer description at time of fault.
1187745	F2 - Error codes E5117 and TE300 reported	GSTARK	25/02/2019	Internal	8490.0	\$0.00	F2 - Error codes E5117 and TE300 reported  Carry out Inspection and Diagnosis of Electrical System  checked no codes found. tested unit found turbo time was still on and interupped. reset tested all ok.
1185866	F2 - Err codes - E300 E101 E200	NWeerasekara	18/02/2019	Internal	8525.0	\$0.00	F2 - Err codes - E300 E101 E200  Carry out Inspection and Diagnosis of Attachment  Check the machine could no't find Err cods Topup coolant and check.
1184600	F2 - Error codes E300 & E2100 and keeps shutting down + Air con issue	DMCDONALD	13/02/2019	Internal	8465.0	\$0.00	F2 - Error codes and keeps shutting down  Carry out Inspection and Diagnosis of Electrical System  checked and comfermed error code. e2636 relating to turbo and e0235 for the coolant level. topped up coolant. and checked turbo operation. couldn't reproduce fualt.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1182773	F2 - Error code and unit cutting out - coolant temp switch	NWeerasekara	7/02/2019	Internal	8411.0	\$0.00	F2 - Error code and unit cutting out - coolant temp switch  Carry out Inspection and Diagnosis of Attachment  Travel to pac nak. Check the machine.No engine oil indicate ditstic top up 15 liters of engine oil. Check electrical system, Test machine. A \C not cool should be check next service F2 - Drive tyre rotation and re-torque unit
1180572	F2 - Drive tyre rotation and re-torque unit	BIG TRUCKS NSW SUB	30/01/2019	External	8317.0	\$2,659.25	F2 - Drive tyre rotation and re-torque unit
1179760	F3 - diagnose broken exhaust clamp	CSTAM	28/01/2019	Internal	8300.0	\$0.00	TECHNICIAN INITIATED JOB  Travel to site,  Carry out Inspection and Diagnosis of Electrical System  Remove ancillary items and Engine mounts from unit. Replace Engine mounts as necessary and Refit to unit. Refit ancillary items,  diagnose broken exhaust clamp rmove one from unit h2646n and fit to f2 not exactly right need new one asap ok to use for now. grease tubs need filing and turbo oil feed line starting to wear F2 - Steam clean radiator
1177662	F2 - Steam clean radiator	AMABBOTT	18/01/2019	Internal	8180.0	\$0.00	F2 - Steam clean radiator
1176516	Door latch issue - Door can only be opened from the inside via the window.	AMABBOTT	15/01/2019	Internal	8161.0	\$0.00	Steam clean equipment as necessary. Door latch issue - Door can only be opened from the inside via the window.  Travel to site,  Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  adjusted door tested ok. check air conditioner operation all ok Spreadier Inspection
1173333	Spreadier Inspection	CSTAM	2/01/2019	Internal	7850.0	\$0.00	Spreadier Inspection
1173203	Inspect bottom spreader. John 9707 8451	CSTAM	2/01/2019	Internal	7954.0	\$0.00	Inspect bottom spreader. John 9707 8451  Travel to site,  Carry out Inspection and Diagnosis of Attachment  inspect spreader drop down legs after impact with container

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1165122	F2: INTERIM SAFETY CHECK-7750hrs	211 Planning B	19/12/2018	Internal	7513.0	\$0.00	F2: INTERIM SAFETY CHECK- 7750hrs
1157227	Scheduled Service - 7500hr service II 500hr type. Level B Service	AMABBOTT	12/12/2018	Internal	7837.0	\$0.00	Service job cancelled as previous service has yet to be completed. Jas Hayer- NMP 11/12/18. Scheduled Service - 7500hr service II 500hr type. Level B Service  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  started service  carried out 500hr service.
1168651	Oil Leak & look at sensors. Parked in maintenance shed	GSTARK	7/12/2018	Internal	7657.0	\$0.00	Travel to site, Oil Leak & look at sensors. Parked in maintenance shed  Travel to site,  Check/Inspect/Diagnose Cylinder  Carry out Inspection and Diagnosis of Electrical System  checked and found to be old oil washed down by rain and over filled drip tray. also found driver tilting back to far and sensor not reading just needed to tilt slight forward to get high gear. tested with driver all ok. INTERIM SAFETY CHECK- 7250hrs
1153791	F2 - INTERIM SAFETY CHECK-7250hrs	AMABBOTT	27/11/2018	Internal	7513.0	\$0.00	INTERIM SAFETY CHECK- 7250hrs  250hr Service

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1164586	F2 - Brakes issues + unit can be started even while in gear. Contact Wayne 9707 8450	DMCDONALD	26/11/2018	Internal	7513.0	\$0.00	Brakes issues. Contact Wayne 9707 8450  Repair Brake components as required,  Repair Transmission Control Lever as necessary,  Carry out Inspection and Diagnosis of Brake System  Labour  Block up unit, adjust Brakes and handbrake,  checked park brake, brake not holding... adjusted and re tested, still not holding. found brake not engaging, checked electricals and hydraulics... found failed solenoid for park brake... replaced, adjusted and tested... all ok after repair. check unit starting in gear, note.... unit will not start in gear! however unit can start with selector in gear but will not engage gear untill park brake released after startup. F2 needs a park brake adjustment and is not stopping fork correctly
1164234	F2 needs a park brake adjustment and is not stopping fork correctly	CMILLAR	23/11/2018	Internal	7494.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Brake System  Labour  Replace Brake Shoe/s,  Block up unit, Adjust brakes and handbrake, F2 - Needs new wiper blades
1158800	F2 - Needs new wiper blades	CMILLAR	5/11/2018	Internal	7244.0	\$0.00	F2 - Needs new wiper blades
1150028	FW - Replace lift chains	DMCDONALD	31/10/2018	Internal	9072.0	\$0.00	FW - Replace lift chains  Replace Lift Chain,  -Replaced lift chains, pins and circlips... adjusted hoses and lubricated new chains. -Note... excess time due to delay of crane arriving and setting up, time spent preparing work.
1155594	F2 -spreader hoist not working and not hoisting up.	RMATTHEWS	24/10/2018	Internal	7081.0	\$0.00	Labour F2 -spreader hoist not working and not hoisting up.  Adjust Switch/es  Inspect, diagnose and adj proxys, test, okay

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1149604	Scheduled Service - 7000hr service II 1000hr type. Level C Service	AMABBOTT	24/10/2018	Internal	7081.0	\$0.00	Scheduled Service - 7000hr service II 1000hr type. Level C Service
1150027	F2 - Check bottom lift cameras. Quote to replace	DMCDONALD	23/10/2018	External	6789.0	\$1,169.25	1000hr Service Check bottom lift cameras
1152918	F2 - low tyre pressure alarm and smoke was coming up from the tyre as it seemed to be rubbing	BIG TRUCKS NSW SUB	15/10/2018	Internal	6950.0	\$0.00	Repair Visual display unit as necessary , F2 - low tyre pressure alarm and smoke was coming up from the tyre as it seemed to be rubbing
1152209	F2: Re-torque tyres & fit Large Bore Valves.	211 Planning B	11/10/2018	External	6904.0	\$1,179.00	F2: Re-torque tyres & fit Large Bore Valves.
1150112	F2: REPLACE DRIVE TYRES * 4 & STEER TYRES * 2	211 Planning B	7/10/2018	External	6843.0	\$30,293.00	F2: REPLACE DRIVE TYRES * 4 & STEER TYRES * 2
1150957	F2 - After Hours Call Out	DMCDONALD	6/10/2018	External	6835.0	\$269.50	TECHNICIAN INITIATED JOB
1150810	F2 - Park brake issue	AMABBOTT	5/10/2018	Internal	6829.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  noise from engine, confirmed noise from turbo... found dump pipe dislodged causing whistle.. re fitted pipe and tested, all ok after repair. F2 - Park brake issue
1150243	F2: DRIVE & STEER RIMS REPLACED	211 Planning B	5/10/2018	External	6801.0	\$11,603.42	Carry out Inspection and Diagnosis of Brake System F2: DRIVE & STEER RIMS REPLACED
1150229	F2: Crack Testing on Rims	211 Planning B	4/10/2018	External	6801.0	\$1,064.34	F2: Crack Testing on Rims
1144137	INTERIM SAFETY CHECK- 6750hrs	211 Planning B	3/10/2018	Internal	6518.0	\$0.00	INTERIM SAFETY CHECK- 6750hrs
1138804	Scheduled Service - 6500hr service II 500hr type	AMABBOTT	3/10/2018	Internal	6789.0	\$0.00	Service missed- job has been cancelled. Jas Hayer- NMP 27/9/18. Scheduled Service - 6500hr service II 500hr type
1144971	Tyre Pressure Monitor USB Cable Configuration	AMABBOTT	20/09/2018	Internal	6616.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Tyre Pressure Monitor USB Cable Configuration
							Carry out Inspection and Diagnosis of Telemetry System  superglued usb cable into unit

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1144398	F2 - losing power and losing all the twist lock lights	AMABBOTT	11/09/2018	Internal	6525.0	\$0.00	F2 - losing power and losing all the twist lock lights  Repair Main Electrical Control Panel as necessary,  no red light twist lock not unlocked all the way. used the override key to correct. tested all ok
1143601	F2 - Locked on to 40ft, spreader having issues moving up and down, override key didn't help.	AMABBOTT	7/09/2018	Internal	6525.0	\$0.00	F2 - Locked on to 40ft, spreader having issues moving up and down, override key didn't help.  Travel to site,
1129386	F2 - INTERIM SAFETY CHECK - 6250hr service II 250hr type	AMABBOTT	29/08/2018	Internal	6380.0	\$0.00	Repair Attachment as necessary, INTERIM SAFETY CHECK- 6250hr service II 250hr type  250hr Service  carried out safety inspection, checked all levels 5L engine oil filled grease tubs
1138945	F2 - Bottom lift camera not working	AMABBOTT	28/08/2018	Internal	6380.0	\$0.00	F2 - Bottom lift camera not working  Fit Full Camera Kit,  no visable damage camera not working, could not see any breaks in harness.
1136518	F2 - Bottom lift arms are not opening.	DMCDONALD	13/08/2018	Internal	6115.0	\$0.00	replaced faulty LHF CAMERA F2 - Bottom lift arms are not opening.  Carry out Inspection and Diagnosis of Attachment  check drop legs not operating... checked operation all ok at time of inspection. visually inspected drop legs.. all ok note: 25 mins to sign in, gain access to facility and wait for unit..  Travel to site,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1126943	Scheduled Service - 6000hr service II 3000hr type	AMABBOTT	8/08/2018	Internal	6235.0	\$0.00	Scheduled Service - 6000hr service II 3000hr type  3000hr Service  Labour  Travel to site,  Pick up parts from W/P and travel to site start service and kit incorrect travel to get correct parts and return to site and continue service
1134755	F2 - Front wiper blades to be replaced	AMABBOTT	6/08/2018	Internal	6016.0	\$0.00	no ewp awaiting mast inspection F2 - Front wiper blades to be replaced  Repair Windscreen Wiper as necessary,  checked unit as front wipers inop. found internal fault in timer relay.
1134728	F2 - Unit hit a crane, please inspect	AMABBOTT	6/08/2018	External	6016.0	\$127.00	Labour F2 - Unit hit a crane, please inspect  Carry out equipment condition assessment
1134436	F2 - Inspect the tyre pressure system	CMILLAR	3/08/2018	External	5981.0	\$680.13	inspected unit after accident. no damage found from incident. F2 - Inspect the tyre pressure system  Repair Switch/es  inspect tyre pressure system and found all sensors are working. tyre pressure's need to be checked and pressures adjusted by the tyre company
1132502	F2 - Inspect rear tyre, Remove logged bolt	BIG TRUCKS NSW SUB	27/07/2018	External	5893.0	\$593.88	F2 - Inspect rear tyre
1125244	Scheduled Service - 5750hr service II 250hr type	NWeerasekara	24/07/2018	Internal	5866.0	\$0.00	Remove logged bolt. Scheduled Service - 5750hr service II 250hr type  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1118822	F2 - Quote - Replace right hand camera on bottom lift leg	DPARENZEE	20/07/2018	External	5819.0	\$1,097.50	250hr Service F2 - Quote - Replace right hand camera on bottom lift leg  Replace camera and adjust.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1126036	Scheduled Service - Fire Suppresion Service *SUBLET TO QTEC*; DAFO type; Level 1 - 12 monthly. Fire Suppression System Service	211 Planning B	18/07/2018	Internal	5608.0	\$0.00	Scheduled Service -
1124720	DRIVE TYRE ROTATION * 4 (JULY 2018)	211 Planning B	16/07/2018	External	5595.0	\$0.00	DRIVE TYRE ROTATION * 4 (JULY 2018)
1130388	Re-Torque tyres on F2	211 Planning B	15/07/2018	External	5686.0	\$636.50	Service job has been cancelled as it was raised incorrectly. Jas Hayer- NMP 27/9/18. Re-Torque tyres on F2 Rotate Position 1-4 Tyres. 15-7-18 MDT Electrical issue
1129533	Rotate Position 1-4 Tyres. 15-7-18	211 Planning B	15/07/2018	External	5686.0	\$2,209.75	
1127736	MDT Electrical issue	DPARENZEE	10/07/2018	Internal	5686.0	\$0.00	
1119420	Transmission fluid leak	AMABBOTT	4/07/2018	Internal	5608.0	\$0.00	Repair Ignition Circuit as required, Transmission fluid leak
1118748	Scheduled Service - 5500hr service II 500hr type (inc 250hr)	AMABBOTT	3/07/2018	Internal	5608.0	\$0.00	Repair Transmission as necessary, Scheduled Service - 5500hr service II 500hr type (inc 250hr)  Labour
1125172	Top up hyd oil and wash down	DMCDONALD	2/07/2018	Internal	5595.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Top up hyd oil and wash down  Top up Hydraulic Oil to correct level,
1124759	Interrmodal leg adjustments on F1 and F2	AMABBOTT	2/07/2018	Internal	5608.0	\$0.00	Steam clean equipment as necessary. Intermodal leg adjustments on F1 and F2  Repair Attachment as necessary,
1125003	F2 - Replace overmast hoses - internal Job - Refer to JN 1124622	AMABBOTT	30/06/2018	Internal	5610.0	\$0.00	Adjust Attachment to correct specification, TECHNICIAN INITIATED JOB  Replace Hydraulic Hose/s and ancillary items,  REPLACE OVERMAST HOSES  Travel to site,  replace hoses test function TECHNICIAN INITIATED JOB
1125002	Overmast hose repair	JINGLIS	30/06/2018	Internal	5595.0	\$0.00	Jobn is internal as issue was reported on the 29th June.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1125001	F2 - After Hours Call Out - Unit wont start	AMABBOTT	30/06/2018	Internal	5610.0	\$0.00	TECHNICIAN INITIATED JOB  Carry out Inspection and Diagnosis of Electrical System  unit wont start
1124622	F2 - Blown hydraulic hose on the spreader. Site contact John 0413 730 482	211 Planning B	29/06/2018	Internal	5595.0	\$0.00	Blown hydraulic hose on the spreader. Site contact John 0413 730 482
1124440	Hydraulic tank oil leaks	DPARENZEE	28/06/2018	Internal	5589.0	\$0.00	Labour on Job# 1125003 Hydraulic tank oil leaks  Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,  Labour  Travel to site,  Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,  Clean hydraulic tank and locate leaks order and pick up parts replace O-rings and test
1098375	117-Series Cab Mount Bolt Upgrade	DPARENZEE	27/06/2018	External	5589.0	\$285.09	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
1122980	Unit makes noise when it accelerates	DPARENZEE	22/06/2018	Internal	5505.0	\$0.00	Unit makes noise when it accelerates  Travel to site,  Carry out Inspection and Diagnosis of Transmission  unit makes shudder/ grinding sound when changing to 3rd gear.
1122515	Recalibrate camera - currently showing a reverse/ wrong direction image	211 Planning B	21/06/2018	Internal	4400.0	\$0.00	Recalibrate camera - currently showing a reverse/ wrong direction image
1110746	Scheduled Service - 5000hr service II 5000hr type	DPARENZEE	19/06/2018	Internal	5498.0	\$0.00	Scheduled Service - 5000hr service II 5000hr type  Labour  5000hr Service

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1121277	F2 - Unit stuck on a box	AMABBOTT	18/06/2018	Internal	5429.0	\$0.00	Unit stuck on a box  Carry out equipment condition assessment  Travel to site,  stock on box due to rust jamming twist lock. used override key to remove. Inspect steer tyre
1119621	F2 - Inspect steer tyre	BIG TRUCKS NSW SUB	12/06/2018	External	5329.0	\$357.00	Arrive on site, inspect the tyre on F2. Condition report after site had an incident over the weekend.  Travel to site,  Carry out equipment condition assessment  inspected spreader. checked for bent/ broken parts all ok. tested twistlocks and lights all ok. fits in box as normal, no faults found. F2 - Seat belt getting stuck and wont extend.
1116891	Condition report after site had an incident over the weekend.	AMABBOTT	4/06/2018	External	5238.0	\$174.50	Repair Seat as necessary,  Rmove seat belt from unit repair and refit so customer could use unit order new part  Fit Seat Belt,  R&R seat belt assembly Unit stuck - twistlocks are caught on a container and cannot be disengaged
1115664	F2 - Seat belt getting stuck and wont extend.	SEDEN	30/05/2018	Internal	5211.0	\$0.00	Repair Attachment as necessary, STEER TYRE REPLACEMENT * 2
1114441	Unit stuck - twistlocks are caught on a container and cannot be disengaged	NWeerasekara	25/05/2018	Internal	5107.0	\$0.00	Leaking oil from Spreader Lock
1106205	STEER TYRE REPLACEMENT * 2	211 Planning B	21/05/2018	External	4828.0	\$13,859.00	Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,  Remove leeking fitting put o.ring. washed and test
1111531	Leaking oil from Spreader Lock	NWeerasekara	15/05/2018	Internal	4956.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1111153	After Hours Call Out - Hydraulic Oil Leak	TKAPEK	15/05/2018	Internal	4945.0	\$0.00	TECHNICIAN INITIATED JOB  tightened hydraulic fitting  30/05MM - 2 breakdowns were reported that night. Call outs charged to Pac nat under the other call out, JN 1111154 on unit H4
1099571	Scheduled Service - 4750hr service II 250hr type. Level A Service.	AMABBOTT	14/05/2018	Internal	4941.0	\$0.00	Scheduled Service - 4750hr service II 250hr type
1106942	Seatbelt will not retract + sublet Cummins JN 1105295	AMABBOTT	1/05/2018	Internal	4771.0	\$0.00	250hr Service Seatbelt will not retract,  Travel to site,  Fit Seat Belt,
1105295	operator reported smoke emitting from engine bay	DPARENZEE	24/04/2018	Internal	4730.0	\$0.00	replaced seal belt. operator reported smoke emitting from engine bay  Repair Exhaust pipe as required,  Labour
1104187	Brake stuck on - clutch brake slipping	NWeerasekara	19/04/2018	Internal	4662.0	\$0.00	Repair Exhaust Manifold as required, Brake stuck on - clutch brake slipping  Carry out Inspection and Diagnosis of Transmission
1101560	PA system not working	NWeerasekara	10/04/2018	Internal	4553.0	\$0.00	Adjust inchin padel and caleebrate. PA system not working
1099952	Unit overheating	AMABBOTT	4/04/2018	Internal	4491.0	\$0.00	Repair Radio, Unit overheating  Carry out Inspection and Diagnosis of Electrical System
1100655	DRIVE TYRE REPLACEMENT * 4	211 Planning B	29/03/2018	External	4491.0	\$20,206.00	code e4769 on dash- adblue level sensor not being read by ecu. instrument reading signal ok 3/4 tank everything is connected recommend cummins check engine computer as we have no access.  Travel to site, DRIVE TYRE REPLACEMENT * 4

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1098768	No tilt forward function on the mast	AMABBOTT	29/03/2018	Internal	4435.0	\$0.00	No tilt forward function on the mast  Travel to site,
1095744	Further Works- Refer to Notes (Please carry out works with 500hr service- 1094162)	211 Planning B	29/03/2018	Internal	4288.0	\$0.00	Adjust Hydraulic Control Valve to correct specification , Further Works- Refer to Notes  Further Works submitted by Andrew Mabbot 8/3/18; Hydraulic oil is low- please top up. Sump gasket has slight leak. Breather filter full of oil- Filter has been replaced and oil leak is to be monitored.  Please complete this work at the same time the 500hr service is being carried out (Service Job # 1094162).
1094162	Scheduled Service - 4500hr service II 500hr type (inc 250hr)	DPARENZEE	28/03/2018	Internal	4433.0	\$0.00	20/03 MM - Refer to job 1095694 Scheduled Service - 4500hr service II 500hr type (inc 250hr)  The 250hr type service on this truck has been combined into the 500hr type service. Jas Hayer- National Maintenance Planner, 14/3/18.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1097543	the Tilt landing fingers on F2 are playing up making the tilt function not work sometimes	AMABBOTT	26/03/2018	Internal	4433.0	\$0.00	Labour the Tilt landing fingers on F2 are playing up making the tilt function not work sometimes  Travel to site,  Repair Main Electrical Control Panel as necessary,
1095694	Top up with hydraulic oil	NWeerasekara	21/03/2018	Internal	4297.0	\$0.00	Repair Hydraulic Control Valve as necessary , Top up with hydraulic oil
1094994	Legs not dropping and no lights	NWeerasekara	15/03/2018	Internal	4365.0	\$0.00	Legs not dropping and no lights
1091694	Scheduled Service - 4000hr service II 2000hr type	DPARENZEE	8/03/2018	Internal	4236.0	\$0.00	2000hr service  Labour
1092670	Re-mount in cab camera	AMABBOTT	7/03/2018	Internal	4236.0	\$0.00	2000hr Service Re-mount in cab camera  Fit Full Camera Kit,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1080849	Install one 30FT Stop Kit	AMABBOTT	7/03/2018	External	4236.0	\$16,082.36	<p>Install one 30FT Stop Kit</p> <p>Please install one 30FT stop kit to truck.</p> <p>Labour</p> <p>Fit Attachment and ancillary items,</p> <p>Fit Hydraulic Valve Section and ancillary items,</p> <p>Travel to site, Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>02/02 MM - Boys attended site but PN advised that they cant give us units today as they are busy. They want it booked in for their preferred day - next Wednesday.</p> <p>Grease All Points on Unit,</p> <p>Remove ancillary items and Attachment, Strip, Inspect and report,</p> <p>Refit Attachment and ancillary items,</p> <p>final update - carried out nacco wiring modification. removed 30ft stopps fitted to h3 and reinstalled to f2. tested operation all ok DRIVE ROTATION_PLANNING PURPOSES ONLY</p>
1090599	DRIVE ROTATION_PLANNING PURPOSES ONLY	211 Planning B	3/03/2018	External	4165.0	\$0.00	<p>Job cancelled- only created for planning purposes. Jas Hayer- NMP 27/6/18</p>
1083821	250hr service+ engine oil change - done as incorrect service kit received	211 Planning B	3/03/2018	Internal	3876.0	\$0.00	<p>Scheduled Service - 4000hr service II 2000hr type **Refer to Notes**</p> <p>Please note the previous service (3750hr service II 250hr type) was cancelled as the 3500hr service was completed at 3723hrs. Jas Hayer- National Maintenance Planner, 5/2/18.</p> <p>250hr Service</p>
1089470	Oil Leak	NWeerasekara	26/02/2018	Internal	4165.0	\$0.00	<p>carry out 250 pm Oil Leak</p> <p>Check/Inspect/Diagnose Cylinder</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1084814	suspected burst hose on the hydraulic spreader	AMABBOTT	8/02/2018	Internal	3935.0	\$0.00	suspected burst hose on the hydraulic spreader  Travel to site,  Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Scheduled Service- 3750hr service II 250hr type **Refer to Notes**
1083827	Scheduled Service- 3750hr service II 250hr type **Refer to Notes**	211 Planning B	5/02/2018	Internal	3876.0	\$0.00	Please note this service has been cancelled as the 3500hr service was completed at 3723hrs. Jas Hayer- National Maintenance Planner, 5/2/18. Oil leak from LHS of mast
1082572	Oil leak from LHS of mast	AMABBOTT	31/01/2018	Internal	3870.0	\$0.00	Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Bottom lift arm is stuck in down position
1080561	Bottom lift arm is stuck in down position	NWeerasekara	22/01/2018	Internal	3780.0	\$0.00	Carry out Inspection and Diagnosis of Attachment
1079846	hydraulic oil and error code 3497 DEF	AMABBOTT	19/01/2018	Internal	3729.0	\$0.00	Check attachment arms drop. hydraulic oil and error code 3497 DEF  Travel to site,  Carry out Inspection and Diagnosis of Electrical System
1075385	Scheduled Service - 3500hr service II 500hr type	RFANCEY	17/01/2018	Internal	3723.0	\$0.00	low adblue. refilled and code now gone. checked levels all ok. hydraulic oil full. Scheduled Service - 3500hr service II 500hr type  Labour
1078702	leaking hydraulic oil from the mast when lifting containers	AMABBOTT	16/01/2018	Internal	3695.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. leaking hydraulic oil from the mast when lifting containers  Replace Hydraulic Hose/s and ancillary items,  Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1077924	alarm for low diff oil keeps going off	NWeerasekara	12/01/2018	Internal	3659.0	\$0.00	alarm for low diff oil keeps going off  Travel to site,  Carry out Inspection and Diagnosis of Electrical System
1074992	Hydraulic Pump Leaking	NWeerasekara	28/12/2017	External	3507.0	\$7,772.52	Top up Engine Oil as required, Hydraulic Leak  Check/Inspect/Diagnose Hydraulic Pump and test operation,  Remove ancillary items and Hydraulic Pump, inspect and report,  Labour  Replace Hydraulic Pump,  Adjust Hydraulic Pressure Settings to correct specification,  Steam clean equipment as necessary. Fork now operates on reduced speed with container ON
1074105	Fork now operates on reduced speed with container ON	AMABBOTT	21/12/2017	Internal	3447.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Transmission Scheduled Service - 3250hr service II 250hr type
1068001	Scheduled Service - 3250hr service II 250hr type	NWeerasekara	20/12/2017	Internal	3443.0	\$0.00	250hr Service
1071357	sideshift and tilt keeps playing up	SDELAVARI	11/12/2017	Internal	3307.0	\$0.00	sideshift and tilt keeps playing up  Travel to site,  Carry out Inspection and Diagnosis of Mast/Carriage  checked all mast + attachment funtions, could not find any faults.
1067253	Still not counting lifts as expected after settings update, confirm wiring is correct - Check to see if CANbus bridge harness has been fitted - Andrew Mabbot to attend	AMABBOTT	7/12/2017	Internal	3263.0	\$0.00	Still not counting lifts as expected after settings update, confirm wiring is correct - Check to see if CANbus bridge harness has been fitted - Andrew Mabbot to attend  Repair Fleet Management System as required,
1070112	DRIVE ROTATION - PLANNING PUPOSES ONLY	211 Planning B	22/11/2017	External	3141.0	\$0.00	repaired forktrack issues with support from speedshield. DRIVE ROTATION - PLANNING PUPOSES ONLY

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1059900	Scheduled Service - 3000hr service II 3000hr type	SGARDNER	22/11/2017	Internal	3085.0	\$0.00	Scheduled Service - 3000hr service II 3000hr type  3000hr Service
1065312	twist lock issue	NWeerasekara	17/11/2017	Internal	3036.0	\$0.00	Labour TECHNICIAN INITIATED JOB  Travel to site,  Repair Attachment as necessary,  R H Twest locks lock out side Check Images. Twistlock issue
1064984	Twistlock issue	NWeerasekara	17/11/2017	Internal	2832.0	\$0.00	tech attended job under Job#1065312 twistlock lights are not working
1064583	twistlock lights are not working	AMABBOTT	16/11/2017	Internal	3030.0	\$0.00	Travel to site,  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  red light dropping out found electrical fault on spreader repairs tested ok Wipers to be fixed
1061260	Wipers to be fixed	AMABBOTT	6/11/2017	Internal	2902.0	\$0.00	Repair Windscreen Wiper as necessary,  wipers not working fuse blown replaced and tested no further fault. Operator advised low on brake -
1058577	Operator advised low on brake -	AMABBOTT	27/10/2017	Internal	2814.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Transmission  Adjust Clutch to correct specification,  braking pedal not neutralising trans, adjusted and calibrated pedal, calibrated transmission.
1055985	Metal object in steer tyre	BIG TRUCKS NSW SUB	18/10/2017	External	0.0	\$590.00	te300 code not going in top gear, sensor malfunction repaired. Arrived on site. Inspect pos 6 on F2. Remove nail, tyre safe to use.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1049678	Scheduled Service - 2500hr service   500hr type **Please check hydraulic oil and top up and also check Chains**	211 Planning B	18/10/2017	Internal	2224.0	\$0.00	Scheduled Service - 2500hr service   500hr type
1055396	Auto-lock function on twistlocks wont work - needs manual override	AMABBOTT	17/10/2017	Internal	2653.0	\$0.00	Auto-lock function on twistlocks wont work - needs manual override  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,
1053714	Coolanrt Leak	SDELAVARI	11/10/2017	External	2590.0	\$0.00	Travel to site, coolant pipe leaking repaired by city hydraulics. topped coolant 20l.
1053606	Coolant Leak	BIG TRUCKS NSW SUB	11/10/2017	Internal	2591.0	\$0.00	
1040919	Scheduled Service - 2000hr service	SDELAVARI	11/10/2017	Internal	2590.0	\$0.00	Scheduled Service - 2000hr service  Labour  2000hr Service
1052281	STEER TYRES; YOKOHAMA	211 Planning B	5/10/2017	External	2224.0	\$13,859.00	Travel to site, STEER TYRES; YOKOHAMA
1052194	remove fuel tank from site	ACRANE	5/10/2017	Internal	2224.0	\$0.00	Travel to site,
1050296	Twistlocks wont unlatch from containers- needs override	SDELAVARI	28/09/2017	Internal	2422.0	\$0.00	Twistlocks wont unlatch from containers- needs override  Travel to site,  Repair Attachment as necessary,  replaced both twistlock rams as per warranty. see pics  Mechanic SDELAVARI replaced order number warranty with 28/09/2017  CM# 171003-000063 for policy support  T Cullen - 5/10/17 - Policy support denied as rectification was an adjustment not a failure
1046786	BT-PTSB_011: Pacific National – Tyre Pressure Audit	SDELAVARI	28/09/2017	Internal	2422.0	\$0.00	BT-PTSB_011: Pacific National – Tyre Pressure Audit
1047991	Scheduled Service - 2500hr service   500hr type	211 Planning B	27/09/2017	Internal	2301.0	\$0.00	Adjust Tyre Pressures to correct specification , Scheduled Service - 2500hr service   500hr type

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1048056	Twist locks wont unlock itself - needs over-ride	SDELAVARI	19/09/2017	Internal	2301.0	\$0.00	Twist locks wont unlock itself - needs over-ride  Travel to site,  Repair Attachment as necessary,  no red light on attachment, adjusted leftside twistlock bar. unit now has red+green light at attachment. 2250hr service *Missed*
1047974	2250hr service *Missed*	211 Planning B	19/09/2017	Internal	2301.0	\$0.00	2250hr service *Missed*
1047853	Twist locks wont unlock by itself - operator has to use the over ride button.	BIG TRUCKS NSW	19/09/2017	Internal	2301.0	\$0.00	Twist locks wont unlock by itself - operator has to use the over ride button.
1048197	Inspect air con	BIG TRUCKS NSW SUB	14/09/2017	Internal	2301.0	\$0.00	duplicate job - refer to JN 1048056 inspection done on 14th sept.
1045424	DRIVE TYRES; + CONDITIONER; YOKOHAMA	BIG TRUCKS NSW SUB	7/09/2017	External	0.0	\$27,686.00	parts reqd for F1 - h12909. Austral attending today 25/09
1045291	spreader is not locking onto boxes - Shift Manager 9707 8450	AMABBOTT	7/09/2017	Internal	2159.0	\$0.00	spreader is not locking onto boxes - Shift Manager 9707 8450  Travel to site,  Carry out Inspection and Diagnosis of Attachment  twist lock cylinder worn adjusted stops and proxy plate.  Mechanic AMABBOTT replaced order number warranty with warrenty  T Cullen 11/9/17 - adjustments and worn parts not warrantable
1043998	unit wont lock on to boxes	MSUTHERLAND	1/09/2017	Internal	2017.0	\$0.00	unit wont lock on to boxes  Repair Attachment as necessary,  travel to site check wont lock.test all proxys adjust L/Hfront proxy and fit lock nut to twist lock bar.grind all landing pins  T Cullen - 6/9/17 Adjustments not covered beyond 500 hours

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1042496	After Hours Call Out - Repair Tyre puncture.	BIG TRUCKS NSW SUB	28/08/2017	External	1921.0	\$2,013.53	<p>Tyre puncture as per message from TMC. Site contact Michael Parker 02 9707 8450</p> <p>Contractor arrived on site on Sunday 27/08, carried out repairs to Pos 4 on unit F2.</p> <p>Returned to site next day to retension wheel nuts.</p>
1041218	Error code on dash, Lost power at accelarator	AMABBOTT	22/08/2017	External	1921.0	\$0.00	
1039541	Fork losing twistlock lights, lights on spreader has been getting stuck and cant unlock - Tony Eagle 9707 8450	AMABBOTT	22/08/2017	Internal	1935.0	\$0.00	<p>Travel to site,</p> <p>Repair Attachment as necessary,</p> <p>adjusted twistlock bar on both sides. adjusted proxys. greased twistlocks.</p> <p>18/08 MM Issue reported today- "The twist lock lights fail when we pick up a box sometimes, also it sometimes happens when the fork is traveling as well, when this happens you can only lower the box it stops the lift function, the operator thinks it could be the proximity sensor or the locator pin."</p> <p>Sean on site,</p> <p>bolt at proxy bracket stripped causing proxy backet to sometimes move, replaced bolt adjusted proxy brackets + adjusted twistlock bars.</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>green light dropping out. twist lock ram wearing down 5mm adjusted twist lock stops. green light still dropping out, adjusted sensor bracket 2-3 times to find correct adjustment. no further fault.</p> <p>T Cullen - 23/8/17 Adjustments not covered under warranty</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1034333	Scheduled Service - 1500hr service   500hr type	NWeerasekara	19/08/2017	Internal	1778.0	\$0.00	<p>Scheduled Service - 1500hr service   500hr type</p> <p>***09/08 MM - Niro's labour for service on job 1037955</p> <p>service pending as customer needed the unit back.</p> <p>****Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Marst chain not check no cherry picker licence. Hydraulicl oil should have be top up.****</p> <p>Mechanic AMABBOTT replaced order number pending service. with pending service</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p>
1037955	replace twistlock lights	NWeerasekara	8/08/2017	Internal	1778.0	\$0.00	<p>500hr Service</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Marst chain not check no cherry picker licence. Hydraulicl oil should have be top up.</p> <p>09/08 MM - lights didn't need replacing. this job had to be cancelled but niro has accidentally added labour for the service on this job. and before this could be fixed, the job was posted. 1750hr service *MISSED*</p>
1037775	1750hr service *MISSED*	211 Planning A	8/08/2017	Internal	1760.0	\$0.00	
1065522	Level 1 fire suuppression service	BIG TRUCKS NSW SUB	27/07/2017	Internal	2832.0	\$0.00	Level 1 fire suuppression service
1035146	Order missing parts	BIG TRUCKS NSW	27/07/2017	Internal	8486.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1035142	Spreader lights goes out - intermittent	NWeerasekara	27/07/2017	Internal	1608.0	\$0.00	Repair Attachment as necessary,  Attended site didn't replace light - he adjusted twist lock and all good.
1033796	Anti heel strike function is not working properly. Anti twist lock lights not working. Enging warning light coming on also. Site contact Michael Riley 0409 445 919	NWeerasekara	24/07/2017	Internal	1560.0	\$0.00	Changed to General Repair as it was an adjustment. -Bergren M., Warranty 02/08/2017 Anti heel strike function is not working properly. Anti twist lock lights not working. Enging warning light coming on also. Site contact Michael Riley 0409 445 919  Found loos prokcimity, Twest lock bolt missnig put new bolt & check
1033303	Index pin losing twist lock. Site contact Shift Managers 02 9707 8450/51	AMABBOTT	20/07/2017	Internal	1532.0	\$0.00	Mechanic NWeerasekara replaced order number warranty with 30914 Index pin losing twist lock. Site contact Shift Managers 02 9707 8450/51  Travel to site,  Carry out Inspection and Diagnosis of Attachment  Repair Attachment as necessary,  confirmed loosing red light intermittantly. found twist lock cylinder stops excessive clearance, adjusted tested ok
1031846	Multiple codes coming up. Site contact Glen Parker 9707 8450 or Michael 02 9707 8422	BIG TRUCKS NSW SUB	17/07/2017	Internal	1481.0	\$0.00	25/7/17 T Cullen - adjustments not covered under warranty Multiple codes coming up. Site contact Glen Parker 9707 8450 or Michael 02 9707 8422  Spoke to Scott from Infinity Forklifts, he said the codes are due to driver error. Driver is trying to chage direction while still moving. more of a safety feature than error code. - Bergren
1026271	Scheduled Service - 1250HR SERVICE   250HR TYPE	SDELAVARI	12/07/2017	Internal	1429.0	\$0.00	Scheduled Service - 1250HR SERVICE   250HR TYPE  250hr Service  no service sheet available for service. torqued wheels. no ewp liecense or chain gauge to check mast or chains.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1029280	After Hours Call Out	MSUTHERLAND	5/07/2017	External	1339.0	\$975.00	After Hours Call Out. Arrived on site at 11:00 pm Fault reported - Issues starting the unit.  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  Chec all proxys and wire harness.fault not found unit going ok Works Completed in June
1034231	DRIVE ROTATION *Pre-Complete Prcicing*	211 Planning B	26/06/2017	External	1565.0	\$2,647.41	DRIVE ROTATION *Pre-Complete Prcicing* Job invoiced for drive tyre rotation - First Rotation The landing lights are not working properly. Michael: 02 9707 8422
1023359	The landing lights are not working properly. Michael: 02 9707 8422	SDELAVARI	14/06/2017	Internal	1045.0	\$0.00	Travel to site,  Adjust Attachment to correct specification ,  checked all proxys+ landing pins all good. play in twistlock bars adjusted twistlock bars, checked various wiring harnesses, harnesses all good could. let driver use unit for half an hour could not fault unit. Wk22 Scheduled 500hr Service -
1012961	Scheduled 1000hr Service -	SDELAVARI	10/06/2017	Internal	1014.0	\$0.00	1000hr Service  Top up cooling system,  no service sheet in service kit. spent 1hr after service to repair armrest. also break down with h3 lights + error code on dash eo387 eo283. coolant leak from interior heater, bturnd taps off. topped up coolant 20L of water. lights on dash gone out, engine codes still present no accleration. have tagged out unit.
1045277	sublet chg for JN 1019453	BIG TRUCKS NSW SUB	29/05/2017	Internal	4146.0	\$0.00	
1019453	Noise coming from AC Vents	BIG TRUCKS NSW SUB	29/05/2017	External	824.0	\$295.35	Warranty  Condition - Noise coming from AC Vents  Cause - Faulty AC Fan Motor
1018279	MDT not working requires replacement	SDELAVARI	24/05/2017	Internal	774.0	\$0.00	Correction - Replace AC Fan Motor MDT not working requires replacement

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1016560	REPLACE BOLTS DUE TO IMPACT DAMAGE	AMABBOTT	17/05/2017	External	661.0	\$932.00	REPLACE BOLTS DUE TO IMPACT DAMAGE  Repair Attachment as necessary,  rh 20/40 cylinder mount sheired bolts off due to impact damage refitted new hoses made washed down machine and tested, ok AFTER HOURS CALL OUT 16/05/17
1016502	AFTER HOURS CALL OUT 16/05/17	RMATTHEWS	16/05/2017	External	660.0	\$1,007.00	Check/Inspect/Diagnose Cylinder  Damage- sheared off all 6 40/20 cyl mounting bolts and torn hyd hoses. Report to Ben Pearce and advisd to tag out for him to inspect in the morning. The unit has blow a hydraulic hose Glen: 02 9707 8450
1016464	The unit has blow a hydraulic hose Glen: 02 9707 8450	201SUBC	16/05/2017	Internal	653.0	\$0.00	The unit has blow a hydraulic hose Glen: 02 9707 8450
1035419	6 monthly Fire Suppression Service	BIG TRUCKS NSW SUB	27/04/2017	Internal	1565.0	\$0.00	
1010415	2 way mic bracket has disappeared The fitment of the anti-heel strike system The relocation of the proximity switches for the laden vehicle speed reduction system	AMABBOTT	21/04/2017	Internal	509.0	\$0.00	2 way mic bracket has disappeared The fitment of the anti-heel strike system The relocation of the proximity switches for the laden vehicle speed reduction system  Carry out equipment condition assessment  Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,
1010337	OVERMAST HOSE HAS DETACHED	AMABBOTT	20/04/2017	External	402.0	\$1,359.50	Labour TECHNICIAN INITIATED JOB  Refit Hydraulic Hose/s and ancillary items,  Travel to site,  Repair Hydraulic Hose/s as necessary,  refitted overmast hose

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
1007192	Transmission light on and consequently shutting F2 down	DTAVERS	6/04/2017	Internal	258.0	\$0.00	<p>Transmission light on and consequently shutting F2 down</p> <p>Hey Team,</p> <p>I have just spoken to Mike Riley over the phone and according to Bob it looks as if the gear selected was in the wrong position</p> <p>Ben,</p> <p>For the meantime we can cancel our technician and monitor this.</p> <p>Regards, Ben Pearce   Field Service Supervisor – Big Trucks ATTEND GREEN LIGHT</p>
1005120	ATTEND GREEN LIGHT	AMABBOTT	29/03/2017	Internal	199.0	\$0.00	<p>Carry out Inspection and Diagnosis of Attachment Wk15 Scheduled 100hr Service -</p> <p>reposition tilt sensors</p> <p>100Hr Service</p> <p>100 hour inspection and repair wiper blades</p> <p>I think you mean reposition height sensor? I could not do due to broken drill and/or no welder here. Complete on 250.</p> <p>REPLACE WIPERS</p> <p>Replace Windscreen Wiper,</p>
1004674	Wk15 Scheduled 100hr Service -	RMATTHEWS	28/03/2017	Internal	251.0	\$0.00	<p>WARRANTEE- windscreen wipers fell apart- replace</p>
1002021	REPLACE WIPERS	RMATTHEWS	17/03/2017	Internal	94.0	\$0.00	
1021559	Replace Hyd hose	201SUBC	16/03/2017	Internal	950.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
992813	COMPLETE PID FOR HANDOVER + RESTART UNIT	RMATTHEWS	10/02/2017	Internal	35.0	\$0.00	<p>Repair Visual display unit as necessary ,</p> <p>Replace Visual display unit,</p> <p>Labour</p> <p>check F2- Proxy senses RE: Moving loaded containers with no Speed Reduction of mast in either upright or tilted position. Also heel strike feature missing or not functioning</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>VSR reported not working, inspect and diagnose.</p> <p>Travel to site,</p> <p>Repair Switch/es</p> <p>Austral: SERVICE CALL TO DEPOT. CHECK FOR FAULT IN STARTING CIRCUIT. REMOVE START RELAY. CHECK FOR ALL INPUTS. ALL OK. REFIT RELAY AND CHECK STARTING. VEHICLE STARTING OK CHECK FOR NO N/S SLEW FUNCTION. CHECK ALL RELEVANT WIRING AND COMPONENTS. FIND NO OUTPUT FROM PROXIMITY SWITCH TO THE FRAME CONTROLLER ON PIN 13. TAP INTO SPARE WIRE IN OVERMAST CABLE FROM N/S SLEW PROXIMITY SWITCH AND CONNECT TO PIN 13 ON FRAME CONTROLLER. RECHECK</p> <p>Repair Main Electrical Control Panel as necessary,</p> <p>Try and set speed reduction system with lap top...plus 1 program outdated for this model. Go to Hyster/yale and upgrade software. Travel back to site and set VSR. Okay. Notice L/H slew cyl proxy not working. Begin diagnosing and truck stopped starting...investigate this!? Come back tomorrow</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
---------	-------------	----------	------	----------	----------	--------	-------

**Owner:** RITC000  
**Equip. Code:** H12909      **Description:** HYSTER H52.00XM-16CH - Tier 4 Engine  
**Make:** HYSTER      **Model:** H52.00XM-16CH      **Serial No.:** H117E01600P

992484	COMPLETE PID FOR HANDOVER + RESTART UNIT	TCONDITISI	10/02/2017	Internal	11.0	\$0.00	<p>VSR system not working, diagnose fault, wire 959 from frame controller missing!? L/H slew returned wire. Seek tech advice from Tharalla, loop a wire in from 958 wire R/H return. Set speedsband test machine.okay. Set a time with Theralla to diagnose and rectify properly .</p> <p>COMPLETE PID FOR HANDOVER</p> <p>Prepare For Hire - Field</p> <p>carry out specs sheet</p>
979398	Non-conformance Tenaris Seat not fitted	NWeerasekara	13/12/2016	Internal	54.0	\$0.00	<p>Refit Battery to unit, Refit ancillary items, Non-conformance seat</p> <p>Contact Management Case            Question Reference #161213-000266            Summary: Non Conformance, tenaris training seat not fitted            Category Level 2: Non-Conformance Spec Error            Factory            Date Created: 12/13/2016 10:52 AM</p> <p>Replace Seat,</p> <p>Change Arm rest &amp; Shift seat. Put new Treanar Seat</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> RITC000							
<b>Equip. Code:</b> H12909		<b>Description:</b> HYSTER H52.00XM-16CH - Tier 4 Engine					
<b>Make:</b> HYSTER		<b>Model:</b> H52.00XM-16CH		<b>Serial No.:</b> H117E01600P			
927060	Prep for Rental - Pacific National	NWeerasekara	14/11/2016	Cap Prep	56.0	\$0.00	Prepare For Hire - Field  Travel to site,  Prepare For Hire - Workshop  Pirtek returns 4/1/17  Carry out New Equipment Predelivery to correct specification.  assist andrew with unit  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  Labour  fit tyre pressure testing unit. wash unit.
						<b>Equipment Total:</b>	<b>\$644,980.65</b>
						<b>Customer Total:</b>	<b>\$644,980.65</b>