

Plant & Vehicle Maintenance & Repairs

Asset Number: CO250 **Serial Number:** CAT0336EKTMZ00227

Make: Caterpillar Model: 336EL Excavator Year of Manufacture: 2013

| Make. | Caterpinal | real of Fiantia | Etai Ci 2015 |
|------------|------------|---|-----------------------|
| Date | Hr/Kms | Work Conducted | Responsible Person |
| 10/12/2015 | 2483 | Change engine oil. 500 hrs on oil. | TG/BH |
| 10/16/2015 | 2492 | 500 hrs service. | TG/BH |
| 12/05/2015 | | Replace tilt hose. | GC |
| 02/01/2016 | 2625 | Repair leak at hyd hose on grab attachment. | TG |
| 04/27/2016 | 2823 | Replace O ring and tighten hyd hoses at swivel for track drive motors. | TG/GC |
| 04/28/2016 | 2823 | Remove blown hose. Hosepower repair hose fitting. Replace hose and test. | Hosepower |
| 06/07/2016 | | Replace cutting edge. | TG/GC |
| 06/14/2016 | 2874 | Inspect air con. Clutch. Clutch ok. Air con not working. Temp E error on screen. | GC |
| 06/15/2016 | 2876 | Remove teeth and edge ass. Fit 2 new standard teeth. | GC |
| 06/15/2016 | 2887 | Hastings inspecting air conditioner. Parts on order, Refer to Hastings Deering Invoice AS300038104 | GC |
| 06/20/2016 | 2900 | Jump start machine, check terminals and charge rate. | TG/GC |
| 06/21/2016 | 2906 | Fit new batteries. Refer to Hastings Deerings Invoice AP300548497. | TG/GC |
| 06/22/2016 | 2918 | Fit new hand piece. Fit hammer to 335 Excavator. Check fittings. Fittings need to be changed. SAE to JIC. | TG/GC |
| 06/24/2016 | n/a | Change hyd line fitting on rock hammer. | TG/GC |
| 06/29/2016 | 2926 | Hastings. Replaced A/C condensor fan. | |
| 06/30/2016 | 2933 | Fit auger. Change hyd hose connectors. Test and adjust. All ok. | TG/GC |
| 07/06/2016 | | Refer to Hastings Deering Invoice AP300038116 | Hastings |
| 07/18/2016 | 2961 | Go to Easy Quip Hire, pick up auger, fit to machine. | GC |
| 07/19/2016 | 2968 | Inspect faulty switch. | GC |
| 07/25/2016 | | Refer to Hastings Deering Invoice AP300552291 | Hastings |
| 07/30/2016 | 2990 | Start 1000 hrs service. Change all filters and drain oils. | TG/GC |
| 08/02/2016 | 2990 | Finish off 1000 hrs service. Fuel and grease. | TG/GC |
| 08/03/2016 | 2990 | Change hydraulic oil. | TG/GC |
| 08/11/2016 | 3001 | Sent to Hastings for RH boom cylinder re-seal and RH control handle replace and switch test. | TG |
| 08/12/2016 | 3001 | Fit new joy stick handle. Test. (Hastings Berrimah). | TG |
| 10/19/2016 | | Refer to Hastings Deering Invoice 40100008275 | Hastings |
| 01/19/2017 | | Refer to Hastings Deering Invoice | Hastings |
| 04/03/2017 | 3196 | Travel to Gravel Pit, rotate cutting edge & fit new bolts, check & measure bolts for Hydraulic hose bracket | GC |
| 04/04/2017 | 3200 | Fit bolts to Hydraulic hose bracket, refit brackets & tension all bolts | TG |
| 06/22/2017 | 3408 | Fit new cutting edge tilt bucket & quick couples | SS / TG |
| 06/28/2017 | 3438 | #89 Replace stick extension hose | TG |
| 07/10/2017 | | Turn cutting edge | MM |
| 07/19/2017 | | Engine oil and filter change | TG GC |
| 08/04/2017 | | All good - centre pin on tilt bucket not taking grease, new cutting edge needed | MM |
| 08/09/2017 | | Replace bucket edge | TG GC |
| 08/10/2017 | 3620 | Change engine oil, change fuel filters, repair RHF indicator, 500hr service | TG |



Plant & Vehicle Maintenance & Repairs

| Asset Number: | CO250 | Serial Number: CAT0336EKTMZ00227 | | |
|---------------|-------------|--|---------------------------|--|
| Make: | Caterpillar | Model: 336EL Excavator Year of Manufacture: | Year of Manufacture: 2013 | |
| 08/12/2017 | 3628 | Fit rubber shroud | TG MM | |
| 09/25/2017 | | Rotate bucket edge | SS | |
| 10/10/2017 | | Inspected oil leaks | TG MM | |
| 10/26/2017 | 3775 | Replace oil filter oring | SS GC | |
| 11/07/2017 | 3785 | Fit rock hammer and recalibrate pressure and flow rates | TG | |
| 01/15/2018 | | Replace secondary fuel filters | TG GC | |
| 01/23/2018 | 3862 | Inspected machine for over heat, test found OK | BO TG | |
| 01/24/2018 | 3862 | Inspected and ordered boom hoses | BO TG | |
| 01/26/2018 | 3862 | Replaced window washer bottle | ВО | |
| 02/01/2018 | 3869 | Inspect a/c issue. Condensor fan u/s, parts ordered. Fit new condensor fan | BO SS | |
| 02/07/2018 | | Top up hydraulic oil | TH | |
| 02/08/2018 | | Replace stick hoses | GC SS | |
| 02/09/2018 | | Finish fitting hyd hoses, test and check for leaks | GC SS | |
| 02/16/2018 | 3902 | Fix a/c vents. Invoice 1338 | Ellis | |
| 02/19/2018 | 3912 | Cleaned out cooling package | BO SS | |
| 03/13/2018 | | Engine oil topped up | MM | |
| 03/23/2018 | | Inspect rock hammer, fit rock hammer and manual (??) greased | TG MM | |
| 04/04/2018 | 3981 | Complete 4000hr service, remove and replace main hydraullic hoses to valve body, inspect and readjust tracks, replace all | | |
| 07/07/2010 | | front light globes | BO GC | |
| 04/21/2018 | | Inspect ram oil leak | BO GC | |
| 04/06/2018 | | Hastings invoice 40100116796 - Machine overheating. Replace parts to fan hub | Hastings | |
| 07/10/2018 | 4156 | Replaced batteries | GC SS | |
| 07/16/2018 | 4150 | Remove main lifting rams, deliver to Hastings for service | TH TG | |
| 07/19/2018 | | 4 Hyd hoses, Hastings invoice 2011429075 | Hastings | |
| 07/19/2018 | | Oil leak - Hastings repair worn seals. Invoice 40100138959 | Hastings | |
| 08/08/2018 | | Replace bucket teeth and locking pins | TG | |
| 08/16/2018 | | Hosepower inv D54562 for replace hose on tilt bucket | Hosepower | |
| 12/10/2018 | 4242 | 250 hr service, replaced cutting edge, wash track body's | SS tg | |
| 05/21/2019 | 4262 | Check a/c fault, high head pressure. De gas system, replace condensor and TX valve, re gas, Test OK | Ellis Auto | |
| 08/22/2019 | 4354 | Purchase seals and fittings to pressure test auto greaser hydraulic hose and coupling. Found faulty hydraulic hose fitting, replace hose | TG | |
| 09/05/2019 | 4450 | Windscreens Territory manufacture 1 front lower windscreen from perspex | TG | |
| 10/01/2019 | 4505 | 500 hour service, change engine oil filters, fuel filters, hyd filters, inspect window, OK until end of job | TG SS | |
| 11/05/2019 | 4515 | Replace slew motor hydraulic hose, Part # 325-9106 Job 705 | TG | |
| 11/13/2019 | 4520 | Remove & replace front window, window glass fitted by Windscreens Territory | TG | |
| 12/16/2019 | 4620 | Replace hydraulic hose for quick hitch, check AC adjusted gas charge, fit 12V condensor fan for test | TG SS | |
| 07/08/2020 | 4736 | Test batteries, jump start and test charge rate. Remove and replace batteries. | TG | |
| 07/12/2020 | 4750 | 250 hour service replaced filters | TG | |



Plant & Vehicle Maintenance & Repairs

| CIVII | | | | |
|---------------|-------------|---|-----------------------------------|--|
| Asset Number: | CO250 | Serial Number: CAT0336EKTMZ00227 | | |
| Make: | Caterpillar | Model: 336EL Excavator Year of Manufacture: 20 | cavator Year of Manufacture: 2013 | |
| 07/14/2020 | 4764 | Check condensor fan, found to be faulty, replace fan and test OK | TG SS | |
| 08/17/2020 | 4816 | 1kg fire ext in cab, not fitting, Make bracket to fit | SS | |
| 09/01/2020 | | Make up pressure washer mount plates for Erkat dust suppression | SS | |
| 09/07/2020 | 4827 | Topped up Hydraulic oil | SS | |
| 10/15/2020 | | Unseized nipples for pins to take grease | SS | |
| 10/15/2020 | 4960 | Serg ordered parts 22/9. Replaced cracked hydraulic hoses | SS | |
| 10/13/2020 | 4956 | Wire up 24V water supply pump, Hosepower plumbed up pressure washer pump and Erkat. Hosepower Scott set pressures and flow for Erkat and tested operation | SS TG | |
| 10/15/2020 | 4970 | Changed over hydraulic motor fan and washers | SS | |
| 10/29/2020 | 5009 | 5000 hr service, all oils sampled, replaced, replaced filters. Sample fluids | SS TG | |
| 11/10/2020 | | Tightened tilt bucket hose fitting | TG | |
| 12/08/2020 | 5145 | Remove and replace fuel level sender in tank | TG | |
| 12/12/2020 | | Replace boot on ripper attachment | SS | |
| 01/14/2021 | 5201 | Fit 24V thermofan to condensor for A/C | SS | |
| 01/14/2021 | 5195 | Replaced broken hose on quick hitch | SS | |
| 02/22/2021 | 5331 | 250 hr service complete. Change oil and filters, grease up and blow filters. | TG/SS | |
| 02/19/2021 | | Replaced teeth on Erkat | TG/SS | |
| 03/31/2021 | 5425 | Fit new washer bottle | SS | |
| 03/22/2021 | 5384 | Replaced hyd hose for quickhitch at boom base | TG | |
| 04/22/2021 | 5503 | 500 hr service, replaced engine oil & filters, fuel filter, repaired coolant leak on overflow tank hoses, took all oil samples | SS | |
| 08/23/2021 | 5664 | Blown hose - Replaced Hydro Hose, made specialy by hose power | TG | |
| 08/30/2021 | 5669 | Blown hose - Replaced hose coming off LH main boom line | TG | |
| 09/20/2021 | 5685 | Hose replaced on slew motor | | |
| 10/02/2021 | 5733 | Machine greased and filters blown out | KS | |
| 11/01/2021 | 5766 | 250 hr service complete, change oil and filters | TG | |
| 01/11/2022 | 5866 | Topped up Hydro Oil, inspected platform OK, fit machine hours sticker | TG | |
| 03/22/2022 | 6083 | Leaking valve, removed valve, replaced damaged fittings & reassembled | TG | |
| 02/21/2022 | 6108 | Complete 2000hr service. Changed engine oil, final drive oil & slew drive oil. Replace all filters. | TG / SS | |
| 05/25/2022 | 6183 | Window tint will be replaced when machine returns to Nebo Rd. Authorised by S Chapman | SS | |
| 14/07/2022 | 6284 | JN#3135 - Repaired leak on erkat, O'ring on hose blown & resealed fitting | SS | |
| 28/07/2022 | 6291 | JN#3132 - Completed 250hr Sve, sampled engine oil, replaced engine oil & filter. Blew out all air filters & cab filters for AC, blew out all coolers | TG / SS | |
| 08/11/2022 | 6300 | JN#3171 - Fault, blown hyd hose. Replace 2x auxilary hoses from main pump. | SS | |
| 09/09/2022 | 6363 | JN#3192 - Fault, Hydraulics stalling eng. Repairs as per TPS invoice. Refer to Inv 0548. | TG SS | |
| 26/10/2022 | 6370 | JN#3237 - Replaced wiring harnesses, clean out DPF, re-seal pump coupling, re seal lift cylinders, re-install refer Inv 0600 T | TPS | |
| 10/31/2022 | | Strip & tint 3 x windows - refer WT Inv 792 att | WT | |
| 11/04/2022 | 6370 | JN#3251 - Remove boom lift cylinders, taken to Hosepower to be re-sealed & fitted refer to att Hosepower inv | TG/HP | |

| EASTARM civil | | Plant & Vehicle Maintenance & Repairs | |
|------------------|-------------|--|----------------|
| Asset Number: | CO250 | Serial Number: CAT0336EKTMZ00227 | |
| Make: | Caterpillar | Model: 336EL Excavator Year of Manufacture: | 2013 |
| 11/01/2022 | 6370 | JN#3231 - Flashing light tested OK | TG |
| 11/14/2022 | 6378 | JN#3263 - Replaced fittings at quick hitch, remove & fit new hose for pilot check valve at base of boom | TG/SS |
| 11/07/2022 | | Main Hydro pump & reseal mounting joint refer att Inv 0622 TPS | TPS |
| 11/03/2022 | | 2 x Lift cylinders to be resealed, kits supplied x EAC refer att Inv INO53487 Hosepower | HP |
| 11/18/2022 | 6393 | Top up hyd oil | SS |
| 12/09/2022 | 6485 | Replaced male quick coupler for remote hydraulics, replaced blown hose on quick hitch | |
| 12/01/2022 | 6579 | Replaced blown hose in engine bay | TG, SS |
| 01/13/2023 | | Changed all fuel filters, drained fuel tank, refilled clean fuel | TG, SS |
| 01/31/2023 | 6628 | Complete 500hr service. Changed oil and filters, sampled all fluid compartments. | |
| 01/31/2023 | 6628 | Remounted aftermarket condensor fan | |
| 01/31/2023 | 6628 | Adjusted wiper arm linkage | |
| 02/16/2023 | 6648 | Changed fumes dispersal filter | TG |
| 03/28/2023 | 6719.6 | Boom function stopped working refer att TPS Inv 0865 | TPS |
| 04/03/2023 | 3357 | 30/3-Pick up ECU from HD, drop off to TPS, John install. 3/4 - tested wiring and solenoid coils for low current faults, found OK, found faulty ECU, replaced ECU with re-mon ECU, reinstalled software into ECU and tested OK, reassemble. | TPS and TG |
| 04/18/2023 | 6754 | JN#3369 - Wont start, no signal at starter motor, checked output from key OK, fuses OK | TPS and TG |
| 04/19/2023 | 6754 | JN#3369 - Wont start, no power to starter motor, checked power at key. OK. Checked all fuses. OK. Tested power back from key and found no power to machine systems ECU. Found fuse faulty under load, replaced fuse and tested. OK Refer | TPS and TG, SS |
| 05/08/2023 | 6780 | Removed line relief valve and found broken spring, replaced relief valve and tested. OK. Found oil leak from pressure switch on pilot lines under cab, Ordered parts, removed 2 remote oil filter hoses | · |
| 05/09/2023 | 6780 | 250 hr service, change oil and filter, fit 2 remote oil filter hoses | SS |
| 05/11/2023 | 6780 | Replace belly plates, remove bucket crowd out relief valve, strip and check. All OK. Blank off bucket cylinder and check for drift. Tested. OK. Removed bucket spool and inspect | |
| 05/12/2023 | 6780 | Inspected spool and found info in SIS relating to valve spool fault, checked troubleshooting procedure and found fault in quick hitch causing oil leakage from crowd circuit, removed quick hitch control valve and dissassembled, found broken O rings, ordered seal bits | SS, TG |
| 05/15/2023 | 6780 | Re-seal quick hitch control valve | SS, TG |
| 05/16/2023 | 6780 | Re-seal soleroids spools for quick hitch valve, re -install control valve and tested. OK | SS, TG |
| 05/18/2023 | 6780 | Replace spool valve stem and stopper with updated parts to stop spool spinning | SS, TG |
| 05/23/2023 | 6780 | Remove stickers to paint counterweights | SS, TG |
| 05/31/2023 | 6780 | 31/5 - Repair cracked plates on handrails at Beta Pave, add strengthening plates | SS, TG |
| 06/05/2023 | 6780 | 1 battery not charging at 5.3 volts. Replaced with genuine Hastings batteries | SS, TG |
| 06/00/2022 | 6700 | Found blown base leaking while at Detanava, ardered now base | |

Fit new hydraulic hose in rotator swivel, degrease and wash down, remove quick hitch and load up tilt bucket to bring back to Nebo

Found blown hose leaking while at Betapave, ordered new hose

Completed paintwork

Betapave, TG, SS

6780

6780

6780

06/09/2023

06/13/2023

06/14/2023

| EASTARM civil | | Plant & Vehicle Maintenance & Repairs | |
|------------------|-------------|--|--------------|
| Asset Number: | CO250 | Serial Number: CAT0336EKTMZ00227 | |
| Make: | Caterpillar | Model: 336EL Excavator Year of Manufacture: 2 | 2013 |
| 06/15/2023 | 6780 | Fit tilt bucket and clean out grease galleries with hydraulic porter power pump | SS, TG |
| 06/16/2023 | 6780 | Refit A/C console covers, order new radio cut out switch. | SS, TG |
| 06/27/2023 | 6780 | Ben fitted CAT stickers | SS, TG |
| 08/16/2023 | 6780 | Replaced LH tap handle for remote hydraulic lines, repaired square drive on LH tap and re-fit handle | Workshop |
| 09/06/2023 | | Quick couplers on stick replaced (tilt bucket) | Workshop |
| 04/15/2024 | 6792 | Found fuel leaking from refueling transfer pump hoses, (not in service), remove hose tail from fuel tank & fit blanking plug | Workshop |
| 05/07/2024 | | Charged batteries | Workshop |
| 05/21/2024 | | Hammer not working, broken wire on joystik, configuration changed in monitor refer att: TPS Inv 1689 | TPS |
| 06/11/2024 | 6886 | OBS-958 Replaced seat regulator motor assembly, tested ok, | |
| 06/18/2024 | 6886 | Add 20L hydraulic oil to system to eliminate low hyd oil engine shutdown posibility fault | Workshop |
| , , | | John Fitzpatrick of TPS inspect screen faults, pin out wiring for fuel primer pump, repair wiring harness. 25/6-started | |
| 06/19/2024 | 6886 | cleaning machine to re-asemble shrouds in cabin and belly plates that were removed to diagnose wiring faults. Refer TPS | |
| , , | | Inv 1781 attached | TPS/Workshop |
| 08/27/2024 | | Remove broken cutting edge | Workshop |
| 10/08/2024 | 6908 | Hosepower for hoses | Workshop |
| | | Electrics hook up for GPS system, sensors on boom, e stick, weld on cable bracket, fit receivers and aerials, run wiring fit | |
| 10/09/2024 | 6908 | control unit to rear console behind seat, fit boom lights and wiring harness to new boom, install Komatsu fittings to boom | |
| | | lift cylinders to match hoses on boom - Refer Att Hosepower Inv INO95956 | Hosepower |
| 10/10/2024 | 6908 | Finish install GPS for longreach system | Workshop |
| 10/11/2024 | 6908 | Freo Cranes hook up stick and fit to longreach boom | Freo Cranes |
| 10/14/2024 | 6908 | Surveyors started calibrations of GPS to boom | |
| 10/17/2024 | 6908 | Fit new bucket for DVO to calibrate | Workshop |
| 10/18/2024 | 6908 | Reseal stick cylinder rod end crossover pipe, replaced faulty O ring, | Workshop |
| 11/06/2024 | 6908 | Fit mud bucket onto longreach stick | Workshop |
| 11/07/2024 | 6908 | DVO surveyors set up on excavator and check calibrations for GPS system before Operator training | Workshop |
| 11/11/2024 | 6908 | Prep to go on to barge, spray with lanoline, clean windows, install stick brace. | Workshop |
| 11/12/2024 | 6908 | Load and float with Longreach to Port | Workshop |
| 11/17/2024 | | Serg went Sund night to replace batteries with old CO201 batteries | Workshop |
| 11/18/2024 | 6975 | Ride boat out to barge, replace batteries | Workshop |
| 11/24/2024 | | Had to replace O ring on crossover hose, use hydraulic sealant, failed. Replaced O ring with O ring from Quick coupler seal | Workshop |
| 12/03/2024 | | Replace hydraulic hose | Workshop |
| 12/04/2024 | | Weld new cutting edge to bucket teeth | Workshop |
| 12/04/2024 | | Scotty from Hosepower inspect boom hoses | Workshop |
| 12/09/2024 | 7169 | Top up engine oil and grease | Workshop |
| | | · · · · · · · · · · · · · · · · · · · | |

Workshop

Workshop Workshop

Workshop

Replace crossover O ring seal and weld bracing onto GPS mount poles

Replaced 1 x O ring RHS crossover, replaced 2x grease nipples on bucket linkage.

Replace O ring in crossover hose. Also replace O ring on other side crossover hose

Change out primary fuel filter at Arnhem Contractor. Active fault code. Blew out fuel lines, test. OK.

12/10/2024

12/12/2024

12/17/2024

12/18/2024

7169

7210

7260

| EASTARM CIVII | | Plant & Vehicle Maintenance & Repairs | | |
|------------------|-------------|---|---------------------------|--|
| Asset Number: | CO250 | Serial Number: CAT0336EKTMZ00227 | | |
| Make: | Caterpillar | Model: 336EL Excavator Year of Manufacture: 2 | Year of Manufacture: 2013 | |
| 12/19/2024 | 7289 | Dog bone came off on nightshift. Straighten and refit in morning | Workshop | |
| 01/08/2025 | 7341 | Flat batteries. Changed over. | Workshop | |
| 01/09/2025 | | Broken bucket pin, Wilkinson made up. | | |
| 01/10/2025 | | Refit bucket crowd cylinder pin and replace blown O ring to cylinder end of crowd cylinder | Workshop | |
| 02/13/2025 | 7344 | 1000hr service, change oil and filter, final drive oils. | Workshop | |
| 02/19/2025 | 7344 | Refill final drives with TDT050, sample and drain swing drive gearbox | Workshop | |
| 02/27/2025 | 7344 | Andrew painted counterweight CAT yellow. | Betapave | |
| 03/14/2025 | | Strip & reseal, new rod seal, Hosepower Inv IN104427 | Hosepower | |
| 04/22/2025 | | Fit new bucket pins to excavator stick boom bucket pins | SS | |
| 04/28/2025 | | Grease , fit new grease nipples to dog bone linkages. Soft seal dipper arm & crowd cylinder hoses & clamp fittings | SS | |
| 04/29/2025 | | Fault find issue with work lights on main boom section, found short in wiring rear LH side work light & replaced blown H3 | | |
| | | bulb | SS | |
| 05/08/2025 | | Ty welded up 336-1800GP to bucket | Tyrone | |
| 24-Jun | 7357 | Wash after Seaswift use. | | |