

N16-2
0809

CUSTOMER:

DATE: Dec 7 2023

ADDRESS:

TECHNICIAN:

CONTACT NAME:

W.O. #:

PHONE:

UNIT #: 90-805 91-901

CUSTOMER SIGNATURE _____

MAKE / MODEL:

SERIAL #:

KM:

HOURS:

COMPLAINT / TASK

Job Completed ☐ Yes ☐ No

OFFICE USE ONLY

Parts Used ☐ Yes ☐ No

 
TOTAL LABOUR HOURS	742 + 2410
--------------------	------------

Parts Order #:

TOTAL PARTS

GRAND TOTAL

5	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100
---	---	---	---	---	---	---	---	---	---	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	-----



0807

DATE:	Dec 6 12023
TECHNICIAN:	Nic nech AS
W.O. #:	
UNIT #:	90-805
MAKE / MODEL:	
SERIAL #:	
KM:	
HOURS:	

Job Completed	☐ Yes	☐ No
Parts Used	☐ Yes	☐ No

	TOTAL LABOUR HOURS	
Parts Order #:	TOTAL PARTS	
	GRAND TOTAL	8

GRAND TOTAL



2001, 5101 46 Ave
Cold Lake, AB T9M 0C8
Ph: 825.723.0201

SERVICE REPORT

0806

☐ Call Out ☐ Shop ☐ Field

CUSTOMER:	DATE: 6/12/23
ADDRESS:	TECHNICIAN: N.C. mech. A.S
	W.O. #:
	UNIT # 90-805
CONTACT NAME:	MAKE / MODEL:
PHONE:	SERIAL #:
CUSTOMER SIGNATURE:	KM:
	HOURS:

COMPLAINT / TASK

DATE	HOURS	WORK COMPLETED
6/18/23	6	12:00-6:00
	2	TRAVEL
		Installed swing arm assembly on 1st drive axle, install hub on PS Fst drive axle, removed swing arm assembly on 2nd drive axle, removed PS bearings dust shields, removed damaged bushing, installed new bushing, installed swing bar assembly, installed bearings, installed new 2nd diff input seal installed 1st diff output seal, installed drive line

Job Completed ☐ Yes ☐ No

Parts Used ☐ Yes ☐ No

OFFICE USE ONLY

TOTAL LABOUR HOURS

8

Parts Order #:

TOTAL PARTS

GRAND TOTAL

☐ Call Out ☒ Shop ☐ Field

CUSTOMER: AMC	DATE: FEB. 21. 23
ADDRESS:	TECHNICIAN: JUSTIN. H
	W.O. #:
	UNIT #: 90-805
CONTACT NAME: GEN	MAKE / MODEL: KENWORTH
PHONE:	SERIAL #:
CUSTOMER SIGNATURE:	KM:
	HOURS:

COMPLAINT / TASK

① POSITIVE AIR TRIPS

DATE	HOURS	WORK COMPLETED
FEB. 21		① - CHECKED ELECTRICAL, RAN UNIT. - PULLED + BEAT ON WIRING + SOLENOID. (O.K) - PULLED SWITCH + CHECKED. (O.K) * NO ISSUES FOUND, I THINK POSSIBLE OPERATOR IS HOOKING SWITCH WITH BOOT OR COVERALS WHEN CLUTCHING. POSSIBLY MOVE SWITCH FROM LOCATION KEVEN WANTED OR TURN SWITCH SIDEWAYS.

Job Completed	☐ Yes	☐ No	OFFICE USE ONLY		
Parts Used	☐ Yes	☐ No	TOTAL LABOUR HOURS		
			Parts Order #:		TOTAL PARTS
			GRAND TOTAL		

 


2001, 5101 46 Ave
Cold Lake, AB T9M 0C8
Ph: 825.723.0201

SERVICE REPORT

0116

☐ Call Out ☒ Shop ☐ Field

CUSTOMER: <u>Amc</u>	DATE: <u>Jan 28/23</u>
ADDRESS:	TECHNICIAN: <u>Harmelton Hene</u>
	W.O. #:
CONTACT NAME:	UNIT #: <u>90-805</u>
PHONE:	MAKE / MODEL:
CUSTOMER SIGNATURE: 	SERIAL #:
	KM: <u>813145</u>
	HOURS: <u>14723</u>

COMPLAINT / TASK

Next Service due @ 14979

ABS lamp on, PASO not working, Driverside worklight out, PS beacon lights out, all Shocks leaking, oil leak by compressor, fan belt missing bands, missing battery disconnect, Airbrake on 5th wheel leaking, A312 brake pot, A112 wheel seal


DATE	HOURS	WORK COMPLETED
		- Found ABS code for open on A112 reconnected ABS sensor and the code went out.
		- PASO would not trip. Found connector unplugged. Hooked it up and it worked as normal.
		- Wayne repaired DS worklight
		- Wayne repaired PS beacon lights
		- Found all the shocks leaking oil. removed and replaced all the shocks on A112/A13.
		- oil was running down rear of engine. found it to be coming from the crank position sensor. replaced the sensor and oil leak stopped.
		- fan belt was not riding on the tensioner tensioner correctly. did the mounting bracket update update and installed a new tensioner. solved the issue.
		- Wayne installed new battery disconnect.
		- Wayne repaired 5th wheel Air leak
		- Removed PS wheel seal and installed a new one
		- Removed and replaced A312 brake pot.
		- greased unit
		- Set brakes.

Job Completed ☒ Yes ☐ No

Parts Used ☒ Yes ☐ No

OFFICE USE ONLY

	TOTAL LABOUR HOURS	
Parts Order #:	TOTAL PARTS	
	GRAND TOTAL	

 

0208

CUSTOMER:	Amc.
ADDRESS:	
CONTACT NAME:	
PHONE:	
CUSTOMER SIGNATURE:	

DATE:	Jan 27/2023
TECHNICIAN:	Wagner Silvano
W.O. #:	
UNIT #:	90-805
MAKE / MODEL:	Kenworth T-800
SERIAL #:	
KM:	
HOURS:	

Pre CURP Inspection.

DATE	HOURS	WORK COMPLETED
Jan 27		Repair Driverside Backup Light wiring. used Blue Shrinkable Butt Connectors and Shrink Tubes. Repair Passengerside Backup Light. Just Bad Connection to Bulbs, Help Ottemmie with Hydraulic Fitting at Pumps. Repair 5 th wheel slide air line - install metal Bushing on mount and 2 1/4" fuel and Connectors. Install 3 sets tires and Steer tires so far.
Jan 28		Put 1 set Rear tires on

Job Completed ☒ Yes ☐ No

Parts Used	☒ Yes	☐ No
------------	---	-----------------------------

OFFICE USE ONLY

 
TOTAL LABOUR HOURS

Parts Order #:

TOTAL PARTS

GRAND TOTAL






CUSTOMER AMC DATE April 28/ 20 22
ADDRESS 62220-RR421 A.F.E NO. _____
JOB LOCATION AMC Shop. P.O. NO. 90-805
JOB NO. 2022-01

WORK DESCRIPTION Oil Service on 90-805

- Take off 2 Broken Brackets Right side Exhaust stack and Weld
- Secure Both truck front fenders
- Tighten up main hydraulic Line at PTO Pump
- Install new shifter knob
- Take unit for 8 new Drive Tires

Supervisor (Print): <i>Wagner Schuy</i>	Signature: <i>[Signature]</i>
Approved by (Print):	Signature:

 

CUSTOMER Amc DATE March 17 20 22
ADDRESS _____ A.F.E NO. _____
JOB LOCATION Amc Shop P.O. NO. _____
JOB NO. 90-805

WORK DESCRIPTION change oil, fuel & air filters.

TOTAL

Signature: _____