

# TRANSWESTERN

## TRUCK CENTRES



1009 41 Street N  
Lethbridge, AB T1H 6J3  
P: (403) 320-6089

PROVIDING PARTS & SERVICE FOR ALL MAKE OF TRUCKS

VIN: ACTIVE IN ALBERTA

Page 1 of 4

BILL TO  
MARK BECK - 12412  
LETHBRIDGE AB T1H 6J3

DELIVER TO  
MARK BECK - 12412  
LETHBRIDGE AB T1H 6J3  
P: (403) 308-0105

MVPAUTH #

SERVICE ORDER: R201004201

DATE ARRIVED	DATE INVOICE	SALES TYPE	ADVISOR	TERMS	CUSTOMER REFERENCE			
5/8/2026 12:00:00AM		SRET	SJUHASZ	CASH				
YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT #	ENGINE HOURS	IN SERVICE	Component Serial #	ODOMETER
2018	VOLVO	VN	4V4NC9EJ3JN901035		25,620			1542453

**Sold Operations**

**JOB #1 CVIP24 AB GOV'T SAFETY INSPECTION WITH WHEELS REMOVED- SUPPLY CURRENT COPY OF TRU**

COMPLAINT CVIP24 CVIP AB GOV'T SAFETY INSPECTION WITH WHEELS REMOVED . SUPPLY CURRENT COPY OF TRUCKS REGISTRATION ATTACHED TO REPAIR ORDER. -

CAUSE CVIP DUE

CORRECTION TechID: \_XN20826 - REMOVED WHEELS FOR MEASURING AND INSPECTION. REINSTALLED AND TORQUED WHEELS TO 500 FTLBS. COMPLETE REPAIRS AND STICKER TRUCK

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 231	CVIP24 CVIP AB GOV'T SAFETY INSPECTION WITH WHI		500.00
	LABOR 231	PULL WHEELS		0.00

Parts: \$0.00 Labor: \$500.00 Misc: \$0.00 Sublet: \$0.00 \$500.00

**JOB #3 231 MISCELLANEOUS**

COMPLAINT REPLACE D/S ABS MODUALTOR VALVE -

CAUSE ABS VALVE FAILED

CORRECTION REMOVED DRIVERS SIDE STEER ABS VALVE FROM UNIT, FOUND THAT THE BRAKE POT AIR LINE WAS RUBBING, CLEANED UP FITTINGS AND INSTALLED NEW ABS VALVE ALONG WITH A NEW MAXI POD AIR LINE.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	201D/1000-AH62066	3/8 ID HOSE ASSY-20 - 3/8	11.22	11.22
1	201M/85143184	MODULATOR	358.24	358.24
0	201M/85143184-CORE	MODULATOR	111.55	0.00
2	201V/8080837	RETAINER	7.36	14.72
6	201V/948211	CABLE TIE	2.18	13.08
4	201V/980464	CABLE TIE	2.27	9.08
	LABOR 231	REPLACE D/S ABS MODUALTOR VALVE		0.00
	VMRS33	013-000-000		

Parts: \$406.34 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00 \$406.34

# TRANSWESTERN

TRUCK CENTRES

SERVICE ORDER: R201004201

ESTIMATE: 20797681

Page 2 of 4

**Sold Operations (Cont.)**

**JOB #4 231 MISCELLANEOUS**

COMPLAINT REPLACE 5TH WHEEL BUSHINGS -  
 CAUSE 5TH WHEEL BUSHINGS WORN  
 CORRECTION REPLACED PIN AND BUSHINGS ON 5TH WHEEL PLATE, CLEANED 5TH WHEEL PLATE AND ADJUSTED.  
 GREASED 5TH WHEEL.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	201D/3889-RK10605	KIT, ILS BRACKET PINS & C	98.28	98.28
	LABOR 231	REPLACE 5TH WHEEL BUSHINGS		0.00

Parts: \$98.28 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00 \$98.28

**JOB #5 231 MISCELLANEOUS**

COMPLAINT REPLACE D/S MUD FLAP HANGER -  
 CAUSE MUD FLAP BRACKETS BENT  
 CORRECTION R&R MUDFLAP HANGERS

NOT AN INVOICE

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	201D/1000-MFB3145SSCX	HANGER 31.5 45 DEG SS CX	280.00	280.00
	LABOR 231	REPLACE D/S MUD FLAP HANGER		0.00
	VMRS33	002-000-000		

Parts: \$280.00 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00 \$280.00

**JOB #6 231 MISCELLANEOUS**

COMPLAINT DIAGNOSE CLEARANCE LIGHTS ON HEADACHE RACK -  
 CAUSE LIGHT BURNT OUT  
 CORRECTION TECH ID XN11012- FOUND AND FIXED BROKEN WIRES AND BAD GROUND. FOUND LIGHT STILL WOULDNT WORK. CHECKED POWER AND FOUND TO HAVE 12V. REPLACED LIGHT AND WORKS PROPERLY NOW.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 231	DIAGNOSE CLEARANCE LIGHTS ON HEADACHE RACK		157.00

Parts: \$0.00 Labor: \$157.00 Misc: \$0.00 Sublet: \$0.00 \$157.00

**JOB #7 231 MISCELLANEOUS**

COMPLAINT DIAGNOSE BRAKE LIGHT OUT ON HEADACHE RACK -  
 CAUSE LIGHT BURNT OUT  
 CORRECTION TECH ID XN11012- FOUND AND FIXED BROKEN WIRES AND BAD GROUND. FOUND LIGHT STILL WOULDNT WORK. CHECKED POWER AND FOUND TO HAVE 12V. REPLACED LIGHT AND WORKS PROPERLY NOW.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	201X/44032R	LED S/T LAMP	43.08	43.08
	LABOR 231	DIAGNOSE BRAKE LIGHT OUT ON HEADACHE RACK		0.00
	VMRS33	034-000-000		

Parts: \$43.08 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00 \$43.08

# TRANSWESTERN

TRUCK CENTRES

SERVICE ORDER: R201004201

ESTIMATE: 20797681

Page 3 of 4

**Sold Operations (Cont.)**

**JOB #8 231 MISCELLANEOUS**

COMPLAINT DIAGNOSE AIR LEAKS -  
 CAUSE REPAIR AIR LEAKS ON FIREWALL  
 CORRECTION AIRED UP UNIT WITH SHOP AIR , FOUND THAT THE BRAKE VALVE FITTINGS ARE LEAKING AS WELL AS THE #2 AXLE LEVELING VALVE, REPAIRED MULTIPLE AIR LEAKS OFF THE BRAKE VALVE ON THE FIRE WALL.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	201D/4485-14858CUT	1/2 SYNDFLEX	1.70	1.70
	LABOR 231	DIAGNOSE AIR LEAKS		0.00

Parts: \$1.70 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00 \$1.70

**JOB #9 231 MISCELLANEOUS**

COMPLAINT REPLACE WINDSHEILD -  
 CAUSE  
 CORRECTION

**NOT AN INVOICE**

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	10205	Benchmark Glass	259.38	259.38
	LABOR 231	REPLACE WINDSHEILD		0.00

Parts: \$0.00 Labor: \$0.00 Misc: \$0.00 Sublet: \$259.38 \$259.38

**JOB #10 231 MISCELLANEOUS**

COMPLAINT 5TH WHEEL ADJUSTMENT -  
 CAUSE 5TH OUT OF ADJ  
 CORRECTION ADJUSTED 5TH WHEEL

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 231	5TH WHEEL ADJUSTMENT		78.50

Parts: \$0.00 Labor: \$78.50 Misc: \$0.00 Sublet: \$0.00 \$78.50

**JOB #11 231 MISCELLANEOUS**

COMPLAINT R&R BATTERY  
 CAUSE  
 CORRECTION

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
4	201D/1000-31RC925C	925CCABATT	99.95	399.80
0	201D/1000-31RC925C-CORE	925CCABATT CORE	22.50	0.00

Parts: \$399.80 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00 \$399.80

**Sold Operations Totals** Parts: \$1,229.20 Labor: \$735.50 Misc: \$0.00 Sublet: \$259.38 \$2,224.08

## NOT AN INVOICE

**DISCLAIMER:**

AN EXPRESS MECHANIC'S LIEN IS HEREBY ACKNOWLEDGED ON THE ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS AND SERVICE THERETO. I AGREE THAT UNTIL ALL REPAIRS ARE FULLY PAID FOR (ACCOUNT IS CONSIDERED UNPAID UNTIL CHEQUES ARE HONOURED AT THE BANK), MY CUSTODY OF THE VEHICLE SET OUT IN THIS DOCUMENT REMAINS WITH YOU AND YOU MAY RESUME POSSESSION BY YOURSELF OR YOUR BAILIFF AT ANY TIME AND REALIZE THE AMOUNT OF YOUR MECHANIC'S LIEN TOGETHER WITH THE COST OF RESUMING POSSESSION AS IF THE VEHICLE HAD NEVER LEFT YOUR CUSTODY OR CONTROL. ANY CLAIMS MUST BE MADE WITHIN 7 DAYS AFTER THE DELIVERY DATE. PAYMENT TO BE NET 30 DAYS FROM DATE OF INVOICE, UNLESS OTHERWISE SHOWN. INTEREST AT 2% (24% PER ANNUM) CHARGED ON OVERDUE ACCOUNTS.

**DISCLOSURE OF NON-MACK/VOLVO PART CUSTOMER ACKNOWLEDGEMENT FORM**

THIS TRANSACTION MAY INCLUDE THE SALE AND/OR INSTALLATION BY THE DEALER OF NON-MACK/VOLVO PARTS. MACK/VOLVO RECOMMENDS USING GENUINE PARTS FOR ALL REPAIRS AND SERVICE ON MACK/VOLVO TRUCKS. YOU HAVE THE RIGHT TO DEMAND THAT ONLY GENUINE MACK/VOLVO PARTS BE USED ON YOUR VEHICLE. NON-MACK/VOLVO PARTS ARE NOT COVERED UNDER THE MACK/VOLVO NEW VEHICLE WARRANTY AND ARE NOT COVERED UNDER THE MACK/VOLVO WARRANTY FOR REPLACEMENT COMPONENTS AND PARTS. ANY FAILURE OF ANY VEHICLE, COMPONENT, OR PART CAUSED BY THE USE OF A NON-MACK/VOLVO PART IS NOT COVERED UNDER ANY MACK/VOLVO WARRANTY. MACK/VOLVO IS NOT RESPONSIBLE FOR THE CONSEQUENCES OF INSTALLING ANY NON-MACK/VOLVO PARTS ON THE VEHICLE. A LIST OF NON-MACK/VOLVO PARTS PURCHASED AND/OR INSTALLED DURING THIS TRANSACTION IS AVAILABLE UPON REQUEST.

\*\*\*\*\*FOLLOW US ON SOCIAL MEDIA\*\*\*\*\*

INSTAGRAM: @transwesterntruckcentres  
 FACEBOOK: @Transwsestertrucentres  
 LINKEDIN: @TRANSWESTERN TRUCK CENTRE'S

	ESTIMATED	BILLED
LABOR		\$735.50
PARTS		\$1,229.20
MISC		\$0.00
SUBLET		\$259.38
<b>SUBTOTAL</b>		<b>\$2,224.08</b>

SHOP SUPPLIES	\$58.84
HAZMAT FEE	\$5.00
TAX	\$114.40
<b>TOTAL</b>	<b>\$2,402.32</b>

Please Remit Payment to:  
 TRANSWESTERN TRUCK CENTRES  
 5022 90 AVENUE SE  
 CALGARY, AB T2C 2I2  
 CANADA



AUTHORIZED BY

ATE \_\_\_\_\_



## Disclaimer

The information contained in this folder has been provided by the consignor and had not been certified by Ritchie Bros. Auctioneers

Ritchie Bros. Auctioneers in no way certifies the completeness or accuracy of this information

Please inspect the equipment. It is "sold as is" no warranties made or implied

---

Brennan LeBlanc  
Divisional Operations Manager  
Western Canada Agriculture