

Invoice: EV-114970

View Message Log

Print Procedures ▾

Print ▾

Re-Send Invoice

Delete

☒ ? Exported**Evans HD Ltd**

1104 12 Ave
Coaldale, AB T1M 0G3, CA
accounts@evanshd.ca
403-388-3616



Invoice: EV-114970

Date: 1/31/2025

Bill To

EVANS TRUCKING
1104 12ave
Coaldale, AB T1M 0G3, CA
P: 403-345-3558

Remit Payment To

Evans HD Ltd.
1104 12 Ave
Coaldale, AB T1M 0G3, CA

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
EV-12898	Net 30	3/2/2025	Pero		Unruh, Carlos	04

Item	Description	Quantity	Rate	Amount
Complaint: PERFORM WHEELS ON CVIP				
Cause: Customer request				
Labor	Correction: Chassis / Chassis / COMPLETED CVIP UNIT FAILED SENT LIST COMPLETED REPAIRS STICKERED UNIT	3.52000	\$160.00	\$563.20
Subtotal				\$563.20
Complaint: PERFORM TOPSET				
Cause: Customer request				
Labor	Correction: Chassis / Chassis / - INSTALLED ROTATIONAL TOOL AND TURN ENGINE OVER TO TDC - REMOVED THE AIR FILTER HOUSING AND REMOVED ALL THE NECESSARY ACCESSORIES TO BE ABLE TO REMOVE THE VALVE COVER - COMPLETED THE VALVE SET - WHEN THROUGH ROTATIONS AGAIN AND CHECK ALL THE JAKES AND ONLY MADE MINOR ADJUSTMENTS ON THEM - PULLED THE INJECTOR HARNESSSES OUT AND REMOVED THE LEAKING CONNECTOR ORINGS CLEANED THE ENDS AND INSTALLED NEW ORING SEALS AND RE-INSTALLED THE HARNESSSES AND TORQUED THEM ALL INTO PLACE - INSTALLED THE VALVE COVER AND BUTTONED THE REST OF THE ACCESSORIES (SAM - JAN 25/25)	3.00000	\$160.00	\$480.00
Parts	INJ HARNESS SEAL (WHITE) - 121394	2.00000	\$6.12	\$12.24
Subtotal				\$492.24
Complaint: REPLACE HVAC FILTERS				
Cause: Customer request				
Labor	Correction: Chassis / Chassis / REMOVED FILTERS INSTALLED NEW FILTERS	0.30000	\$160.00	\$48.00
Parts	RECIRCULATING FILTER - BOA/B4032457001	1.00000	\$23.57	\$23.57
Parts	HVAC FILTER - ABP/N10G-91559	1.00000	\$20.19	\$20.19
Subtotal				\$91.76
Complaint: REPLACE ENGINE AIR FILTER				
Cause: Customer request				
Labor	Correction: Chassis / Chassis / REMOVED OLD FILTER INSTALLED NEW FILTER	0.30000	\$160.00	\$48.00
Parts	OLD CASCADIA AIR FILTER - P610260	1.00000	\$201.07	\$201.07
Subtotal				\$249.07

Item	Description	Quantity	Rate	Amount
Complaint: REPLACE AIR DRYER CARTRIDGE				
Cause: Customer request				
Labor	Correction: Chassis / Chassis / REMOVED CARTRIDGE INSTALLED NEW CARTRIDGE	0.30000	\$160.00	\$48.00
Parts	AIR DRYER CARTRIDGE - WAB/432-901-248-2	1.00000	\$143.60	\$143.60
			Subtotal	\$191.60
Complaint: REPAIR FOR WIRING TO LICENSE PLATE LIGHT RIPPED OFF				
Cause: Customer request				
Labor	Correction: Chassis / Chassis / COMPLETED LINE ON THE PLATE LIGHT INOP LINE	0.00000		\$0.00
Parts	LICENCE PLATE LIGHT HOUSING - LP2000BP	1.00000	\$3.74	\$3.74
			Subtotal	\$3.74
Complaint: Detroit Full Service - Evolution				
Cause: Customer request				
Labor	Correction: Engine / Lubrication // DRAINED OIL REMOVED OIL FILTER INSTALLED NEW FILTER FILLED UNIT WITH OIL RAN UNIT REMOVED FUEL FILTERS GREASED WHOLE UNIT ADJUSTED BRAKES CHECKED OIL LEVEL PRIMED FUEL SYSTEM	1.60000	\$160.00	\$256.00
Parts	SHELL 5-40 BULK OIL - SH500010133	48.00000	\$12.86	\$617.28
Parts	FILTER INSERT KIT (2 FILTER) - DDE/A4700903151	1.00000	\$165.36	\$165.36
Parts	OIL FILTER KIT - DDE/A4731800909	1.00000	\$63.39	\$63.39
Parts	GREASE BULK - SH550029600	1.00000	\$9.02	\$9.02
Parts	CUMMINS ISX/DD13/DD15/DD16 - EASY DRAIN - FEMCO - 10-27200-01	1.00000	\$77.41	\$77.41
			Subtotal	\$1,188.46
Complaint: REPAIR AIR LEAK @ FIRE WALL				
Cause: Customer request				
(Inspection)				
Labor	Correction: Chassis / Chassis / REMOVED INTERIOR TRIM PIECES REMOVED ALL AIR LINES AND SENSOR WIRES REMOVED PASS THROUGH MANIFOLD INSTALLED NEW MANIFOLD INSTALLED ALL AIR LINES INSTALLED ALL WIRES INSTALLED TRIM PIECES BACK UP NO LEAKS	2.60000	\$160.00	\$416.00
Parts	PASSTHROUGH-SW MANIFOLD, AIR, P3 - 12-21425-002	1.00000	\$298.47	\$298.47
			Subtotal	\$714.47
Complaint: REPLACE AIR LEAK @ #2 RH SERVICE LINE				
Cause: Customer request				
(Inspection)				
Labor	Correction: Chassis / Chassis / REMOVED AIR LINE FOUND THERE WAS NO SEALANT PUT PIPE DOPE ON THREADS INSTALLED TESTED FOR LEAKS NO AIR LEAKS	0.25000	\$160.00	\$40.00
			Subtotal	\$40.00
Complaint: CLEAN BATTERY CABLES				

Item	Description	Quantity	Rate	Amount
Cause: Customer request				
(Inspection)				
Labor	Correction: Chassis / Chassis / REMOVED BATTERY CABLES CLEANED ALL CABLES INSTALLED BACK ONTO BATTERIES SPRAYED PROTECTANT	0.55000	\$160.00	\$88.00
			Subtotal	\$88.00
Complaint: REPLACE #2 DIFF TEMP SENSOR WIRES PLUG				
Cause: Customer request				
(Inspection)				
Labor	Correction: Chassis / Chassis / CUT BACK WIRES REMOVED OLD PLUG INSTALLED NEW SENSOR TIED UP WIRING	0.30000	\$160.00	\$48.00
Parts	SENSOR CONNECTOR KIT - ABP/N54-CC-650-180-1	1.00000	\$49.93	\$49.93
			Subtotal	\$97.93
Complaint: PLATE LIGHT INOP				
Cause: Customer request				
(Inspection)				
Labor	Correction: Chassis / Chassis / CUT OLD CORRODED WIRES INSTALLED A NEW PLUG INSTALLED ONTO UNIT WITH A NEW MOUNT TIED UP WIRES	0.80000	\$160.00	\$128.00
			Subtotal	\$128.00
Complaint: REPLACE CLUTCH BRAKE				
Cause: Customer request				
(Inspection)				
Labor	Correction: Chassis / Chassis / REMOVED OLD BRAKE INSTALLED NEW BRAKE	0.75000	\$160.00	\$120.00
Parts	BABCOCK 2 PIECE CLUTCH BRAKE - BAC/SB200	1.00000	\$88.27	\$88.27
			Subtotal	\$208.27
Complaint: ADJUST TIRE PRESSUERS				
Cause: Customer request				
(Inspection)				
Labor	Correction: Chassis / Chassis / ADJUSTED ALL TIRE PRESSURES	0.35000	\$160.00	\$56.00
			Subtotal	\$56.00
Complaint: REPLACE OIL PAN AND GASKET				
Cause: Customer request				
(Inspection)				
Labor	Correction: Chassis / Chassis / DRAINED OIL JACKED UP FRAME TO HAVE ENOUGH CLEARANCE DROPPED PAN CLEANED BLOCK AND INSPECTED FOR ANY ISSUES INSTALLED NEW PAN WITH SILICONE ON EACH JOINT TORQUED BOLTS TO SPEC TIED UP WIRES FOUND A WIRE THAT HAD RUBBED THROUGH ON THE OLD PAN REPAIRED WIRE AND TIED LOOM HIGHER UP TO PREVENT RUBBING FILLED UNIT WITH 39L RAN UNIT AND CHECKED FOR LEAKS ALL GOOD NO LEAKS	3.45000	\$160.00	\$552.00
Parts	OIL PAN - DDE/A4720102313	1.00000	\$948.41	\$948.41
			Subtotal	\$1,500.41
Complaint: CHECK FOR CEL ON				
Cause: Customer request				
(Inspection)				

Evans HD Ltd
1104 12 Ave
Coaldale, AB T1M 0G3, CA
accounts@evanshd.ca
403-388-3616



Invoice: EV-113114
Date: 10/24/2024

Bill To
EVANS TRUCKING
1104 12ave
Coaldale, AB T1M 0G3, CA
P: 403-345-3558

Remit Payment To
Evans HD Ltd.
1104 12 Ave
Coaldale, AB T1M 0G3, CA

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
EV-11986	Net 30	11/23/2024	Pero		Unruh, Carlos	04

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: SWAP TRANSMISSION WITH USED

Cause: Customer request

Labor	Correction: Chassis / Chassis / PULLED TRUCK OFF TRAILER AND INTO SHOP REMOVED DRIVELINE REMOVED ALL CONNECTORS REMOVED AIR LINES UNBOLTED CLUTCH REMOVED TRANSMISSION INSPECTED CLUTCH AND FIGURED WE COULD REUSE IT PULLED TOP COVER AND FOUND THERE WERE SEVERAL GEARS THAT WERE COMPLETELY SHOT REMOVED TOP COVER ON NEW (USED) TRANSMISSION AND FOUND ALL GEARS WERE GOOD INSTALLED NEW GASKET CAGED CLUTCH INSTALLED TRANSMISSION UP INSTALLED CLUTCH TO FLY WHEEL INSTALLED ALL AIR LINES AND CONNECTORS INSTALLED DRIVESHAFT GREASED ALL POINTS FOUND CLUTCH WASNT FEELING GOOD INSPECTED AND FOUND HYDRAULIC RESERVOIR WAS BONE DRY FILLED AND CONTINUOUSLY BLEED THE SYSTEM SYSTEM WAS NOT BLEEDING AIR TRIED SLAVE FROM ANOTHER UNIT AND HAD THE SAME THING USED PRYBAR ON THE FORK AND OPENED THE BLEED SCREW A COUPLE TIMES AND IT WORKED SENT UNIT FOR A TEST DRIVE TEST DRIVE WAS GOOD CHECKED LEVELS AND EVERYTHING LOOKS GOOD CARLOS HAD A CHECK OVER AND EVERYTHING LOOKED GOOD	14.00000	\$160.00	\$2,240.00
Parts	EATON SHIFT TOWER GASKET - 755-4305294	1.00000	\$16.11	\$16.11
Parts	TRANSMISSION GASKET - FUL/4302676	1.00000	\$10.23	\$10.23
Parts	GASKET - FUL/19481	1.00000	\$6.40	\$6.40
Parts	U-JOINT STRAP KIT - KT17SB	2.00000	\$36.21	\$72.42
Parts	BRAKE FLUID DOT3 1L - RCC-15-811	1.00000	\$20.82	\$20.82
			Subtotal	\$2,365.98

Complaint: REPAIR FOR AIR LEAK AT FAN HUB

Cause: Customer request

(Inspection)

Labor	Correction: A/C Cooling System / Fan / REMOVED AIR LINE GOING TO HUB REMOVED BELT REMOVED FAN DRAINED COOLANT REMOVED RESERVOIR REMOVED TOP SHROUD REMOVED HUB TRIED REMOVING TOP CAP ON THE HUB BUT COULD NOT, IS SEIZED, HUB REQUIRES REPLACEMENT REMOVED THE HUB FROM UNIT #07 TESTED HUB AND ALL WORKED WELL AND NO LEAKS	4.00000	\$160.00	\$640.00
-------	---	---------	----------	----------

Item	Description	Quantity	Rate	Amount
	INSTALLED HUB TORQUED BOLTS TO SPEC INSTALLED BELT AND FAN AND TORQUED TO SPEC INSTALLED SHROUD INSTALLED RESERVOIR INSTALLED ALL LINES FILLED RESERVOIR BACK UP RAN UNIT NO COOLANT OR AIR LEAKS UNIT RUNS GOOD			
			Subtotal	\$640.00
Complaint: REPAIR FOR ENGINE CODES (FUEL CUT OFF VALVE)				
Cause: Customer request				
(Inspection)				
Labor	Correction: Exhaust / DOC & DPF / . HOOK UP AND CHECK CODES, FINDING ACTIVE CODE FOR FUEL CUTOFF VALVE. TROUBLESHOOT AS DIRECTED, FINDING ELECTRICAL CIRCUITRY, ECM & FUEL LINES ALL GOOD AND FAILURE OF THE CUTOFF VALVE ITSELF REMOVED FUEL LINES REMOVED PLUGS REMOVED DOSER BLOCK REMOVED BLOCK OFF SPARE ENGINE IN THE SHOP INSTALLED ONTO THE TRUCK TORQUED LINES AND BOLTS PLUGGED ALL CONNECTORS IN PRIMED UNIT RAN UNIT CHECKED CODES AND FUEL CUT OFF VALVE CODE IS INACTIVE NO LEAKS AND UNIT IS SECURE	2.25000	\$160.00	\$360.00
Parts	SEAL RING - DDE/N000000001067	4.00000	\$0.74	\$2.96
			Subtotal	\$362.96
Complaint: REPLACE RH STEER TIRE WITH USED				
Cause: Customer request				
(Inspection)				
Labor	Correction: Chassis / Chassis / REMOVED WHEEL DRAINED AIR SWAPPED TIRE INSTALLED BACK ON FILLED TO 100 PSI TORQUED WHEEL INSTALLED NUT COVERS	0.70000	\$160.00	\$112.00
			Subtotal	\$112.00
Complaint: GREASE UNIT				
Cause: Customer request				
(Inspection)				
Labor	Correction: Chassis / Chassis / . -DANIEL -GREASED UNIT AND FIFTH WHEEL	0.50000	\$160.00	\$80.00
Parts	GREASE BULK - SH550029600	1.00000	\$12.25	\$12.25
			Subtotal	\$92.25
Unit: 04 VIN: 3AKJGLDR5HSJB2709				Labor \$3,432.00
License Plate: 35391P				Parts \$141.19
2017 FREIGHTLINER CASCADIA 125				Shop Supplies \$411.84
Chassis: 1,316,059 Kilometers				Pre-Charge Subtotal \$3,985.03
				GST \$199.25
				(5% of \$3,985.03)
				Total \$4,184.28
				Payments & Credits \$4,184.28
				Balance Due \$0.00
View Fine Print				Capture Signature

Payment Information

Date Created	Date Applied	Payment #	Method	Reference #	Disbursement ID	Amount
11/25/2024	11/26/2024	100665934 (/office/customer/viewCustomerPayment.html?customerPaymentId=100665934)	EFT	November 25, 2024	(/office/configuration/viewBankDeposit.html?depositId=)	\$4,184.28

Invoice Information

Service Order EV-11986
(/office/workorder/viewRepairOrder.html?
repairOrderId=16266042)

PO #:

Save

Promise to pay:

Save

Customer:
EVANS TRUCKING
(/office/customer/viewCustomer.html?
customerId=759832)
NETTIE FRIESEN
accounts.payable@evanstrucking.ca
1104 12ave, Coaldale, AB T1M 0G3,
CA

Shop:
Evans HD Ltd (EV)
accounts@evanshd.ca
1104 12 Ave, Coaldale, AB T1M 0G3,
CA

Created:
Jordan Slomp
9:14AM 10/24/2024

Email/Text Log: The following contacts were sent the
invoice: NETTIE FRIESEN
(accounts.payable@evanstrucking.ca),
Pero (pero@evanstrucking.ca), Cory
Paddock (cory@evanstrucking.ca)
Sent by: Jordan Slomp at 9:14AM
10/24/2024

Unit Information

VIN: 3AKJGLDR5HSJB2709
Year: 2017
Make: FREIGHTLINER
Model: CASCADIA 125
Unit 04
Unit: (/office/customer/viewCustomerUnit.html?
customerUnitId=1767132)
Current Usage: 1,417,540 Kilometers

Invoice Information

Other Costs \$ 0.00
Parts \$ 141.19
Labor 21.45 \$
hours 3,432.00
Shop Supplies \$ 411.84
Subtotal \$
3,985.03
Tax \$ 199.25
Total \$
4,184.28
Balance \$ 0.00

Invoice: EV-106851

View Message Log

Print

Re-Send Invoice

Delete

Exported



Evans HD Ltd

1104 12 Ave
Coaldale, AB T1M 0G3, CA
accounts@evanshd.ca
403-388-3616



Invoice:

EV-106851

Date:

6/30/2023

Bill To

EVANS TRUCKING
1104 12ave
Coaldale, AB T1M 0G3, CA
P: 403-345-3558

Remit Payment To

Evans HD Ltd.
1104 12 Ave
Coaldale, AB T1M 0G3, CA

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
EV-8570	Net 30	7/30/2023	NETTIE FRIESEN		Unruh, Carlos	04

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: REPAIR FOR COOLANT LEAK

Cause: Customer request

Labor	Correction: Chassis / Chassis / . -PRESSURE TESTED COOLING SYSTEM, FOUND TOP RAD TANK WAS SPLIT -REMOVED A/C CONDENSOR AND CHARGE AIR COOLER. REPLACED RAD AND REASSEMBLED -VAC FILLED SYSTEM AND PRESSURE TESTED AFTER.	5.90000	\$150.00	\$885.00
Parts	RADIATOR ASSEMBLY - 05-37145-000	1.00000	\$2,514.80	\$2,514.80
Parts	HOSE-COOLANT UPPER - 05-27657-001	1.00000	\$78.57	\$78.57
Parts	90 DEGREE COOLANT HOSE - 05-29973-008	1.00000	\$31.73	\$31.73
Parts	SHELL ROTELLA 50/50 COOLANT - SH550057739	4.00000	\$16.87	\$67.48
Subtotal				\$3,577.58

Complaint: REPLACE CLUTCH BRAKE

Cause: Customer request

(Inspection)

Labor	Correction: Chassis / Chassis / . -REPLACED 2 PIECE CLUTCH BRAKE.	1.98000	\$150.00	\$297.00
Parts	BABCOCK 2 PIECE CLUTCH BRAKE - BAC/SB200	1.00000	\$55.44	\$55.44
Subtotal				\$352.44

Complaint: REPAIR FOR OIL LEAKS

Cause: Customer request

(Inspection)

Labor	Correction: Chassis / Chassis / . -REPLACED PASS THROUGH SEALS ON # 2-3 AND 4 PASS THROUGH LINES. -NOTICED ENGINE IS POPPING BACK THROUGH AIR INTAKE, PERFORMED RELATIVE COMPRESSION TEST, CYLINDER #6 FAILS AT 0 PERCENT.	1.45000	\$150.00	\$217.50
Parts	INJECTOR SEAL - DDE/A4720780480	3.00000	\$12.44	\$37.32
Subtotal				\$254.82

Complaint: REPLACE CYLINDER HEAD

Cause: Customer request

(Inspection)

Labor	Correction: Chassis / Chassis / . -NOTICED ENGINE WAS RUNNING ROUGH, PERFORMED RELATIVE COMPRESSION TEST, FOUND #6 CYLINDER WAS AT 0 PERCENT. -DRAINED COOLANT, REMOVED INTAKE AND EXHAUST PLUMBING FROM CYLINDER HEAD, PULLED ALL FUEL LINES NEEDED TO REMOVE HEAD -PULLED ROCKER SHAFTS AND CAM BOX -PULLED CYLINDER HEAD, #6 INTAKE VALVES POUNDED IN -STRIPPED PARTS OFF OLD HEAD AND INSTALLED ON NEW CYLINDER HEAD AND PREPPED FOR INSTALL -CLEANED AND CHECKED DECK, INSTALLED NEW CYLINDER HEAD AND TORQUED TO SPEC -SET BACKLASH ON TIMING GEAR TO SPEC -INSTALLED CAM BOX AND ROCKER SHAFTS AND TORQUED TO SPEC.	20.00000	\$150.00	\$3,000.00
-------	--	----------	----------	------------

Item	Description	Quantity	Rate	Amount
	-PERFORMED TOP SET -INSTALLED ALL INTAKE AND COOLING PLUMBING -PLUGGED DEF COOLING PORTS AND CUT OFF COOLANT HOSES -TIED UP ENGINE HARNESS -PRIMED AND STARTED ENGINE, CLEANED UP WORK AREA. -SAVED CORE CYLINDER HEAD IN ORIGINAL BOX.			
Parts	HEAD GASKET - DDE/A4720162120	1.00000	\$1,053.09	\$1,053.09
Parts	CYLINDER HEAD - DDE/RA4730102620	1.00000	\$5,975.44	\$5,975.44
Parts	Dirty Core for CYLINDER HEAD - Dirty Core for DDE/RA4730102620	-1.00000	\$2,437.50	-\$2,437.50
Parts	Inherent Core for CYLINDER HEAD - Inherent Core for DDE/RA4730102620	1.00000	\$2,320.50	\$2,320.50
Parts	METAL SEAL RING - DDE/N000000001071	2.00000	\$3.55	\$7.10
Parts	SEAL - DDE/A4720980080	6.00000	\$12.50	\$75.00
Parts	COOLANT MANIFOLD GASKET - DDE/A4722030880	1.00000	\$44.70	\$44.70
Parts	COOLANT MANIFOLD GASKET - DDE/A4722030980	1.00000	\$34.11	\$34.11
Parts	METAL SEAL - DDE/A4710960380	1.00000	\$108.66	\$108.66
Parts	HEX HEAD BOLT - DDE/A0219901101	4.00000	\$15.14	\$60.57
Parts	O-RING - CAM IDLER GEAR - DDE/A0309979045	1.00000	\$8.74	\$8.74
Parts	SEAL RING - DDE/N000000001069	4.00000	\$0.97	\$3.89
Parts	SEAL RING - DDE/N000000001070	1.00000	\$1.13	\$1.13
Parts	METRIC HEX PLUG - 8030M-16X1.5	1.00000	\$8.06	\$8.06
			Subtotal	\$10,263.49

Complaint: REPLACE LH REAR PANEL

Cause: Customer request

(Inspection)

Labor	Correction: Chassis / Chassis / . -REPLACED LH REAR SIDE SKIRT PANEL -GREASED UNIT, CHECKED LIGHTS CHECKED TRANS AND DIFF FLUID LEVELS, CHECKED TIRE PRESSURES.	1.00000	\$150.00	\$150.00
			Subtotal	\$150.00

Unit: 04 VIN: 3AKJGLDR5HSJB2709
License Plate: 35391P
2017 FREIGHTLINER CASCADIA 125
Chassis: 1,054,772 Kilometers

Labor	\$4,549.50
Parts	\$10,048.83
Shop Supplies	\$729.92
Pre-Charge Subtotal	\$15,328.25
GST (5% of \$15,328.25)	\$766.41
Total	\$16,094.66
Payments & Credits	\$16,094.66
Balance Due	\$0.00

View Fine Print

Capture Signature

Payment Information

Date Created	Date Applied	Payment #	Reference Method #	Disbursement ID	Amount
7/24/2023	7/25/2023	4640460 (/office/customer/viewCustomerPayment.html?customerPaymentId=4640460)	EFT	230724-02 (/office/configuration/viewBankDeposit.html?depositId=)	\$16,094.66

Invoice Information

Service Order EV-8570 (/office/workorder/viewRepairOrder.html?repairOrderId=10673618)		Unit Information VIN: 3AKJGLDR5HSJB2709 Year: 2017 Make: FREIGHTLINER		Invoice Information Other Costs \$ 0.00 Parts \$ 10,048.83	
PO #:					

Invoice: EV-104246

View Message Log

Print

Re-Send Invoice

Delete

Exported

Evans HD Ltd

1104 12 Ave
Coaldale, AB T1M 0G3, CA
accounts@evanshd.ca
403-388-3616



Invoice: EV-104246
Date: 10/21/2022

Bill To

EVANS TRUCKING
1104 12ave
Coaldale, AB T1M 0G3, CA
P: 403-345-3558

Remit Payment To

Evans HD Ltd.
1104 12 Ave
Coaldale, AB T1M 0G3, CA

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
EV-4496	Net 30	11/20/2022	NETTIE FRIESEN		Unruh, Carlos	04

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: REPLACE TRANSMISSION

Cause: Customer request

Labor	Correction: Transmission / Clutch / . -REMOVE EXHAUST -PULL AND HANG DRIVELINE -REMOVE SHIFT TOWER AND AIRLINES/SENSORS -UNBOLT CLUTCH FLYWHEEL -JACK UP TRANNY AND REMOVE BELL HOUSING BOLTS - DROP TRANNY REMOVE FLYWHEEL AND REMOVE CRANK SEAL -PREP SURFACE AND INSTAL NEW CRANK SEAL -INSTALL MACHINED FLYWHEEL -SWAP BELLHOUSING TO NEW TRANSMISSION -INSTALL NEW CLUTCH FORK DUE TO WEAR ON OLD ONE -INSTAL NEW CLUTCH BRAKE -INSTAL NEW CLUTCH ON INPUT SHAFT -INSTAL NEW TRANNY, BOLT HOUSING TOGETHER WITH LOCTITE -BOLT CLUTCH TO FLYWHEEL WITH LOCTITE -INSTAL SHIFT TOWER/ AIRLINES AND SENSORS -INSTAL EXHAUST PIPE WITH NEW GASKET AND MOUNTING BRACKET -LOWER TRUCK AND FILL WITH 13LITRES OF 40W OIL -CLEANUP WORK AREA AND TOOLS	16.50000	\$135.00	\$2,227.50
Parts	18 SPEED TRANSMISSION - RCRTLO18918BP	1.00000	\$4,542.50	\$4,542.50
Parts	Dirty Core for 18 SPEED TRANSMISSION - Dirty Core for RCRTLO18918BP	-1.00000	\$5,200.00	-\$5,200.00
Parts	Inherent Core for 18 SPEED TRANSMISSION - Inherent Core for RCRTLO18918BP	1.00000	\$5,200.00	\$5,200.00
Parts	CLUTCH ASSY - SOLO 1850 - SP/309701-20	1.00000	\$1,630.275	\$1,630.28
Parts	BABCOCK 2 PIECE CLUTCH BRAKE - BAC/SB200	1.00000	\$58.208	\$58.21
Parts	CLUTCH FORK - FULA7786	1.00000	\$329.1875	\$329.19
Parts	FLYWHEEL RESURFACE - FLYWHEELRESURFACE-1	1.00000	\$127.60	\$127.60
Parts	PILOT BEARING - EBG-8639HP	1.00000	\$19.40	\$19.40
Parts	5" SADDLE CLAMP - SAD5	1.00000	\$11.55	\$11.55
Subtotal				\$8,946.23

Complaint: REPLACE REAR CRANK SEAL

Cause: Customer request

(Inspection)

Labor	Correction: Engine / Gaskets / . -REMOVE REAR CRANK SEAL - PREP SURFACE, CLEAN HOUSING -INSTAL NEW SEAL WITH DETROIT SEAL INSTALLER -INSTAL FLYWHEEL.	1.10000	\$135.00	\$148.50
Parts	DD15 REAR CRANK SEAL - 636026	1.00000	\$49.56	\$49.56
Subtotal				\$198.06

Complaint: REPLACE STEER TIRES

Cause: Customer request

Item	Description	Quantity	Rate	Amount
(Inspection)				
Labor	Correction: Chassis / Chassis / . -FIND BAD INSIDE EDGES ON BOTH STEER TIRES -REMOVE BOTH WHEELS, REMOVE TIRES -BUFF OFF ANY CORROSION AND REPLACED VALVE STEMS -REINSTAL TIRES WITH 10 OZ BALANCING BEADS AND INFLATE TO 105 PSI -REINSTAL ON TRUCK AND TORQUE TO 500FT/LBS	1.68000	\$135.00	\$226.80
Parts	275/80R22.5 MICHELIN STEER TIRE - 66205	2.00000	\$909.282	\$1,818.56
			Subtotal	\$2,045.36

Unit: 04 VIN: 3AKJGLDR5HSJB2709
 License Plate: 35391P
 2017 FREIGHTLINER CASCADIA 125
 Chassis: 895,234 Kilometers

Labor \$2,602.80
 Parts \$8,586.85
 Shop Supplies \$500.00
 Pre-Charge Subtotal \$11,689.65
 GST (5.0000% of \$11,689.65) \$584.48
 Total \$12,274.13
 Payments & Credits \$12,274.13
 Balance Due \$0.00

View Fine Print

Capture Signature

Payment Information

Date Created	Date Applied	Payment #	Reference Method #	Disbursement ID	Amount
11/25/2022	11/28/2022	3604053 (/office/customer/viewCustomerPayment.html?customerPaymentId=3604053)	Cheque 6365	(/office/configuration/viewBankDeposit.html?depositId=)	\$12,274.13

Invoice Information

Service Order EV-4496 (/office/workorder/viewRepairOrder.html?repairOrderId=8236143)		Unit Information		Invoice Information	
		VIN:	3AKJGLDR5HSJB2709	Other Costs	\$ 0.00
		Year:	2017	Parts	\$8,586.85
		Make:	FREIGHTLINER	Labor	19.28 hours \$2,602.80
		Model:	CASCADIA 125	Shop Supplies	\$ 500.00
			Unit 04	Subtotal	\$ 11,689.65
		Unit:	(/office/customer/viewCustomerUnit.html?customerUnitId=1767132)	Tax	\$ 584.48
		Current Usage:	1,417,540 Kilometers	Total	\$ 12,274.13
				Balance	\$ 0.00
PO #:	Save				
Promise to pay:	Save				
Customer:	EVANS TRUCKING (/office/customer/viewCustomer.html?customerId=759832) NETTIE FRIESEN nettie@evanstrucking.ca 1104 12ave, Coaldale, AB T1M 0G3, CA				
Shop:	Evans HD Ltd (EV) accounts@evanshd.ca 1104 12 Ave, Coaldale, AB T1M 0G3, CA				
Created:	Terry Molenaar 8:24AM 10/21/2022				

Email/Text Log: The following contacts were sent the
invoice: NETTIE FRIESEN
nettie@evanstrucking.ca, Pero
pero@evanstrucking.ca, DERECK
BRAUN
dereckbraun@evanstrucking.ca
Sent by: Terry Molenaar at 8:24AM
10/21/2022

Invoice: EV-101978

View Message Log

Print ▾

Re-Send Invoice

Delete

☒ Exported

Evans HD Ltd

1104 12 Ave
Coaldale, AB T1M 0G3, CA
terry@evanshd.ca
403-388-3616



Invoice: EV-101978

Date: 2/25/2022

Bill To

EVANS TRUCKING
1104 12ave
Coaldale, AB T1M 0G3, CA
P: 403-345-3558

Remit Payment To

Evans HD Ltd.
1104 12 Ave
Coaldale, AB T1M 0G3, CA

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
EV-3245	Net 30	3/27/2022	NETTIE FRIESEN		Unruh, Carlos	04

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: REPAIR FOR #3 LH TIRE LOW PRESSURE

Cause: Customer request

Labor	Correction: Rear Axle/Final Drives / Wheels/Tires / . - REMOVED WHEEL - AIRED UP TIRE AND SPRAYED DOWN - FOUND A SCREW IN THE TREADS - REMOVED TIRE FROM RIM - PLUGGED AND PATCHED TIRE - MOUNTED TIRE ON RIM - AIRED TO 105 PSI - MOUNTED WHEEL AND TORQUED TO 500 FT/LBS	1.08000	\$125.00	\$135.00
Subtotal				\$135.00

Complaint: PERFORM EMISSIONS UPDATE

Cause: Customer request

(Inspection)

Labor	Correction: Exhaust / DOC & DPF / . (JOHNNY) REMOVED RH STEPS AND FAIRING REMOVED DPF DOC AND SCR MATERIAL INSTALLED SCR PLATE AND DPF WITH NEW CLAMPS TUNED ECM FOR DELETE TOOK UNIT FOR ROAD TEST	5.45000	\$125.00	\$681.25
Parts	M6 X 1 SCREW - DDE/ N910143006001	6.00000	\$0.97304	\$5.84
Parts	SPRING NUT - DDE/A0049941645	6.00000	\$1.99721	\$11.98
Parts	CLAMP - DDE/A6809950202	1.00000	\$76.23813	\$76.24
Parts	DPF EXHAUST CLAMP / GASKET KIT - A0004902241	1.00000	\$166.34925	\$166.35
Parts	TUNING 61806 - 61806	1.00000	\$3,500.00	\$3,500.00
Subtotal				\$4,441.66

Unit: 04 VIN: 3AKJGLDR5HSJB2709
License Plate: 35391P
2017 FREIGHTLINER CASCADIA 125
Chassis: 850,785 Kilometers

Labor \$816.25

Parts \$3,760.41

Shop Supplies \$53.83

Pre Tax Total \$4,630.49

GST (5.0000% of \$4,630.49) \$231.52

Total \$4,862.01

Payments & Credits \$4,862.01

Balance Due \$0.00

View Fine Print

Capture Signature

Invoice: EV-8321



View Message Log

Print ▾

Re-Send Invoice

Delete

☒ Exported

Evans HD Ltd
1104 12 Ave
Coaldale, AB T1M 0G3, CA
terry@evanshd.ca
403-388-3616



Invoice: 8321

Date: 5/12/2020

Bill To
EVANS TRUCKING
1104 12ave
Coaldale, AB T1M 0G3, CA
P: 403-345-3558

Service Order	Terms	Due Date	Authorizer	Customer PO	Unit #
8321	Net 30	6/11/2020			04

Item	Description	Quantity	Rate	Amount
Complaint: CHECK AND REPAIR FOR BUNK HEATER NOT RESTARTING AFTER TEMP IS MEET				
Cause: Historical				
Labor	Correction: Chassis / Frame / - REMOVED WABASTO COVER AND CHECKED FOR LVD RELAY, ITS ALL READY BYPASSED \- PUT COVER BACK ON AND RAN UNIT \- RAN FOR 2 HOURS OF HEAT CYCLES AND HAD NO ISSUES \	0.20000	\$115.00	\$23.00
Parts	ISOLATOR - 03-35804-000	1.00000	\$27.23	\$27.23
Parts	FREIGHT CHARGE - 1	1.00000	\$20.00	\$20.00
Parts	MISC COPPER LUGS - 1	4.00000	\$2.84	\$11.36
Parts	DETROIT DD15 HEAD SET - 631375	1.00000	\$517.32	\$517.32
Parts	TUBE ASSY - A04-32185-472	1.00000	\$117.62	\$117.62
Parts	TUBE ASSY - A04-32186-461	1.00000	\$129.98	\$129.98
Parts	RADIATOR CAP - BHT/W3678002	1.00000	\$35.56	\$35.56
Parts	HOSE CLAMP - BRZ/9210H	3.00000	\$2.66	\$7.98
Parts	1/0 BATTERY CABLE - CABLE1/0	13.00000	\$6.12	\$79.56
Parts	O-RING - DDE/A0299975945	1.00000	\$21.63	\$21.63
Parts	FILTER INSERT KIT - DDE/A4700903151	1.00000	\$98.60	\$98.60
Parts	FILTER INSERT KIT - DDE/A4700903151	1.00000	\$98.60	\$98.60
Parts	METAL SEAL - DDE/A4710960380	1.00000	\$73.63	\$73.63
Parts	COOLANT LINE - DDE/A4722001151	1.00000	\$39.80	\$39.80
Parts	SC5HO-RING - DDE/A4729970245	1.00000	\$12.39	\$12.39
Parts	OIL FILTER KIT - DDE/A4731800409	1.00000	\$45.63	\$45.63
Parts	OIL FILTER KIT - DDE/A4731800409	1.00000	\$45.63	\$45.63
Parts	AIR FILTER - OLD CASCADIA - P610260	1.00000	\$142.95	\$142.95
Parts	SHELL 5-40 BULK OIL - SH500010133	40.00000	\$8.10	\$324.00
Parts	SHELL T6 / 5/ 40 BULK OIL - SH500010133	40.00000	\$7.53	\$301.20
Parts	SRS 2000 - EXTREME 2 BULK - SH550029600	1.00000	\$8.26	\$8.26
Parts	SHELL SRS GREASE 2000 EXTREME - SH550032579	1.00000	\$8.26	\$8.26
Subtotal				\$2,190.19

Complaint: CHECK AND REPAIR FOR PRESSURIZING THE COOLING SYSTEM**Cause:** Historical

Labor	Correction: Chassis / Frame / - RAN UNIT UP TO TEMP AND PULLED A LOADED TRAILER \- COOLING SYSTEM PRESSURES UP AND AIR BUBBLES ARE PRESENT \- REMOVED BUMPER AND SIDE STEP \- DRAINED COOLANT, REMOVED COOLANT HOSES TO HEAD \- REMOVED AIR CLEANER AND INTAKE PIPING \- REMOVED HIGH PSI FUEL LINES \- REMOVED TURBO MOUNTING BOLTS \- REMOVED ENGINE WIRING HARNESS AND INJECTOR HARNESS \- REMOVED VALVE COVER AND CAM FRAME \- REMOVED HEAD BOLTS AND PULLED HEAD \- HEAD GASKET HAD NO OBVIOUS SIGNS OF FAILURE, MOST OF THE COOLANT GROMMETS ARE HARD AND BRITTLE, ONE OF THE GROMMETS ON #3 WAS SPLIT, \- #6 PISTON DOME HAD A MORE DEFINED INJECTOR SPRAY PATTERN AND LOOKED MORE WHITE \- CLEANED BLOCK DECK \- MEASURED LINER PROTRUSION, AVG .008", WITHIN SPEC (.0055" - .0106") \- CLEANED HEAD \- INSPECTED HEAD FOR CRACKS AND FOUND NO SIGNS \- MEASURED HEAD BOLTS FOR RE-USE, NONE ARE STRETCHED \- CLEANED ALL OTHER GASKET SURFACES \- INSTALLED CYLINDER HEAD WITH NEW GASKET AND RE-USED HEAD BOLTS \- TIMED CAMS AND INSTALLED CAM FRAME \- SET VALVE LASH, INTAKE: .016, EXHAUST: .024, JAKES: 4.6MM \- INSTALLED INJECTOR HARNESS \- INSTALLED HIGH PRESSURE FUEL LINES WITH NEW GROMMETS \- INSTALLED VALVE COVER \- INSTALLED ALL COOLANT HOSES AND LINES \- HAD TO REPLACE COOLANT LINES GOING TO DEF TANKS, HOSE BROKE ON REMOVAL \- INSTALLED WRING HARNESS AND TIED UP WIRING \- INSTALLED TURBO WITH A NEW GASKET \- INSTALLED INTAKE PIPING AND AIR CLEANER \- VACUUM FILLED COOLING SYSTEM \- RAN UNIT UP TO TEMP AND PULLED A LOADED TRAILER TO VERIFY COOLING SYSTEM IS NOT PRESSURIZING \- BLAIN 28 HOURS	26.00000	\$115.00	\$2,990.00
-------	--	----------	----------	------------

Item	Description	Quantity	Rate	Amount
				Subtotal \$2,990.00
Complaint: CHECK AND REPAIR FOR REFRIGERATOR SHUTTING DOWN WITH KEY ON ACC				
Cause: Historical				
Labor	Correction:	0.20000	\$115.00	\$23.00
Chassis / Frame / - RAN FRIDGE WITH ACC ON FOR 2 HOURS, COULD NOT GET IT TO TURN OFF \ - CHECKED LVD PARAMETERS, AT 12.5 VOLTS, SET LVD TO 11.5 VOLTS \ - REPLACED FRIDGE LIGHT				
				Subtotal \$23.00
Complaint: DETROIT COMPLETE SERVICE DD-15 EVOLUTION (2 FILTER SYSTEM)				
Cause: Historical				
Labor	Correction:	1.60000	\$115.00	\$184.00
Chassis / Frame / - DRAINED OIL, CHANGED FUEL AND OIL FILTERS, FILLED UNIT WITH 5W40 OIL, \ - GREASED UNIT, \ - RAN UNIT AND CHECKED FOR LEAKS.				
				Subtotal \$184.00
Complaint: GREASE COMPLETE UNIT				
Cause: Historical				
Labor	Correction:	0.30000	\$115.00	\$34.50
Chassis / Frame / - GREASED UNIT AND 5TH WHEEL				
				Subtotal \$34.50
Complaint: RELOCATE INVERTER TO BEHIND PASSENGER SEAT				
Cause: Historical				
Labor	Correction:	4.00000	\$115.00	\$460.00
Chassis / Frame / - REMOVED INVERTER AND OLD WIRING \ - MOUNTED INVERTER BEHIND PASSENGER SEAT \ - MADE NEW BATTERY CABLE FOR INVERTER \ - CUT HOLE IN FLOOR AND PUT A GROMMET TO PROTECT CABLES \ - TIED CABLES UP \ \ BLAIN 4 HOURS				
				Subtotal \$460.00
Complaint: REPAIR FOR ENGINE FAN NOT COMING ON				
Cause: Historical				
Labor	Correction:	0.50000	\$115.00	\$57.50
Chassis / Frame / - RAN TRUCK AND MONITORED WHAT TEMP FAN COMES ON, APPROX 215 F,				
				Subtotal \$57.50
Unit: 04 VIN: 3AKJGLDR5HSJB2709				Labor \$3,772.00
2017 FREIGHTLINER CASCADIA 125				Parts \$2,167.19
Chassis: 798,598 Kilometers				Shop Supplies \$207.87
				Pre Tax Total \$6,147.06
				Old 5.00% (5.0000% of \$6,147.06) \$307.35
				Total \$6,454.41
				Payments & Credits \$6,454.41
				Balance Due \$0.00

View Fine Print

Capture Signature

Payment Information

No Payments have been applied to this Invoice.

Invoice Information

Service Order EV-8321
 (/office/workorder/viewRepairOrder.html?
 repairOrderId=3758288)

PO #:

Save

Promise to pay:

Unit Information

VIN: 3AKJGLDR5HSJB2709

Year: 2017

Make: FREIGHTLINER

Model: CASCADIA 125

Unit: Unit 04
 (/office/customer/viewCustomerUnit.html?)

Invoice Information

Other Costs \$ 0.00

Parts \$ 2,167.19

Labor 32.80 \$ hours 3,772.00

Shop Supplies \$ 207.87

customerUnitId=1767132)

Current Usage: 1,417,540 Kilometers

Customer: EVANS TRUCKING
(/office/customer/viewCustomer.html?
customerId=759832)
NETTIE FRIESEN
nettief@evanstrucking.ca
1104 12ave, Coaldale, AB T1M 0G3,
CA

Shop: Evans HD Ltd (EV)
terry@evanshd.ca
1104 12 Ave, Coaldale, AB T1M 0G3,
CA

Created: Blain Countryman
12:00PM 5/12/2020

Email/Text Log: No log entries

Subtotal	\$ 6,147.06
Tax	\$ 307.35
Total	\$ 6,454.41
Balance	\$ 0.00



Disclaimer

The information contained in this folder has been provided by the consignor and had not been certified by Ritchie Bros. Auctioneers

Ritchie Bros. Auctioneers in no way certifies the completeness or accuracy of this information

Please inspect the equipment. It is "sold as is" no warranties made or implied

Brennan LeBlanc
Divisional Operations Manager
Western Canada Agriculture