

Cummins South Pacific Pty. Ltd.

ABN NO. 42006332949

WORKSHOP TAX INVOICE

Laverton
191-195 Boundary Road
Laverton North Vic 3026
Ph: 03 8368 0800
Fax: 03 9360 0438

COPY

INVOICE NUMBER

INVOICE DATE

21/07/20

PAGE

1

Engine Model:	SIGNATURE/ISX/QSX	Eng No:	79895994	Equip Make:	KENWORTH
FleetNo:	78	Reg No:	XQ08CB	Cust Ord NO:	XQ08CB
Date in Service:	25/04/16	KLMS:		HRS:	
Repair Date:	21/07/20	Chassis NO:	456375	Currency:	AUD
C.O.No.	6458705	Work ordNo.		Facility	322

Complaint:

C clip came off turbo wastegate

Cause:

Found waste gate actuator rod had fallen off, no clip on lever, lever bent

Correction:

- Visually inspected turbo.
- Found waste gate actuator rod had fallen off, no clip on lever, lever bent.
- Nox sensor internal malfunction
- Carried out turbo waste-gate campaign C2261.
- Removed turbo, set up new and then fitted
- Waste-gate travel 0.054" at 31psi.
- Ran, washed and road tested to verify repairs.

Additional parts (Nox sensor) \$986.85

Description	Operation	Unit price	Qty	Extension
Material				
2894943RX	SENSOR, NITROGEN OXIDE (E	986.85	1	986.85
MATERIAL TOTAL				986.85
SUB-TOTAL				986.85
G.S.T				98.69
INVOICE TOTAL				1085.54

All goods and services provided in line with Cummins Terms and Conditions of Sale

Payment Terms 30 Days from End of Month