



Repairs (13851)

Created By: Sandra Bit

Edmonton Trailer Repair Ltd.

28520-114 Avenue Acheson, AB, T7X 6E6 877-962-8195

877-962-8195

TC Registration:

25-0536 (Expires: 2025-12-01)

Client

Fluidpro Oilfield services 9701 - 99 Street Clairmont, AB, T8X 5A8 Ph. No. - 780-533-3338

Tank

Facility

Ser. No. TC Spec. Cert. date Tank mfr. MDIN **Design Pressure**

Mfd. head thick Mfd. shell thick **Exposed Surface** Lining Max. Lading Density **Head Material** Max. Payload Max. Unload Rate

13851 TC 407 2014-07-06 TREMCAR 13118 310.10 kPa 9.525 mm 6.350 mm 60 m2 na 1.2 kg/L 5454-0 29212 kg 1893 L/m at 172 kPa

Date of mfr. VIN Assembler MAWP Test P. Min. head thick Min. shell thick Cap. Shell Material Weld Material Max. Load Rate Original Test Date

Unit Number

14724B 2014-07-06 1T9BL3223FS588015 TREMCAR INC 172 kPa 310.10 kPa 7.163 mm 5.969 mm 28370 litres Design Temp. Range -40 C to 93 C 5454-H32 5356 1893 L/m at 172 kPa 2014-07-06

56238

Repair

Repair Date Weld Material Shell 2025-07-18 5454-H32

Weld Material Head **Description of Repair**

5454-0 WELD REPAIR INSIDE BAFFLES WELD REPAIR UNDER 5TH

WHEEL PLATE

Items Replaced

Manlid Rated Pressure: 53psi Valves Burst Pressure: 100psi PRV Set to Discharge: 30psi PRV Rate of Flow: 379269scfh **Weld Procedure Used**

Approval

Compliance Officer Signed by Tom Hitcherick

Authorized Welder Signed by Waylon Kieth



External Visual Inspections (13851)

Created By: Sandra Bit

TC Registration:

25-0536 (Expires: 2025-12-01)

Facility

Edmonton Trailer Repair Ltd. 28520-114 Avenue Acheson, AB, T7X 6E6 877-962-8195

Client

Fluidpro Oilfield services 9701 - 99 Street Clairmont, AB, T8X 5A8 Ph. No. - 780-533-3338

Tank

Ser. No. 13851 TC 407 TC Spec. 2014-07-06 Cert. date TREMCAR Tank mfr. MDIN 13118 Design Pressure 310.10 kPa Mfd. head thick 9.525 mm Mfd. shell thick 6 350 mm **Exposed Surface** 60 m2 Lining na 1.2 kg/L Max. Lading Density **Head Material** 5454-0 Max. Payload 29212 kg Max. Unload Rate

1893 L/m at 172 kPa

Unit Number 14724B 2014-07-06 Date of mfr. VIN 1T9BL3223FS588015

Assembler TREMCAR INC MAWP 172 kPa Test P. 310.10 kPa Min. head thick 7.163 mm Min. shell thick 5 969 mm

Cap. 28370 litres Design Temp. Range -40 C to 93 C Shell Material 5454-H32 Weld Material 5356

Max. Load Rate 1893 L/m at 172 kPa

Original Test Date 2014-07-06

External Visual Inspection

Inspection Date Manway Pressure

2025-07-18 53 psi

Inspection Expiry Date

2026-07-18

Inspection

Inspect jacketing for dents, digs, scrapes, gouges, perforations, stains, or other defects or signs of damage to the inner vessel or any other condition that might make it unsafe as per 7.2.1(a)

Inspect the entire area of head and shell for dents, gouges, bulges, corrosion, abrasion, cracks, or signs of leakage or other conditions that might render it unsafe for transport as per 7.2.1(a) Not Applicable

Inspect the entire length of every weld for cracks, defects or signs of leakage as per 7.2.1(a)

Ensure devices for tightening manhole covers are operative and covers are leak tight as per 7.2.1(b)

Check all valves, vents, emergency devices and remote closures for corrosion, distortion, cracks, signs of weakness and loose or missing fasteners as per 7.2.1(c) Retest

Ensure all required markings are legible including manway, PRV, couplings, valves and specification plate as per 7.2.1(e)

Inspect supporting structures, pads, bolsters, tie-downs and protective devices for dents, distortion, cracks, signs of weakness and loose or missing fasteners as per 7.2.1(f)

Ensure accompanying or mounted hoses comply with inspection and marking requirements as per 7.2.10.4 and 7.2.10.6

Check to ensure voids are unplugged and show no signs of leakage as per 7.2.1.2 Not Applicable





Corroded or abraded areas are thickness tested as per 7.2.1.3

Pass

All pressure relief devices are inspected for corrosion or damage as per 7.2.1.4
Retest

If lading is corrosive to PRV: re-closing pressure relief valves are replaced or tested as per 7.2.1.4(b) Not Applicable

Gaskets on full opening rear head is inspected and replaced if cut, cracked or split as per 7.2.1.5

Internal self closing valve and off truck emergency shut down system tested as per 7.2.1.6 Not Applicable

Ensure that all bolts or nuts on any flanged connection or blank flange are in place and properly tightened Pass

Defects

Welds-Structure

WELD UP CRACKS UNDER PLATE

Valves-PRV-Manways

PRV CLEANED VALVE IN SUMP REPLACED

PRV List

#	Type of PRV	Manufacturer	PRV Criteria	Discharge Pressure	Opening Pressure	Reseating Pressure	Disposition
1	3" resealing	fort valve		30	30PSI	29PSI	Reinstalled

Tank Disposition

Current Disposition

Tank Repaired / Re-Tested / Returned to Service

Approval

Inspector

Signed by Tom Hitcherick

Service provided by eStandard Solutions

Leakage Tests (13851)

Created By: Sandra Bit

Tel: TC Registration:

877-962-8195 25-0536 (Expires: 2025-12-01)

Facility

Edmonton Trailer Repair Ltd. 28520-114 Avenue Acheson, AB, T7X 6E6 877-962-8195

Client

Fluidpro Oilfield services 9701 - 99 Street Clairmont, AB, T8X 5A8 Ph. No. - 780-533-3338

Tank

Ser. No.	13851	Unit Number	14724B
TC Spec.	TC 407	Date of mfr.	2014-07-06
Cert. date	2014-07-06	VIN	1T9BL3223FS588015
Tank mfr.	TREMCAR	Assembler	TREMCAR INC
MDIN	13118	MAWP	172 kPa
Design Pressure	310.10 kPa	Test P.	310.10 kPa
Mfd. head thick	9.525 mm	Min. head thick	7.163 mm
Mfd. shell thick	6.350 mm	Min. shell thick	5.969 mm
Exposed Surface	60 m2	Cap.	28370 litres
Lining	na	Design Temp. Range	-40 C to 93 C
Max. Lading Density	1.2 kg/L	Shell Material	5454-H32
Head Material	5454-0	Weld Material	5356
Max. Payload	29212 kg	Max. Load Rate	1893 L/m at 172 kPa
Max. Unload Rate	1893 L/m at 172 kPa	Original Test Date	2014-07-06

Leakage Test

Inspection Date	2025-07-18	Inspection Expiry Date	2026-07-18
Test Medium	Water	No. of Compartments	1

Compartment #	Start (psi)	End (psi)	Hold Time (min)	Capacity
1	25	25	65	

Venting devices hold pressure as required, if removed they are bench tested and hold pressure as required Pass

Product piping and valves hold pressure without leakage

Manways and closures inspected for leaks or deformation Pass

Flanged connections checked for leakage

Pass

Inspect the entire area of the head, shell and welds for leaks or deformation including voids and adjacent compartments

Test pressure maintained for minimum of 5 minutes Pass

All leaks are repaired before the tank is marked Pass

Inspect head shell

Defects

No defects found.



Tank Disposition

Current Disposition

Passed / No Defects Found

Approval

Inspector Signed by Tom Hitcherick

Service provided by eStandardSolutions

Internal Visual Inspections (13851)

Created By: Sandra Bit

877-962-8195

TC Registration:

25-0536 (Expires: 2025-12-01)

Facility

Edmonton Trailer Repair Ltd. 28520-114 Avenue Acheson, AB, T7X 6E6 877-962-8195

Client

Fluidpro Oilfield services 9701 - 99 Street Clairmont, AB, T8X 5A8 Ph. No. - 780-533-3338

Tank

Ser. No. 13851 TC Spec. TC 407 Cert. date 2014-07-06 Tank mfr. TREMCAR MDIN 13118 Design Pressure 310.10 kPa Mfd. head thick 9.525 mm Mfd. shell thick 6.350 mm **Exposed Surface** 60 m2 Lining na Max. Lading Density 1.2 kg/L **Head Material** 5454-0 Max. Payload 29212 kg Max. Unload Rate

Unit Number 14724B Date of mfr. 2014-07-06 VIN 1T9BL3223FS588015 Assembler TREMCAR INC MAWP 172 kPa Test P. 310.10 kPa Min. head thick 7.163 mm Min. shell thick 5.969 mm 28370 litres Cap. Design Temp. Range -40 C to 93 C Shell Material 5454-H32 Weld Material 5356 Max. Load Rate

1893 L/m at 172 kPa Original Test Date 1893 L/m at 172 kPa 2014-07-06

Internal Visual Inspection

Inspection Date Inspection

2025-07-18

Inspection Expiry Date

2026-07-18

Lining test completed if lined as per 7.2.2.1(c)

Not Applicable

Enter the tank and inspect for: dents, gouges, cracks, corrosion, abrasions or signs of leakage in the shell or heads including bulkheads as per 7.2.2.1(a)

Retest

Inspect piping, valves and gaskets for damage as per 7.2.2.1(a)

Inspect every weld for cracks, defects or signs of leakage as per 7.2.2.1(b)

Corroded areas are thickness tested if found as per 7.2.2.1(d)

Pass

Defects Welds-Structure REPAIR CRACKS **BOTTOM MOUSE HOLES**

Tank Disposition

Current Disposition

Tank Repaired / Re-Tested / Returned to Service

Approval

 χ

Inspector Signed by Tom Hitcherick

Service provided by eStandardSolutions

Pressure Tests (13851)

Created By: Sandra Bit

Tel:

877-962-8195

TC Registration:

25-0536 (Expires: 2025-12-01)

Facility

Edmonton Trailer Repair Ltd. 28520-114 Avenue Acheson, AB, T7X 6E6 877-962-8195

Client

Fluidpro Oilfield services 9701 – 99 Street Clairmont, AB, T8X 5A8 Ph. No. - 780-533-3338

Tank

Ser. No. 13851 TC Spec. TC 407 Cert. date 2014-07-06 Tank mfr. TREMCAR MDIN 13118 **Design Pressure** 310.10 kPa Mfd. head thick 9.525 mm Mfd. shell thick 6.350 mm **Exposed Surface** 60 m2 Lining Max. Lading Density 1.2 kg/L **Head Material** 5454-0 Max. Payload 29212 kg Max. Unload Rate 1893 L/m at 172 kPa

Unit Number 14724B Date of mfr. 2014-07-06 VIN 1T9BL3223FS588015 Assembler TREMCAR INC MAWP 172 kPa Test P. 310.10 kPa Min. head thick 7.163 mm Min. shell thick 5.969 mm Cap. 28370 litres Design Temp. Range -40 C to 93 C Shell Material 5454-H32 Weld Material 5356 Max. Load Rate 1893 L/m at 172 kPa

Original Test Date 2014-07-06

Pressure Test

Inspection Date	2025-07-18	
Inspection Expiry Date	2030-07-18	
Test Medium	Water	
No. of Compartments	1	
Compartment 1	Start (psi) End (psi) Hold Time 40 40 65	

Test Results

When venting devices are removed, they are bench tested and meet the requirements for the tank

 $\textbf{Product piping with all valves and accessories in place and operative must be pressure tested at not less than 80\% \ \textbf{MAWP} \\ \textbf{Pass}$

When removed from the pressure supply, the test pressure is retained for the specified time for the pneumatic or hydrostatic test

Pas

Inspect the entire area of the head, shell and welds for leaks or deformation. If defects found note the location on the report

Pass

Defects

No defects found.

Tank Disposition

Current Disposition

Passed / No Defects Found

Approval

Inspector Signed by Tom Hitcherick

Service provided by eStandard Solutions

Thickness Tests (13851)

Created By: Sandra Bit

877-962-8195

TC Registration: 25-0536 (Expires: 2025-12-01)

Facility

Edmonton Trailer Repair Ltd. 28520-114 Avenue Acheson, AB, T7X 6E6 877-962-8195

Client

Fluidpro Oilfield services 9701 – 99 Street Clairmont, AB, T8X 5A8 Ph. No. - 780-533-3338

Tank

Ser. No. 13851 TC Spec. TC 407 Cert. date 2014-07-06 Tank mfr. TREMCAR MDIN 13118 **Design Pressure** 310.10 kPa Mfd. head thick 9.525 mm Mfd. shell thick 6.350 mm **Exposed Surface** 60 m2 Lining na Max. Lading Density 1.2 kg/L **Head Material** 5454-0 Max. Payload 29212 kg Max. Unload Rate 1893 L/m at 172 kPa

Unit Number 14724B Date of mfr. 2014-07-06 VIN 1T9BL3223FS588015 Assembler TREMCAR INC MAWP 172 kPa Test P. 310.10 kPa Min. head thick 7.163 mm Min. shell thick 5.969 mm Cap. 28370 litres Design Temp. Range -40 C to 93 C Shell Material 5454-H32 **Weld Material** 5356 Max. Load Rate 1893 L/m at 172 kPa Original Test Date 2014-07-06

External Visual Inspection

Inspection Date

2025-07-18

Inspection

Visibly corroded or abraded areas are thickness tested

Area around lading retaining piping

Pass

High stress areas of the shell, such as the bottom of the tank

Areas around openings, weld joints, shell reinforcements, appurtenance attachment points

Near the upper coupler, suspension attachments and connecting structures

Known thin areas in the tank

Structures adjoining self supporting transport units

Pass

Lowest Measurement

Head: 9.11 mm Shell: 6.11 mm

Defects

No defects found.

Tank Disposition

Current Disposition

Passed / No Defects Found

Approval

A A

Inspector Signed by Tom Hitcherick

Service provided by eStandard Solutions



Upper Coupler Inspections (13851)

Created By: Sandra Bit

877-962-8195

TC Registration: 25-0536 (Expires: 2025-12-01)

Facility

Edmonton Trailer Repair Ltd. 28520-114 Avenue Acheson, AB, T7X 6E6 877-962-8195

Client

Fluidpro Oilfield services 9701 - 99 Street Clairmont, AB, T8X 5A8 Ph. No. - 780-533-3338

Tank

Ser. No. 13851 TC Spec. TC 407 Cert. date 2014-07-06 Tank mfr. TREMCAR MDIN 13118 Design Pressure 310.10 kPa Mfd. head thick 9.525 mm Mfd. shell thick 6.350 mm **Exposed Surface** 60 m2 na Max. Lading Density 1.2 kg/L Head Material 5454-0 Max. Payload 29212 kg

Max. Unload Rate 1893 L/m at 172 kPa

Unit Number Date of mfr. VIN **Assembler** MAWP Test P. Min. head thick

Min. shell thick Cap. Design Temp. Range **Shell Material** Weld Material Max. Load Rate Original Test Date

14724B 2014-07-06 1T9BL3223FS588015 TREMCAR INC 172 kPa 310.10 kPa 7.163 mm 5.969 mm 28370 litres -40 C to 93 C 5454-H32

5356 1893 L/m at 172 kPa 2014-07-06

Upper Coupler Inspection

Inspection Date

2025-07-18

Inspection Expiry Date

2030-07-18

Inspection Corroded or abraded areas Cracks or defects in welds Dents or distortions Pass **Defects** Welds-Structure WELD REPAIRED CRACKS

Tank Disposition

Current Disposition

 
Tank Repaired / Re-Tested / Returned to Service

Approval



Inspector Signed by Tom Hitcherick

Service provided by eStandard Solutions





28520 - 114 Avenue, Acheson, Alberta T7X 6E6 Phone 780.962.8195 | Toll Free 1.877.962.8195 www.edmontontrailer.com | Fax 780.962.8604 (Admin) 780.960.0679 (Parts&Service) | 780.962.8906 (Finance) INVOICE

GST # 89398 4799 RT0001

Promised 12/20/2023 5:00 PM

PO# 48266

Request

Tag SB23B

Cashiered

02/22/2024 4:54 PM

Printed

02/22/2024 4:54:25 PM

Job

Page 1 SO # 101113

CSR

1 SANDRA

Status

Original

Service Invoice CUSTOMER COPY

Customer No FLUIDPRO OILF1 Attn: CHAD MCFARLAND FLUIDPRO OILFIELD SERVICES LTD. 9701 - 99TH STREET CLAIRMONT, AB T8X 5A8 Home Bus (780) 533-3338 (587) 297-0812 Today Cell Email ap@fluidpro.ca

Description

Wash Bay Steaming

Adviso	or Sandra	Bit I	nvoice (Date: 02/22/2024	4:54 PM	Term	See Details	•
Licens	e No	Odome 7	ter In	Odometer Out	Delivery 10/14/20		Stock 14724E	
Year 2015	Make TREMCA		Model Super I	B PUP	Model N	0	Colour	
	e ID No 3223FS588		Selling [EDMON	Dealer TON TRAILER	SO Date 12/20/202		InServ Date 10/14/2022	Location
Engine	Size				Fleet#	SB23E	3	

				1	UCHILDING	O Gu a
Labour	Description					Amount
WB	Wash Bay Steaming					1,240.00
Sublet	Description			Type	CSR	Amount
301739.1	BER-3-1/BERGIES PUMPING AND VACUUM SERVICE/Suck out and disposal from steaming PO301739	of product res	idue	CSUB	SANDRA	975.00
		Labour Tot	al			1,240.00
		Sublet Tota	al			975.00
		Request S	ub-total			2,215.00
Request			***************************************	Job	CSR	Status
WB TAN	KS Repair crack around sump			2	SANDRA	Original
Labour	Description					Amount
WB TAN	KS Repaired crack around sump, inside and out					4,650.00
WB TAN	KS Touched up coating inside where welded, 2 coats					0.00
WB TAN	KS Stiffened up piping attached to sump. Suspect crack was caused by piping moving	ng around and	/or vibrat	ing		0.00
WB TAN	KS Replaced 1 VIC clamp and gasket. Replaced sump bolts					0.00
Part	Description	Shp	ОН	Bin	Price	Amount
58X512	BOLT 5/8X5-1/2 GRD8	8	92	TC9-06	2.74	21.92
58WASH	USS 5/8" USS Flat Washer, Gr. 8	16	557	TC7-05	1.62	25.92
58 LK W	ASH 5/8" Lock Washer	8	5.355	TC8-06	0.34	2.72
58 NUT	58 NUT	8	571	TC8-06	0.88	7.04
MUC4R	4" MUFFLER CLAMP	6	4	E5-08	7.40	44.40
DEVMAT	142 DEVOE DEVMAT 142 BLUE KIT	1	6	G4-10	151.80	151.80
G38VFT-	400 4" FLEXIBLE GROOVED COUPLING W/NITRILE GASKET HEAVY DUTY	1	5	E3-10	63.72	63.72
MUC5R	5" MUFFLER CLAMP	6	2	E5-08	7.73	46.38
MUC5R	5" MUFFLER CLAMP	2	2	E5-08	10.28	20.56
		Parts Total				384.46
		Labour Tot	al			4,650.00
		Request S	ub-total			5,034.46

- . No Refunds or Exchange on Parts after 30 days.
- · No Refunds or Exchange on Electrical Items or Special Orders.
- Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$	BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES
DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MOI	NTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

DATE	CUSTOMER SIGNATURE	
------	---------------------------	--



28520 – 114 Avenue, Acheson, Alberta T7X 6E6 Phone 780.962.8195 | Toll Free 1.877.962.8195 www.edmontontrailer.com | Fax 780.962.8604 (Admin) 780.960.0679 (Parts&Service) | 780.962.8906 (Finance)



GST#893984799RT0001

Promised 12/20/2023 5:00 PM

Attn: CHAD MCFARLAND

9701 - 99TH STREET CLAIRMONT, AB T8X 5A8

FLUIDPRO OILFIELD SERVICES LTD.

(587) 297-0812 Today

ap@fluidpro.ca

Bus

FLUIDPRO OILF1

(780) 533-3338

PO# 48266

Home

Cell

Email

Tag SB23B Customer No Cashiered

02/22/2024 4:54 PM

Printed

02/22/2024 4:54:25 PM

Service Invoice CUSTOMER COPY

Page 2

SO # 101113

					OO m lolli.
Advis	or Sandra	Bit Invol	e Date: 02/22/2024	4:54 PM Ten	m See Details
Licens	e No	Odometer In	Odometer Out 7	Delivery Date 10/14/2022	e Stock No 14724B
Year 2015	Make TREMCA	Mode IR SUPE	I R B PUP	Model No	Colour
	e ID No 3223FS588 • Size		g Dealer INTON TRAILER	SO Date 12/20/2023 Fleet # SB23	InServ Date Location 10/14/2022 3B

Labour 5,890,00 Parts 384.46 Supplies 589.00 Sublet/Tow 975.00 SUB-TOTAL 7,838,46 **GST** 391.92 **PST** 0.00 **TOTAL INVOICE** 8,230.38

- * No Refunds or Exchange on Parts after 30 days.
- No Refunds or Exchange on Electrical Items or Special Orders.
- Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF S	_ Being all or the Balance owing F	OR REPAIRS, PARTS & ACCESSORIE
DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MO	Onth (24% Per annum) Charged on A	ALL OVERDUE ACCOUNTS.

DATE	USTOMER SIGNATURE	



28520 - 114 Avenue, Acheson, Alberta T7X 6E6 Phone 780.962.8195 | Toll Free 1.877.962.8195 www.edmontontrailer.com | Fax 780.962.8604 (Admin) 780.960.0679 (Parts&Service) | 780.962.8906 (Finance)



GST # 89398 4799 RT0001

Promised 05/02/2023 5:00 PM

PO# *

Tag SB-23B

Cashiered

Printed

06/22/2023 4:31:12 PM

Service Invoice CUSTOMER COPY

Page

580.00

Customer No Attn: CHAD MCFARLAN	FLU	JIDPRO OILF1	Advis	or Sandra	Bit		Date:	Te	rm See Detail	# 9981
FLUIDPRO OILFIELD SERVICES LTD. 9701 - 99TH STREET CLAIRMONT, AB T8X 5A8		7 7		Odometer Out			Vo			
	40		Year 2015	Make TREMCA		Model SUPER	B PUP	Model No	Colou	
Home Cell (587) 297-0812		(780) 533-3338	Vehicle ID No 1T9BL3223FS588015			Selling Dealer EDMONTON TRAILER		SO Date 05/02/2023	InServ Date 10/14/2022	Location
Email ap@fluidpro.ca			Engine Size					Fleet # SB-		

Ellian ab	egnulapro.ca		Engine Size		Fleet	¥ SB-23B		
Request	Description				***************************************			
WB TANKS	Repair crack in ba	rrel as per estimate	1531			Job		
Labour	Description					1	SANDRA	Origina
WB TANKS	Repair crack in ba	rrel as per estimate	1531					Amount
WB TANKS	Remove barrel ski	n to find leak, remoi	e piping and outrigger					8,132.50
WB TANKS	Cut apart shell, ins	side baffles, support	across tank					0.00
WB TANKS	Fabicrate new she	Il piece/baffle piece	s/ baffle support					0.00
	install new pieces,	weld completely in.						0.00
WB TANKS	Hydro pressure tes Outside componor	st, coat inside piece nets	s, reinstall all					0.00
MISC	Air/electrical hose/	cord kit with gladhai	nds added by Corey upon pickup					
MISC	\$2000.00 PARTS	AND LABOUR DISC	OUNT - AS PER BRIAN HORN					0.00
Part		Description		Shp	ОН	20 0 (100 cm)		***********
AD66BS		3/16" Alum Rivet (251-375) Dome Head, Sti Stem	20	228	Bin B5-07	Price 0.14	Amount
AD610BSLF		POP RIVET, 3/16	GRIP .501625	20	109	B5-07	0.14	2.80 5.60
AD66BS		3/16" Alum Rivet (.	251-375) Dome Head, Stl Stem	20	228	B5-07	0.14	2.80
12006		GLADHAND - SEF	VICE	2	18	C5-05	5.06	10.12
12008		GLADHAND - EME		2	17	C5-05	5.06	10.12
HAB3-ABS-15		15' AIR/ELEC ABS		1	2	DISPLAY	221.28	221.28
ALUM-PLATE-	1/4-SM	1/4" Alum Plate Sn		8		1SPECOR	19.08	152.64
NPN		NC PIECE OF BAR	FLE	1		1SPECOR	312.00	312.00
DEVMAT142		DEVOE DEVMAT	142 BLUE KIT	5	10	G4-10	126.00	630.00
				Parts Total			.20.00	1,347.36
				Labour Total				8.132.50
				Request Su	b-tota	1		9,479.86
Request WB	Description				·····	Job	CSR	Status
7.575.TT	Wash Bay Steamin	9				2	SANDRA	Approved
Labour NB	Description	w						Amount
AAD	Wash Bay Steaming	9						580.00
				Labour Total				580 00
				Mark Control of the C				

TERMS:

Request Sub-total

No Refunds or Exchange on Parts after 30 days.

No Refunds or Exchange on Electrical Items or Special Orders.

• Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

DATE CUSTOMER SIGNATURE	



28520 – 114 Avenue, Acheson, Alberta T7X 6E6 Phone 780.962.8195 | Toll Free 1.877.962.8195 www.edmontontrailer.com | Fax 780.962.8604 (Admin) 780.960.0679 (Parts&Service) | 780.962.8906 (Finance)



i

GST# 89398 4799 RT0001

Promised 05/02/2023 5:00 PM

FLUIDPRO OILFIELD SERVICES LTD.

(587) 297-0812 **Today** ap@fluidpro.ca

Bus

Attn: CHAD MCFARLAND

9701 - 99TH STREET CLAIRMONT, AB T8X 5A8

PO# *

Home

Cell

Emall

Tag SB-23B Customer No. Cashiered

FLUIDPRO OILF1

(780) 533-3338

Printed

06/22/2023 4:31:12 PM

Service Invoice
CUSTOMER COPY

Page 2

SO #99813

						m ago ic	
Advis	or Sandr	Bit	Invoice	Date:	Ter	m See Detail	s
Licen: Year	Make		Model	Odometer Out 7	Delivery Dat 10/14/2022 Model No	e Stock 14724 Colou	В
2015 Vehici	TREMCA e ID No			B PUP			
1T9BL	3223FS588		Selling EDMON	Dealer ITON TRAILER	SO Date 05/02/2023	InServ Date 10/14/2022	Location
Engine	Size				Fleet# SB-2	238	

 Labour
 8,712.50

 Parts
 1,347.36

 Supplies
 871.25

 SUB-TOTAL
 10,931.11

 GST
 546.56

 PST
 0.00

TOTAL INVOICE

11,477.67

TERMS:

- No Refunds or Exchange on Electrical Items or Special Orders.
- Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF S BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

CATE	CUSTOMER	SIGNATURE
------	----------	-----------



28520 - 114 Avenue, Acheson, Alberta T7X 6E6 Phone 780.962.8195 | Toll Free 1.877.962.8195 www.edmontontrailer.com | Fax 780.962.8604 (Admin) 780.960.0679 (Parts&Service) | 780.962.8906 (Finance)



GST#893984799RT0001

Promised 06/03/2025 5:00 PM

PO# 59905

Tag# SB23A&B

Cashiered 07/22/2025 9:01 AM

Printed

07/22/2025 9:01:07 AM

Page 1

Service Invoice CUSTOMER COPY

Custor									1.
Affa: CF	AD MCFARLAND FLUIDPRO OILF1	CUSTOME Advisor Adam Barbon					SO	# 10	41
FLUIDPI	RO OILFIELD SERVICES LTD	Advisor Adam Barbon	ir invoice Date: 0	7/22/202	5 9:01 AM	Term Se	e Deta	ils	1
CLAIRM	ONT, AB T8X 5A8 Bus (780) 533-3338	License Odo 10 Year Make 2015 TREMCAR Vehicle ID No	m In Odom 10 Model SUPER B LEAD	Out	Delivery 10/14/20 Model N	/ Date 022 lumber	Stoc 1472 Colo	k No 4A	
Email	ap@fluidpro.ca	1T9BL403XFS588014 Engine	Selling Dealer EDMONTON TR	AILER	SO Date 06/03/202 Fleet #	25 10/14	/2022	Loca	tion
Request WB-VIKPT	Description				rieet# ;	SBZ3A	······································		
Labour	VIKPT Tank Inspection - LEAD Description					Job	C	SR	Stat
WB-VIKPT	VIKPT Tank Inspection - LEAD					1	1		Origi:
WB TANKS	Upper Complex Inspection		f.~					Α	mou
WB TANKS	Slight extra cleaning results at a		BINITE	1750 v.				2,	170.
WBTANKS	Nebelia PRV		5	圆圆	習の				250 .
WB TANKS	* Repair inside cracks on least NO TOUR	Oli Do wa same	Marana Marie	Appropriate and	₹[[]]				55.
WB TANKS	Replace valves and VICs as required	PH-UP TO INTERNAL CO.	ATING COMPLETE	ED					465.
Part	Description		·						310.
10233B	2" TTAAA O AOUMM	NIΔ	Shi	о он	Bin	· r	rice		542.:
WD18403Bi	3" Buna-N Disc Rep	2	2 110	E2-05		7.60	Ar	ήοu	
14746B		1	0	E4-03		3.83		15.2	
PC14695W6	3/8 TUBE x 1/8 MP	1	9	D5-08		3.18		43.8	
PC14626	DIIGHTA AANNA	VIIUVI	1	3	D6-10		6.77		3.1
34 S/S BALL	VALVE 3/4 S/S BALL VALV	F EUL DODT ***	1	19	D6-08		5.06		6.7
31109E	PLUG SQUARE HE	C. FOLE PORT, 316	1	3	12-10		5.38		6.0
1164759	4" INLINE ACT NOR	IRIS BFV, VITON/SS	1	9	D1-10		1.05		45,3
(107B	FITTING, TEE, 1/4"	MOT PRACO	1	13	PR2106	1,133		1 1	1.0
°C14686B	Fillian 3/9 custous	1/4 pipe PUSH TO CONN	1	17	D6-07		3,42	1,1,	33.5
°C1469SW6	3 1/4 PUSH TO CONN	114 hibs LOSH TO COM	1	59	D6-09		.93		3.42
10BA	REDUCER, 1/4 TO 1/	190 DEP	1	55	D6-10		.77		3.93
P15003BR	1/8" Fusible Plug, Be	°C	1	18	D4-04		.61		6.77
11022	311G CAN WD40	IIS	1	47	E4-05		.36		0.61
8X2	BOLT 5/8X2 GRD8		1	6	TCPC		.27		5.36
8WASH	5/8 WASH FLAT GR	m a	24	1,066	TC8-06		.79		7.27
8 LKNUT	5/8 NYLON LOCK NU	na na	48	3,685	TC8-05		44		2.96 1,12
	OUT LOCK NO	<i>1</i> 1	24	744	TC8-06		93		2.32
			Part	ls Total		•	00	1,378	
			Lab	our Total				3,892	ı
				uest Sul				5,271	
equest /B-VIKPT	Description		A)	***************************************		1 - l.			
abour B-VIKPT	VIKPT Tank Inspection - PUP Description VIKPT Tank Inspection - PUP					Job 2	102	Sta Orig Amo 2,170	unt

- No Refunds or Exchange on Parts after 30 days.
- * No Refunds or Exchange on Electrical Items or Special Orders.
- Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF S BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES

MICH OF STREETS WOUND AND FORDER I		_ BEING ALLOR THE BALL	MCF OBUNG COR DEBA	IDE DADTE D AFFECCE
DESCRIPTION THE INDICATE MET 3	A DAVE INTEREST OF SECONDE		AACE CANING LOSS SELM	102, FAU12 & ACCE22(
DESCRIBED IN THIS INVOICE, NET 3	S DVI 2' III I EUE 31 OF 529 BEK MO	INTH (24% PER ANNUM) (CHARGED ON ALL OVER	DUE ACCOUNTS
		`		0.0011100
DATE	CUSTOMER SIGNATURE			



28520 - 114 Avenue, Acheson, Alberta T7X 6E6 Phone 780.962.8195 | Toll Free 1.877.962.8195 www.edmontontrailer.com | Fax 780.962.8604 (Admin) 780.960.0679 (Parts&Service) | 780.962.8906 (Finance)



GST # 89398 4799 RT0001

Promised 06/03/2025 5:00 PM

PO # 59905

Tag# SB23A&B

Attn: CHAD MCFARLAND

CLAIRMONT, AB T8X 5A8

(587) 297-0812

ap@fluidpro.ca

9701 - 99TH STREET

FLUIDPRO OILFIELD SERVICES LTD.

Customer No

Cashiered

07/22/2025 9:01 AM

Printed

07/22/2025 9:01:07 AM

Page 2

SO # 104177

Service Invoice CUSTOMER COPY FLUIDPRO OILF1

License

Year 2015 TREMCAR

Model

Shp

OH

Total Invoice

Model Number Colour

(780) 533-3338

Vehicle ID No 1T9BL403XFS588014

06/03/2025

Engine

Fleet # SB23A

WB TANKS WB WB TANKS WB TANKS

Part

Home

Cell

Email

Upper Coupler Inspection

Bus

Today

Repair extensive cracks to baffles. NO TOUCH-UP TO INTERNAL COATING COMPLETED

WB TANKS Replace valves and VICs as required Description MMM26340 CIV-4-345-001701H10

PC14626 PC14686B X107B 110BA FP15003BR PC1469SW6B MUC45R

97UB4 G38VFT-300 58X2

58WASH 58 LKNUT Pup required additional cleaning for extensive welding repairs

4-1/2" MUFFLER CLAMP

2" Green Painters Masking Tape 4" SURE SEAL NITRILE/IRON WITH HANDLE

PUSH TO CONN UNION Fitting 3/8 synflex to 1/4 pipe PUSH TO CONN FITTING, TEE. 1/4" NPT, BRASS REDUCER, 1/4 TO 1/8 1/8" Fusible Plug. Betts 1/4 PUSH TO CONN 90 DEG

4" SS U-Bolt, 1/2" Material 304 3" FLEXIBLE GROOVED COUPLING. WINITRILE GASKET HEAVY DUTY BOLT 5/8X2 GRD8 5/8 WASH FLAT GRD8

5/8 NYLON LOCK NUT

Advisor Adam Barbour Invoice Date: 07/22/2025 9:01 AM Term See Details Odom In Odom Out Delivery Date Stock No 10 10/14/2022 14724A

Make

SUPER B LEAD

Selling Dealer **EDMONTON TRAILER**

SO Date

111 **-**61 4166 10/14/2022

Location

250 00 1.440.00 465.00 1,550.00

542.50 Amount

42 96

14,133.24

Bin Price 1 24 01-05 12 33 12.33 2 PR2204 4 246.28 492.56 2 19 D6-08 6.06 12.12 3 D6-09 3.93 11.79 17 D6-07 3 42 3.42 1 D4-04 0.61 0.61 1 47 E4-05 5.36 5 36

2 55 D6-10 6.77 13.54 2 8 E5-08 8 48 16.96 2 16 13-02 21.84 43 68 1 E3-10 41.69 41.69 24 1.066

TC8-06

48 3.685 TC8-06 0 44 21.12 24 744 TC8-06 0.93 22.32 Parts Total 740.46 Labour Total 6.417 50 Request Sub-total 7,157.96

1.79

Labour 10.310.00 Parts 2.119.23 Supplies 1.031.00 Sub-Total 13,460.23 GST 673 01 PST 0.00

5B23B-7673.45

TERMS:

No Refunds or Exchange on Parts after 30 days.

No Refunds or Exchange on Electrical Items or Special Orders.

* Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDERTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF S. BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

DATE CUSTOMER SIGNATURE



28520 - 114 Avenue, Acheson, Alberta T7X 6E6 Phone 780.962.8195 | Toll Free 1.877.962.8195 www.edmontontrailer.com | Fax 780.962.8604 (Admin) 780.960.0679 (Parts&Service) | 780.962.8906 (Finance)



GST # 89398 4799 RT0001

Promised 06/03/2025 5:00 PM

Description

VIKPT Tank Inspection - PUP

VIKPT Tank Inspection - PUP

Description

PO# 59905

Request

WB-VIKPT

WB-VIKPT

Labour

Tag# SB23A&B

Cashiered

07/22/2025 9:01 AM Service Invoice

Printed

07/22/2025 9:01:07 AM

Page 1

Original

Amount

2.170.00

SO # 104177

Customer No Attn: CHAD MCFARL		JIDPRO OILF1	Advis	or Adam E	Barbour	nvoice	Date: 07/22/202	5 9:01 AM Te	rm See De	tails
FLUIDPRO OILFIELD SERVICES LTD. 9701 - 99TH STREET			Licens	se .	Odom I	n	Odom Out 10	Delivery Da	NET TO CONTROL OF	ock No 724A
CLAIRMONT, AB T8X	5A8		Year 2015	Make TREMCA		Model SUPER	BLEAD	Model Num		lour
Home Cell (587) 297-08	Bus 2 Today	(780) 533-3338		e I D No 403XFS588			Dealer NTON TRAILER	SO Date 06/03/2025	10/14/202	Location
Email ap@fluidpro	ca		Engine	Engine				Fleet # SB23A		

CUSTOMER COPY

WB-VIKPT	VIKPT Tank Inspection - LEAD	Job (CSR 102	Status
Labour	Description	*	102	Original
WB-VIKPT	VIKPT Tank Inspection - LEAD			Amount 2,170.00
WB TANKS	Upper Coupler Inspection			250.00
WB TANKS	Slight extra cleaning required for welding			155.00
WB TANKS	Rebuild PRV			465.00
WB TANKS	Repair inside cracks on lead, NO TOUCH-UP TO INTERNAL COATING COMPLETED			
WB TANKS	Replace valves and VICs as required			310.00
Part	Description Shp OH Bin	- ·		542.50
10233B	3" TTMA GASKET, NA 2 110 E2-05	Price 7.60		Amount
WD18403BN	3" Buna-N Disc Repair Kit (WD300ALV) 1 0 E4-03	43.83		15.20
14746B	45 ELB3/8TX1/4MPT 1 9 D5-08			43.83
PC1469SW6A	3/8 TUBE x 1/8 MPT 90ELB DOT 1 3 D6-10	3.18		3.18
PC14626	PUSH TO CONN UNION 1 19 D6-08	6.77		6.77
34 S/S BALL V		6.06		6.06
BI109E	DILIC SOLIADE LIEAD ALA	45.38		45.38
1164759	A" INILINE ACT NOTOLO DELL'ALTONIO	1.05		1.05
X107B	CITTING TEC 1/4" NOT DOLGO	1.133.54		1,133.54
PC14686B	Fig 2/0	3.42		3.42
PC1469SW6B	AM DURINTO CONTINUE DE CO	3.93		3.93
110BA	BEDLICED 1/4 TO 1/2	6.77		6.77
FP15003BR	100 04-04	0.61		0.61
01022	1/8" Fusible Plug. Betts 1 47 E4-05	5.36		5.36
	311G CAN WD40 1 6 TCPC	17.27		17.27
58X2	BOLT 5/8X2 GRD8 24 1,066 TC8-06	1.79		42.96
58WASH	5/8 WASH FLAT GRD8 48 3,685 TC8-06	0.44		21.12
58 LKNUT	5/8 NYLON LOCK NUT 24 744 TC8-06	0.93		22.32
	Parts Total			1,378.77
	Labour Total			3.892.50
	Request Sub-total			5,271.27
Request	Description	Job C	SR	Status

- No Refunds or Exchange on Parts after 30 days.
- No Refunds or Exchange on Electrical Items or Special Orders.
- Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$	BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIE
DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF	2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

DATE		CUSTOMER SIGNATURE		
------	--	--------------------	--	--



28520 - 114 Avenue, Acheson, Alberta T7X 6E6 Phone 780.962.8195 | Toll Free 1.877.962.8195 www.edmontontrailer.com | Fax 780.962.8604 (Admin) 780.960.0679 (Parts&Service) | 780.962.8906 (Finance) INVOICE

GST # 89398 4799 RT0001

Promised 06/03/2025 5:00 PM

PO# 59905

Home

Tag# SB23A&B Customer No

Attn: CHAD MCFARLAND

9701 - 99TH STREET CLAIRMONT, AB T8X 5A8

FLUIDPRO OILFIELD SERVICES LTD.

Cell (587) 297-0812 Today

Bus

Cashiered 07/22/2025 9:01 AM

Printed

07/22/2025 9:01:07 AM

Page 2

Service Invoice CUSTOMER COPY

SO # 104177

FLUIDPRO OILF1	Advisor Adam Barbour Invoice Date: 07/22/2025 9:01 AM Term See Details							
VICES LTD.	License Odor		m In Odom Out		Delivery Date		Stock No	
	Year Make 2015 TREMCAR		Model SUPER B LEAD		Model Number Color		A EXCECT	
Bus (780) 533-3338 oday	Vehicle ID No 1T9BL403XFS588014 Engine		Selling Dealer EDMONTON TRAILER		SO Date 06/03/2025 10/14/20			Location
					Fleet # SB2	23A		

Email ap@	gfluidpro.ca	Engine	STOR STORMS MAKES	The sail of	Fleet # SB2	3A	
WB TANKS WB TANKS WB TANKS WB TANKS	Upper Coupler Inspection Pup required additional cleaning Rebuild PRV Repair extensive cracks to baffle Replace valves and VICs as seen	S. NO TOUCH-UP TO INTERNAL C	OATING COMP	LETED			250.00 1,440.00 465.00 1,550.00
Part MMM26340 CIV-4-345-001 PC14626 PC14686B X107B 110BA FP15003BR PC1469SW6B MUC45R 97UB4 G38VFT-300 58X2 58WASH 58 LKNUT	Description 2" Green Pail 701H10 4" SURE SEA PUSH TO CO Fitting 3/8 syr FITTING, TER REDUCER, 1/ 1/8" Fusible F 1/4 PUSH TO 4-1/2" MUFFL 4" SS U-Bolt,	Inters Masking Tape AL NITRILE/IRON WITH HANDLE INN UNION Iffex to 1/4 pipe PUSH TO CONN E, 1/4" NPT, BRASS 4 TO 1/8 Ilug, Betts CONN 90 DEG ER CLAMP 1/2" Material 304 GROOVED COUPLING, WINITRILE AVY DUTY GRD8 AT GRD8	Shp 1 2 3 3 1 1 1 2 2 2 1 24 48 24 Par	OH 24 4 19 59	Bin O1-05 PR2204 D6-08 D6-09 D6-07 D4-04 E4-05 D6-10 E5-08 I3-02 E3-10 TC8-06 TC8-06	Price 12.33 246.28 6.06 3.93 3.42 0.61 5.36 6.77 8.48 21.84 41.69 1.79 0.44 0.93	542.50 Amount 12.33 492.56 12.12 11.79 3.42 0.61 5.36 13.54 16.96 43.68 41.69 42.96 21.12 22.32 740.46
1.6	1911				ai ub-total		6,417.50 7,157.96
		5B23A-5786. 5B23B-767	Par Sup Sub	oplies o-Total T	voice	14	10,310.00 2,119.23 1,031.00 13,460.23 673.01 0.00 1,133.24

- . No Refunds or Exchange on Parts after 30 days.
- No Refunds or Exchange on Electrical Items or Special Orders.
- Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$	BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES
DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MOI	NTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

Total a reneral	CUSTOMER SIGNATURE	
DATE	LUSIUWER SIGNATURE	