

Service Log Report

From: Feb-12-2022 To: Aug-12-2026

Service Date	Contract	Mechanic Name	Work Order #	Meter/Mileage	Time	Service Description
Unit Number: 701						
Apr-07-2025	OH25001	BARNONE	8936			unit 701 hrs: 13360 Tighten tire chains on all four tires.
May-20-2025	OH25001	WAJAX	65680			front and rear differentials overfilling with oil the piston seals on the differential lock were found to be worn through in the center carbonized and soft 67 labour hours charged
May-23-2025	OH25001	CHARLIE GEERNAERT	12768		3.5	travel to trailer tire block change air filter and put keeper bolt in travel to parts trailers to get bucket of links, then back to candle rd
May-28-2025	OH25001	CHARLIE GEERNAERT	12612		1.5	fix seat at trailer tire block look at what's leaking
Jun-03-2025	OH25001	BARNONE	9219			June 3, 2025-13605 hr Unit 701 - seat repair
Jun-04-2025	OH25001	CHARLIE GEERNAERT	12829		2	travel over to 2.5km central ridge tighten cleveses on tire chain travel to shop
Jun-06-2025	OH25001	CHARLIE GEERNAERT	12834		5.5	1200hr service at 2.5km central ridge travel to shop

Service Date	Contract	Mechanic Name	Work Order #	Meter/Mileage	Time	Service Description
Unit Number: 701						
Jun-08-2025	OH25001	CHARLIE GEERNAERT	12843		3	travel to 2.5km central ridge remove transmission line travel to shop
Jun-09-2025	OH25001	CHARLIE GEERNAERT	12844		3	get hose made travel to 2.5km central ridge install transmission line
Jun-11-2025	OH25001	CHARLIE GEERNAERT	12854		2	mesure #20 hoses at 2.5km central ridge
Jun-12-2025	OH25001	CHARLIE GEERNAERT	12860		4	travel to 2.5km central ridge remove hoses from machine travel to resource to get hose shortened
Jun-13-2025	OH25001	CHARLIE GEERNAERT	12861		5	travel to 2.5km install hoses on machine
Jun-19-2025	OH25001	CHARLIE GEERNAERT	12914		3	tighten outside links for skidders chain at 2.5km central ridge
Jun-24-2025	OH25001	CHARLIE GEERNAERT	12881		2.5	tighten tire chain at 2.5km central ridge
Jun-24-2025	OH25001	BARNONE	9357			Unit 701_ help Charlie adjust and tighten tire chain
Jun-26-2025	OH25001	CHARLIE GEERNAERT	12889		2.5	wash machine and try to get pin to take grease

Service Date	Contract	Mechanic Name	Work Order #	Meter/Mileage	Time	Service Description
Unit Number: 701						
Jun-27-2025	OH25001	CHARLIE GEERNAERT	12893		2.5	try to get center pin to take grease at 2.5km central ridge take shims out of gropple brakes
Jun-30-2025	OH25001	BARNONE	9414			unit 701- Looked at why articulation pin wasn't taking grease. Inspected passage and looks like bearing spun in bore and grease passage isn't lined up. Drilled a small hole through race.
Jul-02-2025	OH25001	BARNONE	9414			unit 701- tensioned back right tire chain
Jul-02-2025	OH25001	CHARLIE GEERNAERT	13154		3.5	at 2.5km central ridge look at grapple cylinder leak travel into block with side by side fix coolant leak to shop
Jul-07-2025	OH25001	BARNONE	9447			unit 701 Checked tire pressures. Front right tire has a slow leak around bead. Filled tire.
Jul-14-2025	OH25001	CHARLIE GEERNAERT	13060		5.5	at rigel pit install clamp for main return and pressure lines change grease nipple reconnect section of chain look at turbo fins look at why grapple is gree swinging
Jul-14-2025	OH25001	BARNONE	9503			Unit 701- Removed guards and turbo boot. Inspected turbo as requested. No visible damage

Service Date	Contract	Mechanic Name	Work Order #	Meter/Mileage	Time	Service Description
Unit Number: 701						
Jul-15-2025	OH25001	CHARLIE GEERNAERT	13064		3	travel to rigel pit rd 30hr service change clutch disc in cropple take apart again and see if pin is broken
Jul-16-2025	OH25001	BARNONE	9503			Unit 701 Checked grapple and why it wasn't braking after Charlie installed new clutch pack. Cleaned off grease and found splines are broken and there's a large crack all the way around splines side. Got parts quote for repair.
Jul-31-2025	OH25001	CHARLIE GEERNAERT	13113		2.5	travel to rigel pit look at seat look to see what the engine oil leak was from check diff level
Sep-04-2025	OH25001	CHARLIE GEERNAERT	1007	14254	3	wash machine take all guards off
Sep-08-2025	OH25001	BARNONE	9782			Removed nut for grapple pin. Found pin was seized. Tried to remove rod end pin and found it was also seized. Heated around pin to try to free. Pin didn't move. Torched out pin and removed was was left. Removed rod from cylinder. Got both cylinders sent to machine shop for repair. Removed swivel manifold for grapple. Pulled rotate motor. Removed gear and shims. Pulled yoke out of the boom.
Sep-09-2025	OH25001	BARNONE	9782			Drove to customer shop. Tried to heat bearing on yoke to remove. Bearing was over heated before it started to move. Got new bearing ordered. Cut off old one to get seal ring. Brought new yoke in shop and cleaned off. Disconnected boom cylinders. Hooked crane up to boom. Pulled main boom pins and lifted boom off of arch to access bushings. Cut out bushings and pressed in new ones Got a call to install fan pump. Cleaned up. Drove to site.

Service Date	Contract	Mechanic Name	Work Order #	Meter/Mileage	Time	Service Description
Unit Number: 701						
Sep-09-2025	OH25001	BARNONE	9754	14253		started inspection on Put cab down and moved machine out of way and removed tire chains Changed engine oil and filter. Replaced inner and outer air filters
Sep-10-2025	OH25001	BARNONE	9782			put boom back on arch installed new pins
Sep-22-2025	OH25001	TIM NEUSTAETER	16001	14255	10.5	installed grapple shims assembled snobber/brake replaced pins and bushings for both steering cylinders installed airride height adjustment valve on seat replaces cable for seat sumper/shcok
Sep-23-2025	OH25001	TIM NEUSTAETER	16002	14255	6.75	installed grapple cylinders cleaned up thread for pin retainer nut installed grapple nut on damaged side replaced exhaust pipe
Sep-24-2025	OH25001	TIM NEUSTAETER	16004	14255	8.5	installed grapple nut tested AC and recharged install guards replaced strainer filter washed grapple filled hyd
Sep-25-2025	OH25001	TIM NEUSTAETER	16006	14255	2	welded cracks on grapple replaced light

Service Date	Contract	Mechanic Name	Work Order #	Meter/Mileage	Time	Service Description
Unit Number: 701						
Sep-26-2025	OH25001	TIM NEUSTAETER	16008	14255	9.5	installed tire chains and tightened put on rear stump pan installed new seat locking plate and studs assembled seat
Oct-01-2025	OH25001	TIM NEUSTAETER	16016	14309	7	troubleshoot hyd pulled valve from winch valve block and installed into grapple valve section to temperaty fix problem, will oeder correct valve made parts list wen't over operator complaint and made repair list
Oct-02-2025	OH25001	CHARLIE GEERNAERT	20103		7.5	travel to 7.5km archie see what is leaking on boom cyl fix coolant leak under cab see if hyd cooler is leaking remove rod core with Time back to shop
Oct-02-2025	OH25001	TIM NEUSTAETER	16019	14308	6	assisted Charlie wih hyd cooler removal
Oct-03-2025	OH25001	CHARLIE GEERNAERT	20105		4	at 7.5km archie help putting rod cooler into machine
Oct-03-2025	OH25001	TIM NEUSTAETER	16022	14308	10	installed hyd oil cooler reassembled machine
Oct-06-2025	OH25001	TIM NEUSTAETER	15976	14386	7	removed seat welded base back together

Service Date	Contract	Mechanic Name	Work Order #	Meter/Mileage	Time	Service Description
Unit Number: 701						
						reinstalled seat
Oct-07-2025	OH25001	CHARLIE GEERNAERT	20109		1.5	at 15km archie drill and top center pin so can put new grease nipple in
Oct-08-2025	OH25001	CHARLIE GEERNAERT	20111	14353	2	travel to 15km archie see what is leaking under cab change o-ring on pump
Oct-10-2025	OH25001	TIM NEUSTAETER	15990	14366	8.5	replaced part relidf for grapple set hyd pressure for grapple installed seat suspension and adapter plates resealed LHS boom cylinder
Oct-14-2025	OH25001	TIM NEUSTAETER	15993	14366	5	installed grapple trouble shoot why sensor lost reading new sensor failed, used sensor from service
Oct-15-2025	OH25001	CHARLIE GEERNAERT	20119	518	2	at 15km archie tighten tracks
Oct-22-2025	OH25001	TIM NEUSTAETER	20231		1	boosted
Oct-23-2025	OH25001	CHARLIE GEERNAERT	20060	14400	1.5	change 2 battery at 17km Amerada
Oct-23-2025	OH25001	TIM NEUSTAETER	20232	14396	1	boosted
Nov-01-2025	OH25001	CHARLIE	20122	14553	2	travel to the dobson rd

Service Date	Contract	Mechanic Name	Work Order #	Meter/Mileage	Time	Service Description
Unit Number: 701						
		GEERNAERT				300hr service weld locking mechanism on door on blade
Nov-02-2025	OH25001	CHARLIE GEERNAERT	20125		1	travel to dobson get center pin to take grease leak over machine
Nov-03-2025	OH25001	TIM NEUSTAETER	20243	14459	4.5	testing HYD problem/weak grapple
Nov-04-2025	OH25001	TIM NEUSTAETER	20244	14471	3	drilled hole through bearing for upper to grease
Nov-07-2025	OH25001	TIM NEUSTAETER	20249	14501	4	tightened front tire chains
Nov-10-2025	OH25001	TIM NEUSTAETER	20252	14522	4	tightened rear chains
Nov-22-2025	OH25001	TIM NEUSTAETER	20263	14623	7	removed and resealed swivel manifold made new hose installed and tested
Nov-25-2025	OH25001	TIM NEUSTAETER	20266	14659	3	looked at exseseive play in centre joint removed all shims and still had plat
Dec-08-2025	OH25001	TIM NEUSTAETER	20129	14698	12	remove panel and stump pan removed damage hyd line removed driveshaft
Dec-10-2025	OH25001	TIM NEUSTAETER	20133	14698	2	installed Hyd line moved to road started assembly

Service Date	Contract	Mechanic Name	Work Order #	Meter/Mileage	Time	Service Description
Unit Number: 701						
Dec-11-2025	OH25001	CHARLIE GEERNAERT	20512	14700	5.5	help Tim with u-joint job and drive skidders out to Okm willie
Dec-11-2025	OH25001	TIM NEUSTAETER	20135		8	cut off damaged steady bearings installed ujoint,driveshaft,steady bearings installed filled oil and tested
Dec-15-2025	OH25001	CHARLIE GEERNAERT	20519		2	service generator at laydown travel to rogers pass to hely Bob put on clevises on tire chains
Dec-16-2025	OH25001	CHARLIE GEERNAERT	20002		2	travel to rogers pass 600hr service
Dec-18-2025	OH25001	CHARLIE GEERNAERT	20004		5.5	travel to rogers pass see where noise coming from travel to laydown to get transmission filters cut into old filters
Dec-19-2025	OH25001	TIM NEUSTAETER	20204	14771	8.5	drive to bredison trouble shoot noise from drive/transmission change pressure 360psi at idle speed is inspec 900rp, at speed clutch engagement pressure 430 psi at idle
Dec-20-2025	OH25001	TIM NEUSTAETER	20206	14779	3	had operator run machine till it was warm found play in u joints
Dec-22-2025	OH25001	TIM NEUSTAETER	20207	14779	2	reinstalled u-joints and drive shaft
Jan-02-2026	OH25001	CHARLIE GEERNAERT	20577		6.5	travel to 7km rogers pass change u joint
Jan-06-2026	OH25001	TIM NEUSTAETER	20214	14780	3	tested machine could not hear any noise

Service Date	Contract	Mechanic Name	Work Order #	Meter/Mileage	Time	Service Description
Unit Number: 701						
Jan-08-2026	OH25001	CHARLIE GEERNAERT	20585		2.5	at 7km rogers pass see where oil leak is coming from(grapple rotate)
Jan-09-2026	OH25001	WAJAX	6170003992			THE technician found the upper center joint bear has failed the machine was separated and the upper bearing assembly, wear sleeves, pin and upper plate removed and replaced
Jan-09-2026	OH25001	TIM NEUSTAETER	20217		1.5	checked over leak will have to remove more parts to find
Jan-10-2026	OH25001	TIM NEUSTAETER	20219	14801	2	found rotate motor has leaking
Jan-13-2026	OH25001	TIM NEUSTAETER	20222	14801	6	installed rotate motor
Jan-26-2026	OH25001	TIM NEUSTAETER	20187	14914	4.5	joystick dissassemble, will need new joystick LHS went over operator complaints and made parts list
Feb-02-2026		TIM NEUSTAETER	20195	14963	4.5	Unit # 701 - Trouble shot light harness - Installed pressure sensor for service brake
Feb-04-2026		TIM NEUSTAETER	20196	14989	5.5	Unit # 701 - Replaced damaged lights - Build harness for arch / boom lights
Feb-05-2026		TIM NEUSTAETER	20199	14989	3	Unit # 701 - Fixed hydraulic leak under cab.
Feb-06-2026		TIM NEUSTAETER	20200		3.5	Unit # 701 - Fixed hydraulic leak

Service Date	Contract	Mechanic Name	Work Order #	Meter/Mileage	Time	Service Description
Unit Number: 701						
						- Repaired cab pin
Feb-07-2026		TIM NEUSTAETER	20152	15005	2	Unit # 701 - Installed intake gasket
Feb-09-2026		TIM NEUSTAETER	20153	15013	5.5	Unit # 701 - Made grapple pressure harness to replace damaged section - Welded grapple tines
Feb-10-2026		TIM NEUSTAETER	20155	15024	3.5	Unit # 701 - Installed new LHS joystick
Feb-13-2026		CHARLIE GEERNAERT	20317		4	Unit # 701 Travel to 22km Hammer - 900 hr Service - Change o-rings on valve bank by batteries - Change fuel line on injection pump - Bend guard and weld it in place
Feb-17-2026		CHARLIE GEERNAERT	20327		1	Travel to 22 km Hammer - see if shims need to get taken out of grapple.
Feb-18-2026		CHARLIE GEERNAERT	20330	14048	1.5	At 22 Km - Fix coolant leak under cab
Feb-19-2026		TIM NEUSTAETER	20163	15057	1	- boosted
Mar-01-2026	OH25001	CHARLIE GEERNAERT	20352	15174	0.5	at 13km hammer mesure hose for grapple
Mar-02-2026	OH25001	CHARLIE	20353	15178	2	travel to 13km hammer

Service Date	Contract	Mechanic Name	Work Order #	Meter/Mileage	Time	Service Description
Unit Number: 701						
		GEERNAERT				install hose for grapple 1 made
Jun-12-2026	OH25001	CHARLIE GEERNAERT	13993		1	at shop put guards on machine
Jul-09-2026	OH25001	TIM NEUSTAETER	20279		2.5	swapped tires
Jul-09-2026	OH25001	CHARLIE GEERNAERT	13735		2.5	at shop change all 4 tires to old tires
Jul-10-2026	OH25001	CHARLIE GEERNAERT	13736		2	try to fix chains fill all 4 tires with air take tools out of cab
Jul-14-2026	OH25001	TIM NEUSTAETER	20281	15220	5.5	tightened chains picked up parts in town
Jul-20-2026	OH25001	TIM NEUSTAETER	20146	15220	3	swapped tires
Total Hours:				317.75		