

T. Yardley Contracting Ltd

4908 48th Avenue

PO Box 2838

High Prairie, Alberta T0G 1E0

(780) 523-0602

INVOICE

Invoice No.: 4489

Date: 04/01/2025

Page: 1

*Paid chq #212***Sold to:
COLE SIEGLE**

Business No.: 795410281

Quantity	Description	Unit Price	Amount
	VIN - 1XKWDB9X26R987820 - 2006 - KENWORTH - W-900 B	21.80	21.80
1	OIL FILTER CAP CAT- 0884497	2,984.29	2,984.29
1	RADIATOR COMPLETE W/900 LB- 21012505	64.40	64.40
1	FREIGHT CHARGE	58.23	116.46
2	RADIATOR HOSE - 40 - D10302650	1,108.30	1,108.30
1	SUPPORT COMPRESSOR 2590555	1,471.29	1,471.29
1	FAN HUB - GOLD TOP 799366SX	64.37	64.37
1	FREIGHT CHARGE EDMONTON -	68.56	68.56
1	HOOD PIN - GUIDE ASSY LH - M17402PLK /	72.68	72.68
1	HOOD GUIDE ASSY - M17402PLK	7.40	29.60
4	RAD MOUNT KENWORTH - M59284	17.43	17.43
1	CAB AIR FILTER - KW	266.50	266.50
1	CONDENSOR KW - 81359101	9.58	38.24
4	RADIATOR MOUNT - 500845	19.24	76.96
4	RAD MOUNT BUSHING - M17429	13.20	52.80
4	CONDENSOR MOUNT BUSH - M59422	45.76	183.04
4	4" X 6" RED CAC HOSE - 56175716	1,240.90	1,240.90
1	CHARGE AIR COOLER KW - 81259201TF	382.49	382.49
1	FAN BLADE KENWORTH - 810FB9919	88.56	88.56
1	KITTY HAIR - 100868	10.70	10.70
1	PLASTIC FILLER APPLICATION - 80280PFA	45.70	45.70
1	LT WT BODY FILLTER - 905010	17.70	17.70
1	RUST PROTECTANT GRAY - 469038	18.49	18.49
1	BLACK SPRAY PAINT - 469001	242.89	242.89
1	TENSIONER BELT- 89441	249.51	249.51
1	TENSIONER ASSY CAT - 89447	76.16	76.16
1	IDLER PULLY SMOOTH - 89101	154.05	154.05
1	IDLER PULLEY RIBED - 89112	1,678.57	1,678.57
1	OIL COOLER C15 - AK2237962	283.93	283.93
1	OIL COOLER INSTALL KIT - P321411	64.37	64.37
1	FREIGHT CHARGE EDMONTON	14.91	14.91
1	MASKING TAPE - 06547	4.27	4.27
1	SAND PAPER 600 GRIT	111.26	222.52
2	EXHAUST STRAP - M8410043	15.50	15.50
1	BAND CLAMP EXHAUST KW - 562U3705SS	8,041.92	8,041.92
1	MAGNUM BUMPER SLAM LATCH - KW17102	182.47	182.47
1	EXHAUST ELBOW - KW - 562U59160085090A	8.66	6.66
1	GASKET - T/STAT - HSNG - 4N1156	172.64	172.64
1	HOSE 2470055	425.95	425.95
1	ALTERNATOR - 8600889	499.95	499.95
1	COMPRESSOR A/C - LF4376	91.56	91.56
1	BELT SERPENTINE - D8410003061420	123.06	123.06
1	BELT - 8 RIBX105 - 1050K8BLT	166.97	166.97
1	HOSE COOLANT - 2470266	1.44	2.88
2	HOSE CLAMP - 53516		

All WHEELS MUST BE RETORQUED!

As a free service to all clients come back and have them retorqued within 50-100 kms of use. This is clients responsibility, should you choose to have them retorqued elsewhere, T. Yardley Contracting Ltd. is not liable for any consequences. Total Invoice amount is due within 30 days
All overdue accounts are subject to 2% Interest monthly. (24% per annum)
Thank you for your business!

Continue...

T. Yardley Contracting Ltd

4908 48th Avenue

PO Box 2838

High Prairie, Alberta T0G 1E0

(780) 523-0602

INVOICE

Invoice No.: 4489

Date: 04/01/2025

Page: 2

**Sold to:
COLE SIEGLE**

Business No.: 795410281

Quantity	Description	Unit Price	Amount
16	ANTIFREEZE AIR BRAKE 4L- 15264	17.50	280.00
4	WH GUARD - 22MM HUB PILOT- 5903	9.39	37.56
3	BRAKE DRUM, 16.5 X 7 HEAVY DUTY DRUM	178.87	536.61
	Discount 16.14%	-28.87	-86.61
1	SEAL WHEEL, DRIVE- 47691PRO	58.95	58.95
5	MARKER LIGHT LED- 45603	73.04	365.20
2	CLEVIS PIN - 5/8 - 055858	8.50	17.00
2	BRAKE POT - 3030 2.5 " INTRAAX - FS5606INT	93.99	187.98
5	MARKER LIGHT - 2-1/2 LED RED- 10503	13.39	66.95
6	WIRE TWO PRONG - 6" SPACE - FT	3.99	23.94
1	WINDSHIELD K/W LH - DW116430	104.99	104.99
6	EXHAUST CLAMP 5 " STEPPED ALUMINUM - 33276	26.33	157.98
1	EXHAUST PIPE - Y- 5 " EP50YTUBE1	265.35	265.35
2	CLAMP EXHAUST 5 " 35775	15.39	30.78
3	FLEXPIPE 5" - 49092	18.75	56.25
2	DUAL WALL SHRINK TUBE - 1/2 X 6	4.99	9.98
1	WATER PUMP - C15 - C18 - DP1759	998.48	998.48
10	BRAKE AND PARTS CLEANER- 313	9.45	94.50
1	A/C RECHARGE- INCLUDES - LABOUR - REFRIGERANT, OIL AND MACHINE	350.00	350.00
	REMOVE AND REPLACE DRIVE SIDE WINDSHIELD		
	REMOVE AND REPLACE FRONT BUMPER AND INSTALL NEW MOUNTING		
	REMOVE AND REPLACE RADIATOR		
	REMOVE AND REPLACE CHARGE AIR COOLER		
	REMOVE AND REPLACE A/C CONDENSOR		
	REMOVE AND REPLACE RAD HOSE ON TOP PIPE		
	REMOVE AND REPLACE A/C COMPRESSOR		
	REMOVE AND REPLACE ALTERNATOR		
	REMOVE AND REPLACE BELT TENSIONER FOR FAN AND AC		
	REMOVED AND REPLACE BELT IDLERS FOR A/X AND FAN		
	REMOVE AND REPLACE FAN HUB		
	REMOVE AND REPLACE ENGINE WATER PUMP		
	REMOVE AND REPLACE ENGINE OIL COOLER		
	REMOVE AND REPLACE CHARGE AIR BOOTS AS NEEDED		
	REMOVE AND REPLACE PANEL AUX LIGHTS		
	REMOVE AND REPLACE CLEARANCE LIGHTS IN HEADACHE RACK AND WIRING		
	REMOVE AND REPLACE BRAKE POT AXLE 3LHS		
	REMOVE AND REPLACE BRAKE POT AXLE 3RHS		
	REMOVE AND REPLACE COMPLETE EXHAUST SYSTEM		
	WHEEL SEAL LEAK- REMOVED HUB-REMOVED SEAL- INSPECTED HUB- INSTALLED SEAL		
	2RHS		
	BRAKE DRUM- WORE BEYOND SPEC.- REPLACED 2LHS		
	BRAKE DRUM- WORE BEYOND SPEC.- REPLACED 3LHS		
	BRAKE DRUM- WORE BEYOND SPEC.- REPLACED 3RHS		
	REMOVED AND REPLACED COOLANT HOSES GOING TO COOLANT DIVERTER VALVE		

All WHEELS MUST BE RETORQUED!

As a free service to all clients come back and have them retorqued within 50-100 kms of use. This is clients responsibility, should you choose to have them retorqued elsewhere, T. Yardley Contracting Ltd. is not liable for any consequences. Total invoice amount is due within 30 days
All overdue accounts are subject to 2% interest monthly. (24% per annum)
Thank you for your business!

Continue...

T. Yardley Contracting Ltd

4908 48th Avenue
PO Box 2838
High Prairie, Alberta T0G 1E0
(780) 523-0602

INVOICE

Invoice No.: 4489
Date: 04/01/2025
Page: 3

Sold to:
COLE SIEGLE

Business No.: 795410281

Quantity	Description	Unit Price	Amount
72	PERFORMED INSPECTION ON TRUCK- WENT THROUGH DRIVE AXLES	145.00	10,440.00
1	REPAIR FIVERGLASS ON RHS FIREWALL	200.00	200.00
	LABOUR- PULLED UNIT IN TWICE- PERFORMED OVER 2 WEEKS -		
	SHOP SUPPLIES-MISC PARTS		
	Subtotal:		35,357.89
	G - GST 5%		
	GST/HST		1,767.93
All WHEELS MUST BE RETORQUED!		Total Amount	37,125.82
As a free service to all clients come back and have them retorqued within 50-100 kms of use. This is clients responsibility, should you choose to have them retorqued elsewhere, T. Yardley Contracting Ltd. is not liable for any consequences. Total invoice amount is due within 30 days		Amount Paid	0.00
All overdue accounts are subject to 2% Interest monthly. (24% per annum)		Amount Owning	37,125.82
Thank you for your business!			



Commercial Vehicle Inspection Certificate Traffic Safety Act

PART 1 - VEHICLE OWNER AND VEHICLE IDENTIFICATION

Vehicle Type:	Truck	Seating Capacity:	
GVW:		Brake Type:	Air
Owner Name:	COLE SIEGLE		
Address:	P.O. BOX 3364		
City:	HIGH PRAIRIE	Province:	AB
		Postal Code:	T0G1E0
Telephone Number:	(780) 307-2876		
Vehicle Identification Number:	1XKWDB9X26R987820		
Make:	Kenworth	Model:	Construct
Year:	2006	Unit Number:	
Odometer:	29018 KM	Licence Plate Number:	08P037
		Province:	AB

IT IS AN OFFENCE TO FALSIFY AN INSPECTION CERTIFICATE

PART 2 - CERTIFICATION

I certify the vehicle described in Part 1 has passed the inspections and tests established under the Traffic Safety Act for a Commercial Vehicle.

Inspection Facility Name:	Facility Number:
Parts for Trucks, Inc.	18979
Inspection Technician Name:	Technician Number:
Brandon Rideout	C0820
Inspection Technician Signature:	
Inspection Date:	2025/06/20

Order To Be Invoiced

*** THIS DOCUMENT IS NOT AN INVOICE ***



Customer PO	SRO	Printed Date	Open Date
CASH	ACH0000020	6/27/25	

Bill To 3076859

COLE SIEGLE
PO BOX 3364
HIGH PRAIRIE AB T0G 1E0
Canada

Ship To 0

COLE SIEGLE
PO BOX 3364
HIGH PRAIRIE AB T0G 1E0
Canada

Company

Parts For Trucks Inc.
230 Brownlow Avenue
Suite 120
Dartmouth NS B3B 0G5
(902)468-6777

FAX:

Contact:
Phone: 780-307-2876
Email:

Product and Description	Quantity	Unit	Price	Ext Price
Serial Number: 1XKWDB9X26R987820	Customer Unit: 7820			
Item: Truck	Meter Amount: 29,018			
Description: 2006 KENWORTH CONSTRUT				

Oper: 10 Code: SVC-2090 Description: SALVAGE

Subject: CONCERN
Notes:

SALVAGE & CVIP INSPECTION
WHEELS OFF

Subject: customer repairs
Notes:

PERFORMED SALVAGE INSPECTION , REPORTED
FAILS.PROVIDED PASS DOCUMENTS AND CVIP
STICKER ON THE UNIT.
INSTALLED WHEELS, TORQUE WHEELS TO 500 LB FT,
ADJUSTED ALL BRAKES
2 RIGHT INNER TIRE IS REPAIRED

Parts:	128.57
Labour:	786.50
Misc:	1,156.60
Operation Sub-Total:	2,071.67

Line: 1				1,156.60
Misc Code: SHP				
Description: Shop Supplies				
Line: 2				786.50
Work Code: REP				
Description: REP Repair				
Line: 5	1.00	EA	128.57	128.57
Item: k/tire-repair				
Description: tire repair				

Oper: 20 Code: SVC-2010 Description: CHECK

Subject: CONCERN
Notes:

CHECK REAR HOUSING FOR STRAIGHT

Subject: REPAIRS DONE
Notes:

CHECKED BOTH REAR DRIVE HOUSINGS FOR
STRAIGHT, #1 AXLE SLIGHTLY OUT 1/4 BUT STILL IN
SPEC. # 2 ALXLE IS 0

Parts:	0.00
Labour:	462.00
Misc:	0.00
Operation Sub-Total:	462.00

Product and Description	Quantity	Unit	Price	Ext Price
Line: 6 Work Code: REP Description: REP Repair				462.00
Oper: 30 Code: SVC-2060 Description: INSPECT				
Subject: CONCERN Notes:			Subject: REPAIRS DONE Notes:	
CAB INSPECTION SUBLET			PERFORMED CAB INSPECTION (SUBLET SALE)	
			Parts: 450.00 Labour: 0.00 Misc: 0.00 Operation Sub-Total: 450.00	
Line: 8 Item: CAB Description: INSPECTION	1.00	EA	450.00	450.00
Oper: 40 Code: SVC-2020 Description: FRONT ALIGNMENT				
Subject: CONCERN Notes:			Subject: REPAIR DONE Notes:	
FRONT STEER WHEEL ALIGNMENT			CHECKED AND ADJUSTED FRONT ALIGNMENT,ADJUSTED CASTER AND TOE,REMOVED AND REPLACED LF UBOLTS TO CORRECT CASTER,TORQUED UBOLTS TO 320 FT LBS	
			Parts: 43.66 Labour: 357.50 Misc: 0.00 Operation Sub-Total: 401.16	
Line: 9 Work Code: REP Description: REP Repair				357.50
Line: 10 Item: STA-202-1228 Description: Rr 3/4 X 28 Threaded Rod	2.00	EA	20.01	40.02
Line: 11 Item: SPR-175-012 Description: U-Bolt Washer 3/4	4.00	EA1	0.27	1.08
Line: 12 Item: SPR-122-5012 Description: 3/4 Deep Nuts	4.00	EA1	0.64	2.56
Oper: 50 Code: SVC-2020 Description: REAR ALIGNMENT				
Subject: CONCERN Notes:			Subject: REPAIRS DONE Notes:	
REAR TANDEM ALIGNMENT			CHECKED REAR ALIGNMENT,NO ADJUSTMENT REQUIRED	
			Parts: 0.00 Labour: 214.50 Misc: 0.00 Operation Sub-Total: 214.50	

Product and Description	Quantity	Unit	Price	Ext Price
Line: 13				214.50
Work Code: REP				
Description: REP Repair				
Oper: 60	Code: SVC-2080	Description: CHECK		
Subject: CUSTOMER REQUEST		Subject: REPAIS DONE		
Notes:		Notes:		
CHECK FRAME AND REPORT BACK TO CUSTOMER		CHECKED AND REPORT FRAME CHECK REPORT		
		Parts:	0.00	
		Labour:	429.00	
		Misc:	0.00	
		Operation Sub-Total:	429.00	
Line: 14				429.00
Work Code: REP				
Description: REP Repair				
Oper: 80	Code: SVC-1000	Description: SIDESWAY		
Subject: CONCERN		Subject: REPAIRS DONE		
Notes:		Notes:		
REPAIR SIDESWAY		SET UP EQUIPMENT AND PUSH TO FIX SIDESWAY. NOW AT -2MM TO THE RIGHT(WITHIN SPEC)		
		Parts:	0.00	
		Labour:	1,232.00	
		Misc:	0.00	
		Operation Sub-Total:	1,232.00	
Line: 15				1,232.00
Work Code: REP				
Description: REP Repair				
Oper: 90	Code: SVC-1000	Description: TWIST		
Subject: CONCERN		Subject: repairs done		
Notes:		Notes:		
REPAIR TWIST		REPAIRED -3/4" TWIST TO THE RIGHT.BOUNCE UNIT AND RECHECK TWIST.TWIST AT 0.RF SITS 1/8" LOW DUE TO WEAK RF SPRING.RECHECK SIDESWAY AFTER REPAIRED TWIST.		
		Parts:	0.00	
		Labour:	1,232.00	
		Misc:	0.00	
		Operation Sub-Total:	1,232.00	
Line: 16				1,232.00
Work Code: FRM				
Description: FRM Frame Rack Repair				
Oper: 100	Code: SVC-3030	Description: EXHAUST		

Product and Description	Quantity	Unit	Price	Ext Price
Subject: CONCERN Notes: INSTALL MISSING EXHAUST CLAMP FROM FLEX PIPE ON RH/S PAST TURBO Subject: REPAIRS DONE Notes: INSTALLED CLAMP ON FLEX PIPE THAT WAS MISSING BY TURBO				
				Parts: 10.57 Labour: 143.00 Misc: 0.00 Operation Sub-Total: 153.57
Line: 18				143.00
Work Code: REP				
Description: REP Repair				
Line: 19	1.00	EA1	10.57	10.57
Item: WAL-35775				
Description: Hardware-Clamp-U				
Oper: 110 Code: SVC-3000 Description: TORQUE ARM				
Subject: CONCERN Notes: REPLACE TORQUE ARMS OVER #1 DRIVE AXLE Subject: REPAIRS DONE Notes: Removed torque arms over #1 drive. Replaced bushings, reinstalled torque arms with new hardware. Reinstalled alignment shims. Painted all new bolts with orange tamper paste.				
				Parts: 525.92 Labour: 429.00 Misc: 0.00 Operation Sub-Total: 954.92
Line: 20				429.00
Work Code: REP				
Description: REP Repair				
Line: 23	4.00	EA	124.15	496.60
Item: BAT-321-369				
Description: Torque Arm Bushing				
Line: 24	4.00	EA1	2.65	10.60
Item: HPC-079-683				
Description: 5/8X4 Hex Hd Cap Screw G				
Line: 25	4.00	EA1	2.72	10.88
Item: HPC-079-685				
Description: 5/8X5 Hex Hd Cap Screw G				
Line: 26	8.00	EA1	0.63	5.04
Item: HPC-063-524				
Description: 5/8-11 Stever Locknut Gr				
Line: 27	8.00	EA1	0.35	2.80
Item: HPC-101-124				
Description: Hd Tension Washer 5/8				
Oper: 120 Code: SVC-5020 Description: AIR BAGS				

Product and Description	Quantity	Unit	Price	Ext Price
Subject: CONCERN		Subject: REPAIRS DONE		
Notes:		Notes:		
REPLACE AIR BAGS:		REMOVED AIR BAG AND CROSSOVER HOSES		
BOTH FRONTS ON #1 DRIVE		REMOVED RUST SCALE FROM FRAME		
BOTH FRONTS ON #2 DRIVE		REMOVED BOLTS FOR BROKEN P CLAMPS		
LR ON #1 DRIVE		INSTALLED NEW AIR BAGS AND CROSSOVER HOSES		
		JOB REQUIRED MORE TIME DUE TO BADLY SEIZED		
		HARDWARE AND HOSE CONNNECTORS, , AXLE 2 LEFT		
		REAR AIR BAG HAD TO HAVE BRACKETS		
		STRAIGHTEND AND REINSTALLED WITHOUT BREAKING		
		AIR BAG.		
			Parts:	1,728.47
			Labour:	1,144.00
			Misc:	0.00
			Operation Sub-Total:	2,872.47
				1,144.00
Line: 28				
Work Code: REP				
Description: REP Repair				
Line: 31	2.00	EA1	7.26	14.52
Item: FAI-1472-6C				
Description: Airbrake Tee;3/8X3/8 Mpt				
Line: 32	2.00	EA1	1.76	3.52
Item: FAI-120-CB				
Description: Brass Adapter;3/8 Fptx1/				
Line: 33	1.00	EA1	6.32	6.32
Item: FAI-PC1469-4B				
Description: Dot Ptc 90Elbow;1/4X1/4M				
Line: 34	1.00	EA1	7.82	7.82
Item: FAI-PC1469-6B				
Description: Dot Ptc 90Elbow;3/8X1/4M				
Line: 35	10.00	EA1	0.67	6.70
Item: HPC-079-586				
Description: 1/2X2 Hex Hd Cap Screw G				
Line: 36	15.00	EA1	0.47	7.05
Item: HPC-108-522				
Description: Nylon Lock Nut 1/2 Gr8 U				
Line: 37	25.00	EA1	0.20	5.00
Item: HPC-101-122				
Description: Hd Tension Washer 1/2				
Line: 38	6.00	EA1	1.57	9.42
Item: FAI-TS16R-24				
Description: Rubber Cushion Strap;1-1				
Line: 39	12.00	FT	0.81	9.72
Item: FAI-SYN-3/8				
Description: Dot Airbrake Tube;3/8 Bl				
Line: 40	5.00	EA1	170.21	851.05
Item: MER-EAS9547				
Description: Air Spring				
Line: 41	3.00	EA	267.72	803.16
Item: 177.3060K				
Description: AIR BAG HOSE				
Line: 42	1.00	EA1	0.85	0.85
Item: HPC-079-588				
Description: 1/2X2-1/2 Hex Hd Cap Scr				
Line: 43	2.00	EA1	0.47	0.94
Item: HPC-108-522				
Description: Nylon Lock Nut 1/2 Gr8 U				
Line: 44	1.00	EA1	0.67	0.67
Item: HPC-079-586				
Description: 1/2X2 Hex Hd Cap Screw G				
Line: 45	2.00	EA1	0.19	0.38
Item: FAI-1460-4				
Description: Airbrake Comp Sleeve;1/4				

Product and Description	Quantity	Unit	Price	Ext Price
Line: 46	5.00	EA1	0.27	1.35
Item: FAI-1460-6				
Description: Airbrake Comp Sleeve;3/8				

Oper: 130 Code: SVC-1000 Description: AIR TANK

Subject: CONCERN

Subject: REPAIRS DONE

Notes:

Notes:

REPLACE LH/S INNER AIR TANK DRAIN VALVE

REPLACED LH/S INNER AIR TANK DRAIN VALVE

Parts: 14.26
Labour: 71.50
Misc: 0.00
Operation Sub-Total: 85.76

Line: 47 71.50

Work Code: REP

Description: REP Repair

Line: 48 1.00 EA1 14.26 14.26

Item: FAI-241-B

Description: Ground Key Plug Valve;1/

Oper: 140 Code: SVC-1060 Description: GLAD HAND

Subject: CONCERN

Subject: REPAIRS DONE

Notes:

Notes:

REPLACE GLAD HAND SEALS

NEW GLADHAND SEALS INSTALLED

Parts: 29.49
Labour: 71.50
Misc: 0.00
Operation Sub-Total: 100.99

Line: 49 71.50

Work Code: REP

Description: REP Repair

Line: 50 2.00 EA1 1.61 3.22

Item: HDX-10024

Description: Seal-Gladhand

Line: 51 6.00 EA1 0.96 5.76

Item: MFD-S-100

Description: Brake Mate For 5/8 Pushr

Line: 52 1.00 EA1 8.16 8.16

Item: FAI-1495B-L

Description: Terminal Bolt;1/4 Fpt;Lo

Line: 53 1.00 EA1 9.06 9.06

Item: FAI-1469-10D

Description: Airbrake 90Elb;5/8X1/2 M

Line: 54 1.00 EA1 3.29 3.29

Item: FAI-1469-4B

Description: Airbrake 90Elb;1/4X1/4 M

Oper: 150 Code: SVC-3000 Description: PUSH ROD

Product and Description	Quantity	Unit	Price	Ext Price
Subject: CONCERN Notes: SECURE BOTH PUSH ROD JAM NUTS - LOOSE ON #2 DRIVE Subject: REPAIRS DONE Notes: SECURED BOTH PUSH ROD JAM NUTS - LOOSE ON #2 DRIVE				
Parts: 0.00 Labour: 71.50 Misc: 0.00 Operation Sub-Total: 71.50				
Line: 55 Work Code: REP Description: REP Repair				71.50
Oper: 160 Code: SVC-1030 Description: STROKE Subject: CONCERN Notes: INSTALL MISSING STROKE INDICATORS Subject: REPAIRS DONE Notes: STROKE INDICATORS INSTALLED				
Parts: 0.00 Labour: 71.50 Misc: 0.00 Operation Sub-Total: 71.50				
Line: 56 Work Code: REP Description: REP Repair				71.50
Oper: 170 Code: SVC-1000 Description: CLEVIS Subject: CONCERN Notes: FREE UP CLEVIS PINS ON STEER AXLE AND #1 DRIVE AXLE Subject: REPAIRS DONE Notes: FREED UP CLEVIS PINS AS NEEDED				
Parts: 0.00 Labour: 143.00 Misc: 0.00 Operation Sub-Total: 143.00				
Line: 57 Work Code: REP Description: REP Repair				143.00
Oper: 180 Code: SVC-1090 Description: BRAKE Subject: CONCERN Notes: REPLACE #1R BRAKE DRUM Subject: REPAIRS DONE Notes: REPLACED BRAKE DRUM ON #1 DRIVE RHS. TORQUED WHEELS TO 500 FT.LBS.. FILLED OUT TORQUE SHEET AND ATTACHED TO WORK ORDER.				

Product and Description	Quantity	Unit	Price	Ext Price
			Parts:	109.95
			Labour:	71.50
			Misc:	0.00
			Operation Sub-Total:	181.45

Line: 58
Work Code: REP
Description: REP Repair
Line: 59
Item: FLS-93600
Description: 93600 Brake Drum 16.5 X 7

1.00 EA1 109.95 109.95

Oper: 190 Code: SVC-1000 Description: SLACK ADJUSTERS

Subject: CONCERN
Notes:

Subject: REPAIRS DONE
Notes:

REPLACE #1 DRIVE RHS SLACK ADJUSTER

REMOVE AND REPLACED SLACK ADJUSTER ON #1
DRIVE RHS.
INSTALLED NEW COTTER PIN, GREASED, SET BRAKE
TO 38MM

Parts: 123.95
Labour: 214.50
Misc: 0.00
Operation Sub-Total: 338.45

Line: 60
Work Code: REP
Description: REP Repair
Line: 61
Item: HDX-40010155
Description: Aba Kit

1.00 EA1 123.95 123.95

Oper: 210 Code: SVC-5020 Description: FIRE EXTINGUISHER

Subject: CONCERN
Notes:

Subject: REPAIRS DONE
Notes:

INSTALL FIRE EXTINGUISHER

INSTALLED FIRE EXSTINGUISHER BY DRIVER SEAT

Parts: 90.49
Labour: 71.50
Misc: 0.00
Operation Sub-Total: 161.99

Line: 62
Work Code: REP
Description: REP Repair
Line: 63
Item: MDS-B417TX
Description: 2.5Lb Abc Fire Ext. W/V

1.00 EA 90.49 90.49

Oper: 220 Code: SVC-5020 Description: HAZARD KIT

Subject: CONCERN
Notes:

Subject: REPAIRS DONE
Notes:

INSTALL HAZARD KIT

PUT HAZARD KIT IN LHS BUNK STORAGE
COMPARMENT.

Parts: 33.91

Product and Description	Quantity	Unit	Price	Ext Price
			Labour:	0.00
			Misc:	0.00
			Operation Sub-Total:	33.91
Line: 64				0.00
Work Code: REP				
Description: REP Repair				
Line: 65	1.00	EA1	33.91	33.91
Item: UBL-RW03K				
Description: Reflective Warning Trian				
Oper: 230	Code: SVC-1000	Description: DIAG HORN		
Subject: CONCERN		Subject: REPAIRS DONE		
Notes:		Notes:		
DIAG FOR HORN NOT WORKING		DIAGNOSE HORN NOT WORKING. CHECKED FUSES AND RELAYS FOUNT WIRE DISCONNECTED INSIDE STEERING WHEEL. REPAIRED WIRE. HORN WORKS		
			Parts:	0.00
			Labour:	143.00
			Misc:	0.00
			Operation Sub-Total:	143.00
Line: 66				143.00
Work Code: REP				
Description: REP Repair				
Oper: 240	Code: SVC-2060	Description: WIPERS		
Subject: CONCERN		Subject: REPAIRS DONE		
Notes:		Notes:		
REPLACE WIPER BLADES		INSTALLED NEW WIPER BLADES		
			Parts:	35.72
			Labour:	71.50
			Misc:	0.00
			Operation Sub-Total:	107.22
Line: 67				71.50
Work Code: REP				
Description: REP Repair				
Line: 68	2.00	EA1	17.86	35.72
Item: TRI-63-151				
Description: Trico Hd / Five Bar				
Oper: 250	Code: SVC-2060	Description: DOORS		
Subject: CONCERN		Subject: REPAIRS DONE		
Notes:		Notes:		
FREE UP SEIZED HEADACHE RACK CENTER AND RH/S COMPARTMENT DOORS		AIR HAMMERED DOOR HANDLES FREE ON HEADACHE RACK STORAGE COMPARTMENTS, LUBE HANDLES.		
			Parts:	0.00
			Labour:	143.00
			Misc:	0.00

Product and Description	Quantity	Unit	Price	Ext Price
Operation Sub-Total:				143.00

Line: 69
Work Code: REP
Description: REP Repair

Oper: 260 Code: SVC-1060 Description: DIAG LIGHTS

Subject: CONCERN
Notes:

Subject: 2025/08/25 10:54:10
(dave.gagnon@partsfortrucks.com)
Notes:

DIAG FOR REVERSE LIGHTS NOT WORKING
REPLACE AND REWIRE

DIAGNOSE REVERSE LIGHT NOT WORKING. FOUND
REVERSE SWITCH ON TRANSMISSION NO LONGR
WORKING. PIG TAIL AND LHS REVERSE LIGHT WIRING
IS CORRODED. WILL NEED NEW REVERSE LIGHT AND
PIGTAIL
INSTALLED NEW REVERSE LIGHT
WIRED UP NEW PIGTAIL
TIED UP ALL ELECTRICAL.

Parts: 50.77
Labour: 429.00
Misc: 0.00

Operation Sub-Total: 479.77

Line: 70
Work Code: REP
Description: REP Repair

Line: 75
Item: GRT-62271
Description: 4" Back Up Lamp Clear

1.00 EA1 10.14 10.14

Line: 76
Item: UBL-PT9530
Description: Double Contact Right Ang

1.00 EA1 1.13 1.13

Line: 77
Item: k/w-REVE SWITCH
Description: SWITCH

1.00 EA 39.50 39.50

Oper: 270 Code: SVC-1060 Description: DIAG LIGHTS

Subject: CONCERN
Notes:

Subject: REPAIRS DONE
Notes:

DIAG FOR REAR WORK LIGHTS NOT WORKING
REMOVE LIGHTS

DIAGNOSE FOR BOTH REAR WORK LIGHTS INOP.
FOUND THAT WIRES TO BOTH WORK LIGHTS HAVE
BEEN CUT. LOOKED FOR OTHER END OF WIRE. DID
NOT FIND. WORK LIGHTS WILL NEED TO BE REMOVED
OR COMPLETELY REWIRED
REMOVED REAR WORK LIGHTS AS PER CUSTOMER.
PUT WORK LIGHTS IN BUNK

Parts: 0.00
Labour: 214.50
Misc: 0.00

Operation Sub-Total: 214.50

Line: 78
Work Code: REP
Description: REP Repair

Oper: 280 Code: SVC-1060 Description: DIAG SPOT LIGHT

Product and Description		Quantity	Unit	Price	Ext Price
Subject: CONCERN Notes: DIAG FOR LH/S SPOT LIGHT NOT WORKING		Subject: REPAIRS DONE Notes: INSPECT LHS SPOT LIGHT FOR NOT WORKING. TOOK SWITCH APART TO CHECK FOR POWER. FOUNT INTERNAL CONTACT COVERED IN GREASE. CLEANED GREASE OFF AND TESTE. LIGHT NOW WORKS.			
				Parts:	0.00
				Labour:	143.00
				Misc:	0.00
				Operation Sub-Total:	143.00
Line: 81					143.00
Work Code: REP					
Description: REP Repair					
Oper: 290	Code: SVC-1060	Description: MARKER LIGHT			
Subject: CONCERN Notes: REPLACE 3 MARKER LIGHTS ON RH/S		Subject: REPAIRS DONE Notes: REMOVED BROKEN BOLT AND CLEAN OUT HOLE WITH DRILL AND INSTALL NEW BOLT. REMOVED AND REPLACED 3 LIGHTS ON RHS AIR FILTER			
				Parts:	68.58
				Labour:	214.50
				Misc:	0.00
				Operation Sub-Total:	283.08
Line: 82					214.50
Work Code: REP					
Description: REP Repair					
Line: 84		3.00	EA1	4.91	14.73
Item: UBL-LED2000-10AP					
Description: Led 2" Rd Marker Lamp Am					
Line: 85		1.00	EA1	53.85	53.85
Item: AUT-571.LD322A31					
Description: Cab Marker Light Led					
Oper: 300	Code: SVC-1060	Description: WIRES			
Subject: CONCERN Notes: REPAIR EXPOSED ELECTRICAL WIRES GOING DOWN BOTH SIDE MIRRORS		Subject: REPAIRS DONE Notes: - WIRES ARE NOT CONNECTED TO ANYTHING REMOVED CORRODED WIRING AND SHRINKED TUBED ENDS			
				Parts:	0.00
				Labour:	100.10
				Misc:	0.00
				Operation Sub-Total:	100.10
Line: 86					100.10
Work Code: REP					
Description: REP Repair					
Oper: 310	Code: SVC-2060	Description: HOOD			

Product and Description		Quantity	Unit	Price	Ext Price
Subject: CONCERN		Subject: REPAIRS DONE			
Notes:		Notes:			
REPLACE HOOD BUSHINGS, GUIDES AND STRAIGHTEN PLATE		STRAIGHTENED BRACKET, CLEANED, PAINTED. REMOVED ALL 4 HOOD GUIDES, . REMOVED HOOD BUSHING, . INSTALLED HOOD GUIDE AND REPLACED HOOD BUSHINGS, LINED UP HOOD			
				Parts:	121.86
				Labour:	643.50
				Misc:	0.00
Operation Sub-Total:				765.36	
Line: 87		643.50			
Work Code: REP					
Description: REP Repair					
Line: 89		2.00	EA	27.41	54.82
Item: M13472K					
Description: HOOD BUSHING					
Line: 90		4.00	EA	16.76	67.04
Item: M59281					
Description: HOOD GUIDE					
Oper: 320		Code: SVC-2060		Description: CAB	
Subject: CONCERN		Subject: REPAIRS DONE			
Notes:		Notes:			
FREE UP LATCH ON BOTH CARGO COMPARTMENT REPAIR LH/S SLEEPER JOCKY BOX		FREE UP AND LUBE 2 LATCHS ON LH AND RH STORAGE-STEPS. REMOVE COVER ON LH BUNK STORAGE DOOR AND FREE UP DOOR LATCH. RESUCURE DOOR SEAL ON DOOR.			
				Parts:	0.00
				Labour:	143.00
				Misc:	0.00
Operation Sub-Total:				143.00	
Line: 91		143.00			
Work Code: REP					
Description: REP Repair					
Oper: 330		Code: SVC-2060		Description: CAB SHOCK	
Subject: CONCERN		Subject: REPAIRS DONE			
Notes:		Notes:			
SECURE RH/S CAB SHOCK		TIGHTEN UP/SECURE LOWER SHOCK BOLT			
				Parts:	0.00
				Labour:	28.60
				Misc:	0.00
Operation Sub-Total:				28.60	
Line: 92		28.60			
Work Code: REP					
Description: REP Repair					
Oper: 340		Code: SVC-3000		Description: X-MEMBER	

Product and Description		Quantity	Unit	Price	Ext Price
Subject: CONCERN Notes: REPLACE BROKEN BOLT ON LH/S REAR X-MEMBER		Subject: REPAIRS DONE Notes: REPLACED BROKEN BOLT ON LH/S REAR X-MEMBER			
		Parts: Labour: Misc: Operation Sub-Total:			1.40 35.75 0.00 37.15
Line: 95 Work Code: REP Description: REP Repair		35.75			
Line: 96 Item: HPC-063-522 Description: 1/2-13 Stover Locknut Gr	1.00	EA1	0.33	0.33	
Line: 97 Item: HPC-079-586 Description: 1/2X2 Hex Hd Cap Screw G	1.00	EA1	0.67	0.67	
Line: 98 Item: HPC-101-122 Description: Hd Tension Washer 1/2	2.00	EA1	0.20	0.40	
Oper: 350 Code: SVC-2060 Description: BUNK GLASS					
Subject: CONCERN Notes: REPLACE LEFT AND RIGHT UPPER BUNK GLASS					Parts: 3,998.40 Labour: 0.00 Misc: 0.00 Operation Sub-Total: 3,998.40
Line: 99 Item: K/W-R44-1065-5 LH/R44-1065-5 R Description: GLASS-SLEEPER TINTED	1.00	EA	2,762.62	2,762.62	
Line: 100 Item: K/W-K207-1086 Description: SEAL-WEATHERSTRIP	2.00	EA	399.89	799.78	
Line: 101 Item: all weat-glass Description: 2 cab upper glass	2.00	EA	218.00	436.00	
Oper: 360 Code: SVC-1060 Description: DIAG MIRROR					
Subject: CONCERN Notes: DIAG FOR BOTH POWER MIRRORS ONLY MOVE IN DIRECTION REPLACE SWITCH		Subject: REPAIRS DONE Notes: INSPECTED WIRING NO SIGNS OF DAMAGE OR CORROSION , SWITCH NEEDS TO BE REPLACED . REPLACED WITH NEW AND TESTED			Parts: 182.92 Labour: 214.50 Misc: 0.00 Operation Sub-Total: 397.42

Product and Description	Quantity	Unit	Price	Ext Price
Line: 102 Work Code: REP Description: REP Repair				214.50
Line: 104 Item: AUT-577.59521 Description: Mirror Switch Kenworth	1.00	EA	182.92	182.92
Oper: 370 Code: SVC-2060 Description: SEAT BELTS				
Subject: CONCERN Notes: REPLACE DRIVER SEAT BELT	Subject: REPAIRS DONE Notes: INSTALLED NEW DRIVERS SIDE SEAT BELT AND RECEIVER.REINSTALL PANEL			
Parts:				299.04
Labour:				214.50
Misc:				0.00
Operation Sub-Total:				513.54
Line: 105 Work Code: REP Description: REP Repair				214.50
Line: 107 Item: KEN-S84-1070-400 Description: SEAT BELT	1.00	EA	299.04	299.04
Oper: 380 Code: SVC-5060 Description: WELD				
Subject: CONCERN Notes: WELD LH/S FENDER SPLIT	Subject: REPAIRS DONE Notes: REMOVED FENDER BOLT AND WELD UP STAINLESS STEEL FENDER . INSTALLED NEW BOLT.			
Parts:				0.00
Labour:				214.50
Misc:				0.00
Operation Sub-Total:				214.50
Line: 108 Work Code: REP Description: REP Repair				214.50
Oper: 390 Code: SVC-1030 Description: TIRES				
Subject: CONCERN Notes: ADJUST ALL TIRE PRESSURE TO SPEC	Subject: REPAIRS DONE Notes: ADJUSTED ALL TIRE PRESSURE TO SPECS			
Parts:				0.00
Labour:				143.00
Misc:				0.00
Operation Sub-Total:				143.00
Line: 109 Work Code: REP Description: REP Repair				143.00

Product and Description		Quantity	Unit	Price	Ext Price
Oper: 400	Code: SVC-1010	Description: WHEEL SEAL			
Subject: CONCERN		Subject: REPAIRS DONE			
Notes:		Notes:			
REPLACE #1 DRIVE LEFT LEAKING WHEEL SEAL		REPLACE LEAKING WHEEL SEALS AT # 1 DRIVE AXLE LEFT , TOPPED UP OIL.			
				Parts:	122.14
				Labour:	214.50
				Misc:	0.00
				Operation Sub-Total:	336.64
Line: 110					
Work Code: REP					
Description: REP Repair					
Line: 113					
Item: STE-392-9131		1.00	EA1	60.95	60.95
Description: 3929131Drive Wheel Set					
Line: 114					
Item: STE-330-3111		1.00	EA1	3.81	3.81
Description: Gasket					
Line: 115					
Item: HPC-109-524		8.00	EA	0.99	7.92
Description: 5/8-18Nyl Insert Stop					
Line: 116					
Item: CAS-01024-01-SHOP		2.00	EA	24.73	49.46
Description: Syngear 75/90 Per Litre					
Oper: 410					
Code: SVC-1000		Description: 5TH WHEEL			
Subject: CONCERN		Subject: REPAIRS DONE			
Notes:		Notes:			
5TH WHEEL IS SEIZED ON SLIDER TRACK FREE UP AND CHECK OPERATION		FREED UP SEIZED SLIDER ON TRACK			
				Parts:	262.37
				Labour:	715.00
				Misc:	0.00
				Operation Sub-Total:	977.37
Line: 117					
Work Code: REP					
Description: REP Repair					
Line: 123					
Item: HPC-079-677		16.00	EA1	1.62	25.92
Description: 5/8X2-1/2 Hex Hd Cap Scr					
Line: 124					
Item: HPC-063-524		16.00	EA1	0.63	10.08
Description: 5/8-11 Stover Locknut Gr					
Line: 125					
Item: HPC-101-124		32.00	EA1	0.35	11.20
Description: Hd Tension Washer 5/8					
Line: 126					
Item: HOL-XA-11699-B		1.00	EA1	212.04	212.04
Description: Air Cylinder In Box					
Line: 127					
Item: FAI-X124-B		1.00	EA1	2.47	2.47
Description: Brass 45 Elbow;1/4 Mptx1					
Line: 128					
Item: HPC-063-522		2.00	EA1	0.33	0.66
Description: 1/2-13 Stover Locknut Gr					

Product and Description	Quantity	Unit	Price	Ext Price
-------------------------	----------	------	-------	-----------

Oper: 420 Code: SVC-1000 Description: SLIDER

Subject: CONCERN
Notes:

Subject: REPAIRS DONE
Notes:

ADJUST 5TH WHEEL AND SERVICE

ADJUSTED 5TH WHEEL AND SERVICE

Parts: 57.76
Labour: 71.50
Misc: 0.00
Operation Sub-Total: 129.26

Line: 129				71.50
Work Code: REP				
Description: REP Repair				
Line: 130	1.00	EA	25.07	25.07
Item: AUT-KP155K				
Description: Sliding Coiled Air Hose				
Line: 131	1.00	EA	25.07	25.07
Item: AUT-KP155K				
Description: Sliding Coiled Air Hose				
Line: 132	1.00	EA1	7.62	7.62
Item: FAI-PC1462-4				
Description: Dot Plc Union;1/4				

Oper: 430 Code: SVC-1000 Description: 5TH WHEEL

Subject: CONCERN
Notes:

Subject: REPAIRS DONE
Notes:

REPLACED 5TH WHEEL SLIDER AIR LINE

REPLACE 5TH WHEEL SLIDER AIR LINE

Parts: 0.00
Labour: 286.00
Misc: 0.00
Operation Sub-Total: 286.00

Line: 133				286.00
Work Code: REP				
Description: REP Repair				

Net Amount 21,245.75
Misc. Charges 0.00
Freight 0.00
Sales Tax 1,062.29
Sales Tax 2 0.00
Invoice Total 22,308.04

Notes

THIS DOCUMENT IS NOT AN INVOICE

*** WHEELS MUST BE RE-TORQUED BY A QUALIFIED INDIVIDUAL WITHIN 100 KM ***

The company does not assume responsibility for any vehicle left for repairs, storage, or other purposes, or for any

articles left in vehicles. Vehicles are driven by our employees at the owner's risk. THE UNDERSIGNED HEREBY
ACKNOWLEDGES.

CUSTOMER SIGNATURE: _____



CERTIFICATE NUMBER

Salvage Vehicle Inspection Certificate Traffic Safety Act

PART 1 - VEHICLE OWNER AND VEHICLE IDENTIFICATION

Vehicle Type:	Truck	Seating Capacity:	
GVW:		Brake Type:	Air
Owner Name:	COLE SIEGLE		
Address:	P.O. BOX 3364		
City:	HIGH PRAIRIE	Province:	AB
		Postal Code:	T0G1E0
Telephone Number:	(780) 307-2876		
Vehicle Identification Number:	1XKWDB9X26R987820		
Make:	Kenworth	Model:	Construct
Year:	2006	Unit Number:	
Odometer:	29018 KM	Licence Plate Number:	08P037
		Province:	AB

IT IS AN OFFENCE TO FALSIFY AN INSPECTION CERTIFICATE

PART 2 - CERTIFICATION

I certify the vehicle described in Part 1 has passed the inspections and tests established under the Traffic Safety Act for a Salvage Vehicle.

Structural Facility Name:	Facility Number:
Parts for Trucks, Inc.	18979
Structural Technician Name:	Technician Number:
David Martin	B2795
Structural Technician Signature: <i>David Martin</i>	Inspection Date: 2025/06/20
Mechanical Facility Name:	Facility Number:
Parts for Trucks, Inc.	18979
Mechanical Technician Name:	Technician Number:
Brandon Rideout	C0820
Mechanical Technician Signature: <i>Brandon Rideout</i>	Inspection Date: 2025/06/20

NOTICE TO VEHICLE OWNER

1. This inspection certificate expires after 14 days from the inspection date. After 14 days, a complete re-inspection of the vehicle is required.
2. The original of this Certificate must be presented to an Alberta Registry Agent within 14 days; however, there is no requirement to register the vehicle when the certificate is presented.


CERTIFICATE NUMBER

Commercial Vehicle Inspection Certificate

Traffic Safety Act

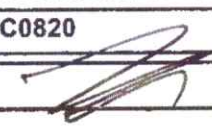
PART 1 - VEHICLE OWNER AND VEHICLE IDENTIFICATION

Vehicle Type:	Truck	Seating Capacity:		
GVW:		Brake Type:	Air	
Owner Name:	COLE SIEGLE			
Address:	P.O. BOX 3364			
City:	HIGH PRAIRIE	Province:	AB	Postal Code: T0G1E0
Telephone Number:	(780) 307-2876			
Vehicle Identification Number:	1XKWDB9X26R987820			
Make:	Kenworth	Model:	Construct	
Year:	2006	Unit Number:		
Odometer:	29018 KM	Licence Plate Number:	08P037	Province: AB

IT IS AN OFFENCE TO FALSIFY AN INSPECTION CERTIFICATE

PART 2 - CERTIFICATION

I certify the vehicle described in Part 1 has passed the inspections and tests established under the Traffic Safety Act for a Commercial Vehicle.

Inspection Facility Name:	Facility Number:
Parts for Trucks, Inc.	18979
Inspection Technician Name:	Technician Number:
Brandon Rideout	C0820
Inspection Technician Signature:	
Inspection Date:	2025/06/20

stan.aline@sasktel.net Ph 931-6612
3246 Millar Avenue
Saskatoon, Saskatchewan S7K 5Y2

Sold to CANADA

COLE SIEGLE

BOX 3364
HIGH PRAIRIE, SK T0G 1E0

INVOICE

Invoice No.: 71087
Date: 26/03/2025
Page: 1
Re: Order No.

Vehicle Information:

Make/Model	KW W900B
Unit #	-
Serial #	-
License	-
Odometer Reading	-
Technician	-

Business No.: 121835466RT0001

Sold By:

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
		1	W900B HOOD FREIGHT	G G	8,379.00	8,379.00 1,480.00
			Subtotal:			9,859.00
			G - GST 5.00% GST			492.95
A-Line Frame & Alignment Services GST: #121835466						
NOTICE: Units and contents left at Owners risk. "TOTAL" INDEBTEDNESS ACCEPTED: Signature:						
					Total Amount	10,351.95