



# Vehicle History Summary

Fleet #	T14
Registration	14KJP
Make	MACK
Model	Granite
VIN / Chassis #	6FMN12H69FD806192
Build Date	02/2015

Date	Reading / Units	Type / Repairer Notes	Repairer
22/01/2026	760,121 kms	<b>Rotate</b> T-812 Tyre rotation	Ocean Tyres
11/11/2025	758,967 kms	<b>Bullbar</b> R-3386 Grind back sharp edges	
13/10/2025	758,553 kms	<b>NHVR Inspection Checklist</b> I-484	
30/09/2025	785,463 kms	<b>Windscreen</b> R-3358	
28/08/2025		<b>Parts</b> O-263	WTG
12/08/2025		<b>Hoses</b> R-3345 repair burst hose under drivers seat	KJP Workshop - Scarlett Guvyner-Treanor
04/07/2025		<b>Check Over</b> R-3333 2nd axle bags worn and cracking compressor leaking oil tie rod boot leaking - steer axle passenger front iff leaking exhaust cover removed and missing	KJP Workshop - Ethan Sagnol
26/04/2025	756,090 kms	<b>Engine Tune Up</b> R-3322 Tune up complete	
11/03/2025	755,327 kms	<b>exhaust rattle</b> R-3265	
10/12/2024		<b>Parts</b> O-260	WTG
12/11/2024	751,843 kms	<b>New</b> T-758	Ocean Tyres
10/10/2024	748,530 kms	<b>NHVR Inspection Checklist</b> I-408 Braketest and shakers passed.	
01/10/2024	748,313 kms	<b>New</b> T-746	Ocean Tyres
07/08/2024	743,743 kms	<b>B - B Service</b> S-1176 brake test - PASSED removed and flushed SCR unit	KJP workshop - Scott Laburniy
25/07/2024		<b>Parts</b> O-248 Air valve	
10/07/2024	737,871 kms	<b>exhaust elbow, Exhaust Flex, Exhaust leak</b> R-3244 R & R exhaust elbow/flex R & R exhaust clamp R & R chevron	
20/05/2024		<b>Oil Leak</b> R-3220 R & R spinner filter	KJP workshop - Mitchell Breen
21/11/2023	718,619 kms	<b>AC</b> R-3119	KJP workshop - Scott Laburniy

Date	Reading / Units	Type / Repairer Notes	Repairer
		1. Tightened up hose clamps on coolant lines 2. Tested AC system , found AC blower motor to be faulty - Replaced blower motor 3. Tightened up wings on rear of cab 4. Tapped threads for exhaust pressure sensor brakcet in head and refitted	
31/10/2023	716,177 kms	<b>Seat R-3104</b> replace valve replace ride height valve '	KJP workshop - Judd Porter
13/10/2023	715,781 kms	<b>Suspension R-3074</b> replace rear track rods	
03/10/2023	715,446 kms	<b>NHVR Inspection Checklist I-328</b> Brake Test Passed Repaired exhaust mounts Replaced exhaust clamps and flex section Tightened air tank mounts	KJP Workshop - Craig Hyde
27/09/2023	715,050 kms	<b>batteries, drivers seat R-3071</b> replaced batteries, made new battery hold down clamp, test turntable and adjust handle, hook up to trailer and park up. bring into shed and set up to air out seat did not play up at all	
26/09/2023	714,961 kms	<b>Coolant , coolant leak R-3069</b> replace leaking coolant hose fill land pressure test R & R blown out header tank - fill again and pressure test	KJP workshop - Scott Laburniy
29/08/2023	709,051 kms	<b>Replace T-634</b>	Ocean Tyres
22/08/2023	708,673 kms	<b>Exhaust, Indicators R-3021</b> R & R flasher R & R exhaust clamp refit coolant temp sensor	KJP workshop - Mitchell Breen
03/08/2023	707,049 kms	<b>Exhaust R-2975</b> remove and tig up exhaust elbow and exhaust shoulder repair DPF cover and manufacture brackets remove and replace exhaust stack rubbers	KJP Workshop - Craig Hyde
01/08/2023	707,049 kms	<b>Wheel Alignment R-2993</b> completed wheel alignment	Doug Kretschmer - KJP Haulage, KJP workshop - Scott Laburniy
31/07/2023	707,049 kms	<b>Air Leak , Suspension R-2994</b> R & R RH cab mount R & R both cab shocks R & R cab sway bar R & R torque rods R & R RHF drive shock	Doug Kretschmer - KJP Haulage
26/07/2023	707,049 kms	<b>Headlight, Seat R-2982</b> R & R drive lights unjam drivers seat	KJP workshop - Mitchell Breen
03/07/2023	705,149 kms	<b>Replace T-613</b>	Ocean Tyres
03/07/2023	705,153 kms	<b>Shockabsorbers R-2952</b> R & R front shockies	KJP Workshop - Craig Hyde
21/06/2023	704,166 kms	<b>broken brackets, Welding R-2934</b> manufactured and welded new cab mount	KJP Workshop - Craig Hyde
21/06/2023	704,166 kms	<b>C - C Service S-963</b> Eng Oil - 40L Diff Oil - 42L Gear box Oil - 20L repair strip g-box filter plug fit new air tank strap R & R air tank drain Brake test - PASSED	KJP Workshop - Craig Hyde, KJP workshop - Scott Laburniy
20/06/2023	704,166 kms	<b>eyewash R-2857</b> make new bracket and fit	KJP Workshop - Craig Hyde
08/05/2023	677,670 kms	<b>Air bag, Low Level Water Warning R-2879</b>	KJP workshop - Mark Johnson, KJP workshop - Mitchell Breen, KJP workshop - Scott Laburniy

Date	Reading / Units	Type / Repairer Notes	Repairer
		CC SMITH MECHANICAL REPAIRS 25/04/23 - connect tech tool read out vehicle information, fault codes, found fault mid 128 PSID 72 fmi 3 voltage shorted to lower voltage. inspect fault code mid 128 PID111 FMI 5 current below or open circuit, inspect plug at sensor check for correct voltage supply of 5V & coolant sensor causing alarm, concerned header tank may be causing fault for incorrect reading. 26/04/23 - disconnected control valve, unbolt and removed heat shield, cleaned oil from housing, put new control valve in and tighten bolts, bolt heat shield on and connect valve, started truck and checked for faults on dash. 27/04/23 - low coolant fault came back up, loosen clamp for coolant level sensor and drop down sensor from its position, coolant light dropped out confirmed concern header tank float has sunk in tank. fitted strap to air tank, replaced LH rear air bag	
04/04/2023	667,595 kms	<b>B - B Service</b> S-914 R&R LHS 2nd axel hub seal R&R RHS hub seal Needs air tank support strap, also alot of oil in air tanks. Service & check over on truck Brake Test passed.	KJP workshop - Mitchell Breen
03/04/2023		<b>Registration</b> O-241	
29/03/2023	647,072 kms	<b>hi-low switch</b> R-2815 Replace indicator stalk	KJP workshop - Mark Johnson
14/03/2023	657,671 kms	<b>batteries, Jump Start</b> R-2833 Jump start, hook up charger and load test.	KJP workshop - Scott Laburniy
20/02/2023	645,831 kms	<b>driving lights</b> R-2552 Install Driving lights to Bonnet to match new trucks.	KJP workshop - Mark Johnson
06/02/2023	636,045 kms	<b>flat tyre</b> R-2808	KJP workshop - Scott Laburniy
04/02/2023	635,956 kms	<b>Air bag</b> R-2719 Tested air bag at service, no fault found Tightened up mud guards Replaced Chevrons Repaired broken exhaust flex	KJP workshop - Mark Johnson
04/02/2023	635,956 kms	<b>Alternator, isolator</b> R-2589 Send to Aces to investigate and rectify problem. Mack: Callout - Alternator not charging at Dingo Road House. Jumped field isolation alternator started charging. Had no alternator in stock so needs new alternator (sent to ACES to finish off)	Aces, Mack / Volvo
04/02/2023	635,956 kms	<b>Roof Air Conditioner Batteries</b> R-2800 Removed and tested batteries, Tested No good Kirk got replacements	
04/01/2023		<b>Puncture Repair</b> T-534	Ocean Tyres
12/12/2022	616,373 kms	<b>B - B Service</b> S-878 brake test passed	KJP workshop - Mark Johnson
05/10/2022	11,508 kms	<b>NHVR Inspection Checklist</b> I-253 Brake test passed	
04/10/2022		<b>Registration</b> O-202	
21/09/2022	609,200 kms	<b>Air Leak</b> R-2696 Found Safety valve leaking, replaced safety valve.	KJP workshop - Scott Laburniy
22/08/2022	607,928 kms	<b>ABS, beacon</b> R-2645 R&R beacon & BAS socket	KJP workshop - Mitchell Breen, KJP workshop - Scott Laburniy
16/08/2022	605,960 kms	<b>Drivers seat valve</b> R-2556 Checked on 16/8 22 and no fault found May have been fixed at service	KJP - Internal Workshop
27/07/2022	601,203 kms	<b>Marker</b> R-2622 Replace rear chevron Replace roof light	KJP Workshop - Kade Porter, KJP workshop - Mark Johnson
25/05/2022	589,553 kms	<b>Dash cam, Self Isolating, wheel nut indicators, Windscreen</b> R-2476	KJP workshop - Mark Johnson, KJP workshop - Scott Laburniy

Date	Reading / Units	Type / Repairer Notes	Repairer
		1) No fault found 2) Fitted wheel nut indicator 3) Windscreen ok, must have been done 4) Garmen not plugged in 5) Filled eye wash bottle	
25/05/2022	589,553 kms	<b>Low Beam</b> R-2417	KJP workshop - Mark Johnson, KJP workshop - Scott Laburniy
		Fitted LED globes to low beam Replaced wiper blades	
25/05/2022	589,553 kms	<b>Air hose, Steering</b> R-2511	KJP workshop - Mark Johnson, KJP workshop - Scott Laburniy
		Looking for loose steering complaint, found washers on front drive axle worn. Chased up parts, couldn't find anything in town. Had to send Kade to Mack. Removed bushes & replaced. Find & repaired air leak Conduct Wheel Alignment.	
29/04/2022	584,714 kms	<b>Battery</b> R-2487	Mack / Volvo
		Flat Batteries - Travelled to location, Attempt to start & found would wind over but drop out. Voltage reading 11.2V, tested batteries all reading 11.8V & 200cca except one that tested replace. Replaced the one battery & truck started. Ran truck & checked charge rate of alternator, was 13.4V Reading low as alternator is charging batteries as well as running lights etc.	
19/04/2022	583,109 kms	<b>Dash panel, E-Stop</b> R-2459	KJP workshop - Mark Johnson
		Water in Isolators / E-Stops. No fault found.	
07/04/2022	581,398 kms	<b>Alternator</b> R-2434	KJP workshop - Mark Johnson
		R&R Alternator Charge up Batteries General look over	
24/03/2022	580,277 kms	<b>air suzi coils</b> R-2412	KJP workshop - Ricky Jones
		R&R damaged Suzi Coil & fitting	
03/03/2022	577,617 kms	<b>Grease and Check over, Headlight</b> R-2364	KJP workshop - Mark Johnson, KJP workshop - Wayne Goodlet
		T&R exhaust brake fault R&R OBU valve Diagnose faulty headlight Complete grease, check over, tidy up wiring in chassis rail Adjust brakes	
02/02/2022	574,874 kms	<b>Fan Belt, Idler pully</b> R-2319	
		Replace belt tensioner- Alternator	
27/01/2022	575,881 kms	<b>Rear main seal</b> R-2286	
		Remove gearbox, clutch and flywheel. Clean up oil from bell housing, fix up air leaks, remove air feed line that was leaking. Fit new rear-main seal and air hot line. Reassemble truck.	
27/01/2022	575,859 kms	<b>C - C Service</b> S-653	
		Brake test Passed 3rd axle - RHS rear track rod bush - loose bolt - LHS wheel bearing needs adjusting 2nd axle - Pivot bush bolts loose LH & RH will need WA due to axle shift Checked 3rd axle wheel bearings by hand, no movement Performed WA and tightened pivot bolts, had to spend time freeing up 3rd axle to adjust	
12/01/2022	573,842 kms	<b>AIR LEAKS, hydraulic oil leak</b> R-2215	
		Removed E stop covers, found RHS E stop with water. Cleaned and resealed. Found wires for E stop rubbed through on tailshaft causing vehicle to isolate. Repaired and secured wiring. Rear wheel oil leak - found residue from previous work done, degreased area and cleaned truck. Found air leaking from fitting on gearbox, firewall manifold fitting and hard pipe from compressor to dryer. tried to tighten fitting on pipe. Need to replace pipe - Defer R&R elbow fitting on gearbox.	
11/01/2022	573,840 kms	<b>Lights</b> R-2278	KJP workshop - Judd Porter
		1. Couldn't find fault between clearance lights and indicators. Aces called in to find fault. Found short in rear trailer socket. R&R 2. Found resistor in indicator LHR blown, removed and fault fixed. 3. Panel beat DPF cover as best as possible. Halo tech tig welding brackets in place.	
04/01/2022	568,598 kms	<b>Battery</b> R-2261	KJP workshop - Mitchell Breen, KJP workshop - Scott Laburniy
		load test all Batteries Replaced all 4 batteries	
22/12/2021		<b>Wheel Bearings</b> R-2241	
		Disassembled both steer hub assemblies, punched out RHS bearings and cleaned up spindle. Removed LHS spindle for replacement. R&R wheel bearings, LHS & RHS steering knuckles LHS brake drums and wheel studs. Fit new split pins to where needed T&R ABS fault Conduct W/A R&R LHR indicator	

Date	Reading / Units	Type / Repairer Notes	Repairer
01/12/2021	559,181 kms	<b>checkover</b> R-2240  Full checkover Check new pipe section to old one and its wrong. Order correct section	KJP workshop - Scott Laburniy, KJP workshop - Tre Szepanowski
16/11/2021	548,869 kms	<b>Air Leak</b> R-2202  Adjusted RHR wheel bearing, added engine oil, scuff LH rear drum & shoe lining as brake test failed. Fault find for brake test failure. Swapped boosters & test passed. Degreased engine bag & repaired air leak in cab. Fit Chevron signs to rear Requires: Second axle pivot bushes & third axle RH side rod bushes Brake Test - PASS	
29/10/2021	545,518 kms 10,262 hrs	<b>Breakdown</b> R-2200  Had Cool Auto Electronics do the breakdown for us Invoice # 13073	
14/10/2021	539,735 kms	<b>Suspension</b> R-2172  Replaced torque rod 2nd axle	KJP workshop - Mitchell Lancaster
06/10/2021	538,813 kms 10,138 hrs	<b>NHVR Inspection Checklist</b> I-169  No issues found, Brake test passed.	
05/10/2021		<b>Registration</b> O-135	
27/08/2021	531,436 kms	<b>Air valves, Wheel Alignment</b> R-2063  performed wheel alignment R & R RH rear Torque rod	KJP workshop - Judd Porter, KJP workshop - Mitchell Lancaster, KJP workshop - Wayne Goodlet
14/08/2021	259,018 kms	<b>Tracker</b> R-2056  fit tracker from T13	KJP workshop - Mitchell Lancaster, KJP workshop - Scott Laburniy
03/08/2021	527,074 kms	<b>B - B Service</b> S-553	KJP workshop - Mitchell Breen
02/08/2021	527,074 kms	<b>Engine Tune Up</b> R-2119  engine tune up completed	KJP workshop - Wayne Goodlet
28/07/2021	524,197 kms	<b>Clutch</b> R-1995  R & R clutch cylinder and solenoid cleaned belt replace main seal T & R gearing brake fault T & R engine brake fault R & R roof A/C mounts T & R engine brake fault T & R gearing issue in transmission replace broken/missing rubber bushes in roof A/C rear main seal leaking fitted PTO gasket, filled gearbox, run calibration, repaired air horn fitted floor panel, cleaned bay, connected to prill trailers and work hydraulic	KJP workshop - Judd Porter, KJP workshop - Mitchell Lancaster, KJP workshop - Scott Laburniy
18/07/2021	524,197 kms	<b>Bushes, Engine Light, gears, Seals</b> R-2000  Loud whistle on engine brake at low RPM's. Contact mack for advice Transmission showing signs of clutch cylinder failing, drop gearbox Remove and replace roof a/c bushes fit PVO with new gasket and fix air wire	KJP workshop - Judd Porter
28/06/2021	525,920 kms	<b>Water Leak</b> R-1944  Remove bunk interior and trim. Hose down for leaks. leaking at cab / bunk join and a Visio mounting. Put screws / bolts into a bay, put all trim and parts in bunk. Find air leak. Moved air lines to push into fitting properly. Forwarding onto Brisbane for cab leaks	KJP workshop - Judd Porter, KJP workshop - Scott Laburniy
22/06/2021	525,809 kms	<b>Exhaust Brake</b> R-1928  R&R valve for engine brake control Seal and refit bunk air T&R ABU Valve issue T&R engine brake fault	KJP workshop - Judd Porter, KJP workshop - Wayne Goodlet
17/06/2021	525,787 kms	<b>Air Conditioner</b> R-1922  ACES: Inspect fault with air conditioning system. Found the hose from compressor to condenser leaking. Hose shoes signs of rubbing - suspect cause is damaged from recent accident. (KJP to repair) Remove cab A/C Unit and clean off old seal Remove and replace high pressure hose and regas	KJP workshop - Judd Porter
16/06/2021	525,787 kms	<b>Exhaust Brake</b> R-1921	KJP workshop - Mitchell Lancaster

Date	Reading / Units	Type / Repairer Notes	Repairer
		DTC showing for transmission, scanned codes showing inactive, performed clutch wear test - came back okay at 5.1mm, performed trans calibration, cleared codes and test drove, rechecked for codes all okay. Found all exhaust manifold bolts under tension, tightened all, tightened turbo V bank clamps - test drove, all tested and working okay.	
02/06/2021	525,415 kms	<b>Air Conditioner, Fit out, General Checkover, Oil Leak</b> R-1892	KJP workshop - Judd Porter
		1. Regas A/C System 2. Remove and replace oil fill O'Ring at Sump 3. Remove and replace left hand rear booster	
24/05/2021	524,145 kms	<b>Fit out after Crash</b> R-1859	KJP workshop - Mitchell Breen, KJP workshop - Mitchell Lancaster
		1. Fitted ROTC Tracker 2. Fitted toolkit and Jack handles in LHS dog box 3. Fitted 4. Fitted new bug deflector 5. , Triangles and DG Bag 6. Fitted long tail suzi coils with QR Valves 7. Fitted 8. Replaced seat covers, floor mats and dash mat 9. Fitted Jack Bracket and Jack 10. Fitted Old Diamond holders 11. Fitted Fitted fire extinguishers, first aid kit and eye wash bottle bracket.	
20/05/2021	524,796 kms	<b>New, Rotate</b> T-316	Ocean Tyres
19/03/2021		<b>Windscreen</b> R-1177	
		Was rebuilt March 2021 after accident - windscreen was replaced during rebuild	
19/01/2021	519,976 kms	<b>New</b> T-255	Ocean Tyres
18/01/2021	519,954 kms	<b>Air Valve, Light, Track Rod, Turntable</b> R-1594	KJP workshop - Judd Porter, KJP workshop - Mitchell Breen
		R & R track rod on RHR R & R air valve on LH side of engine R & R 4 turntable mounting bolts Rivet back light	
06/01/2021	515,493 kms	<b>Exhaust Flex, Rewire, Sensor</b> R-1590	KJP workshop - Judd Porter
		R & R boost pressure sensor and plug R & R 5" exhaust flex on RH side	
30/12/2020	514,883 kms	<b>B - B Service</b> S-432	
		Replaced damaged mud flaps and chevrons degreased and cleaned down engine bay	
29/12/2020	514,883 kms	<b>electrical window</b> R-1555	KJP workshop - Scott Laburniy, KJP workshop - Wayne Goodlet
		Replaced faulty switch	
08/12/2020	510,262 kms	<b>Headlight</b> R-1533	KJP workshop - Mark Johnson
		T & R fault with headlight	
01/12/2020	507,425 kms	<b>Air tank, Oil Leak</b> R-1513	KJP workshop - Wayne Goodlet
		fit new bolt to air tank strap cleaned under truck to find leak Truck took 4.5L of oil	
17/11/2020	501,302 kms	<b>Air tank</b> R-1467	KJP workshop - Judd Porter
		R & R tank strap on LH tank	
11/11/2020	500,151 kms	<b>New</b> T-225	Ocean Tyres
09/11/2020	499,270 kms	<b>Hydraulic Leak</b> R-1444	KJP workshop - Judd Porter
		R & R tema fitting seals	
09/11/2020	499,801 kms	<b>ROTC Pre Check</b> R-1440	KJP workshop - Judd Porter
		Rear main seal leaking all 4 rear drives worn, recommended replacing Power steering reservoir gasket leaking, R & R gasket and washer Brake test - PASSED	
09/11/2020	501,302 kms	<b>Excess Noise, Exhaust</b> R-1389	KJP workshop - Judd Porter
		No sign of exhaust leak, but found rear main is leaking ran diagnostics for transmission and found a number of fault codes	
21/10/2020	493,667 kms	<b>suzi coil</b> R-1397	KJP workshop - Judd Porter
		Travelled to Calliope and fitted new red suzi coil Tidied up suzi coils, removed old coils	
06/10/2020		<b>Registration</b> O-56	
06/10/2020	488,013 kms	<b>Truck annual Inspection</b> I-91	

Date	Reading / Units	Type / Repairer Notes	Repairer
		Brake Test - PASSED	
29/09/2020	486,962 kms	<b>Mud Guard</b> R-1354 Removed and replaced and refitted mudguard	KJP workshop - Scott Laburniy
24/09/2020	486,017 kms	<b>Parts</b> R-1153	
07/09/2020	482,641 kms	<b>Check Over</b> R-1297 Check over, grease, sand and paint rear or truck	KJP workshop - Mark Johnson
02/09/2020	482,065 kms	<b>Lights</b> R-1280 Remove and replace left hand low beam globe Repair broken strobe wiring	KJP workshop - Judd Porter, KJP workshop - Wayne Goodlet
27/08/2020	480,551 kms	<b>Replace</b> T-187	Ocean Tyres
19/08/2020	477,311 kms	<b>Exhaust, isolator, Rattle, Signs, Water Leak</b> R-1163 1. Wayne has signed off fault (in folder - put with job card once handed in) Inspect and reseal rubber seal on bunk A/C T & R rattles lube steering shaft R & R torque rod rear R & R LH rear drive shockie R & R air cleaner	
18/08/2020	477,203 kms	<b>B - B Service</b> S-349 7,000km off as of 14-08-20 Brake test - PASSED	KJP workshop - Bill Shanahan
18/08/2020	477,203 kms	<b>Exhaust</b> R-1233 Remove exhaust remove broken bracket repair broken bracket repair cracks in paint reassemble	KJP workshop - Bill Shanahan
18/08/2020	477,203 kms	<b>Accessories</b> R-1227 Checked camera operation deemed to be faulty replaced camera with second hand spare	KJP workshop - Bill Shanahan
18/08/2020	477,203 kms	<b>Oil Leak</b> R-867 Everything tightened up. All repaired	KJP workshop - Bill Shanahan
30/06/2020	469,309 kms	<b>isolator</b> R-1137 Had to call ACES in to repair truck.	
03/06/2020	467,718 kms	<b>Transmission</b> R-1006 Connected tech tool, no active or recent inactive faults codes, Deleted all inactive fault codes.	KJP workshop - Wayne Goodlet
29/04/2020	461,571 kms	<b>CB Radio</b> R-982 1. remove CB antenna 2. repair Cb antenna lead 3. replace CB antenna and test	KJP workshop - Bill Shanahan
24/04/2020	461,458 kms	<b>Air tank</b> R-969 fit new support strap to air tank	KJP workshop - Mark Johnson
07/04/2020		<b>Steering</b> R-910 no repairs required as per instructed by Kirk	KJP workshop - Judd Porter
20/03/2020		<b>Air line</b> R-877 R & R damage supple lime couples	KJP workshop - Bill Shanahan
19/03/2020	457,253 kms	<b>Electrical</b> R-871 found trailer plug short during dolly check over, stripped down and cleaned, checked trailer plugs, re tested - OK replace LH blown indicator	KJP workshop - Mark Johnson, KJP workshop - Scott Laburniy
18/03/2020	457,251 kms	<b>Check Over, Oil Leak</b> R-864 Washed down oil leaks on engine, Monitor required after each trip to find location Washed and resealed front diff centre housing Completed checkover	KJP workshop - Scott Laburniy, KJP workshop - Wayne Goodlet
24/02/2020	456,432 kms	<b>Air Cooling</b> R-804	KJP workshop - Mark Johnson, KJP workshop - Scott Laburniy

Date	Reading / Units	Type / Repairer Notes	Repairer
		Remove A/C Unit from top of bunk - reseal and refit	
19/02/2020	455,820 kms	<b>Door Latch</b> R-784 R & R door catch and striker R & R lever	KJP workshop - Jason Amos
10/02/2020	454,531 kms	<b>Seat, Steering</b> R-765 R & R steering column strut R & R seat ride height adjuster	KJP workshop - Bill Shanahan
05/02/2020	454,528 kms	<b>Door</b> R-755 Remove door card and reassemble locking mechanism	KJP workshop - Jason Amos
30/12/2019	449,387 kms	<b>Air Conditioner, Lights</b> R-679 1 - Remove and replace blown parker globe 2 - Diagnose bunk A/C Fault. Remove and replace D/C charger for Aux Batteries	KJP workshop - Wayne Goodlet
19/12/2019	447,607 kms	<b>Air Leaks</b> R-669 Remove and replace nito air fittings	KJP workshop - Wayne Goodlet
03/12/2019	445,631 kms	<b>suzi coil</b> R-611 R & R suzi coils air and lights	KJP workshop - Wayne Goodlet
22/11/2019	443,953 kms	<b>C - C Service</b> S-217 Brake test - PASSED	KJP workshop - Judd Porter, KJP workshop - Wayne Goodlet
21/11/2019	443,953 kms	<b>Engine, Front Springs</b> R-583 1. Remove and replace sump gasket 2. Remove and replace shackle bush and pin 3. Remove and replace ear track rod bushes	KJP - Internal Workshop
11/11/2019		<b>boost leak</b> R-556 Remove and replace exhaust gas sensor and rewire. Replace waste gate valve	KJP - Internal Workshop, KJP workshop - Mark Johnson, KJP workshop - Scott Laburniy
01/11/2019	436,436 kms	<b>Engine</b> R-541 Diagnosed boost leak - worn turbo intake flange from incorrect fitment Dismantle exhaust from manifold to exhaust brake Surfaced manifold / turbo flange, cleaned all connecting surfaces Replaced uni joints in steering arm Replace right hand from mudguards Remove and replace bonnet catch receivers Remove, clean headlights, replace bulbs and refit headlights Remove and replace CB microphone Remove and replace air drier purge valve kit. Check over	KJP - Internal Workshop, KJP workshop - Bill Shanahan, KJP workshop - Jason Amos, KJP workshop - Wayne Goodlet
25/10/2019		<b>Air System</b> R-517 Disconnect air hoses from tank after draining Removal of tank Fit new straps Fit welded tank Test for leaks Replace air dryer filter	KJP - Internal Workshop, KJP workshop - Jason Amos
18/10/2019	429,646 kms	<b>exhaust</b> R-498 Check and retighten several clamps, brackets and bolts on the turbo and exhaust.	KJP workshop - Jason Amos
14/10/2019	427,706 kms	<b>Transmission</b> R-483 Remove and replace diff pinion seal	KJP workshop - Judd Porter
13/10/2019	426,722 kms	<b>Accessories, Exhaust Flex</b> R-478	KJP workshop - Bill Shanahan
11/10/2019	426,722 kms	<b>Air Compressor, exhaust, Oil Leak, Seat, Suspension</b> R-468 1 - Remove and replace exhaust flex and clamps 2 - Remove and replace compressor 3 - Remove and replace tappet cover gasket 4 - Sump gasket 5 - Pinion seal, refit tail shaft 6 - Remove and replace exhaust and turbo gaskets Turn tail shaft around, was fitted backwards oil leaking at power steering pump - rework Fit leaks at boost hoses x 2 - rework	KJP - Internal Workshop, KJP workshop - Judd Porter, KJP workshop - Mark Johnson, KJP workshop - Scott Laburniy
09/10/2019	425,741 kms	<b>Truck annual Inspection</b> I-22	
30/09/2019		<b>Registration</b> O-7	

Date	Reading / Units	Type / Repairer Notes	Repairer
30/09/2019	419,925 kms	<b>New T-22</b>	Ocean Tyres
24/09/2019		<b>Transmission R-390</b> Test Drive - No fault found	KJP workshop - Bill Shanahan
24/09/2019	415,965 kms	<b>Lights R-426</b> Replace marker lights	KJP workshop - Scott Laburniy
23/09/2019	415,965 kms	<b>exhaust R-409</b> Exhaust rework. Bolts fell out of exhaust. Paint small section of cab where exhaust has been rubbing.	KJP workshop - Judd Porter
17/09/2019	411,069 kms	<b>Lights R-401</b> Trace and repair light fault at Orica	KJP workshop - Mark Johnson, KJP workshop - Scott Laburniy
17/09/2019	411,028 kms	<b>Windscreen R-314</b> Remove and refit front screen	Windscreen Wizard
16/09/2019	411,028 kms	<b>Air Dryer, Filter R-314</b> Fit air dryer filter	KJP workshop - Judd Porter
16/09/2019	411,028 kms	<b>exhaust R-314</b> Remove and replace exhaust elbow	KJP workshop - Judd Porter
28/08/2019	405,495 kms	<b>Breakdown, Coolant Leak R-327</b> Topped up the coolant and left cap loose. Got it back to the yard and remove and replace header tank	KJP workshop - Nathan Hitchcock
25/08/2019	403,452 kms	<b>B - B Service S-156</b> Brake Test - PASSED	
07/08/2019	398,496 kms	<b>New T-10</b>	Ocean Tyres
23/07/2019	393,737 kms	<b>Bolts, Excess Noise R-233</b> Took bolt and spacer out of T06 to T14 could keep going: Put new bolt and pin into T06 Inspected noise pully found faulty water pump - Remove and Replace Water Pump	KJP workshop - Nathan Hitchcock
12/06/2019	380,785 kms	<b>Handle R-80</b> 1. straightened handle	KJP workshop - Judd Porter
11/06/2019	380,239 kms	<b>isolator R-86</b> Spoke to Mack. Code stays inactive and clears after 365 days counting from date of code being cleared. - ALL OK	KJP workshop - Mark Johnson
16/05/2019	368,347 kms	<b>General R-22</b> - run wiring to pin 7	KJP workshop - Judd Porter
01/03/2019	362,635 kms	<b>B - B Service S-35</b>	
25/09/2018	321,985 kms	<b>C - C Service S-36</b>	

Signed: \_\_\_\_\_  
Name: \_\_\_\_\_  
Date: \_\_\_\_\_