



# Vehicle History Summary

Fleet #	T17
Registration	KJP17
Make	MACK
Model	TRIDENT
VIN / Chassis #	6FMM12H56HD808885
Build Date	10/2017

Date	Reading / Units	Type / Repairer Notes	Repairer
		<b>Inspect and Report, Replace T-689</b> cancelled as no Invoice recieved matching this Tyre Item #	Ocean Tyres
11/02/2026	785,890 kms	<b>Exhaust R-3396</b> Replaced exhaust elbow	
11/02/2026	785,890 kms	<b>AC R-3393</b> Replaced condenser and regassed AC system	
28/01/2026		<b>Exhaust R-3413</b> Fit new exhaust	
16/10/2025	777,675 kms	<b>Lights R-3367</b> Drivers side light repaired 2 roof lights not working (in the middle) working but dull LHS rear parker light has no amber - fixed RHS rear parklight out - Fixed Brake test completed	
10/10/2025	777,675 kms	<b>NHVR Inspection Checklist I-483</b> Inspection Complete	
02/09/2025	777,155 kms	<b>B - B Service S-1295</b>	KJP workshop - Mitchell Breen
21/08/2025	760,543 kms	<b>Engine Tune Up R-3316</b>	
09/07/2025	760,542 kms	<b>Engine Light R-3336</b> hooked up computer and found fault from jeltest, chased wires to find any faults drove in to consult with chris smith oragnise new solenoids, clear codes and hook up trailer	KJP Workshop - Scarlett Guvyner-Treanor, KJP workshop - Scott Laburniy
13/06/2025	750,176 kms	<b>Lights, steps, UHF R-3299</b> BRAKE TEST - PASSED x2	KJP workshop - Scott Laburniy
10/06/2025	747,760 kms	<b>AC R-3329</b> Aces replaced compressor and regassed system	
06/06/2025	748,732 kms	<b>new T-791</b>	Ocean Tyres
05/05/2025	740,003 kms	<b>C - C Service S-1250</b>	
05/05/2025	740,003 kms	<b>B - B Service S-1249</b>	
09/04/2025	726,264 kms	<b>bonnet straps, Lights R-3304</b> R & R sid emarker light repair broken wire LH rear brake light R & R clearnace lights on cob roof R & R RH top bonnet strap R & R LH 1st axle shocky grease and check over trailer	KJP Workshop - Scarlett Guvyner-Treanor
06/04/2025	730,761 kms 14,871 hrs	<b>Windscreen R-3237</b> Done by Pronto	

Date	Reading / Units	Type / Repairer Notes	Repairer
24/03/2025	726,718 kms	<b>new T-774</b>	Ocean Tyres
29/11/2024	701,278 kms	<b>Air bag R-3285</b> R & R RHR airbag	KJP workshop - Judd Porter
26/11/2024		<b>New T-762</b>	Ocean Tyres
30/10/2024	693,874 kms	<b>Tailgate R-3262</b> Butlers replaced	
29/10/2024		<b>Brake Shoes, Cracks R-3279</b> R & R brake shoe butlers to repair cracks	
28/10/2024	693,833 kms	<b>B - B Service S-1181</b> Brake test - PASSED replaced drive axel brakes replaced 3rd axel hubseals patch up air leaks on firewall	KJP workshop - Ricky Jones, KJP workshop - Scott Laburniy
07/10/2024	687,764 kms 3,941 hrs	<b>NHVR Inspection Checklist I-406</b> Braketest shakers passed.	
02/10/2024	685,858 kms	<b>New T-747</b>	Ocean Tyres
11/09/2024		<b>Parts R-3269</b>	WTG
31/07/2024	672,098 kms	<b>Air Compressor, Air Dryer, Air leak R-3256</b>	
15/07/2024		<b>New T-732</b>	Ocean Tyres
15/03/2024	637,995 kms	<b>Air leak, boost leak, Engine Mount, Mudflap R-3184</b> R&R rear engine mounts and exhaust flex replace mudflap Adjust windscreen washers	KJP workshop - Mitchell Breen
15/03/2024	637,995 kms	<b>C - C Service S-1116</b> Brake test complete - PASSED	KJP workshop - Mitchell Breen
01/03/2024	628,422 kms	<b>adblue R-3195</b> CT Smith carried out repairs	CT Smith Mechanical
29/01/2024		<b>Steer Tyres T-678</b>	Ocean Tyres
29/01/2024		<b>Drive Tyres T-683</b>	Ocean Tyres
29/01/2024	626,034 kms	<b>Air Dryer, Air Leak , Engine Mount R-3175</b> Inspect air leak, remove and try to clean purge valve but did not work Drove to rocky to pick up purge valve and fit	KJP workshop - Scott Laburniy
28/01/2024	626,034 kms	<b>B - B Service S-1093</b> Brake test complete - PASSED	KJP workshop - Scott Laburniy
15/01/2024		<b>Puncture Repair T-677</b> Replace / Replace as required	Ocean Tyres
29/11/2023	607,473 kms	<b>Air Leaks, bonnet straps, Vibration R-3132</b> Replace bonnet strap Shaker truck and trailer - Look for missing weights on wheels - jack up and inspect steers - no noticeable faults found	KJP workshop - Scott Laburniy
22/11/2023		<b>tail gate ram, Windscreen R-2772</b>	
22/11/2023	605,184 kms	<b>Cracks R-3152</b>	Butler Fabrication
18/10/2023	597,193 kms	<b>Belt Tensioner, Interior lights, Steering colum, window switch R-3082</b>	

Date	Reading / Units	Type / Repairer Notes	Repairer
		1. R&R steering column strut 2. R&R window switch 3. R&R RH belt tensioner 4. R&R drivers side interior roof light	
04/10/2023		<b>New T-645</b>	Ocean Tyres
18/09/2023	590,999 kms	<b>Suspension R-3052</b>  check over YQ65JI, R & R RH 2nd axle brake booster, replace missing clear reflectors connect computer to truck, laptop talk to ECU's disconnect batteries and let sit R & R shock on 3rd axle R & R front cab shocks check fluid grease	Doug Kretschmer - KJP Haulage, KJP workshop - Scott Laburniy
11/09/2023	588,791 kms	<b>NHVR Inspection Checklist I-327</b>  Brake test - PASSED	KJP workshop - Judd Porter
02/09/2023	585,439 kms	<b>Brakes, Cab Shockies, Tyres, Windscreen R-3028</b>  R & R drive brake shoes	Doug Kretschmer - KJP Haulage, KJP Workshop - Craig Hyde
02/09/2023	585,439 kms	<b>General Checkover R-3038</b>  check over, repair wiring for tail lights	Doug Kretschmer - KJP Haulage, KJP Workshop - Craig Hyde
28/08/2023	582,101 kms	<b>Air bag R-2981</b>  R & R LH & RH airbags	Doug Kretschmer - KJP Haulage
25/08/2023	582,101 kms	<b>B - B Service S-1003</b>  Brake Test - PASSED	Doug Kretschmer - KJP Haulage
04/08/2023	573,353 kms	<b>Check Over, Slack Adjuster, Torque Rods, Wheel Alignment R-3002</b>	
24/07/2023		<b>Flat Tyre T-626</b>	Ocean Tyres
24/07/2023		<b>AC R-2974</b>	
14/07/2023		<b>Exhaust Brake R-2962</b>  no fault found with exhaust brake	KJP workshop - Mitchell Breen
12/07/2023		<b>Treadle valve R-2790</b>	
03/07/2023	563,363 kms	<b>Blower R-2957</b>  Diagnose and repair AC blower motor check over truck and trailer	KJP Workshop - Craig Hyde, KJP workshop - Mitchell Breen
14/06/2023	554,368 kms	<b>Brake Booster R-2929</b>  break down at calliope R & R 1st drive LHS booster	KJP workshop - Mitchell Breen
11/06/2023	552,935 kms	<b>Suspension , ubolts R-2886</b>  Remove and replace 1st drive U-bolts - check over truck and trailer / grease	KJP workshop - Mitchell Breen
09/06/2023	550,261 kms	<b>Front Springs, Leaf spring R-2909</b>  Replace both front spring packs jack up and dismantle spring from truck refit bumper bar shaker wheel align needs U-bolts second axle - Refer to R-2886	KJP Workshop - Craig Hyde, KJP workshop - Scott Laburniy
31/05/2023	548,273 kms	<b>Breakdown, Clutch, Transmission Fault R-2904</b>  Remove gearbox and inspect. Possible clutch replacement WTG 31/05/23 - Cause: Broken Spring in clutch disk. Correction: Connect tech tool and check fault codes, no faults evident for transmission electrical system. Removed transmission from vehicle, found damaged springs in clutch disc, carried out replacement of clutch cylinder and PWM on transmission, have flywheel machined and refit to engine, fit, align and secured clutch kit to flywheel, refit transmission to vehicle, filled trans with collected trans fluid, secured drive shaft with replacement bolts, started, run and operated vehicle around compound, found original fault of no drive was rectified. Air fittings to gear selector ECU were replaced as a precautionary measure as seals were deteriorated. CC Smith called out to yarwun to fix fault on INV#3224	Mack / Volvo, WTG

Date	Reading / Units	Type / Repairer Notes	Repairer
04/05/2023	542,295 kms	<b>C - C Service</b> S-933  Brake test passed	KJP workshop - Mark Johnson, KJP workshop - Scott Laburniy
04/05/2023	542,295 kms	<b>Chassis, Headlight, Tyres, Wheel Alignment</b> R-2863  1. tyre ok, just had repairs to front axles, had W/A 4/05/23 2. all bolts tightened up 3. mudflap replaced 4. replaced headlight bulb	KJP - Internal Workshop, KJP workshop - Mark Johnson, Ocean Tyres
21/04/2023		<b>Drive Tyres, Steer Tyres</b> T-577  Possible replace 2x steer tyres and 4 x drive tyres , but i will leave this to your discretion	Ocean Tyres
14/03/2023		<b>Registration</b> O-237	
03/03/2023	518,408 kms 11,417 hrs	<b>adblue, Derating</b> R-2784  copy of invoice in T17 Folder with very descriptive information on what was done at CC Smith Mechanical. Check for faults, changing ABS lead RHS Derated again brought in to check codes and plugs at adblue module. clean adblue level sensor plug. Retried & sent to CC Smith for Repairs.	KJP workshop - Mark Johnson, KJP workshop - Scott Laburniy
26/11/2022	503,657 kms	<b>Exhaust leak</b> R-2684  Elbow ordered on backorder from Mack Replace elbow grease & check over Fix brake light issue	KJP workshop - Mitchell Breen
24/11/2022		<b>New</b> T-522	Ocean Tyres
12/11/2022	498,758 kms	<b>Oil Leak</b> R-2595  Brought in & degreased & cleaned around filter housing. Remove & Replace filter housing gasket. Degrease & wash engine bay.	KJP workshop - Mark Johnson, KJP workshop - Scott Laburniy
12/11/2022	498,758 kms	<b>B - B Service</b> S-872  Brake Test Passed	KJP workshop - Mark Johnson, KJP workshop - Scott Laburniy
01/11/2022	492,807 kms	<b>Break down</b> R-2736  Go meet up with JJ, fit new wiper arm & handle & travel back to work.	KJP workshop - Mark Johnson
28/10/2022		<b>Puncture Repair</b> T-515	Ocean Tyres
18/10/2022	489,771 kms	<b>coolant leak</b> R-2718  Travel to breakdown, remove and replace header tank Fill with coolant	KJP workshop - Mark Johnson
12/10/2022	486,532 kms	<b>Breakdown</b> R-2710  Went to CA & found coolant leak, not bad. Sent JJ for another load while we came and got parts from workshop. Went out & fixed coolant leak, tried hooking up tech tool but as truck was derated, had to do computer update. Had to bring truck back to workshop, did updated & cleared codes.	KJP workshop - Mark Johnson, KJP workshop - Mitchell Breen
12/10/2022		<b>punc, Puncture Repair</b> T-501	Ocean Tyres
14/09/2022	478,842 kms	<b>NHVR Inspection Checklist</b> I-245  brake test passed	
12/09/2022		<b>Registration</b> O-197	
02/09/2022		<b>Indicators</b> R-2678  Pulled flasher from 15 to trial wrong type, went to Napa & purchased new. Fitted & OK	KJP workshop - Scott Laburniy
26/08/2022	472,852 kms	<b>Beacon</b> R-2663  Beacon collected & fitted by JJ, had Julies approval.	
17/08/2022	468,299 kms	<b>Headlight</b> R-2613	KJP workshop - Mitchell Breen

Date	Reading / Units	Type / Repairer Notes	Repairer
		R&R RHS driver light	
17/08/2022	468,299 kms	<b>Grease and Check over, Repair panel</b> R-2651	KJP workshop - Mark Johnson, KJP workshop - Mitchell Breen
		Full check over & grease Bracket under driver side door cleaned up & welded	
16/08/2022	356,463 kms	<b>ABS, Engine Light</b> R-2472	KJP workshop - Mark Johnson
29/07/2022	461,799 kms	<b>Steer Tyres</b> T-476	Ocean Tyres
22/07/2022	459,253 kms	<b>Air Conditioner</b> R-2463	
		Filter was changed at service	
22/07/2022	459,253 kms	<b>Kick Panel</b> R-2571	
		Repaired by Wayne	
22/07/2022	459,253 kms	<b>Tyres, Wheel Alignment</b> R-2495	
		Was done by Wayne at service	
22/07/2022	459,253 kms	<b>A/C Filter, beacon, Clearance Light, Fan Shroud, Oil Leak</b> R-2537	
		All faults have been looked at and repaired, See R2595 for oil leak job	
22/07/2022	459,253 kms	<b>Diff Lock</b> R-2542	
		Has only played up the once, all good for now	
18/07/2022	457,504 kms	<b>beacon, checkover, Exhaust Flex</b> R-2615	KJP workshop - Mitchell Breen, KJP workshop - Scott Laburniy
		Fit exhaust flex under rear right of cab & re-clamp. Grease & check over, R&R beacon band Remove worn bolts & replace fuel tank crossmember	
15/07/2022	456,952 kms	<b>leaking Radiator</b> R-2609	KJP workshop - Mitchell Breen, KJP workshop - Wayne Goodlet
		R&R radiator R&R top & bottom radiator hoses & clamps	
08/07/2022	454,126 kms	<b>B - B Service</b> S-803	KJP workshop - Wayne Goodlet
30/06/2022	452,547 kms	<b>Breakdown</b> R-2593	KJP workshop - Mitchell Lancaster
		Breakdown @ CA - went onsite with driver to see fault. Found ride height control rod getting caught on valve mounting bolts while unloading. Repositioned control & shortened so it couldn't get caught, tested by inflating bags & returning to ride height. All working ok - driver to monitor at next tip off.	
28/06/2022	451,758 kms	<b>Coolant Leak</b> R-2588	KJP workshop - Mark Johnson
		Meet with JJ at CA, changed pressure end cap with 2nd hand cap, topped up with coolant travel back to shed.	
11/06/2022	445,108 kms	<b>electrical window</b> R-2550	KJP workshop - Scott Laburniy, KJP workshop - Wayne Goodlet
		Inspected faulty window - faulty window regulator	
05/06/2022		<b>Booster, Drag Link, u-bolts</b> R-2530	KJP workshop - Mark Johnson, KJP workshop - Scott Laburniy
		Check over after getting defected. Ordered parts, fitted drag link, replace ubolts, grease beacon, cab filter & repair lights.	
01/06/2022	442,035 kms	<b>Brake Booster</b> R-2528	KJP workshop - Wayne Goodlet
		R&R booster	
23/05/2022		<b>Balance</b> T-441	Ocean Tyres
12/05/2022	436,178 kms	<b>Dash cam</b> R-2408	KJP workshop - Scott Laburniy
		See R-2377 No repair required not enough stock	
12/05/2022	436,178 kms	<b>Camera</b> R-2377	KJP workshop - Mark Johnson

Date	Reading / Units	Type / Repairer Notes	Repairer
		Camera not plugged into power. Connected power and was working okay while doing service. PLEASE INSPECT AGAIN - Driver reported 22/03/22 not working 12/05/2022 - No repair required, not enough stock.	
11/05/2022	436,178 kms	<b>Windscreen Wipers</b> R-2347	KJP workshop - Mitchell Lancaster, KJP workshop - Scott Laburniy
		Hosed out underneath bins, got drive tyres done @ oceans. Greased truck & adjusted brakes, general check over. Looked at wiper fault, could not get it to fault. Look at wipers, fit correct size, adjust tabs to lock better.	
29/04/2022		<b>Battery</b> R-2489	Aces
		Carried out tests & charge rate okay. Battery is unserviceable, customer to replace.	
26/04/2022		<b>batteries</b> R-2480	KJP workshop - Mark Johnson
		R&R batteries on RHS	
12/04/2022	426,799 kms	<b>Door lock</b> R-2445	KJP workshop - Mitchell Breen
		Door lock fixed. ABS light fixed and air leak on passenger side under bonnet fixed	
30/03/2022	423,206 kms	<b>batteries</b> R-2420	KJP workshop - Mitchell Lancaster
		Removed & load tested all batteries - Found both LHS batteries bugged R&R LHS batteries - reinstalled RHS & tested charge rate - 13.8V	
30/03/2022	423,010 kms	<b>Bonnet Latch</b> R-2392	KJP workshop - Mitchell Lancaster
		Already been repaired	
28/03/2022		<b>ABS, Engine Light</b> R-2416	KJP workshop - Mark Johnson, KJP workshop - Mitchell Lancaster, KJP workshop - Wayne Goodlet
		Engine Light - NOX sensor gas outlet, voltage above normal ABS Light - Axle 3 ABS modulator code Fault finding by pulling plugs & inspecting on ABS valves, cleared all fault codes. Repaired bent tarp bars.	
14/03/2022	415,486 kms	<b>Exhaust Pressure Sensor</b> R-2395	Mack / Volvo
		Complaint: Broken Wire Cause: Heat shrink joiner not shrunk letting wire wiggle until its broken Correction: tilted bonnet & removed conduit. Found brown wire broken out of joiner. Removed and replace plug. Connected PC and deleted codes.	
14/03/2022	415,611 kms	<b>C - C Service</b> S-713	KJP workshop - Mark Johnson
03/03/2022		<b>New</b> T-412	Ocean Tyres
22/02/2022	404,819 kms	<b>Check Over, grease, tail gate ram</b> R-2355	KJP workshop - Mark Johnson
		Greased truck, Checked brake adjustment Replaced faulty tail-gate ram lubed up tarp tracks for easy use Gave truck a quick wash	
17/02/2022	404,123 kms	<b>Air Conditioner</b> R-2354	Mack / Volvo
		Checked over and found compressor not working. Tested power to compressor. Vacced down and replaced compressor and receiver drier. Re-gassed system and tested - all okay.	
10/02/2022	400,896 kms	<b>Break down</b> R-2341	Mack / Volvo
		Judd attended break down, found fault and sent it to WTG for them to repair WTG: Air Leak in Engine Bay. Cause: EPG actuator ram leaking, exhaust clamp loose. Correction: Drove truck into bay and inspected exhaust system, all looked ok. Connected PC and read faults. Found nothing active. Carried out engine brake test and found exhaust actuator ram leaking. Removed and replaced with new kit. Found exhaust leak at clamp after turbo, tightened clamp. Tested system.	
06/02/2022	400,291 kms	<b>Exhaust leak</b> R-2315	
		Strip down, remove turbo and exhaust manifold, clean up face of block. remove studs from turbo and exhaust manifold, thread was a little damaged, spent time finding correct tap and cleaned threads came up good. Cleaned face of exhaust manifold, tried to fit bolts as guides didn't work. cut down studs and tried again. tensioned exhaust manifold, fitted seals to turbo oil drain hose. Finish fitted turbo & exhaust pieces. Had to use exhaust back pressure line off t11 due to one on t17 was stripped	
30/01/2022	396,525 kms	<b>Nox sensor, Shock Absorber</b> R-2309	
		Used hose clamps to secure draw bar guard in place R&R nox sensor R&R LH and RH front drive shockies Checkover Found exhaust manifold leaking - New jobcard made Cracks underneath trailer hoist well - New jobcard made	

Date	Reading / Units	Type / Repairer Notes	Repairer
25/01/2022	394,931 kms	<b>Brake Booster, General Checkover</b> R-2301 Need to order nox sensor Check over, grease truck & trailer Connect tech tool & find problem with codes Parts to be ordered	
20/01/2022	392,261 kms	<b>roof lights</b> R-2288 R&R blown bulb in LHS roof marker light on truck. Found drive tyre with damage, driver taken to oceans YQ65JI - Found tailgate ram leaking air from valve Found tyres off the rim 4th axle Driver taken to oceans for tyres R&R tailgate ram	
04/01/2022	387,580 kms	<b>beacon</b> R-2264 Replaced blown bulb in beacon & moved belt to get speed correct	
04/01/2022	387,580 kms	<b>tailgate</b> R-2237 Trailer tailgate air cylinder leaking air (R2264) R&R drivers seat belt Fitted new bonnet latch	
07/12/2021		<b>Puncture Repair</b> T-383	Ocean Tyres
01/12/2021	375,565 kms	<b>Brakes, Suspension, Tyres</b> R-2223 R&R all drive brake shoes and drums R&R FRH rear shackle pins and bushes Ocean fitted new tyres	
26/11/2021	723,776 kms	<b>New</b> T-381	Ocean Tyres
22/11/2021	374,047 kms	<b>B - B Service</b> S-627 36L Mack Engine Oil Brake test past Needs full set of brake shoes and drums on drive Steer tries at wear limit and need replacing R&R LHS steer booster Topped up coolant Some defects in book not signed off - not able to find original Cleared codes, active nox codes still showing	KJP workshop - Mitchell Lancaster, KJP workshop - Tre Szepanowski
22/11/2021	374,189 kms	<b>Call Out</b> T-378	Ocean Tyres
03/11/2021	366,779 kms	<b>broken brackets</b> R-2205 Weld up broken bracket, refit and check all ok	
28/10/2021	365,171 kms	<b>Air Conditioner, Tarp , wheel nut indicators</b> R-2191 Checked A / C pressures, Found to be a blockage, Pressures improved after removing cab filter Replaced cab filter Tensioned wheel nuts Cleared Nox Sensor codes, driver to monitor	KJP workshop - Scott Laburniy, KJP workshop - Tre Szepanowski
07/10/2021	356,945 kms	<b>Flip on Rims, Steer Tyres</b> T-359 Balance Truck (with new tyres) Flipped Pos 1 - 2 on rims	Ocean Tyres
28/09/2021	355,011 kms	<b>Exhaust Flex</b> R-2136 Replaced all 3 sections of exhaust flex	KJP workshop - Mitchell Lancaster
23/09/2021	353,682 kms	<b>Nox sensor</b> R-2129 R & R Nox sensor	KJP workshop - Judd Porter, KJP workshop - Mitchell Breen
21/09/2021	352,906 kms	<b>Air bag</b> R-2130 R&R 3rd axle LHS air bag	KJP workshop - Mitchell Lancaster
21/09/2021		<b>Registration</b> O-134	
16/09/2021	350,417 kms	<b>NHVR Inspection Checklist</b> I-165 Break test - PASSED	KJP workshop - Wayne Goodlet
13/09/2021	348,762 kms	<b>Rotate</b> T-347	Ocean Tyres
22/08/2021	340,008 kms	<b>Engine Tune Up</b> R-2116	
16/08/2021		<b>Exhaust Brake</b> R-2028 run new cables for starter, pos and earth judd replaced both air valves Aces came to look at starting issue ACES: Found high resistance in power / earth cables (to be replaced)	Aces, KJP workshop - Judd Porter

Date	Reading / Units	Type / Repairer Notes	Repairer
08/08/2021	335,288 kms	<b>B - B Service</b> S-550 R & R u bolts on LH 2nd axle	KJP workshop - Wayne Goodlet
20/07/2021	329,480 kms	<b>Guards</b> R-2005 Fit new spray suspension	KJP workshop - Judd Porter
19/07/2021	329,480 kms	<b>Sensor</b> R-1997 Remove and Replace Nox Sensor	KJP workshop - Judd Porter
17/07/2021	328,721 kms	<b>Cab Shockies</b> R-1963 Remove and replace cab shockies Weekly inspection and grease DTC - Refer to R-1997	KJP workshop - Wayne Goodlet
05/07/2021	323,581 kms	<b>tail gate</b> R-1958 Remove and replace air cylinder	KJP workshop - Mark Johnson
02/07/2021	323,089 kms	<b>beacon, Brakes , Shock Absorber</b> R-1822 Repaired plug on top of transmission Secured bottom tank supports Remove and replace front shockies Beacon belt replaced Drive brakes - no repair required	KJP workshop - Mitchell Breen, KJP workshop - Wayne Goodlet
01/07/2021	323,225 kms	<b>Wheel Alignment</b> R-1948 Completed Wheel Alignment for Both Truck and Dog (YQ65JI) Tensioned trailer pivot bolts Remove and replace spray suppression on bonnet and front guard	KJP workshop - Wayne Goodlet
20/06/2021	319,415 kms	<b>batteries , driving lights</b> R-1909 Fit spot light brackets and spotlights Install wiring loom for spotlights Diagnose fault to wiring harness, secure wiring harness Test and adjust lights Replaced 4 x Batteries Old batteries were recharged and put onto T04	KJP workshop - Judd Porter, KJP workshop - Mitchell Breen, KJP workshop - Wayne Goodlet
19/06/2021	319,415 kms	<b>Starter Motor</b> R-1925 Remove and replace starter motor	KJP workshop - Mitchell Breen
16/06/2021	317,793 kms	<b>Wheel Bearings</b> R-1684 No repair required at this stage.	KJP workshop - Wayne Goodlet
13/06/2021	316,872 kms	<b>Check Over</b> R-1918 Cracks in top front pillars inside bin. Cleaned and switch plate sprayed top of trailer Check over / grease	KJP workshop - Scott Laburniy
06/06/2021	314,365 kms	<b>Cab Mounts</b> R-1900 Remove and replace front cab mounts	KJP workshop - Wayne Goodlet
04/06/2021	314,364 kms	<b>Air Conditioner</b> R-1764 R&R A/C suction hose R&R suction hose, remove and flush condensor regas A/C	KJP workshop - Wayne Goodlet
29/05/2021	311,805 kms	<b>Bonnet</b> R-1771 Inspected Bonnet mounts - no wear found	KJP workshop - Wayne Goodlet
28/05/2021	309,291 kms	<b>Breakdown</b> R-1887 Travelled to Caves, inspected and found faulty connector on rear of gearbox. Wiggled plug, all came good. Zip tied plug and pushed locks, all okay. Ordered parts and sent to customer to fix themselves.	Mack / Volvo
24/05/2021	309,158 kms	<b>Breakdown, Clutch</b> R-1868 Called in to look at Clutch problem, hooked up computer, found no faults, followed truck to Mt Larcom to make sure he could run all day - ordered clutch parts Remove and replace clutch cylinder and solenoid valve	KJP workshop - Judd Porter, KJP workshop - Mark Johnson, KJP workshop - Mitchell Lancaster
24/04/2021	294,373 kms	<b>C - C Service</b> S-489	KJP workshop - Judd Porter, KJP workshop - Mitchell Lancaster

Date	Reading / Units	Type / Repairer Notes	Repairer
		Brake Test - PASSED Remove and replace left hand side beacon belt.	
24/03/2021		<b>Gripper R-1392</b> No Fault Found	KJP workshop - Mark Johnson
19/03/2021	276,972 kms	<b>Inspect and Report, New T-291</b>	Ocean Tyres
18/03/2021	276,967 kms	<b>Check Over R-1721</b>  - Made up and fitted fire extinguisher bracket and mounted to truck - Weld in battery isolator and tested - all working - Had wheel nut indicators - Had Beacon fitted - Brake Test - PASSED	KJP workshop - Mitchell Breen, KJP workshop - Mitchell Lancaster
18/03/2021	276,968 kms	<b>Air Conditioner, beacon, Hoses R-1676</b>  1. P clamped A/C hose to manifold. Removed broken bracket Replaced damaged air lines at air tank (rubbed through on hydraulic hoses) 2. Replace broken belt on beacon 3. Remove and replace A/C Gas	KJP workshop - Mitchell Lancaster, KJP workshop - Wayne Goodlet
08/03/2021	272,744 kms	<b>Air Conditioner R-1716</b>  Clean and inspect A/C Filter Remove dust cover and clean A/C Compressor clutch	KJP workshop - Wayne Goodlet
18/02/2021		<b>Electrical R-1691</b>  ACES: Inspect throttle fault and carry out tests on pedal and wiring. Found okay. Reassemble and test	Aces
02/02/2021		<b>Wheel Alignment R-1652</b>  Preformed wheel alignment	KJP workshop - Wayne Goodlet
01/02/2021	262,109 kms	<b>New T-260</b>	Ocean Tyres
22/01/2021	260,722 kms	<b>Booster R-1623</b>  Replaced exhaust back pressure sensor and wiring harness took for test drive - major improvement	KJP workshop - Scott Laburniy
20/01/2021	260,130 kms	<b>Indicators, wheel nut indicators R-1620</b>  1. Repair broken indicator wire 2. Check tension off all wheel nuts (tightened)	KJP workshop - Judd Porter
22/12/2020	255,987 kms	<b>adjust brakes , checkover, grease R-1568</b>  Remove and replace both parker globes greased and checked fluid levels inspected throughout	KJP workshop - Mitchell Lancaster
22/12/2020	255,987 kms	<b>UHF R-1553</b>  Found loose power wire to UHF, soldered wired driver to monitor fir further faults	KJP workshop - Mitchell Lancaster
15/12/2020	253,966 kms	<b>Belt R-1550</b>  Replace broken belt in revolving light Refit globe, tested and working fine	KJP workshop - Mitchell Lancaster
11/12/2020	252,867 kms	<b>B - B Service S-413</b>  Brake Test - PASSED Mack Oil - 37L	KJP workshop - Scott Laburniy
28/11/2020	246,679 kms	<b>Bonnet, Filter R-1518</b>  Remove and replace A/C cabin filter Adjusted bonnet	KJP workshop - Mitchell Lancaster
25/11/2020	245,744 kms	<b>Brakes, Slack Adjuster R-1510</b>  Initial Brake Test failed R & R RH rear slack adjuster Brake Test - PASSED	KJP workshop - Wayne Goodlet
02/11/2020	238,379 kms	<b>step R-1435</b>  Tightened Rivets	KJP workshop - Mitchell Lancaster
19/10/2020	233,308 kms	<b>Welding R-1395</b>  Weld lugs to aluminium tipper and dog	Butler Fabrication
06/10/2020	229,336 kms	<b>Signs R-1366</b>  Supply and install Door logos and stripes	Signtek
24/09/2020	226,974 kms	<b>Accessories, Fitout New Truck R-1335</b>	KJP workshop - Bill Shanahan, KJP workshop - Mark Johnson

Wire in and fit tracker Wire in and fit safety camera Make up frame and fit fridge Fit go via tag repair rattles connect computer and adjust idle time

---

03/08/2020	211,328 kms 4,506 hrs	<b>B - B Service</b> S-382	
------------	--------------------------	----------------------------	--

Karreman Quarries conducted service prior to KJP buying it.

---

14/05/2020	185,797 kms	<b>C - C Service</b> S-381	
------------	-------------	----------------------------	--

Karreman Quarries Pty Ltd conducted service while they still owned it.

Signed: \_\_\_\_\_

Name: \_\_\_\_\_

Date: \_\_\_\_\_