

Asset STX530 CASE

Serial Number Z7F105774

Hours 8021

Added By Comment

Time

	15/01/2024 - TR04 - Kent Auto Machine Repairs - 7874 machine repairs and labour breakdown completed by Kent Air and Electrical. Job Details Machine: Case STX530 Unit no: TR04 Eng hours: 7874.4 Serial no: Z7F105774 Visited Site: Leeton Assessed air conditioning system. Tests and inspection found the A/c compressor to be faulty. Degassed machine removed rehousing found when the compressor had failed it has sent metal throughout the system. Order parts from supplier get them freighted to Leeton Steel. Extensively flushed system of contaminant. Remove evaporator core flushed clean and reinstalled. Supplied and installed new compressor & receiver drier, pressure test, vac regas, checked pressures & temps - all tested fine	
Michael Lofts	Any questions please let me know Toni Kent	01/15/2024 15:29
Michael Lofts	20/11/2023 - MCE Service Report 750 Hour Service performed by James Simonis @ 7831 Hours Service Comments: Nil	11/20/2023 13:51
	25/09/2023 - MCE Service Report 500 Hour Service performed by Max Coleman @ 7528 Hours Service Comments: 500hr service, change eng oil/filter, fuel filter, air cleaner, cab filter, Rear control bank leaking oil from one fitting.	09/25/2023 9:30
Michael Lofts	23/05/2023 - TR04 - SOS Engine Oil Sample - 7187 Hours	05/23/2023 13:00
Michael Lofts	12/05/2023 - MCE Service Report 250 Hour Service performed by Brendan Scott @ 7188 Hours Service Comments: Nil	05/12/2023 10:35
	10/05/2023 - Kent Auto Machine Repairs Hi Richard and Michael, Please see the information below, for machine repairs and labour breakdown completed by Kent Air and Electrical. Job Details Machine: Case 530 Tractor Unit no: TR04 Eng hours: 7,187.5 Serial no: Z7F105774 Visited Site: MC Bray street - Complete electrical checklist and thoroughly check A/C. All checks ok. Disconnect RH indicator (shorted to battery, faulty indicator module). - A/C system tested 4.5-6.5°C in the cab and pressures at 1500rpm were 14psi on the low and 110psi on the high. Cold sweaty low side pipe and cycling. All tested fine. Any questions please let me know.	05/10/2023 14:07
Michael Lofts	19/04/2023 - Tyre Doctor Report - Hours not recorded	04/19/2023 12:48
	9/09/22 Kent Auto Service Report Machine Hrs: 7,026 Attend to RHS clearance indicator on dim and indicators inoperative intermittently. Diagnose faulty flasher module. Price through Prab (\$650). MC to decide on further repair action.	09/20/2022 12:48
Leah Murphy	29/08/22 Kent Auto Service Report 2/2 Third Visit (Michael and Vish) -Complete rear harness installation -Tidy and re-install cushion hitch harness -Tie up and inspect all harnesses -Re-fit armrest and controls after seat install -Wire replacement seat in (heater, operator present & compressor) -Clear all codes and confirm none present -Diagnose faulty rear washer motor - Diagnose worn front and rear wiper heads -Replace melted wastegate actuator hose -Supply and install reverse LED light - Clean battery terminals -Test batteries (OK but require charge) -Confirm charging correctly -Run up A/C & heater, all OK. Fourth visit (Vish) -Supplied and install a new headlight globe, all tested fine.	09/20/2022 9:56
	29/08/22 Kent Auto Service Report 1/2 Machine Hrs: 7,026 First Visit (Michael) Remove panels and guards on rear half of machine, partially remove rear machine wiring harness, unable to access section above diff. Source price and availability with Prab, determine harness available for less repair price and time. Second visit (Vishi, Michael) -Supplied and install new LED work lights on rear fenders. -Found e-stop button jamming, supplied and install new e-stop kit. -Found am/fm radio antenna to be broken, supplied and install new am/fm radio antenna, all tested fine. -Found uhf antenna to be broken, supplied and install a new uhf antenna. -Thoroughly tidy up all engine wiring harnesses, all tested fine. -Replace rear harness and begin securing	09/20/2022 9:55
Leah Murphy	21/03/2022 - Kent Auto Air - Lang Lang Eng hrs: 6915.9 Intermittent AUX hydraulic function faults. Fault codes 51086, 51085 Hydraulic function raise and lower on #4 valve open circuit. Reconnected and configures wiring harness to correct valves on rear end. 51075 hydraulic function lower on #3 was open circuit, tests and inspection found the wire to be broken, rewired from rear end to base of cabin. Diagnosis of intermittent loss of power and hydraulic speed. Assessed cushion hitch fault. Found the wiring system to be working correctly. Handed job back to Billy for further repairs.	03/28/2022 9:02
Lee West		

Lee West	21/03/22 - Kent Auto Air - Lang Lang Eng hrs: 6883.3 Disassemble control armrest, swap AUX lever potentiometers - 2 -4. Re-configure wiring at solenoids. Replace various blown worklight globes. Install replacement LED worklights for rear faulty units.	03/21/2022 14:14
Lee West	07/03/2022 - Kent Auto Air Machine Repair (emailed) - Burdetts Lang Lang. CASE 530D #TR04 PO No. M1237 Assess A/C. Tighten rotary light switch causing light fault. Replace various blown globes.	03/07/2022 15:44
Jun Yang	08/12/21 - MCE: Aux hoses popping out	12/21/2021 12:48
Jun Yang	15/12/21 - MCE service report: blocked hydraulic filter light on	12/21/2021 12:17
Jun Yang	25/11/21 - Kent auto service sheet: Job Details Machine: Case Unit no: - Eng hours: 6,709.3 Serial no: Z7F105774 Visited Site: Pioneer Rd, Lang Lang Swap no 2 with no 1 remote lever controls as diagnosed by Billy. Test, all seemingly OK.	11/26/2021 15:03
Jun Yang	09/09/21 - Jascon field service report: travel to site isolate unit, carry out 500 hr service, sample engine oil, check all fluid levels, grease unit	09/20/2021 9:51
Jun Yang	13/06/20 - MC maintenance report: LH rear mudguard, metal particles, coolant overflow	08/05/2021 15:12
Jun Yang	09/09/19 - Kent service time sheet: air con system, compressor	08/05/2021 15:09
Jun Yang	11/09/19 Kent service time sheet: rear LH roof work lamp globe, LH head lamp, LH roof indicator	08/05/2021 15:08
Jun Yang	27/02/19 - Densley service timesheet	08/05/2021 15:07
Jun Yang	03/07/20 - MC field service report: quick couplers to be mismatched and incompatible	08/05/2021 15:06
Jun Yang	30/07/20 - MC Field service report: wiring to the control valve, fault codes on the dash regarding short to ground etc.	08/05/2021 15:03
Jun Yang	23/09/20 - MC 250 hours maintenance report	08/05/2021 15:02
Jun Yang	18/11/20 - MC equipment hire docket	08/05/2021 15:01
Jun Yang	19/11/20 - MC equipment hire docket	08/05/2021 15:00