

Warren Transport

Asset History Report

Thursday, 22 January 2

W/O No	Description	Complete	Down time	Repair time	Dur.	P/M	Job Type	Cost
Terex Pozitrack PT-60								
65	Not startingReplaced batteryTested goodWork completed by Aidan (OLD Job no 5888)	31/08/2020	.00	.00	.00		Correct	\$0.00
326	Not starting (Job 5869)Inspect systemFound loose connection front e-stop, tighten terminalsReplace rear e-stop contact due to corrosionCheck starting, OKSean	10/08/2020	.00	.00	.00		Break	\$0.00
403	Install new tracksInstalled Jason 7/11/20, No paperwork	7/11/2020	.00	.00	.00		Correct	\$0.00
414	Oil leaking from under Pozi onto new tracksPut over pit found a loose fitting to Rh track motorRemoved fitting, replaced O-rings did it back up and testedDidn't leakAidan	10/11/2020	.00	.00	.00		Break	\$0.00
912	Removed hydraulic fitting and replaced oring. 1x oringworks completed by aidan matthews, 02/06/2021.	2/06/2021	.00	.00	.00			\$0.00
1243	REMOVED AND REPLACED TWO ORINGS TO RIGHT HAND REAR OF THE TRACK.REMOVED AND REPLACED ONE FAN BELT2x ORINGS (P&D inv 131722)5x LITRES HYD OIL1x FAN BELTWORK COMPLETED BY TROY 18/10/2021 3380.9 HOURS	18/10/2021	.00	.00	.00			\$0.00
1246	FOUND EXHAUST LEAK FROM ENGINE PIPEENGINE PIPES WERE RUSTED OUTREMOVED AND REPLACED ENGINE PIPES FROM TURBO TO BAFFLE.CLEANED INSIDE AND OUTSIDE OF CABIN. ALSO ENGINE BAYBLEW OUT AIR FILTER.GREASED VEHICLEJOB COMPLETED BY JACOB CASSIDY 03380 HOURS	18/10/2021	.00	.00	.00			\$0.00
1293	investigate ac fault. carry out testing and diagnose failed relay and relay holder. remove and replace. WTP PARTS:1x acx1942RBL, Relay (from stock).LUCAS LJ AUTO, inv 273, 16/11/21.	16/11/2021	.00	.00	.00			\$0.00
1318	CARRIED OUT SERVICE: CHANGED ENGINE OIL AND	8/12/2021	.00	.00	.00			\$9.89

W/O No	Description	Complete	Down time	Repair time	P/M	Job Type	Cost
	FUEL FILTERS. DRAINED AND REFILLED ENGINE OIL TO CORRECT LEVEL.CLEANED AIR FILTER, CHECKED COOLANT. CHECKED HYDRAULIC OIL.NEXT SERVICE DUE 3634JOB COMPLETED BY JACOB						
1377	10/1/22 = travel to whitsunday quarry, look at terex pt60 not driving. found broken wire on pilot solenoid wiring repaired. 2 hrs labour.works completed by steve cb maintenance, jc 5034.	10/01/2022	.00	.00	.00		\$0.00
1437	investigate start fault on machine. diagnose fuel level too low for prime pick up.refuel machine and test operation. labour lucas. works completed by lj auto, inv 407, 24/2/22.	24/02/2022	.00	.00	.00		\$0.00
1453	investigate ac fault. carry out testing and locate leaking discharge hose. order parts replace hose.2hours labourworks completed by lucas, lj auto, inv 424, 10/3/22.	10/03/2022	.00	.00	.00		\$0.00
1468	remove leaking discharge hose from machine. manufacture new hose and install. remove and replace receiver dryer. pressurise system and leak test. no leaks present.vac and charge system with r134a refrigerant. test operation. reseal roof panel. 5hours labour lucas. LJ Parts:0.7kg of ac refrigerant. lucas supplied. works completed by lucas lj auto, inv 432, we18.3.22.WTP Parts:Orings & Drier [pn: RDX140] -- napa inv 1360145198.	18/03/2022	.00	.00	.00		\$0.00
1647	hydraulic hose fittings ordered/fitted by john warren on saturday 25.6.22(1x) -0612 jseal jic fem 90'elbow(1x) -0612 jseal jic fem(1.50mt) -06 two wire hyd hose smoothcase(1x) hose assembly. supplied by P&D inv 143394.	25/06/2022	.00	.00	.00		\$0.00
1904	strip and reseal hydraulic cylinder. 1 hour labourP&D Parts:consumables, hose clamp, extension spring, wiper seal, imperial rod seal, j seal d/a piston, oring. works by P&D inv 143321. 24/6/22.also, plugs and nuts on P&D inv 143239 ordered by troy.	24/06/2022	.00	.00	.00		\$0.00
2683	P&D supply 1x n50p fipost 520 cca delkor extra heavy duty battery. (p/n: AL22FR-520).P&D inv 172341. 21/3/24.	21/03/2024	.00	.00	.00		\$0.00
2693	19/3 - terex positrack, repair leaking aux bucket hoses,	21/03/2024	.00	.00	.00		\$0.00

W/O No	Description	Complete	Down time	Repair time	Dur.	P/M	Job Type	Cost
	grease, top up oils. order edges for positrack and grader. 2 hours labour, cbm jc 5891. 21/3 - c/o cutting edges. 1.5 hours labour, cbm jc 5893. works by steve carey.							
3264	21.10.2025, completed by: L&S Diesel- top up aircon- check performance	21/10/2025	.00	.00	.00			\$0.00
3287	11.11.2025, completed by: BR All Mechanical- inspect pilot control fault, test machine	11/11/2025	.00	.00	.00			\$0.00
<u>19</u>		<u>Total</u>	<u>.00</u>	<u>0.00</u>				<u>\$9.89</u>

Text

- 2035-595 NUT 7/8-9UNC
- 2035-596 ORING
- 0702-644 HUB CAP WAS 0702-365
- 0702-371 SNAP RING
- 0702-364 WASHER HARDENED
- 0702-367 RETAINER 53MM
- SET45 BEARING AND CONE, LM501349/10
- 0702-597 SEAL SET
- 2035-391 RETAINER INNER
- 0702-368 SEAL LIP
- HYDRAULIC FILTER 0200-204 (BRIS VEGAS)
- FUEL FILTER 26561117 PERKINS----- FLEETGUARD FF 167/ 167A
- ENGINE OIL FILTER 140517050 PERKINS----- FLEETGUARD LF 3874
- AIR FILTER INNER P822769 DONALDSON-----AF 25497
- AIR FILTER OUTER P822768 DONALDSON-----AF 25553
- AC BELT 13A0900
- FAN BELT 13A1005
- CUTTING EDGES 1755 LONG 120MM wide, 15mm thick, Bolt holes 115 from ends, 150 aprt, 5/8 bolts

date	JC #	JOB BY	hours	comments	PARTS
27.06.19	J/C#5377	JASON	3049	CHECKED OVER MACHINE	10 LTRS HYD OIL 1X 20-32 clamp grease
31.07.19	J/C#5438			SERVICE DONE @3095.8 HRS CHANGED FUEL FILTERS CHANGED ENGINE OIL. CHANGED AIR FILTERS NEXT SERVICE DUE @ 3345 HRS>>>>>>>>>>	1X FF 167A 1X LF 3874 AF 25497 AF 25553
20.12.19	no job		3184.5	chris brought bobcat back into yard today, from being down at the marina with ferg.	
6.1.20	5614	aidan		replace wheel bearings on track rollers. Removed aircon aircompressor fue tpo clutch failure. Rewired new switch wire for aircon. Installed new aircon compressor. Replace aircon belt 13A-900. proserpine auto air came to workshop and regassed aircon pn pt60	4 bearing 2 seals 2 curclips 2 caps 2 washers 2 nuts 1x 13A-900 aircon belt 1x ac compressor (cxs7170_
				NOTES: need to order track bushes for track frame	