

| Number | Type                | Date Open  | Date Closed | Kilometres (Hours) | Closed | Fuel Usage (Fault) | Repairer / Notes  | Cost / Invoice  |        |
|--------|---------------------|------------|-------------|--------------------|--------|--------------------|---|---|--------|
| R-8942 | cab bolt            | 10/09/2025 |             |                    |        |                    | 11410 Internal Workshop - Field Service Missing cab mount bolt  | \$0.00  |        |
| R-7584 | window blind        | 06/20/2024 |             |                    |        |                    | Internal Workshop - Field Service Front windscreen blind is broken need new blind and assembly  | \$0.00  |        |
| R-7583 | steer ram           | 06/20/2024 |             |                    |        | 8708, 8725         | Internal Workshop - Field Service Left hand steer cylinder leaking, have re sealed before but rod is damaged  | \$0.00  |        |
| R-7571 | Horn                | 06/18/2024 |             |                    |        | 8413               | A Grade Auto Repair Horn not working.   | \$0.00  |        |
| R-7582 | Pre cleaner         | 06/20/2024 | 12/10/2025  |                    | 3,477  | 0                  | Internal Workshop - Field Service Air filter pre cleaner broken snapped off gone. Need new one.   | \$0.00  |        |
| S-7233 | A - 250 Hours       | 08/25/2025 | 08/29/2025  | 0                  | 3,250  | 0                  | Internal Workshop - Field Service 2x upper torque rods under bin worn out lower torque rods wearing too   | \$0.00  |        |
| R-7752 | Electrical Fault    | 08/06/2024 | 07/30/2024  |                    | 2,946  | 0                  | A Grade Auto Repair A GARDE FOUND FAULTY ENGINE CONTROLLER. FULL DETAILS ATTACHED ON INVOICE.   | \$0.00  |        |
|        |                     |            |             |                    |        |                    | Internal Workshop - Field Service No test bottles provided  |   |        |
|        |                     |            |             |                    |        |                    | Left hand steer cylinder leaking, have re sealed before but rod is damaged<br>Removed front of brake cooling fan motor to remove broken bolt. replaced broken bolts and fitted back up.<br>Remove coolant tank as it had a hole. sent to workshop for patch job. Fitted back up filled with coolant.<br>Air filter pre cleaner broken snapped off gone. Need new one. |   |        |
| S-6285 | C - 1000 Hours      | 06/05/2024 | 06/06/2024  |                    | 3,000  | 0                  | Actually done at 2940hrs  | \$0.00  |        |
| R-6722 | Turbo Timer         | 10/26/2023 | 06/04/2024  |                    |        | 2,940              | 0   | Internal Workshop - Field Service   | \$0.00 |
| R-6723 | Window tint         | 10/26/2023 | 11/30/2023  | 0                  |        | 0                  | 0   |   | \$0.00 |
| R-6917 | Hydraulic fan motor | 11/27/2023 | 11/27/2023  |                    |        | 4,266              | 0   | Porter Equipment Swap electronic solenoids over so fan runs flat out now.   | \$0.00 |
| R-6912 | Park brake          | 11/02/2023 | 11/16/2023  |                    |        | 2,646              | 0   | A Grade Auto Repair Locate no power to park brake solenoid. Fit original body computer to machine, test park brake releases ok.   | \$0.00 |
| R-6750 | Uni joints          | 11/08/2023 | 11/08/2023  | 0                  |        | 2,652              | 0   | Internal Workshop - Field Service replaced both uni joints on shaft   | \$0.00 |
| R-6894 | Accumulator         | 10/31/2023 | 10/31/2023  |                    |        | 2,645              | 0   | Porter Equipment Found charge valves leaking. Replaced charge valves and regas system. Invoice attached.  | \$0.00 |
| R-6672 | Hydraulic pump      | 10/12/2023 | 10/09/2023  | 0                  |        | 2,641              | 0   | Internal Workshop - Field Service Remove replace built up main isolation point as old one was worn.<br>replaced all plastic bushes at isolation point.<br>replaced all bearing and seals at pivot point.<br>replaced all uni"s at pivot point<br>replaced exhaust stack<br>penske come and done valve set on site<br>replaced coolant with castrol<br>replaced turbo manifold and gaskets | \$0.00 |
| S-5817 | A - 250 Hours       | 09/18/2023 | 09/18/2023  | 0                  | 2,627  | 0                  | replaced turbo  | \$0.00  |        |
| R-6097 | Sight Glass         | 03/31/2023 | 09/08/2023  |                    |        |                    | 0   | Internal Workshop - Field Service Need to check sight glass make sure it hasn't been blocked of as it doesn't read - all OK as per Jay Audit 8/9/23   | \$0.00 |
| R-5987 | Fuel                | 03/08/2023 | 09/08/2023  | 0                  |        | 0                  | 6147, 6152  | Replaced check valve as per Jay Audit 8/9/23  | \$0.00 |
| R-6096 | Sump gasket         | 03/31/2023 | 09/05/2023  |                    |        |                    | 0   | Internal Workshop - Field Service Sump gasket leaking. R&R Sump gasket.   | \$0.00 |
| R-6206 | Exhaust             | 05/09/2023 | 09/01/2023  | 22,074             |        | 2,461              | 0   | 6383 bolts  | \$0.00 |
| R-5707 | Engine              | 12/16/2022 | 09/01/2023  | 21,346             |        | 2,184              | 0   | 5819 Internal Workshop - Field Service this will get replaced with new turbo  | \$0.00 |
| R-5302 | Transmission        | 10/07/2022 | 09/01/2023  |                    |        |                    | 0   | 5436 Other. Report any major concerns (Take Pics). Transmission playing up sometimes will stay in one gear and not change Based on audit conducted by Jay on 1/9/23 this repair has been completed by porters in the last 12 months.  | \$0.00 |
| R-5646 | Air Conditioning    | 12/06/2022 | 06/21/2023  | 0                  |        | 2,600              | 0   | 5763, 5867 A Grade Auto Repair New A/c compressor and TX valve. Invoice attached.   | \$0.00 |
| R-6435 | Park Brake Alarm    | 06/21/2023 | 06/14/2023  |                    |        | 2,600              | 0   | A Grade Auto Repair Fitted by A Grade invoice attached.   | \$0.00 |

|        |                           |            |            |        |       |   |                                   |   |        |
|--------|---------------------------|------------|------------|--------|-------|---|-----------------------------------|---|--------|
| R-6348 | Oil leak                  | 06/13/2023 | 06/13/2023 |        | 2,604 | 0 | Internal Workshop                 | Remove two solenoids to allow access to remove leaking hydraulic hose. Remove old hose. Had new one made up on site. Help refit new hose. Refit solenoids and test operation of machine - OK.   | \$0.00 |
| R-6052 | Lights                    | 03/24/2023 | 04/27/2023 |        |       | 0 | 6234                              | A Grade Auto Repair Fixed by A Grade  | \$0.00 |
| R-5706 | Horn                      | 12/16/2022 | 04/27/2023 |        |       | 0 | 5820, 6146                        | A Grade Auto Repair, Internal Workshop - Field Service Horn replaced by A Grade.  | \$0.00 |
| R-5645 | Wipers                    | 12/06/2022 | 04/27/2023 | 0      |       | 0 | 5762, 6090,                       | Internal Workshop - Field Service Fixed by A Grade.   | \$0.00 |
| R-4692 | Lights                    | 07/12/2022 | 04/27/2023 |        |       | 0 | 4991, 6484                        | A Grade Auto Repair Fixed by A Grade<br>Internal Workshop - Field Service Steering cylinder leaking (R-6095).<br>Sump gasket leaking (R-6096).<br>Need to check sight glass make sure it hasn't been blocked of as it doesn't read (R-6097).  | \$0.00 |
| S-5393 | A - 250                   | 03/30/2023 | 03/31/2023 | 0      | 2,409 | 0 |                                   | Bearings on lift cylinder need changing (R-6098).   | \$0.00 |
| R-6181 | Seals, Unis               | 03/01/2023 | 03/01/2023 |        | 2,348 | 0 | Internal Workshop - Field Service | Max & Thomas. Removed jack shaft output from drop box. Removed main drive shaft to middle diff. Removed through shaft and bearing & seals. Inspected parts. Inspected park brake rotor and pads. Replaced through bearing, grease seals. Replaced all unis and bolts. Replaced yoke keeper bolts. Greased unis and oscillation pivot point. Test drove and re-inspected. Marked all bolts to visually inspect for operator. | \$0.00 |
| R-5863 | Hydraulic pump            | 02/09/2023 | 02/09/2023 |        | 2,275 | 0 | Porter Equipment                  | Porters replaced main hydraulic pump, replaced all hydraulic oil. Invoice attached.   | \$0.00 |
| R-5833 | Tyre                      | 02/02/2023 | 02/09/2023 | 21,561 | 2,267 | 0 | 5980                              | Carroll's Tyres CARROL TYRES REPLACED WITH RUNOUTS. Replaced rear axle with runouts. Invoice attached.  | \$0.00 |
| R-5745 | Tyre repairs              | 01/19/2023 | 02/09/2023 | 0      | 2,269 | 0 | 5946                              | CARROL TYRES REPLACED IT WITH RUNOUT.<br>Internal Workshop - Fabrication Other. Mainframe, suspension and articulation point. Play in articulation. Will  | \$0.00 |
| R-5686 | Steering point            | 12/12/2022 | 02/09/2023 | 21,270 | 2,269 | 0 | 5784                              | monitor.  | \$0.00 |
| R-5509 | Engine                    | 11/25/2022 | 02/09/2023 |        | 2,269 | 0 | 5699                              |   | \$0.00 |
| R-5270 | Header tank               | 10/04/2022 | 02/09/2023 | 20,887 | 2,269 | 0 | 5418                              | Damaged. Check for any oil / fluid leaks. Header tank pin hole<br>Shephard Transport Equipment Lost all hydraulic pressure to the whole system. Found damaged hydraulic pump;<br>replaced hydraulic pump, with new oil. Invoice attached.   | \$0.00 |
| R-5973 | Hydraulic pump            | 02/07/2023 | 02/07/2023 |        | 2,275 | 0 | A Grade Auto Repair               | Aircon not working. Replaced a/c compressor and receiver dryer. Replaced blower in cab.   | \$0.00 |
| R-5729 | Air con                   | 01/17/2023 | 02/01/2023 |        | 2,244 | 0 | 5924, 5932                        | Invoice attached.   | \$0.00 |
| S-5174 | B - 500                   | 12/15/2022 | 12/14/2022 | 0      | 2,172 | 0 | Internal Workshop - Field Service |   | \$0.00 |
| R-5139 | Aerial                    | 09/12/2022 | 10/07/2022 | 20,607 | 2,033 | 0 | 5321                              | Other. Aerials. Aerial missing  | \$0.00 |
| R-4819 | Seat Height Control Valve | 07/27/2022 | 10/07/2022 | 19,795 | 2,033 | 0 | 5078                              | Damaged. Seat condition and seat belts. Seat not holding air keeps dropping down<br>Other. Seat condition and seat belts. Bushings in hydraulic ram need replacement no grease can get in bushings  | \$0.00 |
| R-4760 | Grease nipple             | 07/20/2022 | 10/07/2022 | 19,771 | 2,033 | 0 | 5037                              | warn both sides   | \$0.00 |
| R-3816 | Windows                   | 01/29/2022 | 10/07/2022 | 0      | 2,033 | 0 | 4118                              |   | \$0.00 |
| R-3814 | Horn                      | 01/29/2022 | 10/07/2022 | 0      | 2,033 | 0 |                                   |   | \$0.00 |
| R-3812 | Washer Bottle             | 01/29/2022 | 10/07/2022 | 0      | 2,033 | 0 | 4117                              |   | \$0.00 |
| R-3811 | Gear Knob                 | 01/29/2022 | 10/07/2022 | 0      | 2,033 | 0 | 4121                              |   | \$0.00 |
| R-3810 | Reverse Beeper            | 01/29/2022 | 10/07/2022 | 0      | 2,033 | 0 | 4122                              |   | \$0.00 |
| S-4912 | A - 250                   | 09/19/2022 | 10/07/2022 | 0      | 2,033 | 0 |                                   | sump leaking<br>radiator header tank cap leaking needs replacing  | \$0.00 |
| S-4526 | D - 2000                  | 05/02/2022 | 07/08/2022 |        | 1,599 | 0 | Internal Workshop                 | 2000 HR SERVICE COMPLETED BY PORTERS  | \$0.00 |
| R-3815 | Lights                    | 01/30/2022 | 05/26/2022 | 0      | 0     | 0 |                                   | Dash flickering Max inspected and said it is a non-issue. Will close off.<br>Damaged. Other: Major Concerns (Take pics). Tailgate welds cracking. Tailgate has been removed, as per   | \$0.00 |
| R-3849 | Tailgate                  | 02/07/2022 | 05/25/2022 | 0      | 0     | 0 | 4141                              | maintenance meeting 25/05/2022.   | \$0.00 |
| R-3813 | Flashing light            | 01/30/2022 | 01/31/2022 | 0      | 0     | 0 | 4119, 4120                        | Flashing light not working. Max repaired Feb sometime.  | \$0.00 |