

Number	Type	Date Open	Date Closed	Kilometres C	HoursC	Fuel Usage C	Fault	Repairer / Notes	Cost / Invoice
R-8715	HYD Hose	07/10/2025	07/08/2025	0	2,772	0		hosepower hosepower replaced hyd hose	\$0.00
S-7081	A - 250	07/03/2025	07/08/2025	0	2,750	20	0		\$0.00
R-8591	Roller	06/03/2025	06/05/2025		2,620	0	10496	Internal Workshop - Field Service Replaced roller	\$0.00
R-8552	Skirts	05/20/2025	05/27/2025		2,605	0	10365, 1038	Removed and replaced	\$0.00
R-8532	Scrapers	05/12/2025	05/12/2025		2,574	0		Internal Workshop - Field Service Replaced fines head drum scrapper bar rubber Sourced from finlay screening and crushing	\$0.00
S-6826	B - 500	02/20/2025	03/28/2025	2,500	5	0		Changed rubbers in fines shoot to stop spillage	\$0.00
R-8438	Screens	03/27/2025	03/27/2025		2,521	0		Internal Workshop - Field Service Changed bottom screen and rubber under 1x screen	\$0.00
R-8429	OVERSIZE BELT	03/24/2025	02/21/2025		2,438	0		Sourced from crusher spares	\$0.00
								Ram Conveyors REPLACED OVERSIZE BELT.	\$0.00
R-8294	Punch plates	01/24/2025	01/24/2025		2,353	0		Internal Workshop - Field Service Punch plates coming loose as bottom frame has flogged out holes and rubber under plates to thin. Had boilyls make up square washers from 12mm plate so they wont pull through holes, also made new angle pieces to protect heads of bolts. Purchased another set of spacer plates from finlay screening and crushing so we could use the thicker rubbers to get more life. Also now both reclaimers will run the same rubbers instead of two different types needing to be ordered.	\$0.00
R-7922	Rollers	09/11/2024	11/18/2024		2,277	0	9079	Internal Workshop - Field Service Replaced rollers and bracket. This is a double up of a fault.	\$0.00
R-7416	Rollers	04/17/2024	11/18/2024		2,277	0		Internal Workshop - Field Service Ended up finding them through finlay screening and crushing. Replaced bracket and 3x rollers on fines outfeed belt. Second from top head drum.	\$0.00
S-6628	A - 250	10/31/2024	10/31/2024	2,250	2	0		Internal Workshop - Field Service	\$0.00
R-8027	Starter motor	10/15/2024	10/15/2024		2,203	0		A Grade Auto Repair Starter motor faulty was changed out	\$0.00
R-7339	Belt	03/28/2024	09/09/2024		2,182	0	7955	Internal Workshop - Field Service Folded conveyor over and removed skid plate near head drum on fines. Cut section out of plate and welded new steel plate in.	\$0.00
R-7842	Screens	09/05/2024	09/05/2024		2,182	0		Internal Workshop - Field Service Removed old screens and replaced with new ones. Screens sourced from crusher spares Replaced 10x J bolts J bolts supplied by Finlay screening and crushing	\$0.00
R-7841	Cracks	09/05/2024	09/05/2024		2,182	0		Internal Workshop - Field Service Upon inspection found cracks in various spots of machine. Pointed spots out to rob the boilie to repair.	\$0.00
R-7750	DRAINAGE BELT	08/06/2024	07/15/2024		2,007	0		Ram Conveyors RAMS REPLACED DRAINAGE BELT.	\$0.00
R-7312	Belt	03/20/2024	06/28/2024			0	7921	rams Drainage belt changed due to wear and tear. Changed by ram conveyors	\$0.00
S-6338	C - 1000	07/01/2024	06/28/2024	0	2,000	1	0	Internal Workshop - Field Service SERVICE COMPLETED BY TOM. ACTUALLY DONE AT 2006HRS.	\$0.00
R-7603	Screens	06/24/2024	06/24/2024	0	1,982	0		Internal Workshop - Field Service replaced screens, supplied by Crusher Supplies and J-bolts from Finlay	\$0.00
R-7529	Lanyards	06/07/2024	06/06/2024	0	1,945	0		Internal Workshop - Field Service Found 3 lanyards faulty. Adjusted 2 and replaced cable and clamps on 1. Ran and checked all off them.	\$0.00
R-7525	Punch plates	06/04/2024	06/04/2024		1,931	0		Internal Workshop - Field Service Punch plates needed changing du to anting diffrent material size. Removed old plates and replaced with new ones. New bolts sourced from Konnect Brendale New bolts sourced from crusher spares.	\$0.00
R-7414	Drum Bearings	04/17/2024	04/17/2024		1,814	0		Internal Workshop - Field Service Remove replace	\$0.00

S-6134	A - 250	03/15/2024	04/17/2024	1,814	3	0	Head drum bearing motor side on drainage belt failed/Replaced bearing supplied by Finlay. Roller under fines belt has hole Roller carrier bracket broken on the side that holds wing carrier . Need to remove bracket and repair as Finlay don't sell them First punch plate has loose bolts. Tightened up but will need to replace as they will come loose again.	\$0.00
R-7410	Drum Bearings	04/15/2024	04/15/2024	1,808		0	Internal Workshop - Field Service Whilst servicing found head drum bearing motor side for drainage belt has failed. Hasn't been greased. Removed motor and cut old bearing off . Fitted new bearing and motor back on. Greased and ran. Parts supplied by finlay screening and cruching.	\$0.00
R-7012	Roller	01/12/2024	04/15/2024	1,808		0	7492 Roller sourced from finlay screening and crushing	\$0.00
R-6837	Roller	12/08/2023	04/15/2024	1,808		0	7405 Internal Workshop - Field Service	\$0.00
S-5592	B - 500	06/20/2023	11/30/2023	0 1,500	5	0	Actual hours serviced 1475hrs	\$0.00
R-6743	Belt	11/03/2023	11/03/2023	0	1,379	0	Ram Conveyors Oversize belt was torn and know one has a reason why . Called ram conveyors out to replace belt. I tensioned and tracked belt day after.	\$0.00
R-6585	Lanyards	09/14/2023	10/31/2023	0	1,379	0	6933 Lanyards work operator didnt know it was in bypass mode after moving	\$0.00
R-6670	Bearings	10/12/2023	10/12/2023	0	1,344	0	Internal Workshop - Field Service Remove replace	\$0.00
S-5394	A - 250	03/30/2023	03/31/2023	0 1,220	2	0	Internal Workshop - Field Service	\$0.00
R-5855	Punch plates	02/10/2023	02/09/2023	0	1,100	0	Max: Replaced screens and punch plates Replaced all capping rubbers Cut new holes and fitted j clamps All supplied by crusher spares. Invoices attached.	\$0.00
R-5811	Lanyards	01/10/2023	01/10/2023		992	0	A Grade Auto Repair A Grade repaired lanyard problems. Invoice attached.	\$0.00
S-5260	C - 1000	02/08/2023	12/08/2022	0 975	975	0	Internal Workshop - Field Service	\$0.00