



Work Order

WINDREM

Vehicle Code: 75

Year: 2016
Make: INTERNATIONAL
Model: DF677
License No: AR 55228
VIN #: 3HSNUAPT0GN030303
Meter: 1: 1035000 2: 0
Meter Type: Kilom Hours
Transmission:
Engine:
Engine Serial #:

Alt. Vehicle ID:
WO Type:
Est. Downtime:
Hour Estimate:
Reference No:
Requested By:
Reason:
Delay Code:

Work Order #: 33908
Issued: 2026-06-11 10:22 AM
Status: Closed
Date: 2026-06-01 10:44 AM
Employee:
Name:
Page #: 1

Vendor: HAR
Name: HARRISON TRUCK RE
Address: 188 BETHEL RD
City/State: OMEMEE ON

Work Order Notes:

DATE COMPLETED

RELEASED BY - (SIGNATURE REQUIRED)

Exhaust

Section of exhaust manifold to egr cooler leaking. Customer supplies all exhaust manifold parts and updated section to cooler. Installed all supplied parts and resealed all lines on turbo, exhaust pressure sensor tube was damaged during removal from manifold. Replaced rube. Turbo gaskets and hardware not supplied.

Parts Used

Part Number	Part Description	Service Code	Quantity	Cost (each)	Total
OUTSIDE SERVICE	EXHAUST REPAIR		1.00	\$1,959.77	\$1,959.77
5579020	EXHAUST OUTLET KIT		1.00	\$499.99	\$499.99
3683144	CLAMP V BAND	5000	2.00	\$104.55	\$209.10
5486657	GASKET, EXH MAN, CUMMINS	5000	4.00	\$46.80	\$187.20
3682940	Gasket, exhaust manifold	5020	1.00	\$48.91	\$48.91
MAK27AM12	SCREW, M10 x 1.5 x 100, HEX, FLANGED	0120	11.00	\$14.99	\$164.89
4965512	SPACER	0120	12.00	\$24.90	\$298.80
3682940	Gasket, exhaust manifold	5020	2.00	\$48.91	\$97.82
3104230	EGR GASKET	5020	2.00	\$95.88	\$191.76
3685999	EXHAUST MANIFOLD	5020	1.00	\$793.00	\$793.00
3689251	EXHAUST MANIFOLD	5020	1.00	\$1,399.00	\$1,399.00
3683870	EXHAUST MANIFOLD	5020	1.00	\$723.22	\$723.22
Total Parts					\$6,573.46
Total Parts and Service					\$6,573.46



Work Order

WINDREM

Vehicle Code: 75

Year:	2016	Alt. Vehicle ID:	
Make:	INTERNATIONAL	WO Type:	TIRES
Model:	DF677	Est. Downtime:	
License No:	AR 55228	Hour Estimate:	
VIN #:	3HSNUAPT0GN030303	Reference No:	
Meter:	1: 984650	Requested By:	
Meter Type:	Kilom	Reason:	
Transmission:		Delay Code:	
Engine:			
Engine Serial #:			

Work Order #:	33187
Issued:	2025-09-27 12:32 PM
Status:	Closed
Date:	2025-10-28 11:23 AM
Employee:	ROB
Name:	POST
Page #:	1

Work Order Notes:

Replaced steer tires with new - torqued to 480 ft pds
Replaced RS tires with spares - torqued to 480 ft pds

DATE COMPLETED

RELEASED BY - (SIGNATURE REQUIRED)

Services Performed

Service Code	Description	Technician	Actual Hours	Hours	Cost
7004	WHEEL - TIRE REPLACEMENT	ROB		1.50	\$0.00

COMMENT

Total Service	1.50	\$0.00
---------------	------	--------

Parts Used

Part Number	Part Description	Service Code	Quantity	Cost (each)	Total
TIRE	BRIDGESTONE M864 385-65R22.5	7004	2.00	\$826.29	\$1,652.58

Total Parts	\$1,652.58
-------------	------------

Total Parts and Service	\$1,652.58
-------------------------	------------



Work Order

WINDREM

Vehicle Code: 75

Year:	2016	Alt. Vehicle ID:	
Make:	INTERNATIONAL	WO Type:	ANNUAL INSPECTION
Model:	DF677	Est. Downtime:	
License No:	AR 55228	Hour Estimate:	
VIN #:	3HSNUAPT0GN030303	Reference No:	
Meter:	1: 793162 2: 0	Requested By:	
Meter Type:	Kilom Hours	Reason:	
Transmission:		Delay Code:	
Engine:			
Engine Serial #:			

Work Order #:	32876
Issued:	2025-07-08 9:22 AM
Status:	Closed
Date:	2025-10-28 11:23 AM
Employee:	CODY
Name:	FRY
Page #:	1

Work Order Notes:

- Oil in coolant
- Needs shoes and drums on drives and pads on steer
- Missing dust sheilds
- All four slack adjusters worn out
- Oil cooler failed
- Replaced oil cooler
- Replaced thermostat
- Removed cleaned and reinstalled turbo and EGR cooler to replace oil cooler
- Flushed out coolant system
- Replaced shoes and drums on drives
- Replaced pads on steer axel
- Replaced dust sheilds on rear axel
- Replaced slack adjusters on drive acel
- Replaced window regulaor on drivers side
- Set up brakes
- Torqued wheels

DATE COMPLETED

RELEASED BY - (SIGNATURE REQUIRED)

Services Performed

Service Code	Description	Technician	Actual Hours	Hours	Cost
0021	ANNUAL INSPECTION SAFETY	CODY		20.00	\$0.00
COMMENT					
Total Service				20.00	\$0.00

Parts Used

Part Number	Part Description	Service Code	Quantity	Cost (each)	Total
FLT4407B	DRUM, FLEETRITE		2.00	\$289.99	\$579.98
KIT2252H2CG	BRAKE PAD KIT	2501	1.00	\$549.99	\$549.99
2606013C91	KIT POWER DIVI	2501	1.00	\$70.56	\$70.56
Q2123	DUSTSHIELD,BRAKES	2507	1.00	\$49.95	\$49.95
R803048	SLACK ADJUSTER	2502	2.00	\$159.99	\$319.98
R803048	SLACK ADJUSTER	2502	2.00	\$159.99	\$319.98
3684384	SEAL	2502	1.00	\$22.51	\$22.51
3684338	gasket	2502	1.00	\$55.00	\$55.00
4059172	ORING WATERPUMP	2502	1.00	\$17.50	\$17.50
3684336	gasket the	2502	1.00	\$56.88	\$56.88
186780	SEAL THERMOSTAT	5016	1.00	\$35.90	\$35.90
3682673	Gasket, thm	5016	1.00	\$56.49	\$56.49
26164R1	SEAL,THERMOSTAT,O RING	5016	1.00	\$76.02	\$76.02
3689755	GASKET	5016	1.00	\$189.50	\$189.50
3679139	SEAL O RING	5016	1.00	\$7.07	\$7.07
3922794	Seal O Ring	0120	1.00	\$8.89	\$8.89
3678912	SEAL O RING	0120	1.00	\$17.51	\$17.51

WINDREM

Work Order

Vehicle Code: 75

Year:	2016	Alt. Vehicle ID:	
Make:	INTERNATIONAL	WO Type:	ANNUAL INSPECTION
Model:	DF677	Est. Downtime:	
License No:	AR 55228	Hour Estimate:	
VIN #:	3HSNUAPT0GN030303	Reference No:	
Meter:	1: 793162 2: 0	Requested By:	
Meter Type:	Kilom Hours	Reason:	
Transmission:		Delay Code:	
Engine:			
Engine Serial #:			

Work Order #:	32876
Issued:	2025-07-08 9:22 AM
Status:	Closed
Date:	2025-10-28 11:23 AM
Employee:	CODY
Name:	FRY
Page #:	2

			RELEASE BY - (SIGNATURE REQUIRED)	
3678606	SEAL O RING	0120		\$11.80
4973532	Gasket, oil cooler core	0120	2.00	\$22.55 \$45.10
3089025	Seal O-ring	0120	1.00	\$22.65 \$22.65
WF2127	FILTER,WATER	0120	1.00	\$26.86 \$26.86
4329681	GASKET, DOSER	5036	1.00	\$99.99 \$99.99
5292265	ISOLATOR,THERMAL,CUMMINS	5000	1.00	\$12.96 \$12.96
4963857	gasket injector	5000	1.00	\$38.50 \$38.50
4966441	GASKET EXH OUT CONNECTION	5020	1.00	\$37.86 \$37.86
4966441	GASKET EXH OUT CONNECTION	5020	1.00	\$37.86 \$37.86
3684359	EXH GASKET	5020	1.00	\$22.20 \$22.20
FLTEC40VBS	CLAMP 4 IN	5023	1.00	\$46.99 \$46.99
2880213	CLAMP, V BAND	5020	1.00	\$115.99 \$115.99
2880215	GASKET	5020	1.00	\$35.88 \$35.88
3695041	Gasket, Turbo	5020	1.00	\$33.55 \$33.55
4298242	Stud	5020	4.00	\$29.08 \$116.34
4298975	LOCK NUT	5020	2.00	\$12.39 \$24.78
4298975	LOCK NUT	5020	2.00	\$13.65 \$27.30
3627695	Seal O ring	5020	2.00	\$12.48 \$24.95
3678786	SEAL O RING	5020	1.00	\$8.32 \$8.32
3678786	SEAL O RING	5020	1.00	\$8.32 \$8.32
3678762	Seal Grommet	5020	1.00	\$34.87 \$34.87
3684284	washer sea	5020	2.00	\$12.84 \$25.68
3627695	Seal O ring	5020	1.00	\$12.48 \$12.48
3949708	SEAL,O RING	0120	1.00	\$17.30 \$17.30
3949781	seal o ring	0120	1.00	\$13.88 \$13.88
3957131	seal o ring	0120	1.00	\$7.88 \$7.88
4934279	Washer, Sea	0120	2.00	\$10.32 \$20.65
4934279	Washer, Sea	0120	4.00	\$10.32 \$41.29
4934279	Washer, Sea	0120	2.00	\$10.32 \$20.65
3678912	SEAL O RING	0120	1.00	\$17.51 \$17.51
3922794	Seal O Ring	0120	1.00	\$8.89 \$8.89
5264570	OIL GASKET,TURBO DRAIN	5019	1.00	\$9.99 \$9.99
3678925	Seal O ring	5019	1.00	\$8.45 \$8.45
3104230	Gasket, exh gas rcn valve	5019	1.00	\$68.41 \$68.41
3104230	Gasket, exh gas rcn valve	5019	1.00	\$68.41 \$68.41
3678912	SEAL O RING	5019	1.00	\$17.51 \$17.51
3683144	Clamp V Band	5000	1.00	\$100.95 \$100.95
5345814	CONNECTOR TUBE	5000	1.00	\$131.99 \$131.99
3683814	seal o ring	5000	2.00	\$8.15 \$16.30
3683607	seal	5000	1.00	\$9.63 \$9.63
3683940	EXH SEAL	5000	2.00	\$77.69 \$155.38
3687051	SEAL.EGR	5019	1.00	\$35.44 \$35.44
3687223	HOSE, PLAIN, CUMMINS,EGR	5015	1.00	\$132.08 \$132.08
3686839	CLAMP, T BOLT, 3.0"	5015C	1.00	\$49.50 \$49.50

WINDREM

Work Order

Vehicle Code: 75

Year:	2016	Alt. Vehicle ID:	
Make:	INTERNATIONAL	WO Type:	ANNUAL INSPECTION
Model:	DF677	Est. Downtime:	
License No:	AR 55228	Hour Estimate:	
VIN #:	3HSNUAPT0GN030303	Reference No:	
Meter:	1: 793162 2: 0	Requested By:	
Meter Type:	Kilom Hours	Reason:	
Transmission:		Delay Code:	
Engine:			
Engine Serial #:			

Work Order #:	32876
Issued:	2025-07-08 9:22 AM
Status:	Closed
Date:	2025-10-28 11:23 AM
Employee:	CODY
Name:	FRY
Page #:	3

3686838	CLAMP,T BOLT,2.75"	5015C	1.00	\$46.40	\$46.40
3688976	CONNECTION	5015C	1.00	\$63.19	\$63.19
4965487	COOLER CORE	5015C	1.00	\$963.03	\$963.03
3686409	CONNECTION	5015C	1.00	\$403.28	\$403.28
4318947	THERMOSTAT	5015C	1.00	\$146.90	\$146.90
XK3124711QP	Reman Sh	2501	2.00	\$179.99	\$359.98
3685309	CLMAP V BAND	2501	2.00	\$100.36	\$200.72
3685124	SEAL O RING	2501	3.00	\$10.61	\$31.83
4076823	seal egr switch	5000	2.00	\$35.27	\$70.54
4010519	SEAL O RING	5000	2.00	\$8.38	\$16.76
3662377C91	WINDOW REGULATOR, LH	5000	1.00	\$969.22	\$969.22
Total Parts					\$7,528.90
Total Parts and Service					\$7,528.90



Work Order

WINDREM

Vehicle Code: 75

Year: 2016
Make: INTERNATIONAL
Model: DF677
License No: AR 55228
VIN #: 3HSNUAPT0GN030303
Meter: 1: 943686 2: 0
Meter Type: Kilom Hours
Transmission:
Engine:
Engine Serial #:

Alt. Vehicle ID:
WO Type:
Est. Downtime:
Hour Estimate:
Reference No:
Requested By:
Reason:
Delay Code:

Work Order #: 32470
Issued: 2025-04-24 8:01 AM
Status: Closed
Date: 2025-10-28 11:24 AM
Employee: GARNET
Name: MILES
Page #: 1

Work Order Notes:

Replaced down pipe from turbo to can and gaskets

DATE COMPLETED

RELEASED BY - (SIGNATURE REQUIRED)

Services Performed

Service Code	Description	Technician	Actual Hours	Hours	Cost
5023	ENGINE - EXHAUST CLAMP	GARNET		1.00	\$0.00
	COMMENT				
5020	ENGINE - EXHAUST	GARNET		1.50	\$0.00
	COMMENT				
Total Service				2.50	\$0.00

Parts Used

Part Number	Part Description	Service Code	Quantity	Cost (each)	Total
fltec40vbs	CLAMP 4 IN	5023	1.00	\$46.99	\$46.99
2880213	CLAMP, V BAND	5020	1.00	\$115.99	\$115.99
2880215	GASKET	5020	1.00	\$35.88	\$35.88
4039182c3	PIPE, TURBO	5020	1.00	\$2,625.44	\$2,625.44
Total Parts					\$2,824.30
Total Parts and Service					\$2,824.30



Work Order

WINDREM

Vehicle Code: 75

Year: 2016
Make: INTERNATIONAL
Model: DF677
License No: AR 55228
VIN #: 3HSNUAPT0GN030303
Meter: 1: 746813 2: 0
Meter Type: Kilom Hours
Transmission:
Engine:
Engine Serial #:

Alt. Vehicle ID:
WO Type: WARRANTY
Est. Downtime:
Hour Estimate:
Reference No:
Requested By:
Reason:
Delay Code:

Work Order #: 32182
Issued: 2025-01-10 12:25 PM
Status: Closed
Date: 2025-10-28 11:24 AM
Employee:
Name:
Page #: 1

Vendor: WINS
Name: Winslow Gerolamy Mo
Address: 1018 Lansdowne Stre
City/State: Peterborough ON

Work Order Notes:

DATE COMPLETED

RELEASED BY - (SIGNATURE REQUIRED)

- A. Diagnose engine oil leak
Cause: oil fill tube leaking
 - Cleaned oil off of engine
 - Inspected oil leaking from fill tube, cracked
 - Re - Re oil oil fill tube ran hot.
- B. Diagnose air break at firewall
Cause fire wall fitting leaking
 - All bolts stuck in fire wall
 - Removed and replaced connector
 - Filled air and checked for leaks (good, no leaks found)
- C. Diagnose windows wont go down
Cause: Broken power motor wiring
- D. Diagnose engine warning lights on
 - Found left stack pipe restricted and leaking
 - Customer to look after exhaust repair as not warranty

Services Performed

Service Code	Description	Technician	Actual Hours	Hours	Cost
0005	WARRANTY			1.00	\$0.00
COMMENT					
Total Service				1.00	\$0.00
Total Parts and Service					\$0.00



Work Order

WINDREM

Vehicle Code: 75

Year: 2016
Make: INTERNATIONAL
Model: DF677
License No: AR 55228
VIN #: 3HSNUAPT0GN030303
Meter: 1: 732053 2: 0
Meter Type: Kilom Hours
Transmission:
Engine:
Engine Serial #:

Alt. Vehicle ID:
WO Type: WARRANTY
Est. Downtime:
Hour Estimate:
Reference No:
Requested By:
Reason:
Delay Code:

Work Order #: 31748
Issued: 2024-10-03 7:58 AM
Status: Closed
Date: 2025-03-05 1:05 PM
Employee:
Name:
Page #: 1

Vendor: WINS
Name: Winslow Gerolamy Mo
Address: 1018 Lansdowne Stre
City/State: Peterborough ON

Work Order Notes:

DATE COMPLETED

RELEASED BY - (SIGNATURE REQUIRED)

WARRANTY SERVICE:

DIAGNOSE EWL ON - FAILED OUTLET NOX SENSOR (REPLACED)
DIAGNOSE EHAUST LEAK NEAR AFTERTREATMENT - SCR FLANGES CRACKED AND LEAKING (REPLACED SCR AND GASKETS)

DIAGNOSE EWL ON - FAILED VGT ACTUATOR
REMOVED TURBO, REPLACED FAILED VGT ACTUATOR

INV 454320

Services Performed

Service Code	Description	Technician	Actual Hours	Hours	Cost
4099	ENGINE - WARNING LIGHT			1.00	\$0.00
	COMMENT				
5037	ENGINE- SENSOR			1.00	\$0.00
	COMMENT				
5019	ENGINE - TURBO			1.00	\$0.00
	COMMENT				
Total Service				3.00	\$0.00
Total Parts and Service					\$0.00



Work Order

WINDREM

Vehicle Code: 75

Year: 2016
Make: INTERNATIONAL
Model: DF677
License No: AR 55228
VIN #: 3HSNUAPT0GN030303
Meter: 1: 730740 2: 0
Meter Type: Kilom Hours
Transmission:
Engine:
Engine Serial #:

Alt. Vehicle ID:
WO Type: WARRANTY
Est. Downtime:
Hour Estimate:
Reference No:
Requested By:
Reason:
Delay Code:

Work Order #: 31423
Issued: 2024-07-16 3:58 PM
Status: Closed
Date: 2025-03-05 1:05 PM
Employee:
Name:
Page #: 1

Vendor: WINS
Name: Winslow Gerolamy Mo
Address: 1018 Lansdowne Stre
City/State: Peterborough ON

Work Order Notes:

DATE COMPLETED

RELEASED BY - (SIGNATURE REQUIRED)

REPAIR:

DIAGNOSE OIL LEAK AT RIGHT SIDE OF ENGINE - INNER FRONT COVER LEAKING
POWER WASH ENGINE, FOUND LEAKING BETWEEN REAR COVER AND BLOCK
REMOVE FRONT COVER AND RESEAL/ OIL PAN GASKET SEPERATED ON REMOVAL (REPLACED)
RE & RE COOLING PACKAGE FOR ACCESS / REPLACE CRANKSHAFT PULLEY (NOT WITHIN GUIDLINES)

DIAGNOSE RIGHT HAND STEERING BOX LEAKING - BOX LEAKING
POWER WASHE SREERING BOX / FOUND LEAK AT THE FRONT RIGHT SIDE STEERING BOX
RE& RE STEERING BOX / POWER WASH RESIDUAL OIL OFF TRUCK / REPLACE PITMAN ARM SPLINES, PILLED UP ON
REMOVAL

REPLACED 5TH WHEEL CROSSMEMBER (BROKEN)

DIAGNOSE ENGINE WARNING LIGHT ON - CAUSE CHASSIS HARNESS RUBBING ON LOOM
REMOVED AFTER TREATMENT WIRING HARNESS FROM BACK OF ENGINE TO AFTER TREATMENT / REPLACE HARNESS
& RE TEST FOR FAULT 3135 / REPAIR COMPLETE

DIAGNOSE ENGINE LIGHT ON - DPFDP CONNECTOR SEAL LEAKING / REPLACE DPFDP SENSOR AND HARNESS DUE TO
WATER INTRUSSION

DIAGNOSE AIR LEAK UNDER 5TH WHEEL - FOUND RELAY VALVE LEAKING / REPLACED

EXHAUST SMELL IN CAB - BELLOWS MANIFOLD LEAKING
TURBO AND EXHAUST MANIFOLD TO COME OFF TO REPAIR EXHAUST LEAK
DRILL AND INSTALL HELI COILS IN MANIFOLD FOR TURBO MOUNTING
TORQUE TO SPEC / NO LINES ARE HOOKED UP ON TURBO

REPAIR EXHAUST LEAK AT DPF - FLANGES CRACKED AND LEAKING
REMOVED AFTER TREATMENT (INSPECT AND FOUND FLANGES CRACKED-NOT WITHIN REUSE GUIDLINES)
REPLACED DPF, COMPLETE REGEN

INV 453609

Services Performed

Service Code	Description	Technician	Actual Hours	Hours	Cost
5036	ENGINE- DEF/ DPF			1.00	\$0.00
	COMMENT				
5020	ENGINE - EXHAUST			1.00	\$0.00
	COMMENT				
6003	CHASSIS - AIR LEAK			1.00	\$0.00
	COMMENT				
6004	CHASSIS - AIR VALVE			1.00	\$0.00

WINDREM

Work Order

Vehicle Code: 75

Year:	2016	Alt. Vehicle ID:	
Make:	INTERNATIONAL	WO Type:	WARRANTY
Model:	DF677	Est. Downtime:	
License No:	AR 55228	Hour Estimate:	
VIN #:	3HSNUAPT0GN030303	Reference No:	
Meter:	1: 730740 2: 0	Requested By:	
Meter Type:	Kilom Hours	Reason:	
Transmission:		Delay Code:	
Engine:			
Engine Serial #:			

Work Order #:	31423
Issued:	2024-07-16 3:58 PM
Status:	Closed
Date:	2025-03-05 1:05 PM
Employee:	
Name:	
Page #:	2

Vendor:	WINS
Name:	Winslow Gerolamy Mo
Address:	1018 Lansdowne Stre
City/State:	Peterborough ON

	COMMENT	DATE COMPLETED	RELEASED BY - (SIGNATURE REQUIRED)	
4000	ELEC - HARNESS		1.00	\$0.00
	COMMENT			
4099	ENGINE - WARNING LIGHT		1.00	\$0.00
	COMMENT			
5037	ENGINE- SENSOR		1.00	\$0.00
	COMMENT			
Total Service			7.00	\$0.00
Total Parts and Service				\$0.00



Work Order

WINDREM

Vehicle Code: 75

Year: 2016
Make: INTERNATIONAL
Model: DF677
License No: AR 55228
VIN #: 3HSNUAPT0GN030303
Meter: 1: 730740 2: 0
Meter Type: Kilom Hours
Transmission:
Engine:
Engine Serial #:

Alt. Vehicle ID:
WO Type: WARRANTY
Est. Downtime:
Hour Estimate:
Reference No:
Requested By:
Reason:
Delay Code:

Work Order #: 31146
Issued: 2024-07-16 11:55 AM
Status: Closed
Date: 2025-03-05 1:10 PM
Employee:
Name:
Page #: 1

Vendor: WINS
Name: Winslow Gerolamy Mo
Address: 1018 Lansdowne Stre
City/State: Peterborough ON

Work Order Notes:

DATE COMPLETED

RELEASED BY - (SIGNATURE REQUIRED)

RIGHT HAND STEER AXLE SHOCK MOUNT BOLT
THREAD STRIPPED ON BOLT REPLACED BOLT AND LOWER MOUNTING BRACKET
ALSO REPLACED RR DRIVE SHOCK WITH NEW LOWER BOLT
AIR LEAK AT FRONT LEFT BRAKE CHAMBER: PUSH ROD DISTORTED
- REPLACED BRAKE CHAMBER

WO: 453610

Services Performed

Service Code	Description	Technician	Actual Hours	Hours	Cost
6008	CHASSIS - SHOCKS			1.00	\$0.00
	COMMENT				
2506	BRAKES - MAXI KIT			1.00	\$0.00
	COMMENT				
Total Service				2.00	\$0.00
Total Parts and Service					\$0.00



Work Order

WINDREM

Vehicle Code: 75

Year: 2016
Make: INTERNATIONAL
Model: DF677
License No: AR 55228
VIN #: 3HSNUAPT0GN030303
Meter: 1: 730653 2: 0
Meter Type: Kilom Hours
Transmission:
Engine:
Engine Serial #:

Alt. Vehicle ID:
WO Type:
Est. Downtime:
Hour Estimate:
Reference No:
Requested By:
Reason:
Delay Code:

Work Order #: 31023
Issued: 2024-07-04 7:52 AM
Status: Closed
Date: 2025-03-05 1:11 PM
Employee:
Name:
Page #: 1

Vendor: WINS
Name: Winslow Gerolamy Mo
Address: 1018 Lansdowne Stre
City/State: Peterborough ON

Work Order Notes:

DATE COMPLETED

RELEASED BY - (SIGNATURE REQUIRED)

ENGINE LIGHT ON - TURBO SEAMS TO BE SURGING

REPAIR:

COMPLETE AFTERTREATMENT INSPECTION
FOUND DPFDP TUBE WAS LOOSE (TIGHTEN)
FOUND INLET NOX SENSOR LOOSE
SOURCE LOW VOLTAGE - BATTERIES FAILED AND REPLACED

Services Performed

Service Code	Description	Technician	Actual Hours	Hours	Cost
4099	ENGINE - WARNING LIGHT			1.00	\$0.00
	COMMENT				
5037	ENGINE- SENSOR			1.00	\$0.00
	COMMENT				
5037	ENGINE- SENSOR			1.00	\$0.00
	COMMENT				
4006	ELEC - BATTERY REPLACE			1.00	\$0.00
	COMMENT				
Total Service				4.00	\$0.00

Parts Used

Part Number	Part Description	Service Code	Quantity	Cost (each)	Total
OUTSIDE SERVICE	SERVICE & PARTS COST	0100	1.00	\$1,364.61	\$1,364.61
Total Parts					\$1,364.61
Total Parts and Service					\$1,364.61



Work Order

WINDREM

Vehicle Code: 75

Year: 2016
Make: INTERNATIONAL
Model: DF677
License No: AR 55228
VIN #: 3HSNUAPT0GN030303
Meter: 1: 714827 2: 0
Meter Type: Kilom Hours
Transmission:
Engine:
Engine Serial #:

Alt. Vehicle ID:
WO Type: WARRANTY
Est. Downtime:
Hour Estimate:
Reference No:
Requested By:
Reason:
Delay Code:

Work Order #: 30772
Issued: 2024-05-22 11:34 AM
Status: Completed
Date: 2024-05-21
Employee:
Name:
Page #: 1

Vendor: WINS
Name: Winslow Gerolamy Mo
Address: 1018 Lansdowne Stre
City/State: Peterborough ON

Work Order Notes: DATE COMPLETED RELEASED BY - (SIGNATURE REQUIRED)
ENGINE OIL LEAK, CHECK ENGINE LIGHT ON, PASSENGER WINDOW NOT WORKING

REPAIR:
OIL OVER FULL - NO WARRANTY
TEST INJECTORS AND COMPLETE FUEL DIE TEST - GOOD
ROAD TEST TO VERIFY OIL LEAK AND POSSIBLE MAKING OIL
OIL LEAK AT BACK OF FRONT COVER, NOT MAKING OIL
FOUND EGR PIPE WAS BROKEN - REPLACED (NOT WARRANTY)
DIAGNOSE PASSENGER WINDOW NOT WORKING - CORRODED SWITCHES
REPLACE SWITCH DOOR UNLOCK/LOCK, RT WINDOW SWITCH & LT WINDOW SWITCH BOTH IN LT DOOR (WARRANTY)

Services Performed

Service Code	Description	Technician	Actual Hours	Hours	Cost
5031	ENGINE - OIL LEAK			1.00	\$0.00
	COMMENT				
4099	ENGINE - WARNING LIGHT			1.00	\$0.00
	COMMENT				
3019	CAB - WINDOWS			1.00	\$0.00
	COMMENT				
5020	ENGINE - EGR TUBE			1.00	\$0.00
	COMMENT				
Total Service				4.00	\$0.00

Parts Used

Part Number	Part Description	Service Code	Quantity	Cost (each)	Total
OUTSIDE SERVICE	SERVICE & PARTS NON WARRANTY	5031	1.00	\$3,296.92	\$3,296.92
Total Parts					\$3,296.92
Total Parts and Service					\$3,296.92



Work Order

WINDREM

Vehicle Code: 75

Year: 2016
Make: INTERNATIONAL
Model: DF677
License No: AR 55228
VIN #: 3HSNUAPT0GN030303
Meter: 1: 732055 2: 0
Meter Type: Kilom Hours
Transmission:
Engine:
Engine Serial #:

Alt. Vehicle ID:
WO Type:
Est. Downtime:
Hour Estimate:
Reference No:
Requested By:
Reason:
Delay Code:

Work Order #: 31590
Issued: 2024-10-08 2:08 PM
Status: Closed
Date: 2025-03-05 1:05 PM
Employee:
Name:
Page #: 1

Vendor: WINS
Name: Winslow Gerolamy Mo
Address: 1018 Lansdowne Stre
City/State: Peterborough ON

Work Order Notes:

DATE COMPLETED

RELEASED BY - (SIGNATURE REQUIRED)

AC COMPRESSOR NOISY - REPLACED (NON WARRANTY0

inv 454364

Services Performed

Service Code	Description	Technician	Actual Hours	Hours	Cost
5003	ENGINE - A/C COMP			1.00	\$0.00
COMMENT					
Total Service				1.00	\$0.00

Parts Used

Part Number	Part Description	Service Code	Quantity	Cost (each)	Total
OUTSIDE SERVICE	ac comp replacement	5003	1.00	\$1,665.57	\$1,665.57
Total Parts					\$1,665.57
Total Parts and Service					\$1,665.57