



Vehicle History Summary



Fleet #	PM09
Registration	BMR012
Make	Western Star
Model	2021 Prime Mover
VIN / Chassis #	5KKJBEBG2NPNP8782
Build Date	2021

Date	Reading / Units	Type / Repairer Notes	Repairer
30/06/2026	1,095,284 kms	Truck Wash R-3203 see attached jobcard	BMR Logistics
15/06/2026		Electrical R-3142 see attached invoice for details relay replaced	KENNYS AUTO ELECTRICAL TSV
09/06/2026		Engine R-3119 see attached invoice for details	Cummins
26/05/2026	1,076,103 kms	A - 10k S-1427	Primary Mechanical Repairs
22/04/2026		Engine R-2995 REPAIRED IN SERVICE S 1383	BMR Logistics, Penske
21/04/2026	46,515 kms	B - 40k S-1383 REFIT EXHAUST AND TIGHTEN ALL CLAMPS SERVICE AD REPAIR SLEEPER AIR REMOVE AND REKIT FAN HUB WIRE IN LH AND RH SIDE INDICATORS FIT ABS RING TO LHS STEER HUB	BMR Logistics
17/04/2026		Engine R-3008 REPAIRED IN DARWIN BY PENKSE	Penske
15/04/2026	1,042,750 kms	COMPRESSOR R-3132 see attached invoice for details air compressor changed road side	Cummins
14/04/2026	1,039,610 kms	Engine R-2986	PENGELLY TRUCKS AND TRAILERS
13/04/2026	40,300 kms	NEW T-1331	Carroll Tyres Pty Ltd
08/04/2026		COMPRESSOR R-2976	PENGELLY TRUCKS AND TRAILERS
31/03/2026	25,810 kms	Lights R-2948 REMOVE BOTH LOW BEAM LIGHTS, MARK AND CUT LIGHT HOUSINGS TO FIT NEW LIGHTS, FIT LIGHTS AND RETAINING RINGS BEFORE FITTING TO TRUCK REFIT PLUG/BUNG TO DS OF CAB ABOVE CAB BUSH. ROTATE BOTH DRIVER AND PASSENGER FRONT FUEL TANKS	BMR Logistics
25/03/2026	24,988 kms	A - 10k S-1347 9X PRESSURE CHECKS, 1 X RUN OUT REMOVE AND REPLACE LHS STEER WHEEL SEAL FOUND NO ABS RING REMOVE AND REPLACE CAB RIDE HEIGHT VALVE AND RUBBER REPAIR DAMAGE TO EXUHAUST AND WELD UP HOLE REPLACE BOTH LHS AIR BAGS DRAINED 30L OF WATER FROM AIR TANKS TOPPED UP DIFF OIL AND ENGINE OIL DEGREASED TRUCK AND WASHED DOWN	BMR Logistics
05/03/2026	11,444 kms	Main/inspect, Pressure Check T-1272 4X FLIP ON RIM OUTER DRIVE TYRES 2 X FLIP ON RIM DS INNERS 8 DRIVE TYRE ROTATIONS STEER TYRES SIDE TO SIDE 10 X PRESSURE CHECKS	BMR Logistics
03/03/2026	10,225 kms	B - 40k S-1299 REPLACE FRONT RHS AIRBAG REPLACE HOSE TO RHS AIR BAG FROM RIDE HEIGHT VALVE DEGREASE AND WASH DOWN ENGINE BAY TO FIND OIL LEAK CLEAN INNER AC CABIN FILTER	BMR Logistics

Date	Reading / Units	Type / Repairer Notes	Repairer
03/03/2026	10,221 kms	AdBlue R-2861 As attached Replaced Air/Oil filter due to blockage	Primary Mechanical Repairs
13/02/2026	994,974 kms	PUNCTURE T-1228	BMR Logistics
04/02/2026	987,555 kms	Cab R-2780 SEE ATTACHED REPAIR JOBCARD - REMOVED OLD WASHER HOSE AND REPLACED WITH NEW HOSE. WASHER HOSE USED WAS BOUGHT FROM BURSON AUTO PARTS X 3MM. SEE ATTACHED INVOICE AS RECORD OF PURCHASE. MECHANIC BREAKDOWN TIME: MIKAYLA 0.30MINS	BMR Logistics
29/01/2026	981,442 kms	Main/inspect T-1177 SEE ATTACHED TYRE JOBCARD 1177 - PRESSURE CHECKS X 10. ROTATIONS X 8. FLIP ON RIM X 2.	BMR Logistics
15/01/2026	969,154 kms	Main/inspect T-1126 SEE ATTACHED TYRE JOBCARD - 1 RUNOUT.	BMR Logistics
12/01/2026		TURNTABLE R-2603 SEE ATTACHED INVOICE FROM TRUCKLINE TOP PLATE REPAIR KIT (12 BOLT). SEE ATTACHED SERVICE JOBCARD S-1206 STATES REPAIRED PREVIOUSLY.	Truckline
12/01/2026	966,834 kms	C - 100k/Annual S-1206 PENSKE PO #2125 (AIRBAG) SEE ATTACHED PENSKE INVOICE DTH110710T SEE ATTACHED SERVICE JOBCARD - REFIT TOP L/H WING. REPLACED L/H REAR AIRBAG. REPAIR HOLE IN HOSE TO R/H CAB AIRBAG, LENGTHEN HOSE & REROUTE AWAY FROM EXHAUST. REMOVED BROKEN KEY FROM KEY BARREL & FIT SPARE KEY. MECHANICS BREAKDOWN TIMES: NATHAN 4.5HR MIKAYLA 3HR	BMR Logistics
02/01/2026	958,303 kms	Runout T-1094	BMR Logistics
02/01/2026		pres T-1094	
31/12/2025	948,407 kms	Electrical R-2618 SEE ATTACHED REPAIR JOBCARD - "CHECK OVER WIRING FOR TSAIL LIGHTS, REFIT TAIL LIGHT ASSY TO R/H SIDE AND SOLDER ALL WIRES TOGETHER. TEST LIGHTS FOR OPERATION AND ALL WORK.	BMR Logistics
11/12/2025		Chassis R-2238 ATTACHED SERVICE JOBCARD 1087 STATES: AIR COMPRESSOR HEAD GASKET LEAK. DEFERRED ACTION.	BMR Logistics
09/12/2025	935,811 kms	Chassis R-2547 SEE ATTACHED CUMMINS QUOTE 9364362.PO 2003 SENT TO CUMMINS. SEE ATTACHED REPAIR JOBCARD 2547.	BMR Logistics
17/11/2025	918,550 kms	SERVICE CALL/FIT T-1011 SEE ATTACHED INVOICE 1007901.	TYREPOWER SARINA
17/11/2025	919,365 kms	Suspension R-2470 SEE ATTACHED REPAIR JOBCARD	BMR Logistics
10/11/2025	914,347 kms	B - 40k S-1087 SEE ATTACHED SERVICE JOBCARD 1087.	BMR Logistics
10/11/2025	914,347 kms	Cab R-2436	BMR Logistics
06/11/2025	914,355 kms	Air Conditioner Cabin Truck dash , Chassis, Electrical, Reverse Alarm, Steering R-2404 PENSKE PARTS #1805- s/s mudguards, rear tail light, steer column mount. SEE ATTACHED INVOICE DTH109075T./DTH109089T. TRUCKLINE INVOICE 10450978 - wiper blade assy x 2. SEE ATTACHED REPAIR JOBCARD. SEE ATTACHED KENNYS INVOICE FOR AIRCON #62208.	BMR Logistics
05/11/2025	908,840 kms	Air Conditioner Cabin Truck dash R-2358 SEE ATTACHED KENNYS INVOICE 62140.	KENNYS AUTO ELECTRICAL TSV
16/10/2025	892,237 kms	Air Conditioner Cabin Truck dash R-2342	BMR Logistics

Date	Reading / Units	Type / Repairer Notes	Repairer
		NAPA INV 1430364465 WITH CREDIT NOTE: 1430364479-INCORRECT PART. (NOT ENTERED ON XERO). NAPA INVOICE 1430364478 for starter motor 12v bosch & 200A mega fuse st51 bolt on (5pk). WAITING ON REPAIR JOBCARD. SEE ATTACHED REPAIR JOBCARD. (SLEEPER AIR MALFUNCTIONED (SEPARATE JOBCARD - KENNYS AUTO TO INSPECT.	
13/10/2025	889,250 kms	NEW T-977 SEE ATTACHED INVOICE 1007037.	TYREPOWER SARINA
09/10/2025	885,682 kms	Exhaust R-2312 SEE ATTACHED REPAIR JOBCARD	BMR Logistics
09/10/2025	885,682 kms	Electrical R-2325 SEE ATTACHED REPAIR JOBCARD -REMOVED OLD BOLTS, FIT NEW TAIL LIGHT ASSY TO R/H SIDE.	BMR Logistics, Truckline
01/10/2025	878,740 kms	NEW T-967 REPLACE 8 TYRES SEE ATTACHED JOB CARD	BMR Logistics
23/09/2025	872,140 kms	Rotate T-1075	BMR Logistics
17/09/2025	865,595 kms	C - 100k/Annual S-1035 SEE ATTACHED SERVICE JOB CARD.	BMR Logistics
16/09/2025	865,595 kms	Mudflaps R-1955 SEE ATACHED REPAIR JOB CARD	BMR Logistics
16/09/2025	865,595 kms	Engine R-2221 SEE ATTACHED REPAIR JOB CARD WITH A NOTE TO CREATE NEW JOBCARD FOR THE AIR COMPRESSOR CONSTANTLY BLOWING OFF.	BMR Logistics
31/07/2025	821,981 kms	Air Conditioner Cabin Truck dash R-1998 Repaired as attached.	KENNYS AUTO ELECTRICAL TSV
30/07/2025	821,981 kms	B - 40k S-961 INSPECT DRIVE LINE AND ALL UNIS DRIVER HASS REPORTED A VIBRATION	BMR Logistics
23/07/2025		Glass R-1977 Replace wiper blades	BMR Logistics
16/07/2025	806,971 kms	AdBlue R-1946	Penske
09/07/2025	802,925 kms	Rotate T-906 Rotate equal front	BMR Logistics
26/06/2025	792,012 kms	Lights R-1837 Inspect and found fuse blown for indicators. Because fuse was needed to feed trailers as well, a larger amp fuse was fitted.	
22/05/2025	772,457 kms	C - 100k/Annual S-871 Replaced original cab ride height valve as was constantly exhausting	
14/05/2025	766,353 kms	Puncture T-808 1x Puncture Repair left rear inner	BMR Logistics
08/05/2025	650,655 kms	Electrical R-1599 Repair indicator fault. Find and repair fault Replace flasher	KENNYS AUTO ELECTRICAL TSV
06/05/2025	759,776 kms 3,324 hrs	Chassis R-1574 Inspect indicators. Found 20amp fuse was swapped for 7.5amp fuse and flasher relay dead. Replaced with new flasher. Inspect Cruise Control, check all fuses, check for power behind switch and have 13v but when operating switch there is no power out. Check and found half the pins don't match to wires in plug. Swapped back to old switch but fit the new cover. Cruise control now works. Fit new engine brake switch actuator and works fine. Replaced starter motor, engine oil and fuel filter on sleeper air.	

Date	Reading / Units	Type / Repairer Notes	Repairer
06/05/2025	759,776 kms	Puncture T-788 1x puncture repair left rear outer Pressure check	BMR Logistics
02/05/2025	757,957 kms	A - 10k S-854	BMR Logistics
31/03/2025		Engine R-1438 Please see attached Cummins invoice	Cummins
31/03/2025	738,731 kms	Engine R-1406 Replaced both belts on engine	BMR Logistics
24/03/2025	731,819 kms	New, Pressure Check T-721 2x New Steer Tyres Jinyu Pressure Check	BMR Logistics
24/03/2025	731,819 kms	B - 40k S-818 Noticed A/L compressor has been changed but found small leak passing o-ring in flange on compressor. Tighten all 5th wheel bolts and adjusted. Found drag link has bad movement in ball joint and replaced with new drag link. Found sleeper air overfilled with oil, drain excess and test operation. Tightened bolts on cab pan-pard rod. Topped up coolant.	BMR Logistics
26/02/2025		Air Conditioner Cabin Truck dash R-1161	Penske
17/02/2025	710,261 kms 10,392 hrs	Cab R-1095	Cummins
30/01/2025	600,661 kms	Air Conditioner Cabin Truck dash R-1067	Penske
09/01/2025		Brakes R-804 Undo hose from compressor pipe, start cutting back zipties, unbolt and removed walk plate behind cab, found hose wraps far down the chassis, lay out new hose supplied and looked for any joiners in original hose throughout the chassis, found new hose supplied will be to short, refit hose to compressor pipe, ziptie back up in chassis and refit rear walk plate.	BMR Logistics
09/01/2025		Glass R-31	
09/01/2025		Cab R-2	
08/01/2025		Driveline R-804 No Further Leaks	BMR Logistics
08/01/2025	687,321 kms	A - 10k S-712 Coolant condition low. Replaced Passenger Wiper Blade. Steering drag link has movement. Used last of spares to assemble replacement D/S spotlight, adjust and fit missing bolt to secure P/S spotlight. Inspect A/C not working found and repaired wire, when moving truck heard pop from controls and no more A/C, cant find anything wrong with wiring or fuses, believe controls for HVAC have died.	BMR Logistics
03/12/2024	654,521 kms	Suspension R-840 Check kingpins, wheel bearings and suspension bushes and all ok. Shake in steering was due to tyres, new steers and drive tyres replaced by John. Greased kingpins.	BMR Logistics
03/12/2024		Air Conditioner Cabin Truck dash R-888	BMR Logistics
03/12/2024	654,521 kms	Air Conditioner Cabin Truck dash , Chassis R-884 Hammered walkplate/sleeper air cover back into shape due to being pulled off by trailer kingpin. Clean Sleeper air free of oil and dirt build up over engine service area. Carried out sleeper air service replacing Oil & filter, Fuel primary & secondary filters and air filter. Inspect and adjust all belts. Test unit operation and check sorce of oil leaks. Found unused and used oil pressure switches are leaking through switch bodys, will need to order new ones. Refit rear rego/Sleeper cover plate. Refit top walk plate over engine and fit two new bolts, front of cover is strapped down due to handles being broken, will need two new handles for cover.	BMR Logistics
03/12/2024	654,521 kms	Chassis R-840 Loosen adblue tank straps, adjust tank gorward and retighten straps.	BMR Logistics
02/12/2024	654,519 kms	Air Conditioner Cabin Truck dash , Electrical R-884	BMR Logistics

Date	Reading / Units	Type / Repairer Notes	Repairer
		Refit plug in blower fan properly, replaced all blown fuses in Dash which fixed both blower and cigarette plugs	
28/11/2024		Air Conditioner Cabin Truck dash R-867 kennys repaired as per invoice	KENNYS AUTO ELECTRICAL TSV
27/11/2024	649,193 kms	C - 100k/Annual S-637 -Air compressor not cycling off properly when at max air, can hear change in compressor signalling that its getting air to cut off but still keeps building small amount of air and exhausting out air drier.	BMR Logistics
12/11/2024	632,306 kms	New T-439 2 new Tyres longmarch LM217 front	BMR Logistics
12/11/2024		New T-338	BMR Logistics
11/11/2024	631,169 kms	New T-437 8 new JD971 Jinyu	BMR Logistics
11/11/2024		Coolant, Engine R-804	BMR Logistics
08/11/2024	628,739 kms	Runout T-434 2 x Runouts left rear	BMR Logistics
31/10/2024		Chassis R-804 Replaced left hand mudflap.	BMR Logistics
31/10/2024	618,219 kms	Glass R-803 Refit hose to fitting, driver admitted to accidently pulling it out while adjusting wipers.	BMR Logistics
30/10/2024	618,219 kms	Steering R-828 Inspect king pins, found no up or down movement in either side but some side to side movement in L/h side kingpin (not enough movement to warrent repair, still within spec), greased kingpins. All tie rod ends in good condition. Spring bushes ok. Noticed when checking kingpins that Left hand tyre is odd shaped (egged) as tyre rotates freely just off the ground then comes to a halt as tyre touches the ground, this mixed with slight movement in kingpin could be the cause of vibration. Also note that steer tyres are not the same tyres	BMR Logistics
14/10/2024	599,236 kms	Rim T-410 1 x Flip on Rim left front	BMR Logistics
14/10/2024	599,236 kms	A - 10k S-596	LS Contracting
09/10/2024	594,839 kms 1 hrs	Runout T-405 1 x Runout left front	BMR Logistics
23/09/2024	577,412 kms	AdBlue, Exhaust R-804 Unbolt driver side guard under cab for access to exhaust, unbolt U-clamp, remove ad-blue injector hose, unbolt v-bands for flex pipe between dump and doser pipes and remove, break off and remove all crystalised ab-blue from chassis, hoses and remaining v-band with hammer and chisel. Unbolt remaining v-band clamp and remove doser pipe for repair. Hole in Doser pipe was welded closed, refit doser pipe and flex pipe, refit u-clamp and injector hose, refit driver side guard	BMR Logistics
23/09/2024	577,412 kms	Cab R-804 Inspect washers, passenger washer works fine, inspect hose for driver wiper and found driver removed hose from washer jet and ziptie hose to wiper blade to spray directly onto windshield, refit hose to joiner under hood cover, driver must have accidentally pulled hose from fitting while moving hose.	BMR Logistics
23/09/2024	577,412 kms	B - 40k S-582	BMR Logistics

Date	Reading / Units	Type / Repairer Notes	Repairer
		- Compressor hose to be replaced at this service. - Driver wiper washer not working. - Sleeper air due for service, 2190hrs. (1.5hr) Drain oil, Replaced fuel filters and air filter, clean down oil filter housing, unbolt oil pressure sensor unbolt filter housing cover, replaced oil filter, o-ring has swollen for filter housing, ordered new o-ring and fit to housing (was also very fiddly to keep in grooves during fitment), refit oil pressure sensor, fill with new oil and test run operation, wash down sleeper engine. - Ad-blue leak out exhaust doser pipe weld. - Coolant leak driver side of motor, rear of pipe coming out of water pump. - Front diff signs of leak from top of housing, if leak worsens diff will need reseal. (Monitor) - R/h rear mudguard Cracked throughout. - L/h rear mudflap torn.	
09/09/2024	563,413 kms	Cab R-782 Inspect and found water coming out under cab, for hose disconnected under to driver wiper, test and water comes up to windscreens now, passenger water is very pour and driver has hose just facing glass, remove hose and blow out washer jets refit washer jets as both were sitting in incorrect position on wiper arms, pull hose through driver wiper arm and fit to washer jet, test operation again and both are working evenly with good spray pattern.	BMR Logistics
07/09/2024		New T-336 TYRES AND MORE ROAD SIDE REPAIR	TYRES&MORE
03/09/2024	541,853 kms	Cab R-733 Clean of old tape and glue from camera and fit new strong adhesive double sided tape to back of camera, refit camera to windshield. Removed driver pillar where driver camera is mounted, unbolt mount and rescrew and mount points together for camera, refit camera mount to pillar and reinstall pillar to truck.	BMR Logistics
02/09/2024	555,355 kms	Air Conditioner Cabin Truck dash R-772 Sleeper air hoours: 2126hrs Test sleeper air unit, found during starting operation voltage at 13.4v and later dropping down to 12.6v and A/C feels cool but not cold. Unbolt rear and bottom covers on sleeper air unit, attempt to adjust belt tension, found thread on adjustment bolt damaged, removed tensioner bolt and removed all imperfections with correct thread file, refit and adjusted tensioner untill belt was tight again, retest Sleeper Air unit and stayed at 13v+ during operation and cold air out from vents.	BMR Logistics
02/09/2024		Pressure Check T-380 10 x Pressure Checks	BMR Logistics
02/09/2024	555,355 kms	A - 10k S-565	BMR Logistics
29/08/2024		Glass R-767 Replaced both LHS and RHS	Andrew's Mobile Windscreens
21/08/2024		Glass R-148	Andrew's Mobile Windscreens
07/08/2024	538,906 kms	A - 10k S-521	BMR Logistics
02/08/2024	536,053 kms	Cab R-713 Replaced driver seat with new seat.	BMR Logistics
01/08/2024	535,352 kms	Brakes R-708 Cut back service hose to fresh piece, undo fitting from rear of cab and remove olive piece, remove hose from olive piece and stretched olive open a bit, refit olive to hose and refit hose to fitting.	BMR Logistics
30/07/2024	530,193 kms	Cab R-675 Dash camera has been retaped to windscreen	BMR Logistics
30/07/2024	530,193 kms	Electrical R-624 Inspect and repairs have been carried out.	BMR Logistics
30/07/2024	530,193 kms	Lights R-697 Unscrew r/h reverse light, unbolt remaining bolt holding tail-light on, fit oversize washer to cover break in tail-light assembly, sickaflex back of tail-light near break for extra security and rear tail-light assembly and reverse light.	BMR Logistics
26/07/2024	530,193 kms	Exhaust R-607 Break off any build up and clean down exhaust, monitor for next service.	BMR Logistics
26/07/2024	530,193 kms	Brakes, Electrical R-683	BMR Logistics

Date	Reading / Units	Type / Repairer Notes	Repairer
		Remove and replace suzi hoses. Untangle and re-coil electrical leads, wioe of all grease on leads with brake clean and rag, check continuity either end of abs and lights leads to make sure no wires are snapped in coils, intertwined both leads and both suzis' feed leads down the center of suzis', streched suzis and leads out and zip-tied together, replaced both ends of lights lead and secured lead to truck socket with ziptie to ensure lead wont pull out.	
26/07/2024		Battery R-682	Penske
26/07/2024	530,193 kms	Driveline R-607 Condition unchanged since service, small weep around seal with no leak heading towards ground, minicule movement in tailshaft, no repairs required at this point in time, washed down and monitor next service.	BMR Logistics
26/07/2024	530,193 kms	Steering R-573 Tyres where inspected and rotated, no play in steering, kingpins and bearings are good	BMR Logistics
26/07/2024	506,423 kms	Coolant R-559 Topped up coolant	BMR Logistics
25/07/2024	530,193 kms	Air Conditioner Cabin Truck dash R-607 To be carried out with next service.	BMR Logistics
25/07/2024		Glass R-447	BMR Logistics
25/07/2024	530,193 kms	Glass R-675 Passenger window has been inspected and is not cause for replacement as of yet, monitor for further development	BMR Logistics
22/07/2024	528,714 kms	Pressure Check, Rotate T-507 Side 2 Side Steer Rotation 10 x P/C	BMR Logistics
22/07/2024		Cab R-383	
05/07/2024	515,796 kms	Brakes R-620 Bend lock in clip/latch back out and into shape, plug was slightly oval, gave plug small taps with hammer to bring it back into shape turned lead around and plug into truck socket.	BMR Logistics
04/07/2024	514,296 kms	C - 100k/Annual S-450 Sleeper Air hours: 1975hrs (Overdue for service) Weep on front drive output seal (Degreased and monitor) Adblue leak on Doser exhaust pipe (washed down and monitor) Oil and Filter not due.	BMR Logistics
28/06/2024	512,103 kms	Electrical R-597 Inspect and found pin pushed out behind interior lights fuse, also noticed from diagram that interior light fuse and indicator fuses are in wrong positioning. Remove passenger kick panel, reached behind and pushed interior light fuse pin back into holder, pin did not click or stay in place, bend pin into hold to try keep if from falling out, held rear of pin in place and inserted new 15amp blade fuse. Fit 20amp auto-resetting fuse in for indictors and test operation, found indicator relay holding and skipping, remove relay and remove relay cover, found power bar in relay pushed over and just making contact with opposite pin inside, pushed bar back center and refit cover, test operation and works as normal again, should no longer have returning issues.	BMR Logistics
28/06/2024	514,296 kms	Coolant, Engine R-601 Carried out during C service # 450	
26/06/2024	509,210 kms	Electrical R-574 Replaced Flasher relay with LED flasher relay.	BMR Logistics
30/05/2024	493,438 kms	Engine R-459 Nathan - Unbolt lines and clamps around sump, crack free and unbolt all bolts around sump, drop sump down and found oil pick up pipe had been damaged aswell, cleaned pick up pipe for numbers and ordered new oil pick up pipe, refit old sump with 2 bolts. Removed sump, fit new oil pick up pipe and o-ring, removed old sump gasket and cleaned gasket surface with scraper blade and rag, fit new sump and gasket, tightened all sump bolts in sequence, refit hoses and clamps. Replaced Oil filter, topped up oil and coolant once cummins had completed their repairs. Cummins - Cummins removed head from fuel pump and found collapsed spring and broken internals. (BMR ordered and supplied new fuel pump + gaskets) Cummins removed all hoses around fuel pump, removed compressor and blocked coolant hoses, removed fuel pump and cover all holes till new fuel pump arrived. Fit new fuel pump and gaskets, refit compressor with new gaskets and refit coolant lines, refit all hoses and accessories that were previously removed for ease of access, test drive and checked operation of vehicle.	BMR Logistics, Cummins

Date	Reading / Units	Type / Repairer Notes	Repairer
30/05/2024	493,854 kms	A - 10k S-373	BMR Logistics
27/05/2024	493,041 kms	Cab R-349 Removed top bolts from fibreglass wings and added two oversized washers to cover cracks/gap in fibreglass, refit bolts and ensure all bolts on wings are tight. Removed top cover for sleeper air to access bolts, unbolt rear cover and add two oversized washers to cover for wear, refit all covers	BMR Logistics
14/05/2024	483,018 kms	Electrical R-375 Replaced plug center with 2nd hand center in good condition	BMR Logistics
07/05/2024	487,825 kms	Chassis R-332 Greased all points on truck.	BMR Logistics
03/05/2024	484,151 kms	Rim T-164 PUT ON ANOTHER RUN OUT.	BMR Logistics
03/05/2024	465,626 kms	Main/inspect T-146	
03/05/2024	475,825 kms 1 hrs	Main/inspect T-159	
03/05/2024	475,825 kms	New T-179 8 X NEW TYRES	Tyre Evolution
03/05/2024		New, Rim T-123	BMR Logistics
03/05/2024	484,158 kms	A - 10k S-288 Nil grease in stock	BMR Logistics
30/04/2024	484,157 kms	Electrical R-317 Found blown flasher relay, replaced with new	BMR Logistics
29/04/2024	480,483 kms	Chassis R-310 Removed all lights and brackets, removed mudflap, rear light bar, guard and brackets. Gave bracket for rear bar to francis to be welded up, panel beat tail light bar and rear mudguard bracket till bends are gone and back as straight as possible, refit repaired rear bar bracket and refit rear bar, fit rear mudguard bracket, removed mudguard bracket and straightened more then refit, mark and drill new mudguard and fit to truck, refit mudflap, refit all lights and bracket and solder in wiring, check security and operation and everything is good.	BMR Logistics
22/04/2024	475,826 kms	Cab R-216 PO#115 16.4.24 Fit new driver lower flare in place, drill holes for pop rivets, remove flare and run bead of sicaflex on mating surface, pop rivet new flare to mudguard	BMR Logistics
16/04/2024		Glass R-228	
16/04/2024	473,127 kms	Engine R-228 Open engine bay, remove cab rear engine cover and cab driver side cover to access clutch line p-clamps, drained clutch fluid from system and unbolt and p-clamps holding line, remove old clutch line and slide in new upgrade line made by 24hr Hose, resecured line through chassis and engine bay and refit clutch line, reverse bleed clutch line from the bottom till reservoir was over full and then drain any remaining air back out through bottom bleed screw, checked clutch operation and pedal feels harder and more responsive now.	BMR Logistics
05/04/2024	467,447 kms	A - 10k S-254	BMR Logistics
05/04/2024	467,447 kms	Lights R-250 Replaced spotlight bracket with 2nd hand spare on shelf, fit with larger washers and test operation.	BMR Logistics
05/04/2024	465,626 kms	Lights R-247 Found indicator flasher relay not working, replaced with new flasher relay	BMR Logistics
02/04/2024	485,031 kms	Bullbar R-225	BMR Logistics

Date	Reading / Units	Type / Repairer Notes	Repairer
		Inspect and found two broken bolts and one missing all on driver side. Unbolt lower bracket mount and remove, unbolt upper bracket mount, remove, drill and easy-out broken bolts, refit upper bracket in place, antisiezed all bolts and bolt upper and lower brackets. No further movement in bullbar.	
28/03/2024	461,519 kms	B - 40k S-232	BMR Logistics
		Passenger window cracked. Clutch line needs to be replaced (swells when applied)	
27/03/2024	485,845 kms	Lights R-231	BMR Logistics
		Check fuses and found blown fuse, replaced fuse and lights work again. 20amp blade fuse	
27/03/2024	456,847 kms	Bullbar R-226	BMR Logistics
		Nathan 14/3/24 - 15/3/24 Inspect and found 6 broken bolts in bullbar mounts with two bolts holding it on. Unplug all wiring to bullbar and remove p-clamps holding wiring, unbolt all hinge bolts, take weight off bullbar with forklift, unbolt eye-bolts and remove bullbar, take weight off burbar mounting bar with forklift, unbolt remaining 2 bolts and move bar out of the way, drill broken bolts and try to easy-out but bolts are twisted and seized, had multiple attempts at heating with blow torch and spraying with rost off and one one bolt was removed, had to switch to oxy-acetylene torch and a further 3 bolts came out. Francis 15/3/24 Removed remaining 2 broken bolts, antisiezed all bolts and refit bullbar mounting bracket, refit bullbar and wiring.	
27/03/2024	457,847 kms	Brakes R-215	BMR Logistics
19/03/2024	457,847 kms	Pressure Check T-124	
15/03/2024	455,898 kms	Electrical R-207	
		Replaced R/H tail light assembly, soldered in new wiring.	
15/03/2024	455,898 kms	Pressure Check T-113	
13/03/2024	452,671 kms	Coolant R-148	
		Replaced radiator cap, no added coolant needed	
13/03/2024	446,994 kms	Electrical R-144	
		Replaced led electric flasher relay with one picked up from NAPA	
06/03/2024	445,919 kms	New T-74	
		1.3.2024 John 8x drive tyres new 2.5hrs	
06/03/2024	443,406 kms	B - 40k S-193	
		Carried out cummins/adblue flush, removed lines and cleaned out with warm water. Passenger Window needs replacement. Coolant was low, suspect bad radiator cap. *New radiator cap fitted by Francis 29/2 nil stock at the time of service on 27/2* Drive tyres have little tread and need to be regrooved.	
06/03/2024	443,406 kms	Lights R-148	
		Cut out and solder in new side marker light on L/h tail light bar	
06/03/2024	447,802 kms	Rim T-74	
		5.3.24 Nathan Truck come into workshop with flat driver steer tyre, jack up axle, remove tyre and inflate looking for leak on tyre, found leak coming from crack in center of rim. 0.5hr 5.3.24 John Swap tyre onto spare rim on hand, fit to truck and remove jack, inflate tyre to 115psi 0.5hr	
04/03/2024	449,623 kms	Air Conditioner Cabin Truck dash R-144	
		- 4.3.2024 446994kms Inspect and found to be wiring issue for fan dropping out but no wiring issues for the control panel to not be working, inspected control power board disassembled and found would pulse/work when some diodes and chips were bypassed believe control board to be faulty and new board to be ordered. - 7.3.2024 449623kms Remove old wiring for a/c controls, fit new a/c controls and harness and test operation, all a/c controls are working as normal.	
02/02/2024	423,161 kms	Cab R-29	NQ Fuel & Maintenance (RCC Lowth Pty Ltd)
		Replace perished hose on driver wiper washer. (Hose sourced from Penske)	
31/01/2024	421,332 kms	Repair T-5	
		Repair x1 flat tyre	
21/12/2023	396,638 kms	C - 100k/Annual S-38	NQ Fuel & Maintenance (RCC Lowth Pty Ltd)

Date	Reading / Units	Type / Repairer Notes	Repairer
C SERVICE			
19/12/2023	396,638 kms	C - 100k/Annual S-5	NQ Fuel & Maintenance (RCC Lowth Pty Ltd)
C SERVICE			
14/10/2023	357,539 kms	B - 40k S-31	NQ Fuel & Maintenance (RCC Lowth Pty Ltd)
B SERVICE			

Signed: _____

Name: _____

Date: _____