

Work Order History Report

Asset	W/O No	Description	Finished	Done Reading
T0277		Kenworth T401 Prime Mover		
	193122	2 steers as per MV, 11/5/26, Fix Bullbar and Lights as per MV 27/5/26 Mudflaps and brackets	27/05/2026	KM
	193244	Diagnose Vehicle Shutting down, found low coolant fault, pressure tested	14/05/2026	KM
	191810	HVIS Inspection - Yearly. Booked in Dubbo 23/04 @ 1:55pm	23/04/2026	KM
	60727	Workshop Labour: - Batteries had also failed, even after significant charging, they wouldn't hold charge and failed under load. - Remove and replace batteries. - Checked over engine harnesses and main chassis harnesses. - All ok - Checked both coolant sensor and oil pressure sensors - All ok. - Stripped out dash and found a bypass wire that was taped in the original plug for the turbo timer. - If wiggled or removed it would shut the truck down. - Refit original bypass plug in and also replaced associated relay. - Test vehicle.	9/02/2026	Hours
	59714	Diagnose no PTO working,- bypassed as not a requirement for truck at the moment. Diagnose Truck cutting out 12/12/25 - removed roll over protection sensor and returned truck back to work after troubleshooting.	12/12/2025	Hours
	58666	Water Truck - 2000hr Service/Annual 2107hrs	3/11/2025	Hours
	57207	Repair flashing light and trailer blinkers - replace beacon globe - repair bad electrical connection and test -Pyrometer not working, remove and replace faulty sensor	28/08/2025	KM

Asset	W/O No	Description	Finished	Done Reading
	56316	HVIS Inspection - Yearly. Booked in Mudgee 14/08 @ 2:10pm Carried out prep for annual HVIS inspection and completed all required repairs for compliance. Replaced king pin kit and steer wheel seals, renewed PP1 brake valve, replaced A/C hoses due to leak at compressor, fitted new LH seat belt assembly, replaced Airglide suspension air lines, fittings and spacers, repaired and treated corrosion around tank-lid hinges, and completed registration clearance. Includes workshop consumables and freight.	15/08/2025	KM
	55618	Repair dashlights not working 739338km -inspect spotter mirror installed - check transmission of turn table bolts - inspect oil leak at steer pump only minor weep - inspect all lights functioning - inspect all engine fluid levels - check heater and demister function - check wiper/washer function - check tyres inflated - replace turntable lockpins, given to Luke H and sent to site	26/06/2025	KM
	54859	Prime Mover B2 Service (40,000kms) 738745/1810hrs - change out torque rod bushes x 8 - Repair clutch slipping, unable to get adjustment correct out of adjustment, required all linkages readjusting to get correct angle 27/5 Defect list added to work order -Re adjust clutch, adjust all clutch linkages, grease all clutch pivot points - repair loose left hand exhaust shroud, fabricate missing top and bottom shroud exhaust brackets and install - repair power steering leak at steering pump, fitting on top of pump very difficult to access, replace fluid - test trailer plug for operation 28/05 - re adjust clutch, adjust all clutch linkages - grease all clutch pivot points - repair loose left hand exhaust shroud - fabricate missing top and bottom shroud exhaust brackets and install - repair power steering leak at steering pump	28/05/2025	738745 KM
	54845	GPS Not working 738745km - remove and replace GPS, re-program with TFO	13/05/2025	738745 KM
	54092	Diagnose/Repair Air leak *Replace spotter mirror *Main brake air hose rubbed through replaced and spray air line rubbed through placed a joiner in air line	11/04/2025	KM
	53633	A/C repairs - replace tx valve and drier, pressure test - vac down charge with R134A and test	10/04/2025	KM
	53396	A/C / electrical repairs	26/03/2025	KM

Asset	W/O No	Description	Finished	Done Reading
	52365	Bonnet latch repair -Replaced left hand bonnet strap - replaced trailer plug	26/03/2025	KM
	52860	Inspecting front wheel bearings and kinpins Inspecting front hub oil level Repair cab air leaks 735258km - tightened front right wheel bearing and topped up hub oil in right hand kinpin, minimal movement - topped up A/C gas	25/02/2025	735258 KM
	49803	Diagnose and Repair Engine Fan Belt Squeal Replaced A/C belt Replaced two bearing fan belt idler	4/11/2024	728462 KM
	49734	Fit counterweight For Maas Repairs to Use for Licensing.	31/10/2024	KM
	18570	HVIS Inspection - Yearly. Booked Dubbo 12/08 @ 2:40pm	12/08/2024	728177 KM
	18691	Capital - Pre HVIS inspection/ repairs 728,161km Quote \$15,758.35 -R&R front Suspension (springs, bushes, pins and U-bolts) -Replaced Rear Suspension Torque Rod Bushing -Inspected all wheel bearings -Inspected Steer Kingpins -Replaced all Oil cooler hoses from Transmission and P-Clamps -Replaced all Fuel Hoses from Tanks to engine and P-Clamps -Replaced all fuel tank taps -Replaced Fuel tank strap rubbers -Replaced Roof clearance lights x2 needed to replace complete assembly and seal -Replaced 6x blown globes in dash -Replaced Turntable foot bushing and R&R greaseless Pad -Reseal several air fitting on air tanks (Air Leak) -Replace pressure protection valves x2 (leaking air) Check Operation of ADR35 and Tractor Protection -Replace Pancake 1st axle LHS Booster -Replaced both side Headlight Protectors (Broken) Replaced H4 Head light assembly due to water damage -Replaced Rear marker signs -Replaced Driver side aircon vents (broken) -Replaced Driver seat cover -Clutch Adjustment -Unblock Windscreen washers and top up fluid -R&R oil filter leaking -Wash Vehicle -Carry out brake test -Test drive vehicle and inspect for leaks and work carried out -Take Vehicle to HVIS inspection (PASSED)	12/08/2024	728161 KM
	13828	15000KM SERVICE, WIPER BLADES, REPLACE ALL DRIVE TYRES, REPLACE FAULTY CLEARANCE LIGHTS, REPAIR LEAKING STEERING PUMP.	16/04/2024	KM

Asset	W/O No	Description	Finished	Done Reading	
		A1 Earthworx			
	13026	Replace clutch. Inspect reported air leak - no fault found. Replace air bag at drivers side rear. Inspect reported radio not working - no fault found.	3/04/2024	725757	KM
	5721	Vehicle stopped M4 east bound greystains Organise afterhours tyre fitter P & P Truck Repairs Attend site R&R axle 3 right side inner tyre	23/09/2023		KM
	3642	HVIS Inspection - Yearly. Advised Tracy Cheney 26/07. Defects Replaced 2x tyres and Rectified windscreen washers	18/09/2023	701342	KM