Walnut Grove Auto Tech

Your Dealership Alternative, Right Here in Walnut Grove

20092 93A Avenue Langley, BC V1M3Y4 Phone: (604) 888-1617 Email: wgauto@telus.net

Invoice

Bill To Western Pacific Enterprises LTD Jagolicz, Damian 200-19433 96th ave Surrey, B.C. V4N 4C4 Canada

Cell (778) 504-9400 Home (778) 222-4439 Email djagolicz@wpe.ca

Invoice # 63300 Work Order # 81222 Service Advisor Scott Tyrrell Technician Aron Parkanyi Plate BC MM 6171

Description 2013 Chevrolet Silverado 1500 LS V8 4.8L

294CID VIN A

VIN 1GCRKREA2DZ182096

Unit 1062 Odometer 173,295

Invoice Date 10/29/2025 5:00 PM Appointment 10/24/2025 9:00 AM Promised 10/24/2025 6:00 PM

Inspection

[AS1] Seasonal Inspection

Labor 0 Hour \$0.00 *GP

\$0.00 Sub

Service

Seasonal Service

Replace Engine Oil and Oil Filter, Check All Fluid Levels, Check Air filter and Tune up Condition, Check Brakes and Rotate Tires, Check Steering System and Suspension Components, Check Tire Pressures and Condition, Check Heater and Air Conditioning Performance, Check Battery Condition and Charging System, Check all Lights, Check Wiper and Washer system.

Fram - Engine Oil Filter 1 Unit \$14.96 / Unit \$14.96 GP \$15.31 / Litre 5.7 Litre \$87.27 GP

Lucas - 5W30 Synthetic Engine Oil, Meets / Exceeds: GM

dexos1™ Gen 2, API SP, SN Plus, SN, SM,

SL, ILSAC GF-6

Labor 0.9 Hour \$139.50 *GP

(We perform a thorough inspection of the vehicle and document its condition at the time of inspection. However, please note that this inspection cannot guarantee the absence of future issues or problems with the vehicle)

> **Discount** (\$13.95) Sub \$227.78

Air Filter

Remove and Replace components as required to access and install materials, and/or perform needed service. Retest and verify repair as required. Perform final road test where applicable.

Engine Air Filter 1 Unit \$48.31 / Unit \$48.31 GP

> Sub \$48.31

Spark Plug(s) // Recommended due to age and condition

Remove and Replace components as required to access and install materials, and/or perform needed service. Retest and verify repair as required. Perform final road test where applicable.

Spark Plug 8 Unit \$19.98 / Unit \$159.84 GP

1.38 Hours \$213.90 *GP Labor

> **Discount** (\$21.39)Sub \$352.35

Suspension Ball Joint, Lower // Ball joints are loose

Remove and Replace components as required to access and install materials, and/or perform needed service. Retest and verify repair as required. Perform final road test where applicable.

Control Arm with Ball Joint - Front Left Lower 1 Unit \$214.24 / Unit \$214.24 GP Control Arm with Ball Joint - Front Right Lower 1 Unit \$214.24 / Unit \$214.24 GP Labor 5.25 Hours \$814.96 *GP

Discount (\$81.50) Sub \$1,161.94

Suspension Control Arm, Upper // Control arm bushings cracked

Remove and Replace components as required to access and install materials, and/or perform needed service. Retest and verify repair as required. Perform final road test where applicable.

_abor	2.5 Hours		\$387.50 *GP
Suspension Control Arm and Ball Joint Assembly	1 Unit	\$214.09 / Unit	\$214.09 GP
Suspension Control Arm and Ball Joint Assembly	1 Unit	\$214.09 / Unit	\$214.09 GP

Discount (\$38.75) Sub \$776.93

Alignment, Four Wheel 3D // to be done with upper and lower control arms

Inspect steering and suspension system components. Connect alignment equipment to verify and adjust front and rear wheel alignment settings for caster, camber, and toe in/out settings, thrust angle where applicable and center steering wheel. Some vehicles may require installation of alignment shims at additional charges. Adjust to meet manufacturers' specifications. Perform final road test where applicable.

Labor 1.1 Hour \$170.50 *GP

Discount (\$170.50) Sub \$0.00

Diagnose Engine Concern // CEL is on, MANY codes present in system

Scan for code po700 transmission fault, p2272 os sensor bank 2, p2273 o2 rich bank 2 sensor 2, po741 torque convertor system off. Test o2 sensor and After O2 sensors warmed up, found B1S2 never deviated from 450mv. For The torque convertor codes we drove it and found it was coming on when commanded (no shudder felt either?) however the more it's driven and at hwy speed the Labor 1.29 Hour \$199.95 *GP

Discount (\$199.95) Sub \$0.00

Tire Pressure Monitoring System (TPMS) Sensor - all 4 sensors were dead

Remove and Replace components as required to access and install materials, and/or perform needed service. Re-test and verify repair as required. Perform final road test where applicable.

Tire Pressure Monitoring System Programmable Sensor	4 Unit	\$61.23 / Unit	\$244.92 GP
Labor	1 Hours		\$155.00 *GP

Discount (\$155.00) Sub \$244.92

PO -- PO# 9420.4310

Total Parts Total Labor Total Before Taxes & Miscellaneous Charges		\$1,411.96 \$1,400.27 \$2,812.23
(*) Shop Supplies, Enviro Fees, Cleaners, Grease, Lubricant, Small Parts, Fasteners and any other items too small to Invoice	5 %	\$49.95 PG
(G) Canadian Goods and Services Tax (GST)	5 %	\$143.11
(P) BC Provincial Sales Tax (PST)	7 %	\$200.36
Grand Total		\$3,205.65

Total discounts applied is \$681.04

Western Pacific Enterprises LTD charged \$3,205.65 to Account - 487 - Western Pacific Enterprises LTD - Net 30 Days

Thanks for the Business!

I acknowledge receipt of the vehicle and the indebtedness indicated herein.

Customer Signature:_____

Authorization(s)

10/27/2025 12:52 PM \$4,063.87 In Person / Other

Authorized by Western Pacific Enterprises LTD