

LC38-2



J.D.A. Ventures Ltd.
 713031 Range Road 64
 Grande Prairie AB T8W 5E5
 Work: 780-532-5101 Fax: 780-532-5128

Equipment: 265

Work Order #: 29268

Date: 10/1/24

Year: 2016

Make: Peterbilt

Model: 367

Serial Number: 1XPTP4EX8GD284971

Odometer: 838,106

Hours: 21,302

Bay #: 2

Work Order Type: Other Repair

Labor

Description	Mechanic	Quantity/Hours	Amount
1 Complaint: drive shaft	Michael Kennedy	.00	.00
1 Cause: broken off	Michael Kennedy	.00	.00
1.1 Correction: remove drive shaft/steady bearing. Remove straps. Tie up drive shaft/drop. Push out steady bearing. Clean surfaces. Remove u-joint/yoke from other end of broken shaft. Remove strap kit. Remove u-joint. Drain all 3 diffs	Michael Kennedy	4.00	400.00
1.2 Correction: help to install driveline	David Godwin	1.50	150.00
2 Complaint: PS front hub leaking	Michael Kennedy	.00	.00
2 Cause: hub cover	Michael Kennedy	.00	.00
2 Correction: re/re hub cover and filled	Michael Kennedy	2.00	200.00
1.3 Correction: put u-joint in and put drivelines in from transmission to #1 diff. Tested locks - found #1 diff is acting up. Pulled axles out and looked at axles - everything seems fine. Put axles back in	Austin Dean	5.00	500.00
3 Complaint: rebound bolt diff #3	Austin Dean	.00	.00
3 Cause: falling out	Austin Dean	.00	.00
3 Correction: remove bolt and order parts. Clean up workspace and complete paperwork. Install new and tighten bolt down	Austin Dean	3.00	300.00
4 Complaint: tire chains	Austin Dean	.00	.00
4 Cause: need to be removed	Austin Dean	.00	.00
4 Correction: remove tire chains and hang on rack. Clean up work space	Austin Dean	1.50	150.00
5 Complaint: check for air leaks	Austin Dean	.00	.00
5 Cause: in shop	Austin Dean	.00	.00
5 Correction: ran truck and checked for air leaks - good. Check lights as well - good	Austin Dean	1.00	100.00

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
25042111, Spicer Midship Yoke	Edmonton Trailer Sales & Leasing ...	627605	1.00	259.46	259.46
2301236, washer - driveshaft	Edmonton Trailer Sales & Leasing ...	627605	1.00	4.72	4.72
2507411, Driveshaft Nut	Edmonton Trailer Sales & Leasing ...	627605	1.00	20.86	20.86
2505311, spl250 midship shaft	Edmonton Trailer Sales & Leasing ...	627605	1.00	349.99	349.99
spl2503x, U-Joint Kit	Edmonton Trailer Sales & Leasing ...	627605	2.00	239.57	479.14
3434249, Stemco Hubcap & Gasket	Edmonton Trailer Sales & Leasing ...	627605	1.00	80.17	80.17
2505311, spl250 midship shaft	KW Mechanical	221809	1.00	342.95	342.95
3434095, hub cap	KW Mechanical	221809	1.00	72.95	72.95
pb21, spring roller kit	KW Mechanical	221916	1.00	52.37	52.37
2507018x, Strap Kit (see notes)			2.00	24.51	49.02
3303118, Stemco Hub Gasket			2.00	4.88	9.76
trsy759p20, 75w90			60.00	10.10	606.00

Returns

Description	Quantity/Hours	Price/Rate	Amount
2505311, spl250 midship shaft	1.00	349.99	349.99



J.D.A. Ventures Ltd.
 713031 Range Road 64
 Grande Prairie AB T8W 5E5
 Work: 780-532-5101 Fax: 780-532-5128

Sublet

Description	Invoice Description	Price/Rate	Quantity/Hours	Amount
Invoice: 221809 Supplier: KW Mechanical *(CHQ)	kw freight	55.00	1.00	55.00
Invoice: 39365 Supplier: Edmonton Traller Sales & Leasing Ltd. *(CHQ)	Machine drive line	1,421.59	1.00	1,421.59

Mikey - Driveshaft

Total Labor	1,800.00
Total Parts	2,327.39
Total Returns	-349.99
Total Sublet	1,476.59
Shop Supplies	180.00
Invoice Total	5,433.99



J.D.A. Ventures Ltd.
 713031 Range Road 64
 Grande Prairie AB T8W 5E5
 Work: 780-532-5101 Fax: 780-532-5128

Equipment: 265

Work Order #: 28564

Date: 8/16/24

Year: 2016

Make: Peterbilt

Bay #: 1

Model: 367

Work Order Type: Other Repair

Serial Number: 1XPTP4EX8GD284971

Odometer: 834,902

Hours: 21,200

Labor

Description	Mechanic	Quantity/Hours	Amount
1 Complaint: roll through	Bill Maciborsky	.00	.00
1 Cause: as per process	Bill Maciborsky	.00	.00
1 Correction: roll through unit and make a list of repairs needed. Order parts	Bill Maciborsky	2.50	250.00
2 Complaint: PS front hubcap leaking	David Godwin	.00	.00
2 Cause: leaking	David Godwin	.00	.00
2 Correction: re/re with new and fill with oil	David Godwin	.50	50.00
3 Complaint: fifth wheel pins and bushings	David Godwin	.00	.00
3 Cause: worn	David Godwin	.00	.00
3 Correction: remove lock bolts. Lift and remove fifth wheel. Remove bushings - found loose - pins knurled already. Re/re bushings and saddles - reused knurled pins	David Godwin	4.00	400.00
4 Complaint: DS steer dust cover	David Godwin	.00	.00
4 Cause: broken	David Godwin	.00	.00
4 Correction: remove dust cover - extra time to get cover out. Found wrong part was ordered. Install new dust cover	David Godwin	1.50	150.00
5 Complaint: hood cracked	David Godwin	.00	.00
5 Cause: cracked	David Godwin	.00	.00
5 Correction: clean area. Apply epoxy to cracks. Grind down epoxy so bracket fits. Reapply epoxy and install bracket	David Godwin	2.50	250.00
6 Complaint: PS front shock	David Godwin	.00	.00
6 Cause: upper bolt loose	David Godwin	.00	.00
6 Correction: re/re bolt with new and tighten. Install shock	David Godwin	1.50	150.00
7 Complaint: input on diff #1 loose	David Godwin	.00	.00
7 Cause: adjust bearing	David Godwin	.00	.00
7 Correction: drop drive shaft. Pull yoke - had to use puller. Remove seal and tighten up adjuster. Clean surface. Install new seal, yoke, new nut. Install driveshaft with new strap kit **Extra time due to shop inspection**	David Godwin	6.00	600.00
8 Complaint: output diff #1 leaking	David Godwin	.00	.00
8 Cause: seal leaking	David Godwin	.00	.00
8 Correction: remove driveshaft. Remove nut and pull yoke - seized on. Seal rusted/seized on - took extra time to remove. Clean bore of rust and burrs. Install new seal. Install yoke with new nut	David Godwin	3.50	350.00
9 Complaint: pigtail for washer pump	David Godwin	.00	.00
9 Cause: stolen for another unit	David Godwin	.00	.00
9 Correction: replace plug pins and wires. Test - good	David Godwin	1.00	100.00
10 Complaint: input diff #2 leaking	David Godwin	.00	.00
10 Cause: leaking	David Godwin	.00	.00
10 Correction: pull yoke. Remove seal. Adjust bearing. Clean bore. Install new seal. Install yoke with new nut. Install driveline with new strap kits	David Godwin	2.50	250.00
11 Complaint: diff #2 output loose	David Godwin	.00	.00
11 Cause: yoke loose	David Godwin	.00	.00
11 Correction: drop driveline. Remove nut - seized. Remove yoke - nut wasn't all the way in. Install yoke with new nut. Tighten all the way in - no play now. Reinstall driveshaft	David Godwin	2.00	200.00
12 Complaint: coolant level sensor	David Godwin	.00	.00
12 Cause: removed for another unit	David Godwin	.00	.00
12 Correction: build and replace pigtail. Check - no coolant light on	David Godwin	.50	50.00
13 Complaint: DEF tank cover loose	David Godwin	.00	.00
13 Cause: loose	David Godwin	.00	.00
13 Correction: remove broken bolts. Drill holes. Rivet into place	David Godwin	1.00	100.00



J.D.A. Ventures Ltd.
 713031 Range Road 64
 Grande Prairie AB T8W 5E5
 Work: 780-532-5101 Fax: 780-532-5128

Labor

Description	Mechanic	Quantity/Hours	Amount
14 Complaint: bolt digging into air-to-air	David Godwin	.00	.00
14 Cause: cracked	David Godwin	.00	.00
14 Correction: found bracket cracked - remove for welding	David Godwin	1.50	150.00
15 Complaint: mesh on back loose	David Godwin	.00	.00
15 Cause: cracked	David Godwin	.00	.00
15 Correction: cut welds. Removed bracket. Prepped for welding. Weld as needed. Install rear mesh. Install front fender guard. Re-bushing air-to-air	David Godwin	6.50	650.00
16 Complaint: check engine codes	David Godwin	.00	.00
16 Cause: codes	David Godwin	.00	.00
16 Correction: get Evan @ Stahl to investigate issue. Found needs fuel pump head	David Godwin	1.50	150.00
17 Complaint: headache lights dim	David Godwin	.00	.00
17 Cause: fuse holder	David Godwin	.00	.00
17 Correction: re/re fuse holder (burnt out) with 30amp	David Godwin	.50	50.00
18 Complaint: RH upper pull out light flashing	David Godwin	.00	.00
18 Cause: loose wire	David Godwin	.00	.00
18 Correction: recrimped loose wire	David Godwin	.50	50.00
19 Complaint: bunk heater control hanging	David Godwin	.00	.00
19 Cause: loose tape	David Godwin	.00	.00
19 Correction: tape back up	David Godwin	.50	50.00
20 Complaint: hood pivotbushings worn	David Godwin	.00	.00
20 Cause: worn	David Godwin	.00	.00
20 Correction: re/re with new	David Godwin	1.50	150.00
21 Complaint: fuel tanks not equalizing	David Godwin	.00	.00
21 Cause: unknown	David Godwin	.00	.00
21 Correction: check vents for check valves - good. Make fuel cross-over line. Check for leaks - none	David Godwin	1.50	150.00
22 Complaint: service	David Godwin	.00	.00
22 Cause: due	David Godwin	.00	.00
22 Correction: complete service as per checklist - change oil, oil filter and fuel filters. Sample taken. Grease	David Godwin	6.00	600.00
23 Complaint: JDA stainless signs	David Godwin	.00	.00
23 Cause: missing	David Godwin	.00	.00
23 Correction: mark and drill out holes. Install signs with stainless bolts. Clean up work space	David Godwin	3.50	350.00

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
k249362k, dust cover	Stahl Peterbilt	s1755989	1.00	166.38	166.38
hm7564726atr, Hood Mount Pivot Bushing	Stahl Peterbilt	s1755989	2.00	23.34	46.68
b346005, stud, shock mount P/S Steer	Stahl Peterbilt	s1755989	1.00	70.27	70.27
514353etn, Output Nut & Seal	Stahl Peterbilt	s1755989	2.00	128.18	256.36
131008k, Pinion Seal & Nut Kit	Stahl Peterbilt	s1755989	1.00	92.52	92.52
rkpkt2, Pocket Kit Holland 5th Wheel	Stahl Peterbilt	s1755989	1.00	69.58	69.58
rk10605, ILS Bracket Pins & Cushion Kit (2 piece)	Stahl Peterbilt	s1755989	1.00	96.19	96.19
1613chr, Hubcap (Pete)	Stahl Peterbilt	s1755989	1.00	37.37	37.37
hwc12514, nut-hex sl nyl m12-.75x1	Stahl Peterbilt	s1755989	1.00	1.05	1.05
2n2766, Lock Nut	Stahl Peterbilt	s1755989	1.00	7.28	7.28
hwc07084, Nut-Hex Flg Sltd 5/8	Stahl Peterbilt	s1755989	2.00	11.77	23.54
l346021, Bolt Hood Pivot	Stahl Peterbilt	s1755989	2.00	43.73	87.46
trsy759p20, 75w90			3.00	10.10	30.30
mzb1561001, Steel Dustshield			1.00	176.34	176.34
e117, Gloss Black Paint	Napa Ideal Automotive & IND Supp...	901712741	2.00	10.59	21.18
1707018x, Splicer Strap Kit			2.00	31.85	63.70
131008k, Pinion Seal & Nut Kit			1.00	117.29	117.29
n4751001, Kit-Mounting Radiator/CHA	Stahl Peterbilt	s1758745	1.00	154.21	154.21
psc30, Synthetic Grease Tubes			2.00	6.93	13.86
hdxmv32p20, Hydrex MV 32 Hydraulic Oil			20.00	5.34	106.80



J.D.A. Ventures Ltd.
 713031 Range Road 64
 Grande Prairie AB T8W 5E5
 Work: 780-532-5101 Fax: 780-532-5128

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
5515250, Coolant Hose, 2.5" (per inch)			22.00	3.98	87.56
80770, Windex, Aerosol (WC)			1.00	6.48	6.48
abaf1, Air Brake Antifreeze (1L)			2.00	3.79	7.58
anc4388710, 1" x 16' Mini Ratchet Tiedown Strap			2.00	12.78	25.56
cs8sc038125, 3/8 x 1-1/4 GR8 PL NC Bolt			50.00	.28	14.00
cs8sc038150, 3/8 x 1-1/2 GR8 PL NC Bolt			50.00	.36	18.00
822165ea, H.D. ATO Fuse Holder			1.00	1.86	1.86
p037stpas, Retaining Ring			1.00	1.01	1.01
100t38, 3/8" 600# F/P Ball Valve			2.00	3.78	7.56
115c, 3/8 NPT 90 Street Elbow			2.00	3.38	6.76
122c, 3/8NPT Hex Nipple			2.00	1.68	3.36
4496c, #6 X 3/8 NPT 90 Flare Adapter			5.00	2.86	14.30
4488c, #8 X 3/8 NPT FLARE ADAPTER			4.00	1.78	7.12
fs19764flg, Fuel Seperator			1.00	26.51	26.51
ff5825nnflg, Fuel Filter			1.00	67.33	67.33
lf14001nnflg, Spin-On Oil Filter			1.00	64.05	64.05
dsph15blk, 15W40 Oil - Duron SHP Bulk			48.00	5.06	242.88
oilsample, Oil Sample / Anaysis - Basic Wear			1.00	31.50	31.50
q347367flg, Power Steering Cap			1.00	22.25	22.25
psc30, Synthetic Grease Tubes			2.00	6.93	13.86

Sublet

Description	Invoice Description	Price/Rate	Quantity/Hours	Amount
Invoice: E2966311 Supplier: Whitecourt Transport *(CHQ)	stahl to wc jda	48.67	1.00	48.67
Invoice: 108473 Supplier: Schaffer's Custom Welding *(DD)	Go to site and Weld Cracks on Fender Brackets as requested	280.00	1.00	280.00
Invoice: MS18500 Supplier: Stahl Peterbilt *(CHQ)	CHECK ENGINE LIGHT 559 Performed download and began to diagnose for fault 559. There are no related faults. Checked fuel tank levels and both are 3/4 full. Tested for air in fuel, connected test hose, ran in bucket and there are no bubbles present. Performed injector return flow test which measured 50ml - pass. Performed rail release value test - no drops come from valve. Reassembled and pulled fuel pump head and found it plugged and tappets stuck. Assembled fuel pump with new tappets, cam was still good in the pump. Torqued pump head down and hooked up fuel lines with new washers. Assembled power steering pump with new gasket. Primed fuel system and ran up checked for leaks. Cleared faults.	4,914.46	1.00	4,914.46

Bill - Hood / Vibration

Total Labor	5,250.00
Total Parts	2,307.89
Total Returns	.00
Total Sublet	5,243.13
Shop Supplies	525.00
Invoice Total	13,326.02



J.D.A. Ventures Ltd.
 713031 Range Road 64
 Grande Prairie AB T8W 5E5
 Work: 780-532-5101 Fax: 780-532-5128

Equipment: 265

Work Order #: 28326

Date: 8/1/24

Year: 2016

Make: Peterbilt

Model: 367

Work Order Type: Other Repair,Service

Serial Number: 1XPTP4EX8GD284971

Odometer: 830,225

Hours: 21,092

Labor

Description	Mechanic	Quantity/Hours	Amount
1 Complaint: service	Jason Miko	.00	.00
1 Cause: due	Jason Miko	.00	.00
1 Correction: complete service as per checklist - change oil, oil filter, fuel filters and air filters. Sample taken. Removed the water fuel filter housing to clean out debris	Jason Miko	5.00	500.00
2 Complaint: disconnect batteries	Jason Miko	.00	.00
2 Cause: for welding	Jason Miko	.00	.00
2 Correction: disconnect batteries	Jason Miko	.50	50.00
3 Complaint: crankcase oil return line	Jason Miko	.00	.00
3 Cause: leaking	Jason Miko	.00	.00
3 Correction: re/re line	Jason Miko	2.00	200.00
4 Complaint: paint areas of deck	Jason Miko	.00	.00
4 Cause: raw steel	Jason Miko	.00	.00
4 Correction: prime, paint and clear coat the deck where the new supports were welded on to the deck areas	Jason Miko	1.00	100.00
5 Complaint: epoxy fenders	Jason Miko	.00	.00
5 Cause: cracked	Jason Miko	.00	.00
5 Correction: rebuild fenders as needed	Jason Miko	3.00	300.00
6 Complaint: roll through	Bill Maciborsky	.00	.00
6 Cause: as per process	Bill Maciborsky	.00	.00
6 Correction: roll through unit and make a list of repairs needed	Bill Maciborsky	2.00	200.00
7 Complaint: diff #2&3 springs/shocks, #2 RS hanger	Jason Miko	.00	.00
7 Cause: worn	Jason Miko	.00	.00
7.1 Correction: re/re springs, shocks and hangers	Jason Miko	15.00	1,500.00
7.2 Correction: help with shocks, etc	Vern Flammond	8.50	850.00
7.3 Correction: help with shocks, etc	Austin Dean	2.50	250.00
8 Complaint: fuel caps	Jason Miko	.00	.00
8 Cause: leaking	Jason Miko	.00	.00
8 Correction: re/re fuel caps x2	Jason Miko	.50	50.00
9 Complaint: coolant leak	Jason Miko	.00	.00
9 Cause: hose leaking	Jason Miko	.00	.00
9 Correction: found a hose with a rip - replaced. Refilled the system. Check engine light was coolant-related	Jason Miko	2.50	250.00

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
3688012cum, Lube Oil Drain	Stahl Peterbilt	s1751543	1.00	67.94	67.94
210737dan, Oil Seal	Stahl Peterbilt	s1751543	1.00	69.93	69.93
128049, output nut etn	Stahl Peterbilt	s1751543	1.00	20.72	20.72
1707018x, Splicer Strap Kit	Stahl Peterbilt	s1751543	2.00	39.99	79.98
c716004, Shock Absorber	Stahl Peterbilt	s1751543	1.00	132.76	132.76
If14001nnflg, Spin-On Oil Filter			1.00	62.78	62.78
cfr19010, Filter - Air Cab Exterior			1.00	13.91	13.91
rs5288xp, Air Filter			2.00	66.47	132.94
15214, Bug Off - Summer Washer Fluid			1.00	2.82	2.82



J.D.A. Ventures Ltd.
 713031 Range Road 64
 Grande Prairie AB T8W 5E5
 Work: 780-532-5101 Fax: 780-532-5128

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
fs19764flg, Fuel Sperator			1.00	26.11	26.11
ff5825nnflg, Fuel Filter			1.00	65.10	65.10
oilsample, Oil Sample / Anaysis - Basic Wear			1.00	31.50	31.50
dshp15blk, 15W40 Oil - Duron SHP Bulk			45.00	5.06	227.70
ls75125, peterbilt 2lf	Stahl Peterbilt	s1752048	4.00	256.57	1,026.28
c136017, Bushing, fram brkt air t	Stahl Peterbilt	s1752048	4.00	67.19	268.76
hwu01908, Bolt-hex 5/8-11NCX8 GR8 Z	Stahl Peterbilt	s1752048	4.00	15.98	63.92
hwc06894, Nut-hex SL NYL 5/8-11NCX0	Stahl Peterbilt	s1752048	4.00	3.96	15.84
hwu05795, Washer-round sae 5/8 GR8	Stahl Peterbilt	s1752048	8.00	.86	6.88
ubk014015, U-Bolt	Stahl Peterbilt	s1752048	4.00	104.28	417.12
ftc002, Non-Locking Fuel Cap	Stahl Peterbilt	s1752048	2.00	84.55	169.10
0307296, Pad - Wear Air Trac.	Stahl Peterbilt	s1752048	4.00	403.26	1,613.04
hwuo1882, bolt-hex 5/8-11ncx7	Stahl Peterbilt	s1752048	16.00	7.79	124.64
hwu05795, Washer-round sae 5/8 GR8	Stahl Peterbilt	s1752048	24.00	.86	20.64
hwc06894, Nut-hex SL NYL 5/8-11NCX0	Stahl Peterbilt	s1752048	16.00	3.96	63.36
c636001, plate pressure air susp s	Stahl Peterbilt	s1752368	4.00	51.15	204.60
c716004, Shock Absorber	Stahl Peterbilt	s1752350	3.00	132.76	398.28
c116023m02, bracket - 46k air trac assy	Stahl Peterbilt	s1752435	1.00	1,368.53	1,368.53

Sublet

Description	Invoice Description	Price/Rate	Quantity/Hours	Amount
Invoice: E2966689 Supplier: Whitecourt Transport *(CHQ)	stahl to wc jda	35.92	1.00	35.92
Invoice: 108171 Supplier: Schaffer's Custom Welding *(DD)	Repairs on walking deck. Shear and break as required	1,547.89	1.00	1,547.89

Jason - Service / Welding / Headlights /

Total Labor	4,250.00
Total Parts	6,695.18
Total Returns	.00
Total Sublet	1,583.81
Shop Supplies	425.00
Invoice Total	12,953.99



J.D.A. Ventures Ltd.
 713031 Range Road 64
 Grande Prairie AB T8W 5E5
 Work: 780-532-5101 Fax: 780-532-5128

Equipment: 265

Work Order #: 28109

Date: 7/17/24

Year: 2016

Make: Peterbilt

Model: 367

Serial Number: 1XPTP4EX8GD284971

Odometer: 827,366

Hours: 21,010

Work Order Type: Other Repair

Labor

Description	Mechanic	Quantity/Hours	Amount
1 Complaint: check engine light on	Jason Miko	.00	.00
1 Cause: inactive codes	Jason Miko	.00	.00
1.1 Correction: cleared inactive codes and light went out	Jason Miko	.50	50.00
1.2 Correction: replaced the VGT actuator. Attempted to calibrate. Looked up the steps to diagnose and install. Calibration failed multiple times. Followed the fail procedures and it took the calibration. VVGT arc still a little bit short. Hooked up all the removed coolant lines and filled the system. Tied wiring up. Ran unit.	Jason Miko	5.50	550.00
2 Complaint: AC	Jason Miko	.00	.00
2 Cause: not working well	Jason Miko	.00	.00
2 Correction: vacuum AC system and charge. Test - good	Jason Miko	1.50	150.00

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
jet683633, 3/4 Drive 33mm Deep Impact Socket	Northern Metallic Sales (Wtc) Ltd	600-338466	1.00	29.53	29.53
jet683240, 3/4 Drive 1-1/4 Deep Impact Socket	Northern Metallic Sales (Wtc) Ltd	600-338466	1.00	27.01	27.01
jet683953, 3/4 Drive 10" Impact Extension	Northern Metallic Sales (Wtc) Ltd	600-338466	1.00	49.00	49.00
itc020123, 20pc 3/8" DR SAE SKT. Set	Northern Metallic Sales (Wtc) Ltd	600-338466	1.00	107.42	107.42
6378270rxcum, Turbo Actuator Kit	Stahl Peterbilt	S1747128	1.00	2,550.99	2,550.99
3963990cum, Sealing Washer			4.00	4.40	17.60
r134a, R134A A/C Tetrafluoroethane			.50	18.92	9.46

Returns

Description	Quantity/Hours	Price/Rate	Amount
6378270rxcum - Used Core, Turbo Actuator Kit - Used Core	1.00	264.00	264.00

Sublet

Description	Invoice Description	Price/Rate	Quantity/Hours	Amount
Invoice: 23072 Supplier: E-Z Hotshot and Small Haul *(DD)	Freight from Stahl-PB EDM to WC shop	34.45	1.00	34.45

Bill - Actuator



J.D.A. Ventures Ltd.

713031 Range Road 64
Grande Prairie AB T8W 5E5
Work: 780-532-5101 Fax: 780-532-5128

Total Labor	750.00
Total Parts	2,791.01
Total Returns	-264.00
Total Sublet	34.45
Shop Supplies	75.00
Invoice Total	3,386.46



J.D.A. Ventures Ltd.
 713031 Range Road 64
 Grande Prairie AB T8W 5E5
 Work: 780-532-5101 Fax: 780-532-5128

Equipment: 265

Work Order #: 27718

Date: 6/24/24

Year: 2016

Make: Peterbilt

Model: 367

Serial Number: 1XPTP4EX8GD284971

Odometer: 821,284

Hours: 20,880

Bay #: 3

Work Order Type: Other Repair

Labor

Description	Mechanic	Quantity/Hours	Amount
1 Complaint: won't start/alternator not charging	David Godwin	.00	.00
1 Cause: unknown	David Godwin	.00	.00
1 Correction: boosted and got unit started	David Godwin	1.00	100.00
2 Complaint: purges constantly	David Godwin	.00	.00
2 Cause: bad line	David Godwin	.00	.00
2 Correction: re/re purge valve. Start unit. Still has issue. Found line leaking between BCM and frame. Also found flex pipe for exhaust broken and leaking. Unit is also throwing check engine code	David Godwin	2.00	200.00
3 Complaint: flex pipe at stacks	Austin Dean	.00	.00
3 Cause: broken	Austin Dean	.00	.00
3.1 Correction: remove flex pipe. Found clamp on PS loose. Pulled clamp off and found bracket on PS loose. Had to pull PS step apart and put new bolt in bracket and new clamp and gasket. Install new flex pipe in with new clamps and reassemble	Austin Dean	7.50	750.00
3.2 Correction: additional labor - help as needed	David Godwin	1.00	100.00
4 Complaint: air leak behind chassis node	Jason Miko	.00	.00
4 Cause: ruptured hose	Jason Miko	.00	.00
4 Correction: remove the node, attempted to remove from the bracket but was unable to reach the bolt head. Attempted to remove the bracket from the frame side but was unable to remove the upper air tank to get to the frame bolts. Removed the node and found the broken line. Installed a union. Needed to sand the airline to get the fitting to fit. Tested for leaks - found none. Installed all removed parts	Jason Miko	6.00	600.00
5 Complaint: clamp for exhaust not installed	Jason Miko	.00	.00
5 Cause: missing/broken bolts	Jason Miko	.00	.00
5 Correction: needed to use an air hammer to remove cut bolt. Installed the clamp with new bolts. Aired unit up and found another air leak	Jason Miko	1.00	100.00
6 Complaint: air leak	Jason Miko	.00	.00
6 Cause: broken fitting	Jason Miko	.00	.00
6 Correction: found a fitting leaking on the forward lower air line. Removed the line and found the fitting damaged. Replaced fitting on both sides. Installed the removed airline	Jason Miko	1.00	100.00
7 Complaint: no start	Jason Miko	.00	.00
7 Cause: night switch and high winch left on	Jason Miko	.00	.00
7 Correction: found batteries dead - recharged. Changed out the RHS rear fender rear mudflap as it was put on upside down and torn as well	Jason Miko	1.00	100.00

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
900013, Clamp - V band 5"	KW Mechanical	218321	1.00	20.48	20.48
k022105, Purge Valve			1.00	184.14	184.14
ec50plsg, Clamp - Exhaust WB Prefrmd.			2.00	13.30	26.60
6624, #4 Short Nut Compression Union			1.00	1.43	1.43
146810c, #10 X 3/8 NPT AB Fitting			1.00	5.12	5.12
146810d, #10 x 1/2 NPT AB Fitting			1.00	6.34	6.34



J.D.A. Ventures Ltd.
713031 Range Road 64
Grande Prairie AB T8W 5E5
Work: 780-532-5101 Fax: 780-532-5128

Sublet

Description	Invoice Description	Price/Rate	Quantity/Hours	Amount
Invoice: 600-337248 Supplier: Northern Metallic Sales WTC*(DD)	chains x3	325.26	1.00	325.26

Austin - Air Leak / Exhaust Leak / Engine Codes

Total Labor	2,050.00
Total Parts	244.11
Total Returns	.00
Total Sublet	325.26
Shop Supplies	205.00
Invoice Total	2,824.37



J.D.A. Ventures Ltd.
 713031 Range Road 64
 Grande Prairie AB T8W 5E5
 Work: 780-532-5101 Fax: 780-532-5128

Equipment: 265

Work Order #: 27558

Date: 6/12/24

Year: 2016

Make: Peterbilt

Model: 367

Serial Number: 1XPTP4EX8GD284971

Odometer: 820,693

Hours: 20,855

Bay #: 3

Work Order Type: Other Repair

Labor

Description	Mechanic	Quantity/Hours	Amount
1 Complaint: fan hub	David Godwin	.00	.00
1 Cause: leaking	David Godwin	.00	.00
1 Correction: begin removing fan hub. Pull air-to-air. Pull crankcase filter. Pull fan and shroud. Pull fan hub. Clean area and prep for install. Install fitting in hub. Install fan hub and tighten up. Install shrouds, fan and belts. Wire up plugs for crankcase filter plug and positive air shut off (broken wire). Run unit - cuts in and out as should, no air leaks. Ziptie up wires. Install air to air hoses	David Godwin	12.50	1,250.00
2 Complaint: rear fender	David Godwin	.00	.00
2 Cause: cracked	David Godwin	.00	.00
2 Correction: remove rear fender for weld repair - had to torch out bolts. Reinstall after repairs	David Godwin	2.00	200.00
3 Complaint: PS oversize mirror	David Godwin	.00	.00
3 Cause: loose	David Godwin	.00	.00
3 Correction: install P-clamp	David Godwin	.50	50.00
4 Complaint: PS steer dustshield	Austin Dean	.00	.00
4 Cause: missing	Austin Dean	.00	.00
4 Correction: install dustshield	Austin Dean	1.00	100.00
5 Complaint: A1 RS airbag	David Godwin	.00	.00
5 Cause: cords showing	David Godwin	.00	.00
5 Correction: r/r airbag with new. Install ball valve and test - no leaks (seized studs/bag seized to frame)	David Godwin	4.00	400.00
Fan hub parts, dust cover and air bag ordered on WO 27424			.00

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
6694a, #4 x 1/8 NPT 90° Compression Fitting			1.00	1.08	1.08
hc19425, Constant torque clamp			1.00	14.38	14.38
psc30, Synthetic Grease Tubes			1.00	6.84	6.84
122d, 1/2NPT HEX NIPPLE			1.00	2.74	2.74
100t50, 1/2" 600# F/P Ball Valve			1.00	5.32	5.32
100t38, 3/8" 600# F/P Ball Valve			1.00	3.78	3.78
120dc, 1/2 x 3/8 NPT Red Adapter			1.00	2.26	2.26

Sublet

Description	Invoice Description	Price/Rate	Quantity/Hours	Amount
Invoice: 378236 Supplier: Ralcomm Ltd. *(DD)	Supply and install new coax cable and antenna	275.00	1.00	275.00
Invoice: 600-336440 Supplier: Northern Metallic Sales WTC*(DD)	Winchline, 1-1/16" x 190'	2,469.00	1.00	2,469.00



J.D.A. Ventures Ltd.
 713031 Range Road 64
 Grande Prairie AB T8W 5E5
 Work: 780-532-5101 Fax: 780-532-5128

Sublet

Description	Invoice Description	Price/Rate	Quantity/Hours	Amount
Invoice: 600-336570 Supplier: Northern Metallic Sales WTC*(DD)	Chains x2	146.37	1.00	146.37
Invoice: 107549 Supplier: Schaffer's Custom Welding *(DD)	Repair aluminum fenders	240.34	1.00	240.34

Bill - Roll Through / Fan Hub / Mirror / Dust Cover

Total Labor	2,000.00
Total Parts	36.40
Total Returns	.00
Total Sublet	3,130.71
Shop Supplies	200.00
Invoice Total	5,367.11



J.D.A. Ventures Ltd.
 713031 Range Road 64
 Grande Prairie AB T8W 5E5
 Work: 780-532-5101 Fax: 780-532-5128

Equipment: 265

Work Order #: 27424

Date: 6/5/24

Year: 2016

Make: Peterbilt

Model: 367

Serial Number: 1XPTP4EX8GD284971

Odometer: 817,654

Hours: 20,798

Bay #: 3

Work Order Type: Service

W/O Notes: Clutch fan to be installed on future WO#

Labor

Description	Mechanic	Quantity/Hours	Amount
1 Complaint: roll through	Jason Miko	.00	.00
1 Cause: as per process	Jason Miko	.00	.00
1 Correction: roll through unit. Make a list of repairs/parts needed	Jason Miko	2.00	200.00
2 Complaint: service	Jason Miko	.00	.00
2 Cause: due	Jason Miko	.00	.00
2.1 Correction: complete service as per checklist - change oil, oil filter, fuel filters. Sample taken. Grease (keg)	Jason Miko	3.50	350.00
2.2 Correction: help with service	David Godwin	2.00	200.00
3 Complaint: drive axle #1 LS	Jason Miko	.00	.00
3 Cause: leaking	Jason Miko	.00	.00
3 Correction: remove hub, replace bearings and reassemble	Jason Miko	4.00	400.00
4 Complaint: RS signal lights out	Jason Miko	.00	.00
4 Cause: wiring	Jason Miko	.00	.00
4 Correction: repair wiring	Jason Miko	.50	50.00

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
163552, 3/8"x50' Tape Measure	Gregg Distributors (Edmonton) Ltd.	000-803959	1.00	27.32	27.32
79a9798rman, Clutch Fan	Stahl Peterbilt	S1734635	1.00	2,259.16	2,259.16
k249362k, dust cover	Stahl Peterbilt	S1734635	1.00	166.33	166.33
3688113cum, Gear Cover Plug	Stahl Peterbilt	S1734635	1.00	19.26	19.26
3929131, Seal 2106, Grit Guard	Stahl Peterbilt	S1734635	1.00	76.58	76.58
Drive Wheel Set					
stm3303111, Axle Gasket	Stahl Peterbilt	S1734635	1.00	3.38	3.38
as90690, Air Spring	Stahl Peterbilt	S1734635	1.00	143.35	143.35
c346004, STUD-AIR SPRING STL	Stahl Peterbilt	S1734635	1.00	18.22	18.22
hwu05509, Hex Nut	Stahl Peterbilt	S1734635	1.00	2.54	2.54
c0m266, Shock Absorber Bushing	Stahl Peterbilt	S1734635	8.00	26.38	211.04
set430, Wheel Bearing Set / Pre-Set	KW Mechanical	217728	1.00	128.14	128.14
set403, Bearing 594a/592a	KW Mechanical	217724	1.00	54.39	54.39
set429, Wheel Bearing Set / Pre-Set	KW Mechanical	217723	1.00	152.38	152.38
lf14001nnflg, Spin-On Oil Filter			1.00	62.78	62.78
ff5825nnflg, Fuel Filter			1.00	65.10	65.10
fs19764, Fuel Separator			1.00	26.11	26.11
dshp15blk, 15W40 Oil - Duron SHP Bulk			45.00	5.06	227.70
oilsample, Oil Sample / Anaysis - Basic Wear			1.00	31.50	31.50
trs759p20, 75w90			1.00	10.24	10.24



J.D.A. Ventures Ltd.
 713031 Range Road 64
 Grande Prairie AB T8W 5E5
 Work: 780-532-5101 Fax: 780-532-5128

Returns

Description	Quantity/Hours	Price/Rate	Amount
79a9798rman - Used Core, Clutch Fan - Used Core	1.00	528.00	528.00
set403, Bearing 594a/592a	1.00	54.39	54.39

Sublet

Description	Invoice Description	Price/Rate	Quantity/Hours	Amount
Invoice: E2961995 Supplier: Whitecourt Transport	Freight from Stahl-PB Edmonton to WC shop	48.56	1.00	48.56
Invoice: 600-336422 Supplier: Northern Metallic Sales WTC*(DD)	Chains x2	135.42	1.00	135.42

Jason - Service / Lights

Total Labor	1,200.00
Total Parts	3,685.52
Total Returns	-582.39
Total Sublet	183.98
Shop Supplies	120.00
Invoice Total	4,607.11