

WESTERN STAR TRUCKS (NORTH) LTD.

Address 24210 - 114 Avenue | Acheson, ABT7X 6B9 Phone: 780-453-3452 | Toll Free: 1-800-252-7500 | Facc 780-701-2272

Visit us online at www.wsnorth.com

RemitTo: 24210 - 114 Avenue | Acheson, AB T7X 6B9 GST: 892297052

Invoice: 0010347553

Date / Hour: 7/9/2024 5:09:04PM

Repair Order: 47553

Customer:

Branch: WSN

Total Invoice: \$1,786.24 ***CHARGE AR***

Page 1 of 3

Bill To:



Ship To:



Work:

Customer P/O:

Add User: TCARLTON

Unit Number: 410A

Model Year: 2013

Type: TRAILER

VIN: 2LDPF3231DJ054861

Open Date: 07/03/2024

Completion Date: 07/04/2024

Salesperson: TWATEK

Make/Model: TRIPLE E

Meter: 744907 Kilometers

Task:

47-100036.01 CVIP (AB) TRAILER 12 MONTH Complaint: PERFORM TRAILER CVIP - WHEELS ON

Cause: ANNUAL INSPECTION CV7907344.

Correction: "RE-TORQUE WHEELS WITHIN 150KM" PERFORMED CVIP INSPECTION BY WORKSHEET.

Department: SERVICE

Department: SERVICE

Supp.	Part	Description / Ref Number	U/M	Quantity	Extended Price Price
	Labor Quote: 190.00	- <u>-</u>		<u>-</u> -	
			Task 1 Subtotals	Parts:	\$0.00
				Labor:	\$190.00
				Task 1 Subtotals	\$190.00

Task: 13-100005.01 DRIVE/TRAILER BRAKE CHAMBER SPRING POT R/R (ONE)

Complaint: CVIP*** LEFT FRONT AXLE (#1) BRAKE CHAMBER LEAKING

Correction: DISCONNECTED AIR HOSES FROM BRAKE CHAMBER. FITTING ON EMERGENCY LINE WAS SEIZED IN HOSE NUT. REMOVED AIR HOSE. REMOVED AXLE #1 LEFT BRAKE CHAMBER. MEASURED LENGTH OF PUSH ROD ON OLD BRAKE CHAMBER. PUSH ROD ON NEW BRAKE CHAMBER LONGER, CUT PUSH ROD ON NEW BRAKE CHAMBER. INSTALLED FITTINGS ON BRAKE CHAMBER. INSTALLED CLEVIS, INSTALLED BRAKE CHAMBER, CONNECTED AIR HOSES, CONNECTED SLACK ADJUSTER, ADJUSTED BRAKE. APPLIED SERVICE BRAKE. NO AIR LEAKING. JOB COMPLETED.

Supp.	Part	Description / Ref Number	U	/M	Quantity	Price	Extended Price
	FS-5606-18INT	30/30 W/18" PUSH ROD	EA	4	1.0	\$125.66	\$125.66
53							
	HAB-8-36C	AIOR BRAKE HOSE	BA	AG	1.0	\$19.17	\$19.17
	SS SVC	SHOP SUPPLIES			1.0	\$20.77	\$20.77
			Task 2 Subtotals		Parts:		\$144.83
					Labor:		\$259.68
					Miscellaneous:		\$20.77
					Task 2 Subtotals		\$425.28

Task: 13-100026.01 AIR BRAKE SLACK ADJUST ALL

Complaint: CVIP*** BRAKES NEED ADJUSTMENT

Correction: ADJUSTED BRAKES. CUT OLD AXLE #1 LEFT BRAKE CHAMBER SPRING.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Price
	SS SVC	SHOP SUPPLIES		1.0	\$7.99	\$7.99
			Task 3 Subtotals	Parts:		\$0.00
				Labor:		\$99.88
				Miscellaneous:		\$7.99

^{**} See Last Page for Invoice Total **

Department: SERVICE



WESTERN STAR TRUCKS (NORTH) LTD.

Address: 24210 - 114 Avenue | Acheson, ABT7X 689 Phone: 780-453-3452 | Toll Free: 1-800-252-7500 | Fasc 780-701-2272

Visit us online at www.wsnorth.com

Remit To: 24210 - 114 Avenue | Acheson, AB T7X 6B9 GST: 892297052

Invoice: 0010347553

Date / Hour: 7/9/2024 5:09:04PM

Repair Order: 47553

Customer:

Branch: WSN Total Invoice: \$1,786.24

CHARGE AR

Page 2 of 3

Bill To:



Ship To:

Work: Fax: Customer P/O: Open Date: 07/03/2024 Completion Date: 07/04/2024

Add User: TCARLTON

\$107.87

Extended

Extended

Salesperson: TWATEK

Department: SERVICE

Task 3 Subtotals

Task: 59-100001.01 FIFTH WHEEL ADJUST & LUBE Complaint: CVIP*** FIFTH WHEEL ADJUSTMENT

Correction: ADJUSTED FIFTH WHEEL.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Price
	SS SVC	SHOP SUPPLIES		1.0	\$15.98	\$15.98
			Task 4 Subtotals	Parts:		\$0.00
				Labor:		\$199.75
				Miscellaneous:		\$15.98
				Task 4 Subtotals		\$215.73

Task: 60-100014.01 INSTALL REFLECTIVE TAPE Department: SERVICE

Complaint: CVIP*** DECK REFELECTORS WORN

Correction: REMOVED OLD AND REPLACED REFLECTOR TAPES. TASK COMPLETE.

Supp. Part	Description / Ref Number	U/M	Quantity	Price	Price
TL 98127	TAPE, RED/WHITE Reflective 2X150	FT	30.0	\$1.68	\$50.40
BRING WHOLE ROLL PLEASE. 53					
SS SVC	SHOP SUPPLIES		1.0	\$23.97	\$23.97
	Tas	k 5 Subtotals	Parts:		\$50.40
			Labor:	:	\$299.63
			Miscellaneous:		\$23.97
			Task 5 Subtotals		\$374.00

Task: 34-200001.01 LIGHTING REPAIR Department: SERVICE

Complaint: CVIP*** LEFT AND RIGHT-SIDE SIGNAL LIGHT WIRES RUBBED ON FRAME Correction: INSTALLED CLAMPS AND DRILL SCREWS. FIXED HARNES LEFT AND RIGHT SIGNAL LIGHTS.TASK COMPLETE.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	SS SVC	SHOP SUPPLIES		1.0	\$15.98	\$15.98
		Task 6	Subtotals	Parts:		\$0.00
				Labor:		\$199.75
				Miscellaneous:		\$15.98
			1	ask 6 Subtotals		\$215.73

Task: 02-200018.01 HOOD & FENDERS

Complaint: CVIP*** RIGHT REAR FENDER BOLTS ARE LOOSE.

Correction: VARIFIED COMPLAINT OF LOOSE RHS FENDER. INSPECTED AND BOLTS WERE TO WORN OUT TO EVEN TIGHTEN. CUT OFF ALL BOLTS AND REPLACED WITH NEW. FENDER IS NOW TIGHT. JOB COMPLETE.

Department: SERVICE

Mq40:e0:3 4502/e/7 :TuoH \ etaG Invoice: 0010347553

Repair Order 47553

Customer:

Branch: WSN

CHARGE AR Total Invoice: \$1,786.24

Page 3 of 3



Address 24210 - 114 Avenue | Acheson, AB 17X 689
Phome: 780-453-3452 | Toll Free: 1 Fox 780-701-2272

Visit us online at www.wanorth.com

SEO105268 :T20 Remit To: 24210 - 114 Avenue | Acheson, AB TTX 689



Date: 07/04/2024 Fax: моц: :oT qid2 :oT III8

64.804,1\$ \$195.23 86.271\$ 812.78 08.631\$ 00.0\$ \$12.78 \$12.78 Price Price **Extended**

\$1,786.24 20.28\$ **81.107,1**\$ **14.76**\$

70V774 V	771101140 177177		R QUALITY AND FUNCTION VERIFIE		IN NEAL MIANEM HOAS CONTACT DEPARTMENT MAN
DI EVSE			LECTRICAL • CORES MUST BE RET POLIMITY AND FLINCTION VERIEIE		
	SIONS EXCEPTED	ERRORS AND OMISS		X	:3TAQ
		ж	CE OF THE ACCOUNT FOR SAID WO	NAJAB SHT 90 LLA BNIS	18 42.887,† \$ 90 MUS 3HT NI
			GIZ/UNON	realenia alan angona/	OUR) INDEBTEDNESS TO: W
WLEDGE MY	е) невева РСКИОЛ	ART(S) PURCHASES, I (WE	VEHICLE, AND(OR) AUTHORIZED P		
				68	ACHESON, AB TYX 6
					24210 - 114 AVENUE
				ICKS YCHESON	URT RATS NRETERW
			<u>Due Date</u> 8/8/2024	Jenns Net 30	CHARGE AR
	Total Invoice:		J etect end	SUBOL	botheld tremved
	:xsT lstoT				
	.:istotdu2 eolov	val			
	Miscellaneous:	lstoT	90.38\$:lstoT	
	Total Labor:		90.88\$	-	189
	:etrs9 lstoT		J)etail Tax Info:
	Task 7 Subtotals				
	Wiscellaneous:				
	:ahs9	Task 7 Subtotals			
¥	0.1		SHOP SUPPLIES		SS SAC
	Quantity	W/N	Description / Ref Number		hay .qqu
		i incondenno			1101711101 11000 5711
uoraduo -		Salesperson: T			Add User, TCARLTON
Completion	PCUC/E0/2	Open Date: 0			Customer P/O:

ABHD Repair Ltd.

3400 Golf Course Road. Stony Plain, AB T7Z2Y2, CA info@abhd.ca (780) 968-5911



Invoice:

INV-197164

Date:

6/23/2023

Bill To

Remit Payment To
ABHD Repair Ltd.
3400 Golf Course Road.
Stony Plain, AB T7Z2Y2, CA

Service	Order	Terms	Due Date	Authorizer	Customer PO	Serv	vice Writer	Unit #
SO-42	296	Net 30	7/23/2023			Otte	eson, Ben	410A
Item	Descrip	otion				Quantity	Rate	Amount
Inspection								
Labor			MI-TRAILER,C-DOL NILER,C-DOLLY AN	LY AND CONVERTE ID CONVERTER	R: CVIP-	1.00000	\$200.00	\$200.00
							Subtotal	\$200.00
Complaint	: LH#3 bra	ke pot spring	broken	The second secon				
Cause: Cu	ıstomer red	quest						
(Inspection)							
Labor	Installed Installed onto pot	/ Chassis / R vis from slack d air fittings from the control d new pot onto t and tightene	adjuster. Unbolted om old pot onto new o mount and tighten	poing to brake pot. Remo pot from mount. Remo v pot. Threaded on new led nuts into place. Ins s onto slack adjuster.	oved old pot. w clevis. stalled airlines	1.22000	\$135.00	\$164.70
Parts	Brake P	ot Intraax				1.00000	\$82.496	\$82.50
							Subtotal	\$247.20
Complaint	: Hub plug	s aged		Property and the Commission of				
Cause: Co	ustomer red	quest						
(Inspection)							
Labor	Correct Chassis		Cleaned up all hub c	aps and replaced all h	nub plugs.	0.25000	\$135.00	\$33.75
Parts	LARGE	HUB PLUG				6.00000	\$5.97	\$35.82
							100000000000000000000000000000000000000	400.00

Item	Description	Quantity	Rate	Amount
Cause: Cu	istomer request			
(Inspection				
Labor	Correction: Chassis / Chassis / Air up all tires 100psi, install new valve cap om RH#2 outer tire	0.45000	\$135.00	\$60.75
			Subtotal	\$60.75
Complaint	: Multiple hubs low	Willer on Affice St., all alliability bounds also found grant grants. A	alam di la constanti del segrito del propositione del propositione del constanti del constanti del propositione	the contract of the contract o
Cause: Cu	stomer request			
(Inspection)			
Labor	Correction: Chassis / Chassis / Added gear fluid in RH #2 & 3 Hubs	0.36000	\$135.00	\$48.60
Parts	75W90 Gear Oil	1.00000	\$13.86	\$13.86
			Subtotal	\$62.46
Complaint	: LH #2 brake shoes at 5/16	nn a Talligadees (g. jaligadees), die planeter van ja van de degewoerde e	ordinamental describents annual film (1995) es de la 1997 (1995) es de la 1997 (1997) es de la 1997 (1997) (19	a place in the commence was an analysis of the second seco
Cause: Cu	stomer request			
(Inspection)			
Labor	Correction: Chassis / Chassis / Removed brakes from spider. Install new brake shoes on #2 axle, install new brake drums on #1 #2 axle, reinstall all wheels, jack up unit and remove stands and lower axles, set brakes	2.35000	\$135.00	\$317.25
Parts	Q+ BRAKE SHOE	2.00000	\$85.696	\$171.39
Parts	BRAKE DRUM	4.00000	\$184.32	\$737.28
			Subtotal	\$1,225.92
Complaint	: RH#1 wheel seal leaking	PEEEE (CE) 482 EPEEE van John Stein, Steep de James	na mana, disabbahalah (e aire (m. 1917) er (m. 1917)	tan ing uni araw at in memperapakan akhanya gala, aggap da ing
Cause: Cu	istomer request			
(Inspection)			
Labor	Correction: Chassis / Chassis / Removed brake pads. Removed hub cap bolts, then cap and drained fluid. Bent keeper tabs holding jam nut. Backed off jam nut and removed. Removed keeper and backed off adjusting nut and removed. Pulled front bearing and hub off spindle. Knocked out rear bearing and wheel seal. Knocked off seal on spindle. Preped inside of hub and spindle for new seal. Applied blue gasket maker to seal and spindle and Knocked in them both into place. Installed hub back onto spindle and installed adjusting nut torqued to spec using proper procedures. Installed keeper and jam nut, torqued to spec. Installed hub cap and filled with 75W90. Reinstalled brake pads.	0.94000	\$135.00	\$126.90
Parts	WHEEL SEAL	1.00000	\$64.1625	\$64.16
Parts	HUB GASKET	1.00000	\$3.70	\$3.70
Parts	75W90 Gear Oil	1.00000	\$13.86	\$13.86

Item	Description	Quantity	Rate	Amount
			Subtotal	\$208.62
Complair	nt: RH#2 wheel studs loose in hub		- Marketin (* 12.), p. P. (13.), p. S. (13.)	mount of and \$15 and the mount of a 12
Cause: 0	Customer request			
(Inspectio	n)			
Labor	Correction: Chassis / Chassis / Had to replace hub due to stud holes being worn out. Removed hub. Prepped new hub and spindle for new seal. Applied gasket maker to seal and spindle and installed new wheel seal. Installed hub and set bearings. Installed keeper and jam nut, torqued to spec. Installed hub cap and filled with oil.	1.08000	\$135.00	\$145.80
Parts	WHEEL SEAL	1.00000	\$64.1625	\$64.16
Parts	HUB GASKET	1.00000	\$3.70	\$3.70
Parts	Hub Assy TN RLR HP10 ABS, steel wheel	1.00000	\$223.324	\$223.32
Parts	75W90 Gear Oil	1.00000	\$13.86	\$13.86
			Subtotal	\$450.84
Complair	nt: RH #3 cam play	ri () kiladin ya dikirikin na kuji ya ya ya minin ya ya di dikiri dikirikin da ka dikirikin da ka dikirikin da	er aussende der in Nobelstättlich (Edit (1985) (Edit (1986)). Weiter der Leiter (1986) er Leiter (Leiter (1986)	nay an isabilik balika penakuan bahar eminin kuma
Cause: 0	Customer request			
(Inspectio	n)			
Labor	Correction: Chassis / Chassis / Removed brake shoes and dust shield to be able to access cam. Cleaned up around spline snap ring holding cam in place and removed it and spline washers. Removed slack adjuster from cam shaft. Found that Scam journal washers and retaining ring where not previously installed. Unbolted cam tube support brackets and removed. Cam tube was sized in place. Cut old cam shaft so I could remove it. Air Hammered out old cam tube from spider. Cleaned up inside of spider and installed new cam shaft and cam tube. Installed cam tube support bracket and bolted into place. Installed new journal washers and retaining ring. Reattached slack adjuster to cam. Installed spline washers and retaining ring. Filled new cam tube with grease. Reattached dust shield and brake shoes.	1.21000	\$135.00	\$163.35
Parts	Intraxx Cam tube	1.00000	\$72.1375	\$72.14
Parts	RH S Cam 28 spline Intraxx	1.00000	\$47.821	\$47.82
Parts	5.75" Dust Shield Clamp Kit	1.00000	\$16.83	\$16.83
Parts	HALDEX PLASTIC BUSHING	1.00000	\$6.30	\$6.30
			Subtotal	\$306.44

Complaint: Service relay valve leaking

Cause: Customer request

(Inspection)

Item	Description	Quantity	Rate	Amount
Labor	Correction: Chassis / Chassis / Try and drain air tank but drain valve broke trying to turn needle, remove broken drain valve, Try and free up brass fittings but they just stripped, cut airlines to relay valve, remove valve from air tank, install new fittings into new relay valve, install new valve into air tank and plum airlines, install new drain valve into air tank, air up and leak check	1.15000	\$135.00	\$155.25
Parts	RELAY VALVE	1.00000	\$124.7104	\$124.71
Parts	NEEDLE SEAT DRAIN VALVE 1/8MPT	1.00000	\$20.13	\$20.13
Parts	ELBOW, 90 DEGREE 3/8" TUBE X 3/8" PIPE	1.00000	\$6.12	\$6.12
Parts	FITTING, 1/2" TUBE X 3/8" PIPE	2.00000	\$6.08	\$12.16
			Subtotal	\$318.37
Complaint	: Lh#2 haldex pin loose	A CAMPAGNA AND THE STATE OF THE	Para Mariana (Mariana) di Series de Albara, negleta de describara e describara	
Cause: Cu	ustomer request			
(Inspection)			
Labor	Correction: Chassis / Chassis / R&R LH#2 haldex pin	0.34000	\$135.00	\$45.90
Parts	Haldex Pin	1.00000	\$15.015	\$15.02
Parts	HALDEX HEX NUT	1.00000	\$15.345	\$15.35
			Subtotal	\$76.27
Complaint	: Lh#1 clevis pin missing replaced with bolt and washers	ta vange regeljer i vre edingeneed	effective and the first trips and the artists when the con-	
Cause: Co	ustomer request			
(Inspection)			
Labor	Correction: Chassis / Chassis / Remove bolt being used for clevis pin, install proper clevis pin and cotter pin	0.32000	\$135.00	\$43.20
			Subtotal	\$43.20
Complaint	: LH#2 brake pot jam nut backed off completely	ar State States Car, is been	A CONTROL OF THE PERSON OF THE	rain administration understands des
Cause: Co	ustomer request			
(Inspection)			
Labor	Correction: Chassis / Chassis / Dynamite brakes, heat and tigthen brake pot jam nut	0.25000	\$135.00	\$33.75
			Subtotal	\$33.75

Complaint: #2/3 crossmemeber at suspension hangers cracked

Cause: Customer request

(Inspection)

Item	Description	Quantity	Rate	Amount
Labor	Correction: Chassis / Chassis / #2 cross Grind surfaces of cracks clean and remove dirt from behind crack. Cut two pieces of steel for support ans tack plate into place, use clamps to pull in material. Once plate is tacked fully weld plate into trailer. #3 cross Grind surfaces clean and cut off broken weld for shock hanger. Weld shook hanger on and Weld cracks.	2.80000	\$135.00	\$378.00
			Subtotal	\$378.00
Complair	nt: Airline to RH#3 brake pot outer casing ripped and has inner chords exposed	ere, in agricu estretaten est e prese en el supplicabilità i dissi	de la commenda de la circula communidad de la Virgida, que y la	2000 Million (Establish a causes of the armanan
Cause: (Customer request			
(Inspectio	n)			
Labor	Correction: Chassis / Chassis / Cut out damaged section of hose and install reusable union fitting	0.34000	\$135.00	\$45.90
Parts	Union 1/2 Rubber Hose	1.00000	\$18.2325	\$18.23
			Subtotal	\$64.13
er red a diseal Australia de de	Flat Bar	1.00	\$42.65	\$42.65
Unit: 410	A VIN: 2LDPF3231DJ054861		Labor	\$1,963.10
	e King Super B Train HiiBoy 0 Kilometres		Parts	\$1,782.42
Cilassis.	o Miorieu es	She	op Supplies	\$137.42
		Pre-Char	ge Subtotal	\$3,882.94
		annountere almeitikus on al - almeitikus almeitikus om (10 Am.)	Flat Bar	\$42.65
		(5% o	GST f \$3,925.59)	\$196.28
			Total	\$4,121.87
		Payment	ts & Credits	\$0.00
		E	alance Due	\$4,121.87

ABHD Repair Ltd. | 3400 Golf Course Road N.| Stony Plain, AB | T7Z2Y2

Tel: 780-968-5911

I hereby authorize the repair work hereinafter set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highway or elsewhere for the purpose of testing and/or inspection. An express garageholder's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. I understand that I have the right to know before authorizing my repairs what the repairs to my vehicle, and their costs will be. In consideration for the services rendered by ABHD Repair Ltd. to the company, the undersigned personally guarentees payment of all invoices rendered in connection with terms of this engagement. Interest may be charged on all overdue amounts at the rate of 2% per month, 24% annum. ABHD Repair Ltd. offers a 90 Day warranty on all labor, Parts warranty is determined by manufacturer. ABHD Repair Ltd. will offer no assistance with warranty of customer supplied parts. Please remember to retorque all wheels within 75 Km.