ES16-61

TOP DOG MECHANICAL LTD.

INVOICE

Box 1891 Beaverlodge, Alberta T0H 0C0 Canada topdogmech1@gmail.com 780-897-4755

Sold to: Canadian Fiber Optics

Invoice No.:

201265

Date:

07/24/2025

Page:

Business No.:

| Quantity | Description | Tax | Unit Price | Amount |
|---------------------|--|----------|---|----------|
| | PO01443. Unit 106. 2018 Peterbilt 348. 3838hrs. 49157km. | | | |
| | SER#2NP3JJ8X1KMG22431 | | | |
| 1.0 | CVIP 2 Axle HD Truck | G | 500.00 | 500.00 |
| 4.5 | Repair tail light wiring. Check rear flasher strobe not working. Found blown | G | 150.00 | 675.00 |
| | fuse. Replace. Control light up but no rear strobe. Check for power rear | | | |
| | lights. no good. Remove light and controller. Repair RH marker wiring | 1 1 | | |
| 1.0 | Change out driver front shock | G | 150.00 | 150.0 |
| | Repaired air leak by drop box and at air tank and rear relay valve. Tie up | G | 150.00 | 375.0 |
| | line away from driveshaft | | 512000000000000000000000000000000000000 | |
| 2.0 | Replaced rear LH rear air bag | G | 150.00 | 300.0 |
| 1.5 | Replace RH rear airpot. | G | 150.00 | 225.0 |
| | Clean off faded reflective tape and install new | G | 150.00 | 150.0 |
| | Remove sump and winterize? air actuator. Lube and free up valves. | G | 150.00 | 675.0 |
| | Reinstall and test. Replace 3 way ball valve for leaking. Free up rear water | | | 0,0,0 |
| | drain and clean out. | 1 1 | | |
| 4.0 | Weld cracks in boom and fish plate to reinforce. Weld water tank bracket | G | 150.00 | 600.0 |
| | Replaced purge valve for leakinga II the time. Drain air tanks. | G | 150.00 | 150.0 |
| | Shop Supplies | G | 0.08 | 264.0 |
| 3,300.0 | Shop Supplies | | 0.08 | 204.0 |
| 1.0 | Fleetline Shock | G | 143.78 | 143.7 |
| | | | | |
| | Tire, recyc fee, change over | G G | 494.00 | 494.0 |
| | 3/4 Three Way Ball Valve | | 46.18 | 46.1 |
| | Anti Sail Bracket Chrome | G | 19.44 | 19.4 |
| | Purge Valve Kit | G | 213.86 | 213.8 |
| | ft Reflective tape | G | 5.25 | 78.7 |
| | 3030 Spring Brake, Welded Clevis, LS | G | 80.39 | 80.3 |
| | Air Bag | G | 119.48 | 119.48 |
| 1.0 | 3/8 Union | G | | |
| | Subtotal: | | | 5,259.88 |
| | G - GST 5% | 1 1 | | |
| | GST/HST | 1 1 | | 262.99 |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| hipped B | y. Tracking Number. | <u> </u> | Total Amount | 5,522.8 |
| omment | : Payment due upon reciept of invoice. Thank you for your business! | | Amount Paid | 0.00 |
| Cilillett | . Tayment due apont reciept of invoice. Thank you for your business! | | Amount Falu | 0.00 |
| old By: | | | Amount Owing | 5,522.87 |

TOP DOG MECHANICAL LTD.

INVOICE

Box 1891 Beaverlodge, Alberta T0H 0C0 Canada topdogmech1@gmail.com



Sold to: Canadian Fiber Optics

Invoice No.:

200483

Date:

02/16/2024

repairs-tail light, ABS, brake drumage:Boiler repair

Business No.:

| Unit Price | Amount |
|--|--|
| 400.000 140.000 140.000 140.000 140.000 140.000 0.080 55.320 20.440 1,732.900 284.726 6.360 107.510 6.950 1,985.350 | 400.00 420.00 280.00 490.00 980.00 910.00 246.40 165.96 81.76 1,732.90 569.45 6.36 107.51 27.80 |
| 106. 2018 Peterbilt. 1952 hrs. 17340km. SER#2NP3JJ8X1KM622431. P 2 Axle HD Truck maintenance - CVIP air tail lights for strobing. Found corrosion in pigtails and lights. Replace hts and 4 pigtails mose ABS. Had Code for LH rear. Check wiring and sensor. Adjust gap ensor lace both rear brake drums for heavy grooving from rocks. Replaced RH pads for groving and chipping. love boiler. Remove broken fittings. Remove broken and twisted metal take to boiler repair man to have reinforced. all insulation into boiler. Mount boiler and weld down solid. Fabricate and sell top boiler support. Hook up air actuator lines. D Supplies T Integrated Back up G Series Pigtail out, Tire, switch over, balance and stem. The Drum Tior Lamp, Chrome plated E Kit 2 Shoes ESII Togs Total: G Series Pigtail G C G G G G G G G G G G G G G G G G G G | 2 2 Axle HD Truck maintenance - CVIP air tail lights for strobing. Found corrosion in pigtails and lights. Replace hts and 4 pigtails nose ABS. Had Code for LH rear. Check wiring and sensor. Adjust gap ensor lace both rear brake drums for heavy grooving from rocks. Replaced RH pads for groving and chipping. Nove boiler. Remove broken fittings. Remove broken and twisted metal take to boiler repair man to have reinforced. It insulation into boiler. Mount boiler and weld down solid. Fabricate and sell top boiler support. Hook up air actuator lines. In page 10 Series Pigtail Out, Tire, switch over, balance and stem. It is proving an deliption of the page 11 deliption of the page 12 deliption of the page 12 deliption of the page 13 deliption of the page 14 deliption |
| 0 0 0 0 0 0 0 0000000 | G 400.000 G 140.000 G 140.000 G 140.000 G 140.000 G 140.000 G 140.000 G 0.080 G 0.080 G 55.320 G 20.440 G 1,732.900 G 284.726 G 6.360 G 107.510 G 6.950 |
| | 400.000 140.000 140.000 140.000 140.000 0.080 55.320 20.440 1,732.900 284.726 6.360 107.510 6.950 |