



HIGHWAY 10 EAST
YORKTON, SK S3N 2X3
306-782-4313
truckproz@sasktel.net
www.truckproz.com

EE24-3

Invoice: 01S13608
Date / Hour: 2025-03-12 11:00:12AM
Repair Order: 13608
Customer:
Branch: 1
Total Invoice: \$1,098.49
Charge
Page 1 of 1

Please make cheques payable to: **101076904 Sask Ltd**
Remit payment to: Box 1059 Yorkton, SK S3N 2X3

Bill To: YORKTON CONCRETE 2012 LTD

Ship To: YORKTON CONCRETE 2012 LTD

Work:

Shop:

Customer P/O: UNIT 19 Charris CMEADOWS Orig R/O: 0 Completion Date: 03/11/2025

Unit Number: 19 Model Year: 2015 Make/Model: MACK GU714
Type: TRUCK VIN: 1M2AX20C0FM001183 Meter: 224269 Kilometers

Task: 1 14850 REPLACE ENGINE FAN Department: SERVICE

Complaint: REPLACE ENGINE FAN.

Correction: FOUND FAN BLADE HAD CONTACTED NEW FAN RING RUBBER BREAKING MULTIPLE BLADES APART, CUT OFF ALL THE RUBBER RING FROM FAN RING AS IT WAS BADLY DAMAGED. REMOVED TOP RADIATOR HOSE, UNPLUGGED COOLANT TANK SENSOR, REMOVED OVERFLOW LINES, FLIPPED COOLANT TANK TOWARD CAB AND OUT OF THE WAY, REMOVED FAN SHROUD AND FAN BLADE, INSTALLED NEW FAN BLADE AND TORQUED FAN BOLTS TO SPEC. REINSTALLED SHROUD, FLIPPED COOLANT TANK BACK INTO PLACE, TIGHTENED BOLTS, ORDERED BOLT FOR HOOD SPRING SPACER. REINSTALLED OVERFLOW LINES AND TOP RADIATOR HOSE, PLUGGED IN COOLANT SENSOR AND TOPPED UP COOLANT LEVEL. TIED UP WIRES AND LINES. INSTALLED NEW BOLT AND REINSTALLED HOOD SPRING.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	47354451604KM	FAN BLADE MACK	EA	1.0	\$337.83	\$337.83
	5050P	50/50 PINK ANTIFREEZE (EXTENDED LIFE)	EA	1.0	\$13.04	\$13.04
	ENV100	ENV100		1.0	\$1.25	\$1.25
	BRKC	KLONDIKE BRAKE BLAST	EA	1.0	\$3.84	\$3.84
	M8B	M8 METRIC BOLT	EA	1.0	\$5.00	\$5.00
	M8FLW	M8 METRIC FLAT WASHER	EA	1.0	\$0.62	\$0.62
	FR7	FREIGHT - AIR		1.0	\$155.00	\$155.00

Detail Tax Info:

GST# 817668478RT0001 \$49.90
PST \$50.51
Total: \$100.41

3.00

Total Parts: \$360.33
Total EHC: \$1.25
Total Labor: \$450.00
Total Miscellaneous: \$155.00
Total SHOP SUPPLIES: \$31.50
Invoice Subtotal: \$998.08
Total Tax: \$100.41
Total Invoice: \$1,098.49

Payment Method Terms Due Date
Charge NET 30 2025-04-11

*** ANY WHEEL OR U-BOLT THAT HAS BEEN REMOVED OR REPLACED, NEEDS TO BE RETORQUED TO SPEC. IT IS CUSTOMER RESPONSIBILITY TO MAKE SURE THAT THIS IS DONE AT THE CORRECT INTERVAL***

ALL PARTS WITH CORE CHARGE ARE SUBJECT TO CHARGE BACK PENDING VENDOR INSPECTION *** WARRANTY ITEMS SUBJECT TO CHARGEBACK PENDING VENDOR CLAIM & REJECTION**

** NO RETURNS ON INSTALLED ELECTRICAL COMPONENTS ***

* 101076904 SASK LTD IS NOT RESPONSIBLE TO ENSURE COMPLIANCE OF REGIONAL REGULATIONS *

CAB CARD TAX EXEMPTIONS ALLOWED: PENDING CHARGES TO YOU AT ANY DATE; SHOULD THE TAXING AUTHORITY DETERMINE THAT ABOVE GOODS ARE TAXABLE. PST CREDITS WILL NOT ISSUED ONCE THEY HAVE BEEN PAID.

#817668478RT0001

THANK-YOU FOR YOUR BUSINESS!!!!!!!



HIGHWAY 10 EAST
YORKTON, SK S3N 2X3
306-782-4313
truckproz@sasktel.net
www.truckproz.com

Invoice: **01S13512**
Date / Hour: 2025-02-05 11:04:33AM
Repair Order: 13512
Customer:
Branch: 1
Total Invoice: \$5,027.69
Charge

Page 1 of 4

Please make cheques payable to: **101076904 Sask Ltd**
Remit payment to: Box 1059 Yorkton, SK S3N 2X3

Bill To: YORKTON CONCRETE 2012 LTD

Ship To: YORKTON CONCRETE 2012 LTD

Work:

Shop:

Customer P/O: UNIT 19 Charris CMEADOWS Orig R/O: 0 Completion Date: 02/04/2025

Unit Number: 19 Model Year: 2015 Make/Model: MACK GU714
Type: TRUCK VIN: 1M2AX20C0FM001183 Meter: 224231 Kilometers

Task: 1 0211 TANDEM/TRIDRIVE SAFETYINSPECTION Department: SERVICE

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
Task 1 Subtotals			3.00	Parts:		\$0.00
				Labor:		\$450.00
				Task 1 Subtotals		\$450.00

Task: 2 80500 CHECK AND REPAIR LIGHTS Department: SERVICE

Complaint: RHS OF MIDDLE TRIO CAB MARKERS DIM.

Correction: REMOVED AND REPLACED LIGHT, TESTED, LIGHT WORKED.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	TRLHB9015A	2" AMBER LED BEEHIVE LIGHT	EA	1.0	\$7.95	\$7.95
Task 2 Subtotals			0.30	Parts:		\$7.95
				Labor:		\$45.00
				Task 2 Subtotals		\$52.95

Task: 3 75200 REPAIR AIR SYSTEM Department: SERVICE

Complaint: PURGE VALVE ON DRYER DOESN'T ALWAYS SEAT.

Correction: REMOVED DRYER CARTRIDGE, FOUND HOUSING FULL OF CARBON, REMOVED HOUSING AND PURGE VALVE, WASHED HOUSING, INSTALLED NEW CARTRIDGE AND PURGE VALVE, REINSTALLED HOUSING, RECONNECTED AIR LINES, USED ONE NEW FITTING FOR AIR LINES, CHECKED FOR 12 VOLT WITH KEY ON TO PLUG, GOOD, AIRED UP TRUCK, BLED AIR DOWN TO 60 PSI AND AIRED UP AGAIN, PURGING GOOD.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	146810D	CONNECTOR	EA	1.0	\$6.12	\$6.12
	BENK022105	AD-IS / AD-IP PURGE VALVE KIT	EA	1.0	\$153.00	\$153.00
	BRKC	KLONDIKE BRAKE BLAST	EA	1.0	\$3.84	\$3.84
	FTCFS065624N	AD-IP CARTRIDGE	EA	1.0	\$114.70	\$114.70

**** ALL AUTOSHIFT AND NEWER ALLISONS MUST USE PURAGUARD COALESCING CARTRIDGES. THEY DO NOT WANT ANY OIL IN THE TRANSMISSION CONTROL SYSTEMS *****

Task 3 Subtotals	1.80	Parts:	\$277.66
		Labor:	\$270.00
Task 3 Subtotals			\$547.66

Task: 4 60200 REMOVE AND REPLACE AIR BAG Department: SERVICE

Complaint: 4TH AXLE RHS AIR BAG WORN OUT.

Correction: CUT AIR LINES, REMOVED AIR BAG AND ORDERED NEW AIR BAG. INSTALLED NEW AIR BAG WITH NEW FITTINGS, REPLACED JUMPER LINE BETWEEN 4TH AXLE AND 5TH AXLE, SECURED AIR LINES AND WIRES, AIRED UP TRUCK, LEAK CHECKED, NO LEAKS.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	103B	FITTING	EA	1.0	\$1.93	\$1.93

** See Last Page for Invoice Total **



HIGHWAY 10 EAST
YORKTON, SK S3N 2X3
306-782-4313
truckproz@sasktel.net
www.truckproz.com

Invoice: **01S13512**
Date / Hour: 2025-02-05 11:04:33AM
Repair Order: 13512
Customer:
Branch: 1
Total Invoice: \$5,027.69
Charge
Page 2 of 4

Please make cheques payable to: **101076904 Sask Ltd**
Remit payment to: **Box 1059 Yorkton, SK S3N 2X3**

Bill To: YORKTON CONCRETE 2012 LTD

Ship To: YORKTON CONCRETE 2012 LTD

Work:		Shop:				
Customer P/O:	UNIT 19	Charris	CMEADOWS	Orig R/O:	0	Completion Date: 2025-02-04
113B11/2		NIPPLE		EA	1.0	\$4.23 \$4.23
14606		SLEEVE		EA	1.0	\$0.46 \$0.46
14726B		AIR BAG TEE		EA	1.0	\$6.10 \$6.10
14856		BRAKE HOSE 3/8		EA	6.0	\$1.06 \$6.36
AS9865P		MACK AIR BAG		EA	1.0	\$269.48 \$269.48
PTX59206		6ML PST THREAD SEALANT		EA	1.0	\$9.43 \$9.43
FR7		FREIGHT			1.0	\$20.00 \$20.00
Task 4 Subtotals						Parts: \$297.99
				1.40		Labor: \$210.00
						Miscellaneous: \$20.00
						Task 4 Subtotals \$527.99

Task: 5 60700 REPLACE SHOCK(S) Department: SERVICE

Complaint: 2ND AXLE RHS, BOTH 3RD AXLE, BOTH 4TH AXLE AND 5TH AXLE RHS SHOCKS LEAKING.

Correction: TORCHED BOTTOM SHOCK BOLTS ON BOTH 3RD AXLE, BOTH 4TH AXLE AND 5TH AXLE RHS SHOCKS, REMOVED SHOCKS, REMOVED 2ND AXE RHS SHOCK, ORDERED SHOCKS. INSTALLED NEW SHOCKS, ANTI-SEIZED NEW HARDWARE, INSTALLED NEW HARDWARE AND TIGHTENED.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	66878	MACK SHOCK ABSORBER	EA	1.0	\$54.90	\$54.90
	GR81/2FLW	1/2 GRADE 8 FLAT WASHER	EA	3.0	\$0.25	\$0.75
	GR81/2N	1/2 GRADE 8 NUT	EA	2.0	\$0.68	\$1.36
	GR83/4B	3/4 GRADE 8 BOLT	EA	2.0	\$8.43	\$16.86
	GR83/4FLW	3/4 GRADE 8 FLAT WASHER	EA	9.0	\$0.51	\$4.59
	GR83/4N	3/4 GRADE 8 NUT (NC)	EA	3.0	\$1.70	\$5.10
	GR85/8B	5/8 GRADE 8 BOLT	EA	5.0	\$5.20	\$26.00
	GR85/8FLW	5/8 GRADE 8 FLAT WASHER	EA	10.0	\$0.96	\$9.60
	MON65504	MONROE HD SHOCK	EA	5.0	\$101.91	\$509.55
	STL3/4LN	3/4 STEEL LOCK NUT	EA	4.0	\$1.82	\$7.28
	STL5/8LN	5/8 STEEL LOCK NUT (NC)	EA	5.0	\$1.16	\$5.80
Task 5 Subtotals						Parts: \$641.79
				4.80		Labor: \$720.00
						Task 5 Subtotals \$1,361.79

Task: 6 90400 WINDSHIELD WIPER /WASHER REPAIR Department: SERVICE

Complaint: LHS WIPER WORN OUT.

Correction: REMOVED AND REPLACED LHS WIPER BLADE.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	201	20 EXACT FIT WIPER BLADE	EA	1.0	\$11.98	\$11.98
Task 6 Subtotals						Parts: \$11.98

**** See Last Page for Invoice Total ****



HIGHWAY 10 EAST
YORKTON, SK S3N 2X3
306-782-4313
truckproz@sasktel.net
www.truckproz.com

Invoice: **01S13512**
Date / Hour: 2025-02-05 11:04:33AM
Repair Order: 13512
Customer:
Branch: 1
Total Invoice: \$5,027.69
Charge

Page 3 of 4

Please make cheques payable to: **101076904 Sask Ltd**
Remit payment to: Box 1059 Yorkton, SK S3N 2X3

Bill To: YORKTON CONCRETE 2012 LTD

Ship To: YORKTON CONCRETE 2012 LTD

Work:			Shop:			
Customer P/O:	UNIT 19	Charris	CMEADOWS	Orig R/O: 0	Completion Date:	2025-02-04
				0.10	Labor:	\$15.00
				Task 6 Subtotals		\$26.98
Task: 7 90300 BODY REPAIR			Department: SERVICE			
Complaint: LHS HOOD GUIDE AND CABLE MOUNT MISSING FROM HOOD.						
Correction: STARTED TO BUILD AN INTERIOR PLATE TO TRY TO CLAMP INTO PLACE WITH OUTER PLATE TO INTERIOR HOOD MOUNT, DISCUSSED WITH CUSTOMER AND THEY WILL TAKE TRUCK AND DO FIBERGLASSING - A MORE EXTENSIVE REPAIR.						
Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	20802371	MACK LHS HOOD GUIDE	EA	1.0	\$144.66	\$144.66
	82392414	MACK GU HOOD SPRING	EA	1.0	\$114.55	\$114.55
Task 7 Subtotals				Parts:	\$259.21	
				1.00	Labor:	\$150.00
				Task 7 Subtotals		\$409.21
Task: 8 16250 REPAIR FENDER(S)			Department: SERVICE			
Complaint: RHS FRONT FENDER TOP MOUNT BROKEN.						
Correction: REMOVED FENDER, CUT A PIECE OF METAL TO MAKE BRACE, DRILLED HOLES IN BRACE AND FENDER, RIVETED BRACE TO FENDER AND MOUNTED FENDER, REPLACED BROKEN U-NUT AND TIGHTENED BOLTS.						
Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	M6B	M6 METRIC BOLT	EA	2.0	\$0.79	\$1.58
	MISC7	FLAT BAR		1.0	\$15.00	\$15.00
Task 8 Subtotals				Parts:	\$1.58	
				1.00	Labor:	\$150.00
				Miscellaneous:	\$15.00	
				Task 8 Subtotals		\$166.58
Task: 9 14200 REPAIR COOLING SYSTEM COMPONENT			Department: SERVICE			
Complaint: FAN SHROUD BROKEN APART AND LOOSE.						
Correction: REMOVED COOLANT RESERVOIR, SWUNG TO THE SIDE, REMOVED RADIATOR SHROUD BOLTS, COULDN'T GET RADIATOR SHROUD OUT AS IT WAS HITTING THE TOP RADIATOR HOSE. REMOVED TOP RADIATOR HOSE AND REMOVED RADIATOR SHROUD AND REMOVED FAN SHROUD, REINSTALLED PLASTIC RADIATOR SHROUD, REINSTALLED COOLANT RESERVOIR AND HOOKED UP COOLANT HOSES, REINSTALLED TOP RADIATOR HOSE, ZIP TIED WIRES UP, FILLED RESERVOIR WITH COOLANT AND HOOKED UP RHS HOOD SPRING.						
CUSTOMER NEEDED TRUCK, FAN SHROUD ON ORDER AND DIDN'T RECEIVE IT IN TIME, CUSTOMER WILL INSTALL.						
Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	5050P	50/50 PINK ANTIFREEZE (EXTENDED LIFE)	EA	1.0	\$13.04	\$13.04
	ENV100	ENV100		1.0	\$1.25	\$1.25
Task 9 Subtotals				Parts:	\$13.04	
				EHC:	\$1.25	
				2.00	Labor:	\$300.00
				Task 9 Subtotals		\$314.29
Task: 10 80400 SERVICE BATTERIES			Department: SERVICE			

** See Last Page for Invoice Total **



HIGHWAY 10 EAST
YORKTON, SK S3N 2X3
306-782-4313
truckproz@sasktel.net
www.truckproz.com

Invoice: **01S13512**
Date / Hour: 2025-02-05 11:04:33AM
Repair Order: 13512
Customer:
Branch: 1
Total Invoice: \$5,027.69
Charge
Page 4 of 4

Please make cheques payable to: **101076904 Sask Ltd**
Remit payment to: **Box 1059 Yorkton, SK S3N 2X3**

Bill To: YORKTON CONCRETE 2012 LTD

Ship To: YORKTON CONCRETE 2012 LTD

Work:	Shop:
Customer P/O: UNIT 19	Charris CMEADOWS
Orig R/O: 0	Completion Date: 2025-02-04

Complaint: BATTERIES NEED SERVICING.

Correction: REMOVED CABLES, CLEANED TOP OF BATTERIES, CLEANED CABLE ENDS, CLEANED GROUND SIDE JUMPER CABLES, POSITIVE SIDE WAS TOO FAR GONE, INSTALLED NEW CABLES AND SPRAYED WITH TERMINAL PROTECTOR.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	849305	8" POSITIVE BATTERY JUMPER	EA	1.0	\$27.95	\$27.95
Task 10 Subtotals				Parts:		\$27.95
				0.80 Labor:		\$120.00
				Task 10 Subtotals		\$147.95

Task: 11 90500 REMOVE AND REPLACE GLASS **Department: SERVICE**

Complaint: LHS WINDSHIELD CRACKED.

Correction: SUBLET GLASS - CRYSTAL GLASS REMOVED AND REPLACED LHS WINDSHIELD.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	SLGLASS	REPLACED LHS WINDSHIELD		1.0	\$381.13	\$381.13
Task 11 Subtotals				Parts:		\$0.00
				0.00 Labor:		\$0.00
				Miscellaneous:		\$381.13
				Task 11 Subtotals		\$381.13

Detail Tax Info:

GST# 817668478RT0001	\$227.83
PST	\$243.23
Sales Tax	\$0.00
Total:	\$471.06

16.20

Total Parts:	\$1,539.15
Total EHC:	\$1.25
Total Labor:	\$2,430.00
Total Miscellaneous:	\$416.13
Total SHOP SUPPLIES:	\$170.10
Invoice Subtotal:	\$4,556.63
Total Tax:	\$471.06
Total Invoice:	\$5,027.69

<u>Payment Method</u>	<u>Terms</u>	<u>Due Date</u>
Charge	NET 30	2025-03-07

*** ANY WHEEL OR U-BOLT THAT HAS BEEN REMOVED OR REPLACED, NEEDS TO BE RETORQUED TO SPEC. IT IS CUSTOMER RESPONSIBILITY TO MAKE SURE THAT THIS IS DONE AT THE CORRECT INTERVAL.***

ALL PARTS WITH CORE CHARGE ARE SUBJECT TO CHARGE BACK PENDING VENDOR INSPECTION *** WARRANTY ITEMS SUBJECT TO CHARGEBACK PENDING VENDOR CLAIM & REJECTION**

** NO RETURNS ON INSTALLED ELECTRICAL COMPONENTS ***

* 101076904 SASK LTD IS NOT RESPONSIBLE TO ENSURE COMPLIANCE OF REGIONAL REGULATIONS *

CAB CARD TAX EXEMPTIONS ALLOWED: PENDING CHARGES TO YOU AT ANY DATE; SHOULD THE TAXING AUTHORITY DETERMINE THAT ABOVE GOODS ARE TAXABLE. PST CREDITS WILL NOT ISSUED ONCE THEY HAVE BEEN PAID.

#817668478RT0001

THANK-YOU FOR YOUR BUSINESS!!!!!!!