



unit 138

INLAND AUTO CENTRE LTD. COPY

213-1
MAY
CHRYSLER

11600-8th Street
Dawson Creek, BC V1G-4R7 Tel: (250) 782-5507 Fax: (250) 782-3912



ENTERED



SERVICE ORDER CUSTOMER COPY

SO# 122896

Status
Printed 07/09/2024 12:35:03 PM

User 204 Page 1

Customer No

Key Energy Ltd.
Box 167 79133 Range Rd. 131
Bay Tree, AB T0H 0A0
GST: 732043721

Home (780) 864-5839 Bus
Cell Today
Email

Type
Term Charge

Advisor Shanay	Promised 06/27/2024 6:00 PM	Tag#
Shop	Opened 06/27/2024	Location
Priority	Cashiered 07/09/2024 12:34 PM	PO #

License DB3708	Odom In 345604	Odom Out 345645	In Service Date	Stock No
Year 2011	Make DODGE	Model RAM TRUCK	Model Number	Colour White
Vehicle ID No 3D6WU7CL0BG617145	Selling Dealer	Extended Warranty	Delivery Date	
Engine				

Request	Description	Job	CSR	Status
21DIAGA	CONCERN THE VEHICLE IS NOT SHIFTING PROPERLY - SUSPECTED SHIFT SOLENOID	1	132	Original
Labour	Description		Type	Amount
21DIAGA	CONCERN THE VEHICLE IS NOT SHIFTING PROPERLY - SUSPECTED SHIFT SOLENOID		CPR	720.00
Rate	180.00		Labour Total	720.00
Technician	57 - Roger		Request Sub-total	720.00

Cause CONCERN THE VEHICLE IS NOT SHIFTING PROPERLY - SUSPECTED SHIFT SOLENOID .
INSPECT AS68RC AUTO TRANS. FLUID LEVEL & CONDITION = GOOD.
TRANS. OP. & SHIFTING SEEMS NORMAL AT THIS TIME.
CHECK DTCS & FOUND
TCM P2806 Transmission Range Sensor Alignment- Stored
TCM U140D Implausible Wheel Speed Signals Received- Stored
TCM U1449 Implausible ERS Message Received- Stored

Correction CLEAR STORED DTCS & VERIFY GOOD RANGE SENSOR DATA & SHIFTER CABLE CONDITION & ADJUSTMENTS.
DTCS WILL NOT RESET.
INSPECT TRANS. & RANGE SENSOR WIRING & TRANSMIOSSION SOLENOID WIRING & WIGGLE TEST WIRING. FOUND MIL CAME & TRANS. DEFAULTED.
CHECK DTCS & FOUND
TCM P0778 Pressure Control Solenoid 2 Circuit- Active
FOUND THERE IS DAMAGED WIRING TO PRESURE CONTROL SOLENOID 2 CIRC. T814, THE C2 CONNECTOR WAS NOT LATCHED, INSP. & FOUND CONNECTOR IS FULL OF DIRT. ALSO FOUND THE WIRING FOR THE TRANS. COOLER TEMP. SENSOR IS HANGING DOWN & HAS LOST ITS LOOM.
REPAIR TRANS. WIRING, RELOOM, & REROUTE TRANS. WIRING, & CLEAN CONNECTORS AS NECESSARY.
CLEAR DTCS & VERIFY REPAIR.

Request	Description	Job	CSR	Status		
09LEAKD	CUSTOMER CONCERN THERE IS AN OIL LEAK	2	132	Original		
Labour	Description		Type	Amount		
09LEAKD	CUSTOMER CONCERN THERE IS AN OIL LEAK		CPR	360.00		
09LEAKD	CUSTOMER CONCERN THERE IS AN OIL LEAK		CPR	1,188.00		
Part	Description	Shp	Bin	Type	Price	Amount
68005162AA	GASKET	1	01D06	CW15S	50.78	50.78
5114418AA	GASKET	1	01B02	CW15S	108.38	108.38
5179091AD	GASKET	1	21A03	CW15S	986.85	986.85
CV52001	CRANKCASE FILTER	1	06C04	CW15S	187.44	187.44

DATE _____ CUSTOMER SIGNATURE _____ G.S.T # R102489812

CHEQUE CHARGE CASH
 DEDUCTIBLE CREDIT CARD

INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS. INLAND AUTO CENTRE LTD COMPLIES WITH ALL THE PRIVACY ACT LEGISLATION. BY PROVIDING YOUR SIGNATURE YOU CONSENT TO OUR USE OF SUCH INFORMATION. COMPANY PRIVACY POLICY AVAILABLE UPON REQUEST.



SERVICE ORDER
CUSTOMER COPY

SO# 122896

Status
Printed 07/09/2024 12:35:03 PM

User 204 Page 2

Table with 2 columns: Customer No (Key Energy Ltd., Box 167 79133 Range Rd. 131, Bay Tree, AB T0H 0A0, GST: 732043721, Home (780) 864-5839 Bus, Cell Today, Email) and Advisor/Shop/Priority (Shanay, 06/27/2024 6:00 PM, 06/27/2024, 07/09/2024 12:34 PM, Tag#, Location, PO #)

Table with 5 columns: License (DB3708), Odom In (345604), Odom Out (345645), In Service Date, Stock No, Year (2011), Make (DODGE), Model (RAM TRUCK), Model Number, Colour (White), Vehicle ID No (3D6WU7CL0BG617145), Selling Dealer, Extended Warranty, Delivery Date, Engine

Table with 7 columns: Item Description (LEVY CCF, 68218940CC, LEVY O, 68218941CB, LEVY CC, 5083285AA, LEVY F, FRT, 5080631AB, Rate, Technician, Cause, Correction), Part/Service (CASE FILTER LEVY, OIL, oil levy, OIL, LEVY, FILTER, FILTER LEVY, FREIGHT, PLUG), Quantity (1, 2, 2, 2, 1, 1, 1, 1), Description (WALL, 07F01, WALL, 07E02, WALL, 06A04, WALL, TEST, 04C04), Stock No (CW15S, CW15S, CW15S, CW15S, CW15S, CW15S, CW15S, CW15S, CW15S), Price (1.25, 13.96, 0.05, 57.96, 0.75, 13.56, 0.55, 10.00, 47.88), Total (1.25, 27.92, 0.10, 115.92, 1.50, 13.56, 0.55, 10.00, 47.88, 1,552.13, 1,548.00, 3,100.13)

Cause inspected and found oil leaks coming from topp of engine possible fuel leaks at fuel rail steering box looks like it is leaking, possible rear main and oil pan gasket leaks. recommend degreasing engine and trans to see where the fluids are coming from. there is a backup lamp inop. got authorization to clean and test drive. after test drive reinspected and found the ccv filter gasket and the pass through gasket are leaking, looks like the rocker box gasket is leaking, also looks as if the rear main and the oil pan are also leaking but the rocker box and oilpan and rear main may just look like they are leaking due to the other leaks above dripping down onto them. found as well the transmission cooler line on the drivers side of bellhousing has a repair done to it that is leaking.

Correction REPLACED THE LOWER VALVE COVER AND THE UPPER VALVE COVER GASKETS AND THE PCV GASKET REPLACED THE PCV AND DID A OIL CHANGE R/T OK STILL SOME OIL COMING FROM THE BELL HOUSING. IS LIKELY TO JUST BE JUST RESIDUE FROM THE VALVE COVER LEAKS CUSTOMER TO MONITOR RETURNED VEHICLE TO CUSTOMER

NOTE: THE TRANY COOLER LINES ARE LEAKING WHERE THEY WERE PREVIOUSLY REPAIRED

DATE _____ CUSTOMER SIGNATURE _____

G.S.T # R102489812

 
CHEQUE [] CHARGE [] CASH []
DEDUCTIBLE [] CREDIT CARD []

INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWNG FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS. INLAND AUTO CENTRE.LTD COMPLIES WITH ALL THE PRIVACY ACT LEGISLATION. BY PROVIDING YOUR SIGNATURE YOU CONSENT TO OUR USE OF SUCH INFORMATION. COMPANY PRIVACY POLICY AVAILABLE UPON REQUEST.



INLAND AUTO CENTRE LTD.

11600-8th Street
Dawson Creek, BC V1G 4R7 Tel: (250) 782-5507 Fax: (250) 782-3912



Status
Printed 07/09/2024 12:35:03 PM

SERVICE ORDER CUSTOMER COPY

SO# 122896

User 204 Page 3

Customer No
Key Energy Ltd.
Box 167 79133 Range Rd. 131
Bay Tree, AB T0H 0A0
GST: 732043721
Home (780) 864-5839 Bus
Cell Today
Email
Type
Term Charge

Advisor	Shanay	Promised	06/27/2024 6:00 PM	Tag#	
Shop		Opened	06/27/2024	Location	
Priority		Cashiered	07/09/2024 12:34 PM	PO #	

License	Odom In	Odom Out	In Service Date	Stock No
DB3708	345604	345645		
Year	Make	Model	Model Number	Colour
2011	DODGE	RAM TRUCK		White
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
3D6WU7CL0BG617145				
Engine				

Labour	2,268.00
Parts	1,552.13
Supplies	100.00
Env Fee	3.00
Sub-Total	3,923.13
GST	196.16
PST	274.62
Total Invoice	4,393.91

JOB#: _____

TIME TICKET#: _____

TIME TICKET DATE: _____

BILLED BACK: YES/NO/NA

DATE _____ CUSTOMER SIGNATURE _____

G.S.T # R102489812

CHEQUE CHARGE CASH
DEDUCTIBLE CREDIT CARD

INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS. INLAND AUTO CENTRE LTD COMPLIES WITH ALL THE PRIVACY ACT LEGISLATION. BY PROVIDING YOUR SIGNATURE YOU CONSENT TO OUR USE OF SUCH INFORMATION. COMPANY PRIVACY POLICY AVAILABLE UPON REQUEST.



**SUPREME
DIESEL**

PO Box 910, 1, 60056 TWP Rd 732 Sexsmith, AB T0H 3C0
780-568-3277~ 1-866-755-3277
sales@supremediesel.ca ~ service@supremediesel.ca
www.supremediesel.ca

Invoice

Bill To Randco Millwright Services Ltd
Faulkner, Bryan
8501 111A St
Grande Prairie, AB T8V 5L4
Canada

Invoice # 14794
Work Order # 21005
Invoice Date 6/12/2023 8:18 AM
Appointment 4/14/2023 12:15 PM
Service Advisor Pamela
Technician CB

Cell
Email

Plate AB CKY1345
VIN 3D6WU7CLOBG617145
Unit 6

Description 2011 Ram 5500 SLT L6 6.7L 408CID VIN L
Odometer 326,825

Concern

Engine Concern

Customer purchased engine from us. Did not have time to install it. Would like us to install it. Customer will bring engine over. Hood is missing also, customer will supply hood.

Engine serial number: D4325 Invoice: 17345

0 Hour	\$145.00 / Hour	\$0.00 *EG
	Sub	\$0.00

Service

Engine General Service

Remove and Replace components as required to access and install materials, and/or perform needed service, adjustments as required. Additional fluids may be required to complete this service. Retest and verify repair as required. Perform final road test where applicable.

Labor to perform engine replacement. Performed injector testing. All injectors passed. Re-installed parts with new gaskets and o-rings where required. Performed valve adjustment. Performed a hot re-torque. Filled engine with 13 liters of oil. Replaced oil filter and replaced fuel filter. Performed cooling system pressure test. Fixed several hose leaks with new gear clamps. Filled system with coolant. Cleared codes. Performed tune (mini max died on return to stock procedure). Installed EZ Lynk tune and put on stock power single tune. Test drove unit. Confirmed fluid levels. No leaks and no codes. Does have WIF code. Unit will need good fuel asap. Installed new fan shroud, thermostat, grid heater relay, oil cooler, torque converter seal, S&B air intake, crank sensor, and block heater. Repaired exhaust. Removed valve cover and replaced valve cover and injector harness. Cleaned off related area. Also installed customer supplied batteries. Road tested. Okay. Repair complete.

25 Hour	\$145.00 / Hour	\$3,625.00 *EG
---------	-----------------	----------------

Extra Labor for exhaust system install and repair

1.5 Hours	\$145.00 / Hours	\$217.50 *EG
-----------	------------------	--------------

57620 - Spin on Oil Filter dodge

1 Unit	\$18.45 / Unit	\$18.45 G
--------	----------------	-----------

10W30 Oil C - 10W30 Oil Conventional

13 Litre	\$10.04 / Litre	\$130.52 G
----------	-----------------	------------

Chevron Delo 400 SDE

68157291AA / MO-291 - 2010+ Fuel Filter Dodge 6.7L

1 Unit	\$94.42 / Unit	\$94.42 G
--------	----------------	-----------

ANTI 50/50 - ANTIFREEZE 50/50 Delo ELC Red Drum Embittered

20 Litre	\$4.90 / Litre	\$98.00 G
----------	----------------	-----------

Labor to uninstall minimaxx tuner- failed on uninstal- black screen and wont turn on with usb cable. possible dead unit now. technician installed new ezlynk single tune.

0.5 Hours	\$145.00 / Hours	\$72.50 *EG
-----------	------------------	-------------

CP LT EZ LYNK - EZ LYNK SINGLE TUNE

1 Unit	\$1,045.00 / Unit	\$1,045.00 G
--------	-------------------	--------------

DODGE/FORD/GM LIFETIME *** PISTON CRACKING

75-5092 - S&B COLD AIR INTAKE SYSTEM 10-12 DODGE

1 Unit	\$383.48 / Unit	\$383.48 G
--------	-----------------	------------

6.7L CUMMINS COTTON CLEANABLE (KF-1053, WF-1032)

Price reflects a price reduction of \$166.52 from the standard price of \$550.00

KF-1053 - S&B AIR FILTER 10-12 DODGE 6.7L	2 Unit	\$126.37 / Unit	\$252.74 G
Freight.- to ship in air filter	1 Unit	\$28.86 / Unit	\$28.86 G
Freight - Freight	1 Unit	\$30.00 / Unit	\$30.00 G
3500022 - Block Heater Kit ***Broken Cord	1 Unit	\$142.92 / Unit	\$142.92 G
RY1779 - Grid Heater Relay ***BROKEN	1 Unit	\$107.57 / Unit	\$107.57 G
WP-2151 - Water Pump ***BEARING NO GOOD	1 Unit	\$215.82 / Unit	\$215.82 G
426-190 / 14289 - Engine Coolant Thermostat 1998-2010 Dodge Ram and 2011-2020 Ram 5.9/6.7	1 Unit	\$46.64 / Unit	\$46.64 G
3975818 / B18CR67EOC - ENGINE OIL COOLER 2003-18 5.9, 6.7 CUMMINS	1 Unit	\$499.90 / Unit	\$499.90 G
PC590 - Crank Sensor ***BROKEN	1 Unit	\$97.79 / Unit	\$97.79 G
68048997AA - Coolant Pipe *** REPLACE MODIFIED STOCK PIECES- RISK OF LEAK AND FUTURE ISSUES	1 Unit	\$264.60 / Unit	\$264.60 G
68019663AA - Transmission Input Shaft Seal *** DAMAGED FROM TORQUE CONVERTOR SLIDING OUT	1 Unit	\$74.53 / Unit	\$74.53 G
68090876AA - Shroud	1 Unit	\$387.68 / Unit	\$387.68 G
VCG7 - Valve Cover Gasket/Injector Harness	1 Unit	\$422.65 / Unit	\$422.65 G
LJ400 - L40AT-AM 4" LAP JOINT ALUMINIZED CLAMP	3 Unit	\$21.95 / Unit	\$65.85 G
		Sub	\$8,322.42

Injector Testing Per Injector - Dodge * RECOMMEND DUE TO ENGINE FAILURE/ New engine**

Test injector flow and return			
Labor	2.69 Hour	\$145.00 / Hour	\$390.05 *EG
		Sub	\$390.05

Total Before Taxes & Miscellaneous Charges			\$8,712.47
(*) Shop Supplies			\$107.00 G
(E) Environmental Fee			\$7.00 G
(G) Canadian Goods and Services Tax (GST)		5 %	\$441.32
Grand Total			\$9,267.79

Thanks for the business!

I acknowledge receipt of the vehicle and the indebtedness indicated herein. I acknowledge that I am responsible to Retorque the vehicle's wheel nuts at 50 km after this service.

Customer Signature: _____ 

Randco Millwright Services Ltd paid \$9,267.79 by Check

Authorization(s)

4/14/2023 12:19 PM \$3,925.95 Engine Concern
Authorized by Randco Millwright Services Ltd



SUPREME DIESEL

Authorization

Bill To: Randon Milwright Services Ltd
Bryan

Work Order # 19687
Appointment 12/20/2022 2:48 PM
Promised 12/21/2022 5:00 PM
Service Advisor Courtney
Technician PA

Call
Email

Service

Cash / Counter Sale

The following is a list of material items you purchased which are not associated with services or repairs

568707818LB - 5.7 DODGE CUMMINS STREET SERIES 1 Unit \$9,268.97 / Unit \$9,268.97 G
LONG BLOCK W/ ARP STUDS (STD/AUTO) 5.7 5.18 (GSS + 88RFE)

S/N: INVOICE #

**Full core credit subject to inspection for damages or fault

not completely drained

* includes \$2,500.00 core charge

CORECNTR Container - Engine Core Container 1 Unit \$500.00 / Unit \$500.00 G
Sub \$12,268.97

Total Parts \$12,268.97
Total Labor \$0.00
Total Before Taxes & Miscellaneous Charges \$12,268.97

(G) Canadian Goods and Services Tax (GST) 5% \$613.45
Grand Total \$12,882.42

I hereby authorize the repairs to be done along with the required materials and agree that you are not responsible for loss or damage to the vehicle or contents in the case of fire or theft or causes beyond your control. I hereby grant you and your employees' permission to operate the vehicle on the streets and highways or elsewhere for the purpose of testing and/or inspection. I acknowledge my indebtedness for the amount of this invoice and acknowledge and agree that in the event of non-payment that the repairer is entitled to liens under any available Repair Liens or Storage Liens Legislation. This information and any other information we have in our data base is restricted to authorized personnel only. This information will be used solely for the current and future service of your vehicle, warranty registration, and any other use required by law. You have a right to a written estimate. A repairer may not charge an amount that is more than ten (10) percent above that estimate. If you waived your right to an estimate, the repairer must have your authorization of the maximum amount that you will pay for the repairs. The repairer may not charge more than the maximum amount you authorized. In either case, the repairer may not charge for any work you did not authorize.

Customer Signature: _____

POSTED

JAN 11 2023

*Please send signed authorization to service@supremediesel.ca

Authorization(s)

12/20/2022 2:49 PM 512.882.42 Cash / Counter Sale
Authorized by Randon Milwright Services Ltd

2000.00
Dwp
Sent Dec 22/22

Paramount Diesel Ltd.

9102 108 Street
 Grande Prairie, Alberta T8V 4C8
 Canada

INVOICE

Invoice No.: 14711
 Date: 03/08/2022
 Ship Date:
 Page: 1
 Re: Order No.

Sold to:
 Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

Ship to:
 Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

POSTED
AUG 11 2022

5406

Business No.: 803981653RP0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount		
VIN#3d6wu7cL088 617145	322859-KM		Truck intermittantly looses power and shuts down, scan for codes, found low rail pressure codes.monitor rail pressure while driving-found rail pressure is not matching desired. unplug regulator-pressure goes to 30000 psi. replace rgulator and install updated fuel rail, retest ok					
			parts	G		848.25		
			Labour	G		513.00		
			Subtotal:			1,361.25		
			G - GST 5%					
			GST			68.06		
Shipped By:					Tracking Number:		Total Amount	1,429.31
Comment:							Amount Paid	0.00
Sold By:							Amount Owing	1,429.31

PARAMOUNT DIESEL

INVOICE

9102 108 Street
Grande Prairie, Alberta T8V 4C8
Canada

Invoice No.: 14567
Date: 24/06/2022
Page: 1

Sold to:

Randco Millwright Services Ltd.
8501 111A ST.
Grande Prairie, AB T8V 5L4

Ship to:

Randco Millwright Services Ltd.
8501 111A ST.
Grande Prairie, AB T8V 5L4

POSTED
JUL 13 2022

Business No.: 803881653RP0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
3D8WU7CL0BG17 1145	221873-KM		Check and advise belt blew off. Verify concern and inspect-replace serpentine belt, tensioner assembly as well as idler pulley			
			Parts	G		397.71
			Labour	G		135.00
			Replace both hood lift shocks			
			Parts	G		43.18
			Labour	G		81.00
			Subtotal:			656.89
			G - GST 5%			
			GST			32.85
Paramount Diesel Ltd. will not be held liable for parts or components failure due to misuse, lack of maintenance or custom non factory - vehicle add-ons. All warranties must be performed at Paramount diesel Ltd. at their discretion. Paramount Diesel will not be held responsible for third party charges. 1 Year limited warranty on parts and labour.						
Comment: Unit#5408					Total Amount	689.74
					Amount Paid	0.00
					Amount Owing	689.74

PARAMOUNT AUTO BODY

9602 112 Street
 Grande Prairie, AB T8V 4E7
 Tel: (780) 832-6174
 Direct Office Line for A/P and A/R: 780-830-0811
 Email: paramountautobody@outlook.com

Invoice

Date	Invoice #
9/06/2022	4040

unit #

Ranco Millwright Services Ltd.
 8501 - 111A St
 Grande Prairie AB
 T8V 5L4

2011 Dodge 5500 ST
 VIN#3D6WU7CL0BG617145
 5400

Claim No.	Policy No.	S.O No.	1516
Description	Qty	Rate	Amount
Grille Assembly	1	650.00	650.00
Deflector,Hood	1	148.00	148.00
Rockguard	1	300.00	300.00
Shop Material	1.2	18.00	21.60
Body Labour	1.2	90.00	108.00
GST on sales		5.00%	61.38

POSTED
 SEP 12 2022

Paramount Auto Body Ltd. will not be held liable for parts or components failure due to misuse or lack of maintenance. All warranties must be performed at Paramount Auto Body Ltd. Paramount Auto Body Ltd. will not be held responsible for third party charges. GST/HST No. 747900520	Total	\$1,288.98
	Payments/Credits	\$0.00
	Balance Due	\$1,288.98

Paramount Diesel Ltd.
 9102 108 Street
 Grande Prairie, Alberta T8V 4C8
 Canada

INVOICE

Invoice No.: 14488
 Date: 03/06/2022
 Ship Date:
 Page: 1
 Re: Order No.

Sold to:
 Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

Ship to:
 Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

POSTED

JUN 27 2022

Business No.: 803981653RP0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
3D6WU7CL0BG17 145	319743-KM		Check for truck running rough again. Verify concern and scan for codes-has memory code for cyl#4 misfire. Perform injector shut down test cyl#4- no difference. Remove valve cover-test injector wiring from PCM to injector-is good. Replace cyl#4 injector with aftermarket Bosch injector and reassemble. Clear code and road test- tech noted truck started misfiring on road test. Perform injector shut down test again-cyl#3 misfiring. Disassemble and replace cyl#1,2,3,6 injectors and reassemble. Clear code and road test- ok now Parts Labour Subtotal: G - GST 5% GST	G G		4,060.00 1,080.00 5,140.00 257.00
Shipped By: _____ Tracking Number: _____					Total Amount	5,397.00
Comment: Unit#5406					Amount Paid	0.00
Sold By: _____					Amount Owing	5,397.00

PARAMOUNT DIESEL

9102 108 Street
Grande Prairie, Alberta T8V 4C8
Canada

INVOICE

Invoice No.: 14361
Date: 02/05/2022
Page: 1

Sold to:

Randco Millwright Services Ltd.
8501 111A ST.
Grande Prairie, AB T8V 5L4

Ship to:

Randco Millwright Services Ltd.
8501 111A ST.
Grande Prairie, AB T8V 5L4

POSTED

2022

Business No.: 803981653RP0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
3D6WU7CL0BG61 7145	319891-KM		Check and advise wheels came loose. Verify concern and inspect for damaged wheel studs-passenger side front wheel studs are damaged. Replace all 10 wheel studs on RF wheel.			
			Parts	G		469.75
			Labour	G		405.00
			Remove rear wheels and inspect-tech noted studs all look ok but driver's side rear brake pads and rotor are worn out of spec. Disassemble and replace rear pads, LH rear rotor and wheel seal and install new caliper pin kits			
			Parts	G		766.07
			Labour	G		607.50
			Customer noted on cold start truck ran extremely rough and shut down. Restarted and truck blows excessive black smoke and is misfiring. Verify concern and scan for codes-no related codes. Monitor engine data- no data available for injector balance rates.			
			Try to isolate cylinder by performing injector cut off test- found cyl#5 injector misfiring. Remove and replace injector with aftermarket Bosch injector. Reassemble and retest-ok now			
			Parts	G		812.00
			Labour	G		1,080.00
			RF shock is leaking-remove and replace both front shocks and springs			
			Parts	G		607.13
			Labour	G		405.00
			Subtotal:			5,152.45
			G - GST 5%			
			GST			257.63
Paramount Diesel Ltd. will not be held liable for parts or components failure due to misuse, lack of maintenance or custom non factory - vehicle add-ons. All warranties must be performed at Paramount diesel Ltd. at their discretion. Paramount Diesel will not be held responsible for third party charges. 1 Year limited warranty on parts and labour.						
Comment: Unit#5406						Total Amount Amount Paid Amount Owing
						5,410.08 0.00 5,410.08

PARAMOUNT DIESEL

9102 108 Street
Grande Prairie, Alberta T8V 4C8
Canada

INVOICE

Invoice No.: 14199
Date: 16/03/2022
Page: 1

Sold to:

Randco Millwright Services Ltd.
8501 111A ST.
Grande Prairie, AB T8V 5L4

Ship to:

Randco Millwright Services Ltd.
8501 111A ST.
Grande Prairie, AB T8V 5L4

POSTED
APR 05 2022

Business No.: 803981653RP0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount	
3D6WU7CL0BG61 7145	314624-KM		Passenger side window regulator is broken- customer has disassembled. Replace passenger side window regulator assembly with aftermarket part.				
			Parts	G		315.24	
			Labour	G		243.00	
			Check for exhaust leak-found bolt missing from rear of manifold. Remove lower bolt and replace gasket and install new bolt and spacer				
			Parts	G		95.21	
			Labour	G		270.00	
			Cruise control isn't working - perform electrical diag.-found switch is faulty. Remove and replace speed control switch on column with factory replacement switch-retest-ok now				
			Parts	G		88.77	
			Labour	G		270.00	
			Exhaust brake not working- perform diag. Found turbo speed sensor wiring is broken-repair wire and retest- no change. Test wiring for turbo actuator-all ok. Remove and replace turbo actuator with Holset actuator and perform re-learn procedure				
			Tech noted re-learn procedure failed multiple times. Refer to shop manual wiring schematics-trace communication wires along frame rail to rear of truck, unwrap harness and inspect-found broken wires on frame by t-case. Repair broken wires and try to perform				
			re-learn procedure- ok now. Retest- turbo and exhaust brake functioning normally now. Rewrap and resecure wiring harness.				
	Parts	G		1,025.00			
	Labour	G		675.00			
	Inspect for engine oil leak-found valve cover is leaking. Replace valve cover assembly with factory replacement part						
	Parts	G		732.13			
	Labour	G		270.00			

Paramount Diesel Ltd. will not be held liable for parts or components failure due to misuse, lack of maintenance or custom non factory - vehicle add-ons. All warranties must be performed at Paramount Diesel Ltd. at their discretion. Paramount Diesel will not be held responsible for third party charges. 1 Year limited warranty on parts and labour.

Comment: Unit#5406

Continue...

PARAMOUNT DIESEL

9102 108 Street
Grande Prairie, Alberta T8V 4C8
Canada

INVOICE

Invoice No.: 14199
Date: 16/03/2022
Page: 2

Sold to:

Randco Millwright Services Ltd.
8501 111A ST.
Grande Prairie, AB T8V 5L4

Ship to:

Randco Millwright Services Ltd.
8501 111A ST.
Grande Prairie, AB T8V 5L4

Business No.: 803981653RP0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
			Remove both rear leaf packs and add one extra leaf to each pack.Reassemble with new center bolts and u-bolts on one side			
			Parts	G		458.55
			Labour	G		877.50
			Sublet for tire repair	G		65.00
			Tire rotation	G		135.00
			Road test- tech could hear growling noise from rear.Inspect-found rear driveshaft support bearing is worn out and .Remove and replace steady bearing with factory replacement part			
			Parts	G		287.60
			Labour	G		337.50
			Perform alignment check	G		70.00
			Top transmission fluid 1L	G		19.97
Mar 28,2022	318149-km		Inspect for engie oil leaking again-engine oil dipstick tube is leaking.Replace oring and reseal tube and zip tie trans and oil tube together to prevent tubes from moving.Perform engine oil service using AC Delco filter and customer supplied oil	G		202.50
			Engine oil filter - PF1070F	G		14.76
			Clean and oil aftermarket air filter	G		54.00
			Subtotal:			6,506.73
			G - GST 5%			
			GST			325.36
Paramount Diesel Ltd. will nto be held liable for parts or components failure due to misuse, lack of maintenance or custom non factory -vehicle add-ons. All warranties must be performed at Paramount diesel Ltd. at their discretion. Paramount Diesel will not be held responsible for third party charges. 1 Year limited warranty on parts and labour.						
					Total Amount	6,832.09
Comment: Unit#5406					Amount Paid	0.00
					Amount Owng	6,832.09

Paramount Diesel Ltd.
 9102 108 Street
 Grande Prairie, Alberta T8V 4C8
 Canada

INVOICE

Invoice No.: 13900
 Date: 13/12/2021
 Ship Date:
 Page: 1
 Re: Order No.

Sold to:

Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

Ship to:

Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

POSTED

JAN 15 2022

Unit 3406

Business No.: 803981653RP0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
3C8WU7CL0BG61 7145	312009-KM		Check and advise exhaust brake isn't working. Verify concern and scan for codes-no codes. Perform pin point test -recommend performing VGT relearn procedure-customer needs truck and declined further repairs at this time- order VGT gaskets and customer will rebook for further inspection/repair	G		256.00
			Check and advise driver's side headlight not working intermittently. Remove LED headlight on driver's side and install factory replacement bulb. Leave original LED light in truck for customer	G		19.77
			Parts	G		102.40
			Labour	G		
			Check and advise both bumper mounted trailer plug and 5th wheel trailer plug not working. Verify concern and inspect-tech noted 7pin trailer plug on bumper wired in incorrectly causing internal short-replace 7pin plug on bump as well as 7pin plug on deck	G		20.26
			Check all power and ground- all ok. Hook to trailer and test- all functioning normally now	G		256.00
			Parts	G		
			Labour	G		
			Check and advise customer noted after truck is up to operating temp brake pedal goes soft. Verify concern and inspect-no visual concerns found. Try to bleed brake system-no air in system. Road test-pedal still soft. Bleed brakes again-got dead pedal after bleed. Remove fluid reservoir cap and bleed system again-tech noted air came out of front brake system. Retest-brakes feel ok now-customer to monitor	G		448.00
			Brake Fluid	G		40.88
			Tech noted axle seals are leaking-customer to rebook for further inspection/repairs			
Jan. 6, 2022	313025-km		Perform engine oil service using customer supplied engine oil filter and 15w40 engine oil.			
Comment:					Continue...	

Paramount Diesel Ltd.
 9102 108 Street
 Grande Prairie, Alberta T8V 4C8
 Canada

INVOICE

Invoice No.: 13900
 Date: 13/12/2021
 Ship Date:
 Page: 2
 Re: Order No.

Sold to:
 Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

Ship to:
 Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

Business No.: 803981653RP0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
			Check and advise brake pedal not returning and feels like brakes are still applied after releasing pedal. Verify concern and inspect- check for air in system-no air found. Suspect master cylinder has internal damage and cup seals are not sealing. Remove and replace brake master cylinder and install good used assembly including reservoir. Bench bleed replacement master cylinder and install in truck. Refill brake fluid with new fluid and bleed all four brakes. Road test- brakes feel firm and pedal returns normally now. Parts & Fluid Labour	G G		265.34 256.00
			Subtotal:			1,664.65
			G - GST 5%			83.23
Shipped By: _____ Tracking Number: _____					Total Amount	1,747.88
Comment: _____					Amount Paid	0.00
Sold By: _____					Amount Owning	1,747.88

Paramount Diesel Ltd.
 9102 108 Street
 Grande Prairie, Alberta T8V 4C8
 Canada

INVOICE

Invoice No.: 13840
 Date: 08/12/2021
 Ship Date:
 Page: 1
 Re: Order No.

Sold to:
Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

Ship to:
Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

NOTED

Business No.: 803981653RP0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
3D6WU7CL0BG61 7145	311305-KM		Perform CVIP inspection- Billed to Adrenaline Auto Sales			51.20
			Clean aftermarket air filter	G		4.99
			Top up windshield washer fluid	G		
			Install and wire up Autometer pyrometer and install single pod pillar mount			445.00
			Parts	G		258.00
			Labour	G		85.00
			Road test -tech noted truck started to overheat-radiator was just replaced.Inspect-found coolant level too low-suspect cooling system wasn't purged properly after rad replacement			38.40
			Power steering leaking - hose under resevoir leaking-install new clamp -ok now	G		4.99
			Top up windshield washer fluid	G		
			Customer removed front driveshaft.Install one new u-joint in front shaft and reinstall in truck			38.21
			Parts	G		140.80
			Labour	G		64.00
			Rewire license plate ID light	G		128.00
			Check and advise customer noted PTO is leaking and would like RPMs increased.Verify concern and inspect-found two nuts missing on PTO.Replace nuts and clean up oil residue. Tech noted double tapping button when PTO is engaged will increase RPMs by 200 RPM			
			Tech noted truck wouldn't start in shop intermittently-hit starter and truck will start.Remove and replace starter with aftermarket Wilson starter and install new starter switch connector.Retest-truck starts everytime now.			537.33
			Parts	G		320.00
			Labour	G		565.00
			Perform transmission service with WIX filter and factory replacement ATF for Aisin transmission			
Comment:						Continue

Paramount Diesel Ltd.
 9102 108 Street
 Grande Prairie, Alberta T8V 4C8
 Canada

INVOICE

Invoice No.: 13840
 Date: 08/12/2021
 Ship Date:
 Page: 2
 Re: Order No.

Sold to:
 Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

Ship to:
 Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

Business No.: 803981653RP001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
			Check and advise truck has broken wheel stud on rear. Verify concern and inspect-found one stud broken on driver's side rear. Remove rear duals and replace one rear wheel stud and nut on driver's side. Wash mud from wheels			72.60
			Parts	G		128.00
			Labour	G		
			Truck isn't blowing air in cab from any vents. Connect scanner and check actuator function-mode door actuator is sticking. Remove blower motor and check evap core with boroscope-found evap core is plugged solid. Disassemble and evac AC system. Disassemble dash assembly and inspect heater core while apart-found heater core is plugged. Upon disassembly tech noted blower motor wires are damaged and truck isn't equipped with cabin air filter. Replace evap core, heater core, mode door actuator and install accessory cabin filter kit. Repair blower motor wires and reassemble. Recharge AC system and retest-all ok now			539.37
			Parts	G		85.00
			Refrigerant	G		1,280.00
			Labour	G		
			Check and advise fuel pump is clicking off before tank is full. Verify concern and inspect- found fuel filler neck is kinking. Remove filler neck and shorten-secure and add 40L of fuel- tech noted pump didn't click off-ok now			50.00
			Fuel	G		192.00
			Labour	G		64.00
			Check and advise customer noted oil leaking. Verify concern and inspect-found hydraulic lines next to t-case are leaking. Tighten hose clamp on big line and wash off oil residue. Recheck- ok now			64.00
			Tech noted exhaust pipe is cracked by t-case- weld exhaust pipe	G		
Comment:						Continue...

Paramount Diesel Ltd.
 9102 108 Street
 Grande Prairie, Alberta T8V 4C8
 Canada

INVOICE

Invoice No.: 13840
 Date: 08/12/2021
 Ship Date:
 Page: 3
 Re: Order No.

Sold to:
Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

Ship to:
 Randco Millwright Services Ltd.
 8501 111A ST.
 Grande Prairie, AB T8V 5L4

Business No.: 803981653RP0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
			Inspect,found passenger side LED headlight not working.Remove headlight and put harness in truck for customer.Customer to order warranty replacement bulb.Install factory replacement bulb until warranty LED light arrives.			
			Parts	G		19.77
			Labour	G		102.40
			Check and advise positive air shut off isn't working.Verify concern and test power and ground to solenoid-is good.Remove valve and bench test- found shut off valve is faulty.Remove shut off and fabricate new intake pipe	G		384.00
			Paint trailer hitch after customer repair	G		38.40
			Subtotal:			5,678.46
			G - GST 5%			
			GST			283.93
Shipped By: Tracking Number:					Total Amount	5,962.39
Comment:					Amount Paid	0.00
Sold By:					Amount Owning	5,962.39