

J26-5
MAY



Red Deer
8046 Edgar Industrial Cres.
Red Deer, AB T4P 3R3
P: (403) 309-8225

BODYSHOP
6533 79th AVE SE
Calgary, AB T2C 4S6
P: (825) 257-5782

SERVICE INVOICE: R108004913:01
ESTIMATE: E108001231
Tag Number:
License Plate Number: N64

BILL TO
NEWAY OILFIELD SERVICES - 11816
18 WESTPARK COURT
FORT SASKATCHEWAN AB T8L 3W9
P: (403) 895-0781

DELIVER TO
NEWAY OILFIELD SERVICES - 11816
18 WESTPARK COURT
FORT SASKATCHEWAN AB T8L 3W9
P: (403) 895-0781

DATE INVOICE	SALES TYPE	ADVISOR	TERMS	PO #				
3/16/2023	SRET	8331	NET30	KEVIN				
YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT #	ENGINE HOURS	IN SERVICE	Component Serial #	ODOMETER
2013	FREIGHTLINER	122SD	1FUJGNDR9DDFA7202	64	0	10/12/2009		380257

Sold Operations

JOB #1 101

ENGINE REPAIRS

COMPLAINT
CAUSE
CORRECTION

REMOVE AND REPLACE WITH NEW 3/4 LONG BLOCK ENGINE

MOVE UNIT INTO SHOP, HAVING TO USE THE FORKLIFT AS UNIT IS A NO START. DRAIND THE COOLANT AND EVACUATE A/C SYSTEM. REMOVED THE HOOD, PUT ON A SKID AND MOVED OUTSIDE. REMOVED RADIATOR, RAD MOUNT, STARTED TO REMOVE PIECES FROM AROUND ENGINE. DRAINED POWER STEERING AND REMOVED THE RESEVOIR. CONTINUED REMOVING PIECES FROM ON AND AROUND ENGINE/TRANSMISSION TO GET READY FOR REMOVAL. REMOVED ENGINE AND TRANSISSION FROM TRUCK. GET TRANS OFF ENGINE AND PLACED ON STAND. REMOVED CLUTCH AND STARTED TO REMOVE PIECES FROM OLD ENGINE AND MOVED THEM OVER TO THE NEW ENGINE. CONTINUED REMOVING PIECES FROM OLD ENGINE AND INSTALLING ONTO THE NEW ENGINE. GOT NEW ENGINE INTO TRUCK. TRANSMISSON AND CLUTCH BOLTED UP AND DRIVE LINE. CONTINUE WORKING ON ENGINE, THE ENGINE IS NOW IN COMPLETELY. RAD IS IN, NEEDS COOLANT AND HOOD. ADJUSTED CLUTCH AND A/C NEEDS TO BE DONE. FILLED UNIT WITH COOLANT, FOUND A HARD LINE LEAKING, PUT IN ASR FOR THIS AND SET THE CLUTCH. FOUND THE CLUTCH LINKAGE NEEDS TO BE ADJUSTED. INSTALLED HOOD. HAND IN CORES. BRING TRUCK BACK IN AFTER RUNNING UP TO TEMPERATURE AND FOUND A COOLANT LEAK AT THE UPPER RAD HOSE. TIGHTENED THE CLAMP AND WASHED THE ENGINE. DRAINED COOLANT AND OIL AND EVACUATE A/C SYSTEM. REMOVED HOOD, RAD/CAC/CONDENSOR ASSEMBLY. REMOVED PTO AND DRIVELINE AND REMOVED ALL PIECES ATTACHED TO ENGINE AND TRANSMISSION. REMOVED ENGINE AND TRANSMISSION ASSEMBLY, SPLIT ENGINE AND TRANSMISSION AND PLACED TRANS BACK UNDER TRUCK. REMOVED PIECES FROM OLD ENGINE THAT DID NOT COME ON NEW ENGINE, INSTALLED PIECES ON NEW ENGINE AND INSTALLED ENGINE INTO TRUCK. INSTALLED TRANSMISSION AND ALL PIECES THAT WERE PREVIOUSLY ATTACHED TO THE ENGINE. INSTALLED RAD ASSEMBLY, HOOD AND FILLED ALL FLUIDS. INPUTTED NEW INJECTOR TRIM CODES AND SET NEW ENGINE SERIAL NUMBER 472903R1015705. RAN UNIT UP TO TEMPERATURE AND CHECKED FOR LEAKS, GOOD WITH NO LEAKS FOUND.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
65.00	LABOR 101	REPLACE WITH NEW 3/4 LONG BLOCK		10,367.50
1.00	108D/03-36867-010	ELEMENT-FILTER,AIR, 8X25, 24U	388.80	388.80
1.00	108D/DDE R23539393	LB+ DD15 EPA10 D472903 FSUMP	29,000.00	29,000.00
1.00	108D/DDE R23539393-CORE	LB+ DD15 EPA10 D472903 FSUMP	8,125.00	8,125.00
40.00	108X/PET-DHP15BLK	BULK,15W40HP	4.99	199.60
40.00	10	GOVERNMENT FEE CODE 10	0.10	4.00
13.00	108D/OWI AMAC53	ALLIANCE OAT ELC 50/50	14.00	182.00
6.00	108D/ABP R01 RA4600701087	IT- INJ HDEP EPA07/EPA10/GHG14	743.44	4,460.64
6.00	108D/ABP R01 RA4600701087-CORE	IT- INJ HDEP EPA07/EPA10/GHG14	406.25	2,437.50
1.00	108D/04-27150-000	FITTING-COOLANT LINE,UREA SYS,	42.52	42.52
1.00	108D/DDE A0179978945	MOUNTING O-RING, HIGH PRESSURE	27.73	27.73



SERVICE INVOICE: R108004913:01

ESTIMATE: E108001231

Sold Operations (Cont.)

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.00	108D/DDE A4720709232	KIT - HIGH PRESSURE FUEL LINE	137.63	137.63
4.00	108D/DDE N000000001068	SEALING RING - GENERAL PURPOSE	1.09	4.36
8.00	108D/DDE N000000001069	SEALING RING, M14	0.77	6.16
1.00	108D/DDE A4710780380	GASKET	54.50	54.50
3.00	108D/DDE A0179979545	O-RING	3.04	9.12
1.00	108D/DDE A4722030315	FITTING - FUEL LINE	17.75	17.75
6.00	108D/DDE A4720980080	MOUNTING SEAL, INTAKE MANIFOLD	9.96	59.76
1.00	108D/DDE A4729970245	O-RING - GENERAL PURPOSE	9.64	9.64
1.00	108D/DDE A4721420880	SEAL	4.89	4.89
1.00	108D/DDE A4721421880	SEAL	128.14	128.14
1.00	108D/DDE A4721421980	SEAL	128.30	128.30
1.00	108D/DDE A4710780280	GASKET	70.73	70.73
1.00	108D/DDE A4722000154	COUPLING - WATER MANIFOLD	18.00	18.00
1.00	108D/DDE A4729970245	O-RING - GENERAL PURPOSE	9.64	9.64
1.00	108D/DDE A4730960280	METAL SEAL	55.06	55.06
1.00	108D/DDE A0209976545	O-RING KIT	20.34	20.34
1.00	108D/DDE A4720980180	SEAL - INLET ELBOW, INTAKE MAN	7.88	7.88
1.00	108D/DDE A4720160121	SEAL, ROCKER COVER	67.31	67.31
1.00	108D/DDE A0309976645	OIL SUPPLY O-RING, AIR COMPRES	3.67	3.67
1.00	108D/DDE A4721841980	SEAL	96.20	96.20
1.00	108D/DDE A4722030315	FITTING - FUEL LINE	17.75	17.75
1.00	108D/DDE A4720180780	GASKET, CRANKCASE BREATHER	10.74	10.74
1.00	108D/DDE A4720180180	SEAL	7.94	7.94
1.00	108D/DDE A4722030980	GASKET - WATER MANIFOLD	27.18	27.18
1.00	108D/DDE A4722030880	GASKET - WATER MANIFOLD	35.61	35.61
1.00	108D/ABP N15R 28P1601	ALTERNATOR RX DR 28SI IR/IF 12	181.99	181.99
1.00	108D/ABP N15R 28P1601-CORE	ALTERNATOR RX DR 28SI IR/IF 12	65.00	65.00
1.00	108D/DDE A0029951502	CLAMP - PIPE SECTION TURBOCOMP	53.46	53.46
1.00	108D/DDE A5411870080	GASKET TURBOCHARGER OIL RETURN	10.92	10.92
1.00	108D/DDE A4721802520	TUBE - OIL DRAIN, TURBOCHARGER	52.36	52.36
4.00	108D/DDE A0219901101	MOUNTING BOLT, TURBOCHARGER	12.06	48.24
1.00	108D/DDE A4721421380	GASKET - EXHAUST LINE, TURBOCO	10.91	10.91
1.00	108D/DDE A0019957302	PIPE CLAMP	35.23	35.23
4.00	108D/DDE N000000001070	SEALING RING, M16	0.91	3.64
2.00	108D/DDE N000000001067	SEALING RING, M10	0.48	0.96
2.00	108D/DDE N000000001066	SEALING RING - GENERAL PURPOSE	3.21	6.42
1.00	108D/DDE A4721420143	BASE	4.89	4.89
1.00	108D/BRZ 62020H C	CLAMP-HOSE,13/16-1 3/4IN, 1/2	1.41	1.41
1.00	108D/BRZ 9216H	CLAMP-HOSE,13/16-1 1/2IN,1/2IN	3.06	3.06
2.00	108D/TCX AMS013	GASKET-5 INCH SPHERICAL W/TABS	15.44	30.88
3.00	108D/DDE A4720503734	OUTLET ROCKER ARM	374.78	1,124.34
0.00	LABOR 101	REPALCE ENGINE		0.00
1.00	108D/02-12176-000	BEARING-PILOT,72 X 30 X 19MM	58.88	58.88
1.00	108D/SP 6.5 70 18X	STRAP BOLT KIT *D	15.89	15.89
1.00	108D/BRZ 9216H	CLAMP-HOSE,13/16-1 1/2IN,1/2IN	3.06	3.06
2.00	108D/BRZ 9212H	CLAMP-HOSE,11/16-1 1/4IN, 1/2I	2.82	5.64
1.00	108D/DDE 23516100	GASKET	5.38	5.38
1.00	108D/FUL 4305294	GASKET *D	11.07	11.07
1.00	108D/DDE A0019950502	CLAMP - EGR PIPE	34.57	34.57
3.00	108D/PH 891HT12RL	HOSE *D	9.31	27.93
2.00	108D/BRZ CT 9416	CLAMP	7.76	15.52



SERVICE INVOICE: R108004913:01

ESTIMATE: E108001231

Sold Operations (Cont.)

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.00	108D/DDE A4720780335	HARDWARE, MOUNTING - HIGH PRES	28.91	28.91
1.00	108X/GRE/LPS-C07416	NO FLASH CONTACT CLEANER	74.65	74.65
1.00	108D/23-12485-250	CLAMP-CONSTANT TORQUE,HOSE,2 9	20.36	20.36
1.00	108D/DDE A0000905151	KIT - FILTER INSERT	109.35	109.35
1.00	8P	GOVERNMENT EHC CHARGE 8P	1.00	1.00
2.00	108D/BRZ 9216H	CLAMP-HOSE,13/16-1 1/2IN,1/2IN	3.06	6.12
1.00	108D/DDE A4722002452	TUBE - COOLANT, AIR COMPRESSOR	32.34	32.34
1.00	108D/PAC 12015792	CONNECTOR-FEMALE,2 CAV,WEATHER	0.98	0.98
1.00	108D/PAC 12010973 B	CONNECTOR-MALE,2 CAV,WEATHER P	1.30	1.30
2.00	108D/PAC 12124582 L	TERMINAL-MALE,WEATHER PACK,14-	0.48	0.96
2.00	108D/PAC 12124580	TERMINAL-FEMALE,WEATHER PACK,1	0.23	0.46
4.00	108D/PAC 15324982 B	SEAL-CABLE,FMALE,METRI-PACK	0.14	0.56
1.00	108X/PC1462-4	1/4 UNION	8.49	8.49
2.00	108D/OWI AMAC53	ALLIANCE OAT ELC 50/50	14.00	28.00
-6.00	108D/ABP R01 RA4600701087-CORE	IT- INJ HDEP EPA07/EPA10/GRG14	406.25	-2,437.50
-1.00	108D/ABP N15R 28P1601-CORE	ALTERNATOR RX DR 28SI IR/IF 12	65.00	-65.00
1.00	108D/F80B 14B192 AA	RELAY-70AMP,SPST,GY,MXD TERM	47.06	47.06
1.00	108D/23-13265-001	RELAY-12V,MICRO,SPDT,280,10-20	14.25	14.25
4.00	108D/DDE A4720140683	MOUNTING BOLT ASSEMBLY, OIL PA	12.23	48.92
-1.00	108D/DDE R23539393-CORE	LB+ DD15 EPA10 D472903 FSUMP	8,125.00	-8,125.00

Prepay: \$0.00 Parts: \$37,478.95 Labor: \$10,367.50 Misc: \$5.00 Sublet: \$0.00 \$47,851.45

JOB #12 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT MISSING ONE BATTERY, REPLACE
 CAUSE MISSING
 CORRECTION INSTALL MISSING BATTERY AND INSTALL NEW HOLD DOWN BOLTS DUE TO BREAKING DURING REMOVAL.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.60	LABOR 031-0011CC	MISSING ONE BATTERY, REPLACE		95.70
1.00	108D/ABP A31S925VL	12V VALUE STARTING BATTERY GRP	119.34	119.34
1.00	108D/ABP A31S925VL-CORE	12V VALUE ST	33.75	33.75
	V	sn 0002434586		

Prepay: \$0.00 Parts: \$153.09 Labor: \$95.70 Misc: \$0.00 Sublet: \$0.00 \$248.79

JOB #13 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT FAN BLADES ARE DAMAGED, NEEDS REPLACING - ABLE TO DO UNDER MAIN REBUILD LINE
 CAUSE DAMAGE
 CORRECTION COMPLETED ON JOB#1.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.00	108T/ATN-810.FB9907	FAN BLADE	126.35	126.35

Prepay: \$0.00 Parts: \$126.35 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00 \$126.35

JOB #14 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT MISSING INTAKE MANIFOLD SENSOR - ABLE TO DO ON REBUILD LINE
 CAUSE MISSING
 CORRECTION COMPLETED ON JOB #1.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.00	108D/DDE A0081530128	TEMP. SENSOR	28.99	28.99
1.00	108D/DDE N000000001069	SEALING RING, M14	0.77	0.77

Prepay: \$0.00 Parts: \$29.76 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00 \$29.76



Sold Operations (Cont.)

JOB #15 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT D/S HOOD WIRING TO CHASSIS, LOTS OF SPLICES AND WAS HARDWIRED, RECOMMEND CLEANING UP AND INSTALLING CONNECTOR

CAUSE

CORRECTION CLEANED UP WIRES AND INSTALLED NEW CONNECTORS.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
2.00	LABOR 99-0	D/S HOOD WIRING TO CHASSIS, LOTS OF SPLICES AND		319.00
Prepay: \$0.00 Parts: \$0.00 Labor: \$319.00 Misc: \$0.00 Sublet: \$0.00				\$319.00

JOB #16 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT ONE BOX COVER IS LOOSE UNDER FAIRING, INSTALL

CAUSE INSTALL

CORRECTION INSTALLED NEW CLIPS AND NEW BOLTS. RE INSTALLED THE ONE BOX COVER, NOTED THE BOLTS WERE SEIZED AND HAD TO BE HEATED TO REMOVE THE STEPS.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.00	LABOR 246-6174E	ONE BOX COVER IS LOOSE UNDER FAIRING, INSTALL		159.50
10.00	108D/DDE N910105006023	SCREW, M6 X 16	0.48	4.80
10.00	108D/23-12625-000	SPRING NUT-M6x1.0,U-TYPE,STEEL	1.87	18.70
Prepay: \$0.00 Parts: \$23.50 Labor: \$159.50 Misc: \$0.00 Sublet: \$0.00				\$183.00

JOB #17 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT BROKEN WIRES AT D/S FRAME GROUND- REPAIR

CAUSE BROKEN

CORRECTION REPAIR DAMAGED GROUND WIRES

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.60	LABOR 003-206EE	BROKEN WIRES AT D/S FRAME GROUND- REPAIR		95.70
2.00	108D/PAC 12010974 B	CONNECTOR-MALE,WEATHER PACK,4	2.25	4.50
2.00	108X/TEC 76 2177	2 PIN CONNECTOR	4.35	8.70
8.00	108D/PAC 12089040 L	TERMINAL-MALE,WEATHER PACK,18	0.41	3.28
8.00	108D/PAC 12124580	TERMINAL-FEMALE,WEATHER PACK,1	0.23	1.84
16.00	108D/PAC 15324982 B	SEAL-CABLE,FMALE,METRI-PACK	0.14	2.24
Prepay: \$0.00 Parts: \$20.56 Labor: \$95.70 Misc: \$0.00 Sublet: \$0.00				\$116.26

JOB #18 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT MCM 21 PIN CONNECTOR IS BROKEN- REPLACE

CAUSE BROKEN

CORRECTION RE-PIN NEW CONNECTOR.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.00	LABOR 99-0	MCM 21 PIN CONNECTOR IS BROKEN- REPLACE		159.50
1.00	108D/23-13149-029	PLUG 21CAV MCP2 8S AI BK SEAL	27.96	27.96
4.00	108D/TYC DCT110HIR	TIE STRAP	2.18	8.72
Prepay: \$0.00 Parts: \$36.68 Labor: \$159.50 Misc: \$0.00 Sublet: \$0.00				\$196.18



Sold Operations (Cont.)

JOB #19 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT REAR ENGINE MOUNTS ARE SPLIT
 CAUSE DAMAGE
 CORRECTION REMOVED OLD MOUNTS AND HARDWARE, REPLACED WITH NEW MOUNTS AND NEW HARDWARE. TORQUED TO SPEC ACCORDING TO WORK SHOP MANUAL. ALSO INSTALLED NEW FRONT MOUNT AND ADDED A MISSING BOLT FROM CRUSH ROD IN FRONT CROSS MEMEBER.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
2.00	108T/ATN-M46852K	REAR MOTOR MOUNT	145.23	290.46
2.50	LABOR 068	REAR ENGINE MOUNTS ARE SPLIT		398.75
1.00	108D/01-33963-000	ISOLATOR-ASY,ENG,FRONT UPPER	55.42	55.42
1.00	108D/01-33964-000	ISOLATOR-ASY,ENG,FRONT LOWER	44.30	44.30

Prepay: \$0.00 Parts: \$390.18 Labor: \$398.75 Misc: \$0.00 Sublet: \$0.00 \$788.93

JOB #20 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT CLUTCH BRAKE TABS ARE BROKEN- REPLACE - ABLE TO DO ON REBUILD LINE
 CAUSE REPLACE
 CORRECTION COMPLETED ON JOB #1.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.00	108D/BAC SB200	BRAKE KIT, CLUTCH	43.04	43.04

Prepay: \$0.00 Parts: \$43.04 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00 \$43.04

JOB #21 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT AC COMPRESSOR BEARINGS ARE GONE- REPLACE COMPRESSOR AND DRYER, TEST SYSTEM - ABLE TO DO ON MAIN REBUILD LINE
 CAUSE DAMAGED
 CORRECTION COMPLETED ON JOB#1.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.00	LABOR 028	AC COMPRESSOR BEARINGS ARE GONE- REPLACE CO		0.00
1.00	108D/ABP N83 2020 21031	COMP 10S15C 163MM PV8 12V	310.49	310.49
1.00	108D/ABP N83 319015	RECEIVER DRIER *D	57.08	57.08
4.00	108D/23-13202-000	SEAL-MINI STAT-O-SEAL PLUS 8	5.14	20.56
2.00	108D/23-13203-000	SEAL-MINI STAT-O-SEAL PLUS 10	5.40	10.80
4.00	108X/MWS-R134A	FREON,R134A	19.00	76.00

Prepay: \$0.00 Parts: \$474.93 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00 \$474.93

JOB #23 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT REPLACE INJECTION PUMP
 CAUSE DAMAGED
 CORRECTION COMPLETED ON JOB#1.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.00	108D/DDE RA4700902150	HIGH PRESSURE FUEL PUMP DD13	1,657.61	1,657.61
1.00	108D/DDE RA4700902150-CORE	HIGH PRESSURE FUEL PUMP DD13	568.75	568.75
-1.00	108D/DDE RA4700902150-CORE	HIGH PRESSURE FUEL PUMP DD13	568.75	-568.75

Prepay: \$0.00 Parts: \$1,657.61 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00 \$1,657.61



SERVICE INVOICE: R108004913:01

ESTIMATE: E108001231

Sold Operations (Cont.)

JOB #25 101 ENGINE REPAIRS

COMPLAINT SWAP REAR STRUCTURE FROM CORE ENGINE WITH CUSTOMER SUPPLIED PART
 CAUSE
 CORRECTION REPLACED REAR STRUCTURE FROM CORE ENGINE WITH CUSTOMER SUPPLIED PART

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.00	LABOR 101	SWAP REAR STRUCTURE FROM CORE ENGINE WITH C		159.50
Prepay: \$0.00 Parts: \$0.00 Labor: \$159.50 Misc: \$0.00 Sublet: \$0.00				\$159.50

JOB #26 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT BROKEN BOLTS ON FENDERS
 CAUSE DAMAGE
 CORRECTION DRILL NEW HOLES AND INSTALLED FENDERS.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.00	LABOR 99-0	BROKEN BOLTS ON FENDERS		159.50
Prepay: \$0.00 Parts: \$0.00 Labor: \$159.50 Misc: \$0.00 Sublet: \$0.00				\$159.50

JOB #29 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT REPLACE LEAKING HARD COOLANT LINE
 CAUSE LEAKING
 CORRECTION DRAINED COOLANT, REMOVED INTAKE AND REMOVED THE BAD LINE. INSTALLED NEW LINE AND FILLED UNIT WITH COOLANT.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
2.50	LABOR 234-7075A	TIME TO REPLACE THE PLASTIC DEF COOLANT LINES		398.75
1.00	108D/DDE A4722002452	TUBE - COOLANT, AIR COMPRESSOR	32.34	32.34
Prepay: \$0.00 Parts: \$32.34 Labor: \$398.75 Misc: \$0.00 Sublet: \$0.00				\$431.09

JOB #30 ASR ADDITIONAL SERVICE REQUEST

COMPLAINT ADJUST CLUTCH LINKAGE TO PROPER FREE PLAY
 CAUSE OUT OF ADJUSTMENT
 CORRECTION ADJUSTED CLUCH LINKAGE, GOOD.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.00	LABOR 25-2	SET CLUTCH		159.50
Prepay: \$0.00 Parts: \$0.00 Labor: \$159.50 Misc: \$0.00 Sublet: \$0.00				\$159.50

JOB #31 90026 PARTS OVER THE COUNTER

COMPLAINT PARTS OVER THE COUNTER
 CAUSE
 CORRECTION

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
2.00	108D/OWI AMAC53	ALLIANCE OAT ELC 50/50	14.00	28.00
Prepay: \$0.00 Parts: \$28.00 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00				\$28.00

Sold Operations Totals		Prepay: \$0.00	Parts: \$40,494.99	Labor: \$12,472.90	Misc: \$5.00	Sublet: \$0.00	\$52,972.89
-------------------------------	--	----------------	--------------------	--------------------	--------------	----------------	--------------------



SERVICE INVOICE: R108004913:01

ESTIMATE: E108001231

INVOICE REPRINT

Authorization of Repairs & Warranty

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees' permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. The dealership is not responsible for damages from freezing due to lack of antifreeze.

I agree that any warranty coverage noted on this statement of account is based solely on New West Truck Centres estimate of warranty coverage and that I remain responsible for any portion of the charges incurred which is shown as being covered by warranty if the warranty coverage is not accepted by the manufacturer and I agree that such rejected amount should be charged to my account and that I will promptly pay such amount.

	ESTIMATED	BILLED
LABOR		\$12,472.90
PARTS		\$40,494.99
MISC		\$5.00
SUBLET		\$0.00
DEPOSIT		\$0.00
SUBTOTAL		\$52,972.89
SHOP SUPPLIES		\$500.00
MISC SUPPLIES		\$0.00
TAX		\$2,673.64
TOTAL		\$56,146.53

PRINTED NAME _____

SIGNATURE _____

Pre-Work Disclaimer

I agree to receive New West Truck Centres newsletter containing news, updates and promotions regarding New West Truck Centres products. You can withdraw your consent at any time. Please refer to our Privacy Policy or contact us for more details.

X _____

Emissions Disclaimer

I agree this vehicle emissions system has not been defeated, modified or deleted. New West Truck Centres assumes no responsibility for damage to any aftermarket or modified component as a result of our diagnostics or repairs. Do you authorize New West Truck Centres to undertake any no charge outstanding recalls, field service modifications or campaigns recommended by the manufacturer to the chassis or engine.

X _____

Please Remit Payment To:

NEW WEST FREIGHTLINER INC.

5925 79 Ave. SE

Calgary, AB T2C 5K3

GST#: 100731173