

PREMIUM TRUCK & TRAILER INC.

K26-4
JUN



<input type="checkbox"/> Branch 1 1015 GREAT STREET PRINCE GEORGE, BC V2N 2K8 Ph: (250) 563-0696 Fax: (250) 563-0526	<input type="checkbox"/> Branch 2 4600 COLLIER PLACE WILLIAMS LAKE, BC V2G 5E9 Ph: (250) 398-7411 Fax: (250) 398-7414	<input checked="" type="checkbox"/> Branch 3 #5-1340 STEVENS RD KELOWNA, BC V1Z 1G2 Ph: (250) 769-7255 Fax: (250) 769-3032	<input type="checkbox"/> Branch 4 5408 HWY 16 WEST TERRACE, BC V8G 0C6 Ph: (250) 635-4938 Fax: (250) 635-9535	<input type="checkbox"/> Branch 5 1875 KRYCZKA PL KAMLOOPS, BC V1S 1S4 Ph: (250) 374-3100 Fax: (250) 374-0631
---	--	---	--	--

BILL TO
REMCAN PROJECTS LIMITED PARTNERSHIP

DELIVER TO
REMCAN PROJECTS LIMITED PARTNERSHIP -

P:
F:

P:
F:

SERVICE INVOICE: R103006707:01

DATE ARRIVED	DATE INVOICE	SALES TYPE	ADVISOR	TERMS	CUSTOMER REFERENCE
Jan-06-2020	Feb-28-2020	SRET	YALE	NET30	BP13844

YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT #	ENGINE HOURS	IN SERVICE	Component Serial #	ODOMETER
2012	FREIGHTLINER	M2	1FVPC7DV5CDBH5512	TRK-043	0	4/13/2012	471913S0082158	496690

Sold Operations

JOB #1 01 ENGINE

COMPLAINT PERFORM 3/4 ENGINE RE-BUILD

CAUSE

CORRECTION *****NEW ENGINE SN 471903R1104687*****

REMOVED HOOD, RAD ASSEMBLY AND SUPPORTS.
 REMOVED ENGINE FROM UNIT AND SUPPORTS.
 SWAPPED OVER COMPONENTS FROM OLD ENGINE TO NEW 3/4 ENGINE.
 INSTALLED NEW INJECTOR HARNESS FAN BELTS AND TENSIONERS
 INSTALL REPLACEMENT ENGINE IN TRUCK AND REASSEMBLED.
 PERFORMED PARKED REGEN AND MONITERED FOR LEAKS. GOOD..
 PERFORMED EXTENSIVE ROAD TEST AND CHECKED FOR LEAKS.
 FOUND ALL GOOD.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 01-10	ENGINE - TRUCK		
1	103C/4988280	GASKET, HYDRAULIC PUMP		
1	103D/23-12485-250	CLAMP-CONSTANT TORQUE, HOSE, 2 9		
2	103D/23-13202-000	SEAL-MINI STAT-O-SEAL PLUS 8		
2	103D/23-13204-000	SEAL-MINI STAT-O-SEAL PLUS 12		
1	103D/BRZ B9224 0425FRU	CLAMP-HD SPRING T BOLT, HOSE, 4.		
1	103D/DDE A0000701632	HPF LINE KIT		
2	103D/DDE A0019950502	PIPE CLAMP		
4	103D/DDE A0029905054	HEX NUT		
4	103D/DDE A0029906714	STUD		
1	103D/DDE A0060705101	OIL SEAL KIT		
3	103D/DDE A0179979545	O-RING		
1	103D/DDE A0189973145	O-RING, TURBO DRAIN PIPE DDE		
1	103D/DDE A0239977145	O-RING		
2	103D/DDE A4600980180	GASKET		
1	103D/DDE A4701340140	BRACKET		
1	103D/DDE A4710780280	GASKET		
1	103D/DDE A4710780380	GASKET		
1	103D/DDE A4710960380	METAL SEAL		
1	103D/DDE A4711400814	E/MFLD PARTS		

Sold Operations (Cont.)

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	103D/DDE A4711405675	EGR COOLER		
1	103D/DDE A4711420680	GASKET		
1	103D/DDE A4711508233	INJECTOR HARNESS,FRONT		
1	103D/DDE A4711508333	INJECTOR HARNESS,REAR		
1	103D/DDE A4712030680	SEAL		
1	103D/DDE A4712030780	SEAL		
1	103D/DDE A4712031180	SEAL		
1	103D/DDE A4720180180	SEAL		
1	103D/DDE A4720180780	SEAL,OIL SPINNER DDE		
6	103D/DDE A4720980080	SEAL		
1	103D/DDE A4720980180	SEAL		
1	103D/DDE A4721400548	CONN PIPE		
1	103D/DDE A4721841980	SEAL,OIL COOLER MOUNTING MODUL		
1	103D/DDE A4722000154	CONN PIPE		
1	103D/DDE A4722021219	GUIDE PULLEY		
1	103D/DDE A4729970245	O-RING		
1	103D/DDE A5411870080	GASKET,TURBO DRAIN DDE		
6	103D/DDE N000000001069	SEAL RING (20mm O.D. x 14mm I		
1	103D/DDE R23539389	3/4 ENG DD13 ENGINE		
1	103D/DDE R23539389-CORE	3/4 ENG DD13 ENGINE		
-1	103D/DDE R23539389-CORE	3/4 ENG DD13 ENGINE		
1	103D/DDE RA4710967999	REMAN DD13 TURBO-EPA10 COACH		
1	103D/DDE RA4710967999-CORE	REMAN DD13 TURBO-EPA10 COACH		
-1	103D/DDE RA4710967999-CORE	REMAN DD13 TURBO-EPA10 COACH		
100	103D/GRO 83 6021	TIE STRAP-11.75X.18,BLK,NYL *D		
30	103D/SLL 500010047	CK4 10W30 T5 BULK		
2	103D/SLL 550045139	10W30 ROTELLA T4 - 5LT		
1	103D/TCX AMS014AM	CLAMP KIT-SLIP,4IN		
1	103D/TCX T130130349AB2	CLAMP,4 INCH SPHERICAL		
6	103X/LAW88718	CLAMP SILICONE #10 (10)		
14	103X/REC16-324	(YELLOW)MIXED FLEET 50/50ELC		
1	103X/RJWA4722020319	GUIDE PULLEY		
1	EFTR>7	FILTER >7"		
2	EHC5L	5LTR + FLUID		
30	EHCBLK	BULK OIL		

Sold Operations (Cont.)

JOB #2 25 CLUTCH

COMPLAINT REPLACE CLUTCH WHILE ENGINE CHECK CROSS SHAFTS ETC
CAUSE

CORRECTION INSPECTED CLUTCH
FOUND BROKEN SPRING, CLUTCH BUTTONS KEYSTONE WORN OUT, RELEASE FORK BUSHINGS AND INPUT SHAFT HAS WEAR AND THE CLUTCH BRAKE IS COMPLETELY WORN.
TRIED TO REMOVE FRONT INPUT COVER BUT COULDN'T GET THE INPUT SHAFT COVER OFF.
HAD TO REMOVE CLUTCH HOUSING,
REMOVED COVER AND INPUT SHAFT BEARING AND INPUT SHAFT,
INSTALLED NEW SHAFT, BEARING AND REINSTALLED CLUTCH HOUSING AND GASKET,
INSTALLED NEW CLUTCH AND PILOT BEARING INTO FLYWHEEL.
INSTALLED NEW GREASE WHIP.
FLYWHEEL NEW ON ENGINE NO RESURFACING NEEDED.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	103D/02-12176-000	BEARING-PILOT,72 X 30 X 19MM		
1	103D/FUL A7786	ASSY-YOKE-CLUTCH RELEASE *D		
1	103D/FUL K2468	CLUTCH INST KIT *D		
1	103D/SP 309701 82	CLUTCH-ADVANTAGE SELFADJUST *D		
1	103X/868-2-1/2A	CONNECTOR 5/32TX1/8NPT		
1	103X/NAP79082	12" GREASE WHIP		
	LABOR 26-10	CLUTCH AND INPUT SHAFT		

Parts: \$1 Labor: \$ Misc: \$0.00 Sublet: \$0.00

JOB #3 01 ENGINE

COMPLAINT PRESS WASH ENGINE
CAUSE

CORRECTION STEAMED ENGINE AND FRAME .

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 01-10	PRESS WASH ENGINE		

JOB #5 01 ENGINE

COMPLAINT INSPECT ENGINE MOUNTS AND ESTIMATE IF NEEDED
CAUSE

CORRECTION FOUND OLD MOTOR MOUNTS RUBBER CRACKED INSIDE. REMOVED AND REPLACED MOTOR MOUNTS WITH NEW.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 01-10	ENGINE - TRUCK		
2	103X/ATMM46852	MOTOR MOUNT REAR		
4	103X/LAW80933	5/8 STOVER LOCK NUT (25)		
4	103X/LAWFA68106	5/8X4 GR8 SCREW (10)		
2	103X/LAWFA68261	1/2X1-1/4 HEXCAP SCREW GR8		
4	103X/LAWFA88439	1/2 FLAT WASHER G-8 (100)		

Parts: \$ Labor Misc: \$0.00 Sublet: \$0.00

Sold Operations (Cont.)

JOB #6 42 BRAKES

COMPLAINT REMOVE AND REPLACE TREADLE VALVE

CAUSE

CORRECTION TREDLE VALVE EXHAUST PORT MISSING AND RUBBER SEAL WAS CONTAMINATED INSIDE.
REMOVED AIR LINES AND TREDLE VALVE. SWAPPED OVER FITTING AND INSTALLED NEW VALVE.
TEST OPERATION AND FOUND GOOD.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	103D/BW OR286171	E - 6 BRAKE VALVE DUAL *D		
1	103X/103-A	FTG		
1	103X/103-B	FTG		
1	103X/1460-4	SLEEVE		
1	103X/1461-4	BRASS NUT		
1	103X/1468-4A	BRASS ELBOW		
1	103X/1468-4B	BRASS CONNECTOR		
1	103X/1469-6C	BRASS ELBOW 90		
1	103X/1472-6B	TEE		
4	103X/1485-4-REEL	TUBING, 1/4" AIR BRAKE BY FT		
	LABOR 42-10	REMOVE AND REPLACE TREADLE VALVE		

JOB #7 01 ENGINE

COMPLAINT REPLACE HEATER CORE

CAUSE

CORRECTION FOUND HEATER CORE LEAKING,
HAD TO CUT OUT COVER AND REMOVE DASH PANELS ,
SERVERAL HOLES WERE ALREADY BROKEN ON THE DASH,
REMOVED AND INSTALLED NEW HEATER CORE .
INSTALLED NEW COVER AND MOUNTING BOLTS

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 01-10	REPLACE HEATER CORE		
1	103D/A05-29155-000	PIPE-HEATER MANIFOLD,M2,112V,D		
1	103D/VCC T1001837R	HEATER CORE AY SERVICE KIT		

\$

JOB #8 88 HOOD, GRILL & CAB FENDERS

COMPLAINT CHECK\REPLACE HOOD PIVOT BUSHINGS

CAUSE

CORRECTION FOUND HOOD PIVOT BUSHINGS WORN OUT. ONE BUSHING FELL OUT WHEN REMOVING THE HOOD.
REMOVED AND REPLACE FRONT HOOD BUSHINGS.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
2	103D/AUR VCW 8	END, ROD 1/2UNF - 2B RH	24.25	
	LABOR 88-10	HOOD, GRILL & CAB FENDERS - TRUCK		

0

Sold Operations (Cont.)

JOB #9 54 ELECTRICAL INSTUMENTS AND CONTROLS

COMPLAINT REPAIR FOR WINDSHIELD WIPER MOTOR INOP
 CAUSE
 CORRECTION FOUND WIPER MOTOR WASNT TURNING,
 CHECKED FOR POWER TO MOTOR, HAD POWER.
 REMOVED AND REPLACED MOTOR AND TESTED OPERATION. FOUND PASSENGER ARM SPLINES WERE
 STRIPPED.
 REPLACED THE ARM THEN ADJUSTED THE LINKAGE TO PROPER SWEEP.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	103D/A22-74082-001	ARM-WINDSHIELD WIPER,M2,RH	39.04	
1	103D/TRI F98999 831	MOTOR	97.96	
	LABOR 54-10	ELECTRICAL INSTUMENTS AND CONTROLS - TRUCK		

Parts: \$137.00 Labor: \$289.80 Misc: \$0.00 Sublet: \$0.00

JOB #11 00 GENERAL INFORMATION

COMPLAINT CHECK FOR AIR LEAK
 CAUSE
 CORRECTION DURING TESTING, FOUND THE UNIT HAD AN AUDIBLE AIR LEAK. SOAPED DOWN UNIT AND TIGHTEND
 FITTINGS. FOUND DRAIN VALVE AT SECONDARY TANK LEAKING. REMOVED AND REPLACED AIR VALVE.
 FOUND NO FURTHER LEAKS.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 00-10	CHECK FOR AIR LEAK		
1	103D/TDA R95512105N	DRAIN VALVE *D	13.86	

Parts: \$13.86 Labor: \$172.50 Misc: \$0.00 Sublet: \$0.00 \$

JOB #12 00 GENERAL INFORMATION

COMPLAINT Detailed interior -as per Troy
 CAUSE
 CORRECTION

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	S-LABR	Interior Detail		

JOB #13 13 AIR COMPRESSOR

COMPLAINT CHECK REPAIR FOR AIR COMPRESSOR LEAKING OIL AND NOISY
 CAUSE
 CORRECTION FOUND AIR COMPRESSOR SLOW TO BUILD AIR AND LEAKING OIL. OUTSIDE OF COMPRESSOR LOOKED LIKE
 IT WAS VERY HOT REMOVE AND INSPECTED COMPRESSOR. FOUND A LOT OF WEAR. OBTAINED AUTH TO
 REPLACE WITH NEW
 SWAPPED FITTING OVER TO NEW COMPRESSOR AND INSTALL ON UNIT.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	103D/DDE EA4711303615	AIR COMP ASM		
1	103D/DDE EA4711303615-CORE	AIR COMP ASM		
-1	103D/DDE EA4711303615-CORE	AIR COMP ASM		
	LABOR 13-10	AIR COMPRESSOR - TRUCK		

Parts: \$ Labor: \$ Misc: \$0.00 Sublet: \$0.00

Sold Operations (Cont.)

JOB #14 20 ENGINE COOLING SYSTEM, RADIATOR

COMPLAINT REPLACE HOSES AND WORN COMPONENTS

CAUSE

CORRECTION REMOVED AND REPLACED SEVERAL COOLANT LINES AND PIPES THAT WERE GETTING BRITTLE.

REMOVED AND REPLACED AIR FILTER ASSEMBLY

REPLACED PTO SWITCH.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 01-10	ENGINE - TRUCK		
1	103D/01-32733-057	BELT-FAN DRIVE,10 RIB,2057MM,H		
1	103D/05-28601-000	HOSE-HEATER,SUPPLY,DD13,M2,112		
1	103D/05-28602-000	HOSE-HEATER,RETURN,DD13,M2,112		
1	103D/23-09528-062	CLAMP-SUPPORT,1.125 ID		
1	103D/BUS B174 1137 20R0	COVER-CHASSIS,PDM,ETCHED		
1	103D/DDE A0000905151	KIT - FILTER INSERT		
1	103D/DDE A0081530128	TEMP. SENSOR		
1	103D/DDE A4712000352	COOLANT LINE		
1	103D/DDE A4712002152	CLNT LINE		
1	103D/DDE A4719935596	V-RIBBED BELT		
1	103D/DDE A4721530759	VALVE,ENGINE BRAKE SOLENOID		
1	103D/DDE A4722000040	BRACKET KIT		
1	103D/DDE A4722000252	COOLANT LINE		
1	103D/DDE A4722020319	IDLER PULLEY		
1	103D/DDE A4722030315	PIPE		
1	103D/DDE A4729970353	HOSE		
1	103D/DDE A4729970453	HOSE		
1	103D/DN P607965	ELEMENT, FILTER, ENGINE AIR *D		
4	103D/GRO 83 8003	TUBING-SPLIT FLEX,1/4IN,50F *D		
4	103D/PLC 194NACP	MINIATURE BULB BOXED		
2	103D/TCX AMS012	GASKET-4 INCH SPHERICAL W/TABS		
2	103X/56-8	CAP, JIC		
2	103X/58-8	PLUG, JIC		
1	103X/COA30TK4123	PTO SWITCH		
2	103X/LAW88725	2-9/16 - 3-1/2 HOSE CLAMP (10)		
2	103X/LFSCCP10X1.5X50	METRIC ALLEN HEAD CAPSCREW		
	LABOR 20-10	ENGINE COOLING SYSTEM, RADIATOR - TRUCK		
1	P-FRT	Parts Freight, A0000701632		

Sold Operations Totals

Parts Labor Misc: \$30.03 Sublet: \$0.00

\$

Disclaimer of Warranties: Any warranties on the products sold hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty or merchantability or fitness for a particular purpose, and Premium Truck & Trailer Inc., neither assumes nor authorizes any other person to assume for it liability in connection with the sale of said products.

Terms: Due end of month following, 2% service charge per month on past due accounts. All claims and returned goods must be accompanied by this invoice. No returns on electrical or special order parts. No returns after 30 days. 15% re-stock charge on all returned parts. I hereby grant Premium Truck & Trailer Inc. a security interest over all my present and after acquired personal property as security for any amount due to it under this contract for any repair work, or parts purchased, including interest and collection expenses.

I hereby acknowledge my indebtedness to Premium Truck & Trailer Inc. in the amount shown on this invoice for goods and/or services requested by me.

	ESTIMATED	BILLED
LABOR		
PARTS		
MISC CHG		
SUBLET		\$0.00
SUBTOTAL		
SHOP SUPPLIES		\$250.00
GST		
PST		
TOTAL		\$
TOTAL w/ EST.		

Please Remit Payment to:
Premium Truck & Trailer Inc.
 1015 Great Street
 Prince George BC V2N 2K8

AUTHORIZED BY _____

DATE _____