



IRON 5 Equipment & Repair Ltd.
(587) 402-6665
service@iron5.ca
1403 6 Street, Nisku, AB, Canada, T9E 7M7
Company Business/GST number:793589235RT0001

Invoice # 1200
Against Estimate#: 10242
Created: Oct 2, 2025
Invoiced: Oct 16, 2025
Service Advisor: Scott Hutton

Racuda Logistics Inc.
(306) 270-8506
racudalogistics@gmail.com
209 Augusta Blvd E., Warman, SK, Canada, S0K 4S1

T880
VIN: 1XKZD40X1HJ988822
Mileage: 0
License Plate:

536-1

Customer Concern #1

CVIP
Troubleshoot injectors

CVIP - Truck Inspection (1-3 Axles)

Authorized

Service Notes: Complete Cvip And Torque Wheels To 500 Ftlbs.

Item	Name	Description	Disc./Fees	Subtotal
1	CVIP - Truck Inspection (1-3 Axles)		\$0.00	\$700.00
			Amount: \$700.00	Subtotal: \$700.00
			Disc: \$0.00	

Diagnose Engine Codes

Authorized

Service Notes: Found Red Code 4726 Spn 1239 Fmi 16 Engine Fuel Leakage Valid Above Normal Operating Range. Try Doing A Fuel Injector Load Test Run Engine To Proper Parameters , Test Stops And Says The Parameters Not Met . Try Erasing Still There. Hook Up The Lap Top Scan No Fuel Code With Cummings Insite Try To Check Fuel Pressure Same Effect. There Is An Red Code 687 Spn 103 Fmi 1 Low Turbocharger Speed Valid But Below Normal Operation That Keeps Coming Back As Well As A Few Others. Do Some Research For The Turbo Speed Sensor , Inspect Sensor Wire And Find Oil In The Connector Clean Test Same Thing, Cut Zip Ties Inspect Wire And Find A Break. Order New Sensor Install. Test Fault For Turbo Goes Away Erase Codes Engine Light Doesn't Come Back On. Drive Around Block Shut Off, Restart Ok

Item	Name	Description	Price x Qty / Hrs	Amount	Disc./Fees	Subtotal
1	Standard Labour Rate - Shop		\$160.00 x 2.5	\$400.00		\$400.00
2	Sensor		\$726.82 x 2	\$1,453.64		\$1,453.64
			Amount: \$1,853.64		Disc: \$0.00	Subtotal: \$1,853.64

CVI - Reverse lights do not work.

Authorized

Service Notes: 1 HOUR TO DIAG, REPAIRS TBD

Checked Lights No Power. Inspected Wiring Ok. Checked Switch Ok . Found Connection At Rear , Got A Signal Put Back Together And No Wire Going To Reverse Lights . Jump Wires And Make Sure Signal Is Going To Lights , Take A Part Plug And De-Pin And Move Wire To Proper Location, Test. Ok

Item	Name	Description	Price x Qty / Hrs	Amount	Disc./Fees	Subtotal
1	Standard Labour Rate - Shop		\$160.00 x 1.5	\$240.00		\$240.00
			Amount: \$240.00		Disc: \$0.00	Subtotal: \$240.00



IRON 5 Equipment & Repair Ltd.
(587) 402-6665
service@iron5.ca
1403 6 Street, Nisku, AB, Canada, T9E 7M7
Company Business/GST number:793589235RT0001

Invoice # 1200
Against Estimate#: 10242
Created: Oct 2, 2025
Invoiced: Oct 16, 2025
Service Advisor: Scott Hutton

CVI - Emergency shut off is not working.

Authorized

Service Notes: 1 HOUR TO DIAG, REPAIRS TBD

Un Able To Get To Program Remove And Put In Dash.

Item	Name	Description	Price x Qty / Hrs	Amount	Disc./Fees	Subtotal
1	Standard Labour Rate - Shop		\$160.00 x 1	\$160.00		\$160.00
				Amount: \$160.00	Disc: \$0.00	Subtotal: \$160.00

CVI - D/S and P/S Mirror is cracked.

Authorized

Service Notes: Replace Left Side Upper Mirror.
Replace Right Side Lower Convex Mirror.

Item	Name	Description	Price x Qty / Hrs	Amount	Disc./Fees	Subtotal
1	Standard Labour Rate - Shop		\$160.00 x 2	\$320.00		\$320.00
2	GLASS UPPER MAIN	154810011	\$453.69 x 1	\$453.69		\$453.69
3	GLASS LOWER CONVEX	154810012	\$453.69 x 1	\$453.69		\$453.69
				Amount: \$1,227.38	Disc: \$0.00	Subtotal: \$1,227.38

CVI - P/S and D/S Axle 2 Air bags are leaking.

Authorized

Service Notes: REMOVE AIR BAG, CLEAN AREA, INSTALL NEW AIR BAG, TEST FUNCTION.
Remove Air Bag And Connection Is Very Corroded Have To Free Up Fittings On End Of Hose And Clean Threads With Thread Fil
e Install New Air Bags Test .Ok

Item	Name	Description	Price x Qty / Hrs	Amount	Disc./Fees	Subtotal
1	Standard Labour Rate - Shop		\$160.00 x 2	\$320.00		\$320.00
2	AIRBAG	AS95410	\$261.13 x 2	\$522.26		\$522.26
				Amount: \$842.26	Disc: \$0.00	Subtotal: \$842.26

CVI - P/S and D/S Axle 2 Guides are missing.

Authorized

Service Notes: Install Guides With New Hardware.

Item	Name	Description	Price x Qty / Hrs	Amount	Disc./Fees	Subtotal
1	Standard Labour Rate - Shop		\$160.00 x 1	\$160.00		\$160.00
2	GUIDES STOP-REAR	C83-1055	\$342.34 x 2	\$684.68		\$684.68
				Amount: \$844.68	Disc: \$0.00	Subtotal: \$844.68



IRON 5 Equipment & Repair Ltd.
(587) 402-6665
service@iron5.ca
1403 6 Street, Nisku, AB, Canada, T9E 7M7
Company Business/GST number:793589235RT0001

Invoice # 1200
Against Estimate#: 10242
Created: Oct 2, 2025
Invoiced: Oct 16, 2025
Service Advisor: Scott Hutton

CVI - P/S and D/S Axle 2 Backing plates are missing.

Authorized

Service Notes: REMOVED DAMAGED COMPONENTS. CLEAN AND PREP AREA, INSTALL NEW BACKING PLATES.

Item	Name	Description	Price x Qty / Hrs	Amount	Disc./Fees	Subtotal
1	Standard Labour Rate - Shop		\$160.00 x 2	\$320.00		\$320.00
2	BACKINGPLATE KIT	K088118KBXW	\$260.21 x 2	\$520.42		\$520.42
				Amount: \$840.42	Disc: \$0.00	Subtotal: \$840.42

CVI - Clutch Needs to be Adjusted.

Authorized

Service Notes: ADJUST CLUTCH AND TEST Adjusted Ok

Item	Name	Description	Price x Qty / Hrs	Amount	Disc./Fees	Subtotal
1	Standard Labour Rate - Shop		\$160.00 x 0.5	\$80.00		\$80.00
				Amount: \$80.00	Disc: \$0.00	Subtotal: \$80.00

CVI - No stop electric Signal from rear cable.

Authorized

Service Notes: 1 HOUR TO DIAG, REPAIRS TBD
Found Fuse Is Blowing. Found Rubbed Wire In Harness , Repair Ok

Item	Name	Description	Price x Qty / Hrs	Amount	Disc./Fees	Subtotal
1	Standard Labour Rate - Shop		\$160.00 x 2	\$320.00		\$320.00
				Amount: \$320.00	Disc: \$0.00	Subtotal: \$320.00

Thank you for your business. The work is complete and your payment is due upon pickup of the vehicle. Mechanics liens may be placed on vehicles until repairs are paid for in full. Please contact us promptly if you have any questions about anything we did.

Service Amount	\$7,108.38
Part	\$4,088.38
Labor	\$3,020.00
Add: Fees	\$151.00
Shop supplies	\$151.00
Subtotal	\$7,259.38
Passsthrough Taxes	\$0.00
Sales Taxes (GST - 5%)	\$362.95
Invoice Total	\$7,622.33
Paid to date	\$0.00
Remaining Balance	\$7,622.33

Signature: