

Equipment

Carlton 2015 wood chipper

Client remarks:

- Wood chipper is not chipping well and doesn't throw product.
- Also client said brakes don't work

Inspection:

- Found wore out anvil
- Large hole and damaged belly pan.
- Main drum was missing 1/2 its air fins.
- Brake drums cracked and sized solid

Repair:

- Removed old anvil and replaced with new anvil.
- Removed drive belt cover
- Remove Drive belt
- Removed belt pulleys and keyway
- Removed upper infeed roller, upper shoot, main drum cover, main bearings
- Hoisted out drum for repair
- Welded and repaired belly pan hole well drum was removed
- Cut and welded new air fins on drum

- Checked wires and found broken wires in harness. Repaired wires and tested light.
- replaced broken lights and tested brakes (failed brakes)
- Jacked up unit and removed wheels
- Removed drums and failed brake assembly.
- Replaced full brake assembly with new
- Installed drums and wheels.
- tested brakes and confirmed working properly

Repair:

- Removed old anvil and replaced with new anvil.
- Removed drive belt cover
- Remove Drive belt
- Removed belt pulleys and keyway
- Removed upper infeed roller, upper shoot, main drum cover, main bearings
- Hoisted out drum for repair
- Welded and repaired belly ban hole well drum was removed
- Cut and welded new air fins on drum

- Checked wires and found broken wires in harness. Repaired wires and tested light.
- replaced broken lights and tested brakes (failed brakes)
- Jacked up unit and removed wheels
- Removed drums and failed brake assembly.
- Replaced full brake assembly with new
- Installed drums and wheels.
- tested brakes and confirmed working properly

Parts:

-\$1829.90

Labour:

\$110× 46= \$5060

QTY.	UNIT PRICE	TOTAL
1	\$6,889.90	\$6,889.90

Equipment

Installs Repair steps: