

H09-15
BLUE-MAR

CUSTOMER #:

209890



Mercedes-Benz
Edmonton West

TERRA PRO

53345 RR 232

SHERWOOD PARK, AB T8A 4V2

HOME: 780-819-4113 CONT: 780-819-4113

BUS: CELL: 780-819-4113

INVOICE

PAGE 1

17407 - 111 Avenue, Edmonton, AB T5S 0A1

Tel.: 780-484-9000 Fax: 780-484-8827

www.mbedmontonwest.com

GST: 80568 6961 RT 0001

SERVICE ADVISOR: 496 COLTON PHILLIPS

COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	KILOMETERS IN/ OUT	TAG	
	15	MERCEDES 2C144-4	WD3CE7CC2FP169735	BMJ-2639	98421/98423	T1181	
IN SVC DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
26JUN15 IS							
26JUN15 DD	25JUN15	26JUN2019	17:00 11JUL24	23245		CASH	12JUL24
R.O. OPENED		READY		OPTIONS: DLR:00741 ENG:64289641729838			
11JUL24		12JUL24		TRN:72268320190477 1)WD3 906633 1P 169735			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CUSTOMER REPORTS STARTS REMAINING LIGHT IS ON, PLEASE CHECK AND

ADVISE. QUOTED \$200-400 DIAGNOSIS

100 DIAGNOSIS

430 CV

97.00 97.00

100 REPLACE AD BLUE LINE

430 CV

659.60 659.60

1 906-470-16-00-64 ADDITIVE LINE

185.08 185.08 185.08

1 168-545-27-28-64 PIN BUSHING

8.12 8.12 8.12

2 000-540-40-05 CABLE HARNESS

19.52 19.52 39.04

PARTS: 232.24 LABOR: 756.60 OTHER: 0.00 TOTAL LINE A: 988.84

Inspected and confirmed "1 Start remaining" is displayed in the instrument cluster and the check engine lamp is on. Connected battery charger, XENTRY and performed quick test. "P20E800 The pressure in the AdBlue~ system is too low. The self-test was not OK", "P20E823 The pressure in the AdBlue~ system is too low. Pressure buildup is not possible in the system" and "P13DF00 The AdBlue~ system has a malfunction" are set in the SCR control unit. Pressure tested the system and inspected for leaks, found the AdBlue feed line is leaking and requires replacement. Also requires a new connector housing and repair terminals due to corrosion in the connector. Removed the right front inner fender liners. Removed and replaced the AdBlue feed line. Removed the corroded connector and wiring. Installed new wiring terminals and connector housing. Refit the inner fender liners. Reset the starts remaining message and cleared all fault codes. Pressure tested the AdBlue system, no leaks detected. Performed test drive, no warning messages or fault codes returning.

B 0797097~2021120015 - NC342154X4 (C) - MY15 906 4X4 BLUETEC II FIELD

MEASURE CANADA~~Campaign~

CAUSE: AS PER MB FM #2021120015

021212 PERFORM FIELD MEASURE WORK INSTRUCTIONS

430 WV

(N/C)

490000 REMOVE SEIZED NOX SENSOR

430 WV

(N/C)

EXCLUSION OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The above purchaser understands and agrees that dealer makes no warranties of any kind, express or limited, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency or comfort.

I hereby authorize MB Edmonton West Ltd. to collect, use and disclose the personal information in this document in accordance with and for the purposes identified in MB Edmonton West Ltd. Privacy Policy, which purposes I acknowledge have been communicated to me.

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
G.S.T. / P.S.T.	
PLEASE PAY THIS AMOUNT	

CUSTOMER #:

209890


Mercedes-Benz
Edmonton West

INVOICE

TERRA PRO

53345 RR 232

SHERWOOD PARK, AB T8A 4V2

HOME: 780-819-4113 CONT: 780-819-4113

BUS:

CELL: 780-819-4113

PAGE 2

17407 - 111 Avenue, Edmonton, AB T5S 0A1

Tel.: 780-484-9000 Fax: 780-484-8827

www.mbedmontonwest.com

GST: 80568 6961 RT 0001

SERVICE ADVISOR: 496 COLTON PHILLIPS

CELL: 780-819-4113										SERVICE ADVISOR: 496 COLTON PHILLIPS										
COLOUR			YEAR		MAKE/MODEL				VIN				LICENSE		KILOMETERS IN/ OUT				TAG	
			15		MERCEDES 2C144-4				WD3CE7CC2FP169735				BMJ-2639		98421/98423				T1181	
IN SVC DATE			PROD. DATE		WARR. EXP.		PROMISED				PO NO.		RATE		PAYMENT		INV. DATE			
26JUN15 IS																				
26JUN15 DD			25JUN15		26JUN2019		17:00 11JUL24								CASH		12JUL24			
R.O. OPENED				READY				OPTIONS: DLR:00741 BKG:64289641729838												
11JUL24				12JUL24				TRN:72268320190477 1)WD3 906633 1P 169735												

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	642-905-19-00-85	TS	NOX SENSOR				(N/C)
			CORE CHARGE W				(N/C)
1	220-546-18-43	BRACKET					(N/C)
4	000-994-32-11	PIN LOCK					(N/C)
2	007-997-56-90	STRAP					(N/C)
4	000000-003477-64	NUT					(N/C)

FC: PART#: COUNT:

CLAIM TYPE:

AUTH CODE: 00797097

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: 0.00
 Connected battery charger and XENTRY. Performed quick test and pre-inspection. Removed the rear NOx sensor. Found the front NOx sensor is seized. Extra time required to removed the seized NOx sensor and repair the damaged threads. Installed new upstream and downstream NOx sensors. Connected battery charger and XENTRY. Performed exhaust after-treatment software upgrades and coding.

 C PERFORM QUALITY CONTROL CHECK AND INPUT TECH NOTES. PLEASE NOTE,
 QUOTES ARE VALID FOR 30 DAYS
 CAUSE: PERFORM QUALITY CONTROL CHECK AND INPUT TECH NOTES. PLEASE NOTE,
 QUOTES ARE VALID FOR 30 DAYS
 00TN PERFORM QUALITY CONTROL CHECK AND INPUT TECH
 NOTES. PLEASE NOTE, QUOTES ARE VALID FOR 30
 DAYS

430 CV 0.00 0.00
 PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE C: 0.00
 psiQC by 430. Verified VIN and mileage. Wheels torqued to 240Nm.
 Tire pressures set to 47/70psi. Coolant at -37C. Found the steering wheel is off center while on test drive and service overdue message is displayed. No history on file for vehicle, recommend a full vehicle inspection, major B service and a wheel alignment. May require additional service repairs.

EXCLUSION OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The above purchaser understands and agrees that dealer makes no warranties of any kind, express or limited, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency or comfort.

I hereby authorize MB Edmonton West Ltd. to collect, use and disclose the personal information in this document in accordance with and for the purposes identified in MB Edmonton West Ltd. Privacy Policy, which purposes I acknowledge have been communicated to me.

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
G.S.T. / P.S.T.	
PLEASE PAY THIS AMOUNT	

CUSTOMER #:

209890



Mercedes-Benz
Edmonton West

INVOICE

TERRA PRO

53345 RR 232

SHERWOOD PARK, AB T8A 4V2

HOME: 780-819-4113 CONT: 780-819-4113

BUS: CELL: 780-819-4113

PAGE 3

17407 - 111 Avenue, Edmonton, AB T5S 0A1

Tel.: 780-484-9000 · Fax: 780-484-8827

www.mbedmontonwest.com

GST: 80568 6961 RT 0001

SERVICE ADVISOR: 496 COLTON PHILLIPS

COLOUR		YEAR	MAKE/MODEL		VIN	LICENSE	KILOMETERS IN/ OUT		TAG
		15	MERCEDES 2C144-4		WD3CE7CC2FP169735	BMJ-2639	98421/98423		T1181
IN SVC DATE	PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE	
26JUN15 IS									
26JUN15 DD	25JUN15	26JUN2019	17:00 11JUL24				CASH	12JUL24	
R.O. OPENED		READY		OPTIONS: DLR:00741 ENG:64289641729838					
11JUL24		12JUL24		TRN:72268320190477 1)WD3 906633 1P 169735					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

PLEASE NOTE THAT DASH CAMERAS WILL BE
DISCONNECTED TO PROTECT THE PRIVACY OF ALL
GUESTS.
RETORQUE OF WHEELS RECOMMENDED AFTER ALL TIRE
SERVICES.

54.19

EXCLUSION OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The above purchaser understands and agrees that dealer makes no warranties of any kind, express or limited, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency or comfort.

I hereby authorize MB Edmonton West Ltd. to collect, use and disclose the personal information in this document in accordance with and for the purposes identified in MB Edmonton West Ltd. Privacy Policy, which purposes I acknowledge have been communicated to me.

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOUR AMOUNT	756.60
PARTS AMOUNT	232.24
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	95.00
TOTAL CHARGES	1083.84
LESS INSURANCE	0.00
G.S.T. / P.S.T.	54.19
PLEASE PAY THIS AMOUNT	1138.03



Euroservice Autohaus LTD
 14 ROWLAND CRES
 ST. ALBERT, AB T8N 4B3
 Tel: 780-459-0546 • Fax: 780-459-1352
 euroserviceautohaus@gmail.com

DEMO/SERVICE VAN LASER.

UNIT # 23245

Invoice I004235

Technician: Paul T
 Date: 02-15-2022 12:16 PM
 R/O: I004259

Customer

Vehicle 2015 Mercedes-Benz Sprinter 2500 Base
 3.0 DIESEL
 WD3CE7CC2FP169735

km In: 93,432
 km Out: 93,432
 License Plate: BMJ2639 AB

Work Performed

Labor

Labor	Tech	Hrs	Price	Total
CHECK FOR POWER STEERING SYSTEM IS NOISY:		0.60	130.00	78.00
-FOUND POWER STEERING PUMP IS LEAKING FROM THE SHAFT				
REPLACE POWER STEERING PUMP		3.00	130.00	390.00
REPLACE SERPENTINE BELT TENSIONER		1.00	130.00	130.00

Parts	Part No	Qty	Price	Total
POWER STEERING FLUID	AAAQ 1 46 0001	1.00	25.00	25.00
POWER STEERING PUMP	AAA0003 466 93 01	1.00	455.00	455.00
BRAKE CLEAN	AAABC	2.00	6.00	12.00
BELT TENSIONER	AAA642 200 13 70	1.00	195.00	195.00

Total

Labor	SubTotal	\$1,285.00
Labor		598.00
Parts		687.00
Hazmat*		0.00
Supplies*		41.86
GST/HST		66.34
PST		0.00

Invoice Total \$1,393.20

* Shop Supply & Hazmat Fees: This charge represents costs and profits where applicable to this repair facility for miscellaneous shop supplies, and/or waste removal.

Date	Method	Reference	Amount
02-15-2022	VISA	Paid 2 15 2022	1,393.20
Payment Totals			1,393.20
Balance Due			0.00

Authorization

Original Estimate Total:
 Authorization Method: email text phone fax in person
 Date:
 Contact Details:
 Authorized By:

X

Customer Signature

Save replacement parts for inspection or return? (Core may apply) Yes No