



Brandt Tractor Ltd.  
101 Burnt Park Dr.  
Red Deer, AB  
T4P 0J7  
(403) 343-7557

Service  
Invoice



JOHN DEERE

208-7  
BILL-MAR

SOLD TO:

PIDHERNEY'S INC

S/N # 1FF300GXALF731578

INVOICE DATE	BRANCH	INVOICE NO.
31AUG22	105	1559479

PAGE
1
SALE TYPE
WARRANTY
CUSTOMER NO.
58453072

S PIDHERNEY'S INC  
H P.O. BOX 940  
I  
P  
T ROCKY MOUNTAIN HOUSE, AB  
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPAN
5675	403-845-3072	1559479	01	17AUG22	599
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	1522	MARVIN

DESCRIPTION	AMOUNT
<p>REPAIR LOW COOLING FAN SPEED.</p> <p>COMPLAINT: LOW COOLING FAN SPEED</p> <p>CAUSE: CAUSED BY SHORTED SENSOR</p> <p>CORRECTION: Checked SA5 remote for codes. Found 1631.01 - filled out service task assessment with tech and ordered potential parts Operated excavator until 1631.01 code active - code intermittent: Low Fan Speed. Fan speed reading 0 RPM. Checked wiring from speed sensor to ECM - good. Fan speed sensor shorted . Filled out STA. Removed 2 panels. Replaced fan speed sensor. Run excavator, fan speed never went to zero again. Installed lower panels. SGS *** DISREGUARD TIME FOR TECH 5102 CHARGED IN ERROR *** 2 N N131838 O-RING 1 N AT460574 SENSOR ** TOTAL LABOR ** CARBON TAX SURCHARGE</p> <p>&gt;&gt;--&gt; SEG# 01 PRT LAB MSC</p>	

<p>PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM). MINIMUM CHARGE OF \$1.50.</p> <p>I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.</p> <p>X _____ SIGNATURE</p> <p>_____ DATE</p>	<p>DESCRIPTION</p> <p>TOTAL PARTS</p> <p>TOTAL LABOR</p> <p>MISC. CHARGES</p> <p>SALES TAX</p> <p>PLEASE PAY THIS TOTAL → **CONTINUED**</p>
--	---

CUSTOMER COPY





Brandt Tractor Ltd.  
101 Burnt Park Dr.  
Red Deer, AB  
T4P 0J7  
(403) 343-7557

**Service  
Invoice**



**JOHN DEERE**

INVOICE DATE	BRANCH	INVOICE NO.
30NOV22	105	1560400

SOLD TO:

PIDHERNEY'S INC

S/N # 1FF300GXALF731578

PAGE
1
SALE TYPE
WARRANTY
CUSTOMER NO.
58453072

S PIDHERNEY'S INC  
H P.O. BOX 940  
P  
T ROCKY MOUNTAIN HOUSE, AB  
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
5675	403-845-3072	1560400	01	07NOV22	599
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	2064	MARVIN

DESCRIPTION	AMOUNT
REPAIR DEF TEMP HIGH CODE 4366.16  COMPLAINT: DTC 4366.16 DEF Tank Temperature Moderately High  CAUSE: CAUSED BY FAILED CONTROL VALVE  CORRECTION: Confirm presence of DTC 4366.16, found code to be active when engine is warmed up to operating temperature. Verify coolant control valve (Y5019) is connected, appears to be connected properly. Clear DTC. Check for battery voltage at coolant control valve solenoid plug, no volotage detected. With Ignition OFF, engine OFF, disconnect coolant supply and return lines from coolant control valve, blow air into supply port of control valve, air exhausts out of return line, indicating coolnat control valve is stuck in the open position. Complete service task hazard assessment. Remove failed coolant control valve. Install new coolant control valve,	

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM). MINIMUM CHARGE OF \$1.50.		QST # 1226957240	
I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.		DESCRIPTION	AMOUNT
X _____ SIGNATURE		TOTAL PARTS	
_____ DATE		TOTAL LABOR	
		MISC. CHARGES SALES TAX	
		PLEASE PAY THIS TOTAL	**CONTINUED**



Brandt Tractor Ltd.  
101 Burnt Park Dr.  
Red Deer, AB  
T4P 0J7  
(403) 343-7557

Service  
Invoice



INVOICE DATE	BRANCH	INVOICE NO.
30NOV22	105	1560400

SOLD TO:

PIDHERNEY'S INC

S/N # 1FF300GXALF731578

PAGE 2
SALE TYPE
WARRANTY CUSTOMER NO. 58453072

S  
H  
I  
P  
P  
I  
D  
H  
E  
R  
N  
E  
Y  
'  
S  
I  
N  
C  
P  
O  
B  
O  
X  
9  
4  
0  
R  
O  
C  
K  
Y  
M  
O  
U  
N  
T  
A  
I  
N  
H  
O  
U  
S  
E  
A  
B

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
5675	403-845-3072	1560400	01	07NOV22	599
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	2064	MARVIN

DESCRIPTION	AMOUNT
connect supply and return coolnat lines to new control valve. RUn machine up to operating temperature to confirm repair. DTC 4366.16 no longer appears. SGS	
1 N AT456096 SOLENOID VACY	
** TOTAL LABOR **	
CARBON TAX SURCHARGE	
>>--> SEG# 01 PRT LAB MSC	
REPAIR 676.14 GLOW PLUG CODE	
COMPLAINT: DTC "676.14 Cold Start Aid Relay Signal Not Received When Expected" becomes active when attempting to start engine.	
CAUSE: Glow plugs shorted to ground internally.	
CORRECTION: Confirm complaint of 676.14 fault code. Check 50A fuse for glow plug circuit, found fuse had burnt out. Check glow plug supply wire to ground, found supply wire appears to be shorted to ground. Disconnect supply wire from glow plugs, supply wire no longer shorted to ground, indicating	

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM). MINIMUM CHARGE OF \$1.50.	QIT # 1226957240	DESCRIPTION	AMOUNT
I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics llen is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.		TOTAL PARTS	
		TOTAL LABOR	
		MISC. CHARGES SALES TAX	
		PLEASE PAY THIS TOTAL	→ **CONTINUED**
X _____ SIGNATURE	_____ DATE		



Brandt Tractor Ltd.  
101 Burnt Park Dr.  
Red Deer, AB  
T4P 0J7  
(403) 343-7557

Service  
Invoice



INVOICE DATE	BRANCH	INVOICE NO.
30NOV22	105	1560400

SOLD TO:

PIDHERNEY'S INC

S/N # 1FF300GXALF731578

PAGE
3
SALE TYPE
WARRANTY
CUSTOMER NO.
58453072

S  
P  
I  
D  
H  
E  
R  
N  
E  
Y  
'  
S  
I  
N  
C  
P  
O  
B  
O  
X  
9  
4  
0  
  
R  
O  
C  
K  
Y  
M  
O  
U  
N  
T  
A  
I  
N  
H  
O  
U  
S  
E  
A  
B

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALES PRN
5675	403-845-3072	1560400	03	09NOV22	599
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	2064	MARVIN

DESCRIPTION	AMOUNT
<p>one or more glow plugs are shorted to ground internally. Remove connectors from glow plugs, found 4 out of six glow plugs shorted to ground. Remove engine hood and covers, remove counter weight from machine to access engine. Remove exhaust manifold and turbochargers to gain access to glow plugs. When attempting to remove glow plugs, all six broke due to threads being siezed in cylinder head. Using glow plug extraction kit to remove broken peices of glow plugs, found that glow plugs threads siezed which caused the threads to pull out of head. Only repair at this point is to replace cylinder head. Remove cylinder head and related components. Made parts list and ordered additional parts required for reassembly. Install new cylinder head. Reassemble rockers, pushrods and injectors. Set valves, install valve cover, and install thermostat housing. Install EGR cooler bracket. Start routing wires and hoses to proper locations and securing in place. Install exhaust manifold and turbos.</p>	

<p>PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM). MINIMUM CHARGE OF \$1.50.</p> <p>I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.</p> <p>.X _____ SIGNATURE</p> <p>_____ DATE</p>	<p>DESCRIPTION</p> <p>TOTAL PARTS</p> <p>TOTAL LABOR</p> <p>MISC. CHARGES</p> <p>SALES TAX</p>	<p>AMOUNT</p>
	<p>PLEASE PAY THIS TOTAL</p>	<p>**CONTINUED**</p>



Brandt Tractor Ltd.  
101 Burnt Park Dr.  
Red Deer, AB  
T4P 0J7  
(403) 343-7557

Service  
Invoice



SOLD TO:

PIDHERNEY'S INC

S/N # 1FF300GXALF731578

INVOICE DATE	BRANCH	INVOICE NO.
30NOV22	105	1560400

PAGE
4
SALE TYPE
WARRANTY
CUSTOMER NO.
58453072

S PIDHERNEY'S INC  
H P.O. BOX 940  
P  
T ROCKY MOUNTAIN HOUSE, AB  
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
5675	403-845-3072	1560400	03	09NOV22	599
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	2064	MARVIN

DESCRIPTION	AMOUNT
Hook up all lines and electrical then install CAC tubes and intake. Install EGR cooler. Install exhaust pipe to after treatment. Fill with coolant and test run. Install counter weight and hoods. Install new fuse for glow plugs, clear codes for glow plugs, Return parts and core head.SGS	
6 N RE538937 GLOW PLUG	
1 N R536309 RELAY	
1 N 57M10404 FUSE	
1 N RE539787 WIRING HARNCY	
1 N RE539912 SCREW	
1 N 19M9083 CAP SCREW CY	
7 N 19M10070 CAP SCREW	
1 N R529510 GASKET	
1 N DZ108963 FUEL LINXY	
1 N DZ108962 FUEL LIN	
1 N DZ108961 FUEL LINCY	
1 N DZ108960 FUEL LINCY	
1 N DZ108958 FUEL LINCY	
1 N DZ108959 FUEL LINXY	
6 N RE549731 TUBE	
1 N DZ110131 GASKET KCY	
26 N R534287 SCREW CY	
1 N RE587954 CYLINDERCY	
1 N R528313 TUBE	
2 N R530341 STUD	
12 N R539762 FLANGE N	

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM). MINIMUM CHARGE OF \$1.50.

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X \_\_\_\_\_  
SIGNATURE

\_\_\_\_\_  
DATE

DESCRIPTION	AMOUNT
TOTAL PARTS	
TOTAL LABOR	
MISC. CHARGES	
SALES TAX	
PLEASE PAY THIS TOTAL	→ **CONTINUED**



Brandt Tractor Ltd.  
101 Burnt Park Dr.  
Red Deer, AB  
T4P 0J7  
(403) 343-7557

Service  
Invoice



INVOICE DATE	BRANCH	INVOICE NO.
30NOV22	105	1560400

SOLD TO:

PIDHERNEY'S INC

S/N # 1FF300GXALF731578

PAGE 5 SALE TYPE
WARRANTY CUSTOMER NO. 58453072

S  
H  
I  
P  
P  
T  
O  
PIDHERNEY'S INC  
P.O. BOX 940  
ROCKY MOUNTAIN HOUSE, AB

PURCHASE ORDER NO. 5675	PHONE NUMBER 403-845-3072	WORK ORDER NO. 1560400	SEG. 03	DATE OPENED 09NOV22	SALESPRN 599	AUTHORIZED BY MARVIN
MAKE JD	MODEL 300GLC	SERIAL NO. 1FF300GXALF731578	EQUIP. NO. 5675	METER 2064		

DESCRIPTION			AMOUNT
1	N DZ101520	HOSE	
3	N R534282	FLANGE N	
2	N DZ106685	CLAMP	
1	N DZ114387	OIL LINE	
1	N DZ120384	GASKET	
1	N T142419	O-RING	
3	N DZ113158	STUD	
** TOTAL LABOR **			
CARBON TAX SURCHARGE			
>>--> SEG# 03 PRT			
LAB			
MSC			

<p>PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM), MINIMUM CHARGE OF \$1.50.</p> <p>I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.</p> <p>X _____ SIGNATURE</p> <p>_____ DATE</p>	<p>QST # 122697240</p>	DESCRIPTION	AMOUNT
	TOTAL PARTS		
	TOTAL LABOR		
	MISC. CHARGES SALES TAX		
PLEASE PAY THIS TOTAL		➔	



Brandt Tractor Ltd.  
101 Burnt Park Dr.  
Red Deer, AB  
T4P 0J7  
(403) 343-7557

**Service  
Invoice**



INVOICE DATE	BRANCH	INVOICE NO.
17FEB23	105	1561131

SOLD TO:

PIDHERNEY'S INC

S/N # 1FF300GXALF731578

PAGE
1
SALE TYPE
WARRANTY
CUSTOMER NO.
58453072

S PIDHERNEY'S INC  
H I P.O. BOX 940  
P  
T ROCKY MOUNTAIN HOUSE, AB  
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALES PRN
5675	403-845-3072	1561131	01	11JAN23	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	2575	MARVIN

DESCRIPTION	AMOUNT
<p>REPAIR FAN SPEED LOW</p> <p>COMPLAINT: COMPLAINT OF LOW FAN SPEED</p> <p>CAUSE: Debris caught in the fan motor speed solenoid - seized</p> <p>CORRECTION: Checked SA5 remote for codes. Found code 1639.18 for fan speed low. Filled out service task assessment with tech. Ordered potential parts. Fill out STA. Customer complains of high engine temps and active code 1639.18 fan speed very low. Removed under house paneling to access the fan motor. Unplugged the fan motor speed solenoid. Ran machine and monitored fan speed. Fan speed does not go to full speed with solenoid unplugged. Suspect of a failed fan motor solenoid valve. Removed fan motor solenoid from valve. Removed valve from the fan motor. Inspected the fan motor valve. Found debris caught in the valve. Installed new valve into place and tightened, installed new solenoid and</p>	

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM). MINIMUM CHARGE OF \$1.50.

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X \_\_\_\_\_  
SIGNATURE

\_\_\_\_\_  
DATE

QST# 1224957240

DESCRIPTION	AMOUNT
TOTAL PARTS	
TOTAL LABOR	
MISC. CHARGES	
SALES TAX	
PLEASE PAY THIS TOTAL	**CONTINUED**



Brandt Tractor Ltd.  
101 Burnt Park Dr.  
Red Deer, AB  
T4P 0J7  
(403) 343-7557

**Service  
Invoice**



**JOHN DEERE**

INVOICE DATE	BRANCH	INVOICE NO.
17FEB23	105	1561131

SOLD TO:

PIDHERNEY'S INC

S/N # 1FF300GXALF731578

PAGE
2
SALE TYPE
WARRANTY
CUSTOMER NO.
58453072

S PIDHERNEY'S INC  
H P.O. BOX 940  
P  
T ROCKY MOUNTAIN HOUSE, AB  
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPAN
5675	403-845-3072	1561131	01	11JAN23	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	2575	MARVIN

DESCRIPTION	AMOUNT
<p>Tightened. Reinstalled connector plug. Ran machine. Unplugged fan solenoid and fan goes to full speed correctly. During machine operation fan increases and engine temp increases correctly. Fan working correctly. SGS</p> <p>1 N AT393253 ELEC PROCY ** TOTAL LABOR ** CARBON TAX SURCHARGE</p> <p>&gt;&gt;--&gt; SEG# 01 PRT LAB MSC</p>	

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM), MINIMUM CHARGE OF \$1.50.

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X \_\_\_\_\_  
SIGNATURE

\_\_\_\_\_  
DATE

DESCRIPTION	AMOUNT
TOTAL PARTS	
TOTAL LABOR	
MISC. CHARGES SALES TAX	
PLEASE PAY THIS TOTAL	➔

CUSTOMER COPY



Brandt Tractor Ltd.  
101 Burnt Park Dr.  
Red Deer, AB  
T4P 0J7  
(403) 343-7557

**Service  
Invoice**



INVOICE DATE	BRANCH	INVOICE NO.
29MAY25	105	1569469

SOLD TO:

PIDHERNEY'S INC

S/N # 1FF300GXALF731578

PAGE
1
SALE TYPE
WARRANTY
CUSTOMER NO.
58453072

S PIDHERNEY'S INC  
H ap@pidherneys.com  
P #17 GATEWAY BLVD  
T ROCKY MOUN, AB  
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
5675	403-845-3072	1569469	01	01MAY25	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	5194	MARVIN

DESCRIPTION	AMOUNT
REPAIR 676.14	
COMPLAINT: Code 676.14 Starting Aid Fault	
CAUSE: Glow plug internal short causing relay and fuse to short	
CORRECTION: Customer complains of active code 676.14 Starting Aid Fault. Tested glow plugs and found #3 reads OL with a multi meter. Test fuse and relay - shorted. Removed 2 Exhaust clamps and exhaust tube from the turbo to the after treatment assembly. Unbolted and removed 15 bolts holding down the valve cover. Removed OCV steel line from the valve cover. Lifted and removed valve cover from the engine. Unbolted 6 bolts securing the injector harness down and the 12 nuts to the injectors. Removed Injector harness out of the way. Removed 9 Bolts securing the Rocker shaft assembly down to the rocker box. Lifted and removed the rocker shaft assembly. Removed the 12	

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM). MINIMUM CHARGE OF \$1.50.

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X \_\_\_\_\_  
SIGNATURE

\_\_\_\_\_  
DATE

DESCRIPTION	AMOUNT
TOTAL PARTS	
TOTAL LABOR	
MISC. CHARGES SALES TAX	
PLEASE PAY THIS TOTAL	**CONTINUED**



Brandt Tractor Ltd.  
101 Burnt Park Dr.  
Red Deer, AB  
T4P 0J7  
(403) 343-7557

**Service  
Invoice**



**JOHN DEERE**

INVOICE DATE	BRANCH	INVOICE NO.
29MAY25	105	1569469

**SOLD TO:**

PIDHERNEY'S INC

S/N # 1FF300GXALF731578

PAGE
2
SALETYPE
WARRANTY
CUSTOMER NO.
58453072

S PIDHERNEY'S INC  
H ap@pidherneys.com  
P #17 GATEWAY BLVD  
T ROCKY MOUN, AB  
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
5675	403-845-3072	1569469	01	01MAY25	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	5194	MARVIN

DESCRIPTION	AMOUNT
<p>Rocker Bridges from the valves. Disconnected return fuel line from the Rocker box. Lifted and removed the Rocker Box assembly from the Cylinder head. Removed Glow plug from the cylinder head and installed new Glow plug into place with never sieze on the threads. Removed the Old Glow plug harness - harness broke on removal. Installed new glow plug harness and tightened 3 mounting bolts. Lifted and reinstalled the Rocker box into place on the cylinder head with a new gasket. Reinstalled 12 Rocker Bridges onto valves in the correct Orientation. Lifted and reinstalled The rocker shaft assembly into place. Installed 9 New bolts securing the rocker box and rocker shaft down Torqued hardware to spec. Connected 1 Glow plug connector to each glow plug. Reinstalled the injector harness. Tightened 12 Nuts and 6 bolts. Reinstalled the valve cover with a new gasket and tightend hardware. Reinstalled OCV steel line. Reinstalled the Exhaust pipe from the Turbo to Aftertreatment assembly and tightened clamps. Removed and replaced the Glow plug relay and Glow plug fuse. Tested</p>	

<p>PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM). MINIMUM CHARGE OF \$1.50.</p> <p>I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.</p> <p>X _____ SIGNATURE</p> <p>_____ DATE</p>	057 # 1226957240	DESCRIPTION	AMOUNT
	TOTAL PARTS		
	TOTAL LABOR		
	MISC. CHARGES SALES TAX		
PLEASE PAY THIS TOTAL	▶	**CONTINUED**	

CUSTOMER COPY



Brandt Tractor Ltd.  
101 Burnt Park Dr.  
Red Deer, AB  
T4P 0J7  
(403) 343-7557

Service  
Invoice



INVOICE DATE	BRANCH	INVOICE NO.
29MAY25	105	1569469

SOLD TO:

PIDHERNEY'S INC

S/N # 1FF300GXALF731578

PAGE
3
SALE TYPE
WARRANTY
CUSTOMER NO.
58453072

S PIDHERNEY'S INC  
H | ap@pidherneys.com  
P #17 GATEWAY BLVD  
T ROCKY MOUN, AB  
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
5675	403-845-3072	1569469	01	01MAY25	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	5194	MARVIN

DESCRIPTION	AMOUNT
machine operation. Glow plugs are working correctly and code is stored. Machine is working correctly. UDUSYN	
1 N R528743 GASKET	
1 N R522412 O-RING	
1 N DZ120750 GLOW PLU	
1 N R536309 RELAY	
1 N 57M10404 FUSE	
1 N RE539787 WIRING H	
1 N R532242 GASKET	
1 N R520867 O-RING	
1 N 19M9083 CAP SCRE	
7 N 19M10070 CAP SCRE	
1 N RE539912 SCREW	
1 N R529072 SEALING CY	
** TOTAL LABOR **	
ENVIRONMENTAL FEE	
>>--> SEG# 01 PRT LAB MSC	

<p>PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM), MINIMUM CHARGE OF \$1.50.</p> <p>I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.</p> <p>X _____ SIGNATURE</p> <p>_____ DATE</p>	<p>DESCRIPTION</p> <p>TOTAL PARTS</p> <p>TOTAL LABOR</p> <p>MISC. CHARGES</p> <p>SALES TAX</p> <p>PLEASE PAY THIS TOTAL →</p>
--	---



Brandt Tractor Ltd.  
10630 176th St.  
Edmonton, AB  
T5S 1M2  
(780) 484-6613

Service  
Invoice



JOHN DEERE

INVOICE DATE	BRANCH	INVOICE NO.
29MAR25	106	1632075

SOLD TO:

PIDHERNEY'S INC

S/N # 1FF300GXALF/51578

PAGE
1
SALE TYPE
WARRANTY
CUSTOMER NO.
58453072

S PIDHERNEY'S INC  
H P.O. BOX 940  
P  
T ROCKY MOUNTAIN HOUSE, AB  
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
	403-845-3072	1632075	02	22FEB22	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	1522	KI

DESCRIPTION	AMOUNT
<p>CHECK/ REPAIR PILOT FILTER SEPARATION</p> <p>COMPLAINT: CUSTOMER COMPLAINT OF PILOT FILTER SEPARATION.</p> <p>CAUSE: STUCK OR STICKING PILOT RELIEF CAUSING PRESSURE SPIKES CAUSING FILTER HOUSING SEPARATION.</p> <p>CORRECTION: TEST PILOT PRESSURE ON UNIT. TEST SYSTEM AND CIRCUIT PRESSURES PILOT FILTERS BLOWING APART REMOVE AND CAP 4 LINES TO PILOT FILTER ASSEMBLY. UNBOLT AND REPLACE FILTER ASSEMBLY. CONNECT 4 LINES AND RUN UNIT. TEST PILOT PRESSURE. PRESSURE ON SPECIFICATION. RT UNIT HAS 4YR/5000HR SECURE PTH WARRANTY 1 N 4629717 FILTER ** TOTAL LABOR ** CARBON TAX SURCHARGE</p> <p>&gt;&gt;--&gt; SEG# 02 PRT LAB MSC</p>	

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM). MINIMUM CHARGE OF \$1.50.

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X \_\_\_\_\_  
SIGNATURE

\_\_\_\_\_  
DATE

DESCRIPTION	AMOUNT
TOTAL PARTS	
TOTAL LABOR	
MISC. CHARGES SALES TAX	
PLEASE PAY THIS TOTAL	➔



Brandt Tractor Ltd.  
10630 176th St.  
Edmonton, AB  
T5S 1M2  
(780) 484-6613

Service  
Invoice



SOLD TO:

PIDHERNEY'S INC

S/N # 1FF300GXALF731578

INVOICE DATE	BRANCH	INVOICE NO.
30NOV24	106	1654261

PAGE
1
SALE TYPE
WARRANTY
CUSTOMER NO.
58453072

S PIDHERNEY'S INC  
H #17 GATEWAY BLVD  
P equip.parts@pidherneys.c  
T ROCKY MOUN, AB  
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
.	403-845-3072	1654261	02	22NOV24	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	4972	TE

DESCRIPTION	AMOUNT																				
<p>DIAG/REP FOR GLOWPLUG FAULT</p> <p>COMPLAINT: CUSTOMER COMPLAINT ERROR CODE FOR GLOW PLUGS</p> <p>CAUSE: #3 GLOW PLUG FELL APART - WEAK MATERIAL</p> <p>CORRECTION: 3.0-CHECKED FUSE FOR GLOW PLUGS AND FOUND IT HAD BLOWN. BEGAN CHECKIN CONTINUITY OF GLOW PLUGS AND FOUND #3 HAD FAILED. 13.50-DRAIN COOLANT, REMOVED EGR COOLER. REMOVED EXHAUST MANIFOLD/TURBOS TO ACCESS GLOW PLUGS. REMOVED FAILED GLOW PLUG AND INSTALLED NEW PART. ASSEMBLED ALL REMOVED PARTS. REPLACED 1 EXHAUST MANIFOLD STUD AND NUT. REPLACED 50 AMP FUSE. VACCUM FILLED COOLANT SYSTEM. TURNED ON KEY AND GLOW PLUGS CYCLED, RAN UNIT UP TO OPERATING TEMP AND CHECKED OVER FOR ISSUES. ALL GOOD. COMPLETE TECH REPORT.MMAGTIBAY</p> <table> <tr> <td>1</td> <td>N</td> <td>DZ120750</td> <td>GLOW PLU</td> </tr> <tr> <td>1</td> <td>N</td> <td>57M10404</td> <td>FUSE</td> </tr> <tr> <td>1</td> <td>N</td> <td>DZ10229</td> <td>STUD ST</td> </tr> <tr> <td>1</td> <td>N</td> <td>R539762</td> <td>FLANGE N</td> </tr> <tr> <td>5</td> <td>N</td> <td>TY26575</td> <td>COOL-GAR</td> </tr> </table>	1	N	DZ120750	GLOW PLU	1	N	57M10404	FUSE	1	N	DZ10229	STUD ST	1	N	R539762	FLANGE N	5	N	TY26575	COOL-GAR	
1	N	DZ120750	GLOW PLU																		
1	N	57M10404	FUSE																		
1	N	DZ10229	STUD ST																		
1	N	R539762	FLANGE N																		
5	N	TY26575	COOL-GAR																		

<p>PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM), MINIMUM CHARGE OF \$1.50.</p> <p>I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.</p> <p>X _____ SIGNATURE</p> <p>_____ DATE</p>	<p>DESCRIPTION</p> <p>AMOUNT</p>
	TOTAL PARTS
	TOTAL LABOR
	MISC. CHARGES SALES TAX
PLEASE PAY THIS TOTAL	**CONTINUED**

CUSTOMER COPY



Brandt Tractor Ltd.  
10630 176th St.  
Edmonton, AB  
T5S 1M2  
(780) 484-6613

**Service  
Invoice**



**JOHN DEERE**

INVOICE DATE	BRANCH	INVOICE NO.
30NOV24	106	1654261

SOLD TO:

PIDHERNEY'S TNC

S/N # 1FF300GXALF731578

PAGE
2
SALETYPE
WARRANTY
CUSTOMER NO.
58453072

5 PIDHERNEY'S INC  
H #17 GATEWAY BLVD  
P equip.parts@pidherneys.c  
T ROCKY MOUN, AB  
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
	403-845-3072	1654261	02	22NOV24	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	4972	TE

QUANTITY	DESCRIPTION	AMOUNT
24	N WDF WASTE DI	
1	N RE304965 CLAMP XY	
1	N DZ100677 CLAMP	
1	N R530923 GASKET	
	** TOTAL LABOR **	
	CARBON TAX SURCHARGE	
<p>&gt;&gt;--&gt; SEG# 02 PRT LAB MSC !</p> <p>DIAG/REP FOR TURBO SHAFT SEAL LEAK</p> <p>COMPLAINT: CUSTOMER COMPLAINT OIL LEAK AT TURBO</p> <p>CAUSE: INTERNAL SEALS OF TURBO FAILED - WEAK MATERIAL</p> <p>CORRECTION: 0.50-REMOVED CHARGE AIR HOSE FROM VGT AND FOUND TO BE FULL OF ENGINE OIL. 1.50- REMOVED FAILED TURBO. DRILLED OUT 3 BROKEN BOLTS FROM EXHAUST MANIFOLD. 3.0- EASY OUT STILL NOT REMOVING BROKEN BOLTS. REEMED OUT HOLES ENOUGH TO USE A TAP TO REMOVE REMAINDER OF BOLT FROM THREADS. INSTALLED NEW TURBO, REPLACED MOUNTING HARDWARE. REPLACED TURBO DRAIN TUBE BOLTS. REPLACED EXHAUST CLAMP. HOOKED UP ALL THE REMOVED PARTS. PRELUBED TURBO. STARTED MACHINE, RAN UP</p>		

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUAL). MINIMUM CHARGE OF \$1.50.

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X \_\_\_\_\_  
SIGNATURE

\_\_\_\_\_  
DATE

DESCRIPTION	AMOUNT
TOTAL PARTS	
TOTAL LABOR	
MISC. CHARGES	
SALES TAX	
PLEASE PAY THIS TOTAL	**CONTINUED**

CUSTOMER COPY



Brandt Tractor Ltd.  
10630 176th St.  
Edmonton, AB  
T5S 1M2  
(780) 484-6613

**Service  
Invoice**



INVOICE DATE	BRANCH	INVOICE NO.
30NOV24	106	1654261

SOLD TO:

PIDHERNEY'S INC

S/N # 1FF300GXALF731578

PAGE 3
SALETYPE
WARRANTY CUSTOMER NO.
58453072

S PIDHERNEY'S INC  
H #17 GATEWAY BLVD  
P equip.parts@pidherneys.c  
T ROCKY MOUN, AB  
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALES PRH
.	403-845-3072	1654261	03	22NOV24	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	300GLC	1FF300GXALF731578	5675	4972	TE

DESCRIPTION	AMOUNT
TO OPERATING TEMPERATURE AND CHECKED OVER FOR ISSUES. ALL GOOD. COMPLETED TECH REPORT.MMAGTIBAY	
2 N R28776 O--RINGO--	
1 N R529606 O--RING	
1 N DZ10840 GASKET	
1 N R536934 GASKET	
1 N T142419 O--RING	
10 N R532299 CAP SCREXY	
1 N R528112 SEAL	
2 N DZ114164 O--RINGO--	
2 N N275831 SCREW	
1 N R534438 GASKET	
1 N R537824 O--RING	
1 N DZ126978 TURBOCHA	
1 N DZ128753 GASKET	
1 N RE304965 CLAMP	
** TOTAL LABOR **	
CARBON TAX SURCHARGE	
>>--> SEG# 03 PRT LAB MSC	

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM), MINIMUM CHARGE OF \$1.50.

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X \_\_\_\_\_  
SIGNATURE

\_\_\_\_\_  
DATE

DESCRIPTION	AMOUNT
TOTAL PARTS	
TOTAL LABOR	
MISC. CHARGES SALES TAX	
PLEASE PAY THIS TOTAL	