

E19-1  
BLUE-MAR

**Industrial Diesel Repair & Performance Ltd**  
4017 Charles Street  
Red Deer County, AB T4S2B3, CA  
service@idrp.ca  
4038963572



Invoice: **INV-26036**  
Date: **1/22/2026**

Bill To  
Davis Farms

Service Order	Terms	Due Date	Authorizer	Customer PO	Unit #
SO-2253	COD	1/22/2026	Ryan Davis		1

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: DELETE AFTERTREATMENT FAULTS

Cause: .

Labor	<b>Correction:</b>	8.00000	\$625.00	\$5,000.00
-------	--------------------	---------	----------	------------

Chassis / Chassis / REMOVED PIPE FROM TURBO INTO DOC, REMOVED PIPE FROM CATALYST INTO STACK PIPING, WHILE REMOVAL I FOUND THE PIPE TO BE SNAPPED AND RESTING IN ITS SELF, MEASURED DISTANCE BETWEEN AND ITS ROUGHLY 70 INCHS FOR NEW PIPE TO BE ROUTED, ONCE REMOVED I CUT THE TURBO BACK PIPE AND WELDED A 4"-5" ADAPTER AND RAN A 6" HARD PIPE OUT AND ONCE IN PLACE I WELDED IT UP, REMOVED 2 DEF LINES AND THE HARNESS AND RAN THEM UNDER THE FRAME FOR ROOM TO RUN THE EXHUAST BACK, RAN 30" OF FLEX PIPE INTO A 14" HARD PIPE, REMOVED THE PIPE INTO THE STACK AND CUT THE BROKEN FLEX PIPE OUT, INSTALLED 33" OF FLEX PIPE ONTO THE END AND RAN INTO THE NEW HARD PIPE, MADE A BRACKET TO ATTATCH TO THE CLAMP ON THE SMALL SECTION OF HARD PIPE ABOVE THE DPF, REMOVED A PLATE AND INSTALLED THE BRACKET UNDER IT, TIGHTEND ALL THE EXHUAST CLAMPS, REMOVED THE INTAKE PIPING FOR THE TURBO AND REMOVED THE FLEX PIPE FOR THE EGR, INSTALLED THE BLOCK OFF PLATE WITH A NEW GASKET AND INSTALLED THE FLEX PIPE BACK, CUT OFF FLANGES THAT WOULD FIT THE EMISSIONS AND WELDED PLATES ON THE BACK, INSTALLED THEM WITH NEW GASKETS, INSTALLED THE BLOCK OFF PLATE ON THE COLD SIDE OF THE CROSS OVER TUBE. - Completed: 1/20/2026

Parts	CLAMP-EXHAUST WB PREFRMD 5" ALMZ	4.00000	\$15.73	\$62.92
Parts	NUT, SPEED M8	1.00000	\$17.00	\$17.00
Parts	EXHAUST BLANK PLATE	2.00000	\$32.00	\$64.00
Parts	STR AIGHT 5" EXHAUST TUBING	2.00000	\$34.65	\$69.30
Parts	FLEXTUBE, 5.00", SS P/FT	6.00000	\$27.83	\$166.98
Parts	MUFFLER CLAMP SADDLE, HD , 5.00 "	1.00000	\$14.70	\$14.70
Parts	GASKET, AFM DEVICE	1.00000	\$30.74	\$30.74
Parts	GASKET, AFM DEVICE	2.00000	\$31.05	\$62.10
Parts	GASKET,EXH GAS RCN VALVE	1.00000	\$74.26	\$74.26
Parts	GASKET, AFM DEVICE	1.00000	\$38.69	\$38.69

AND FILLED BACK UP, TOPPED OFF WITH NEW FLUID - Completed: 1/16/2026

Parts	5/8" BLACK PUSH-ON HOSE	1.00000	\$5.62	\$5.62
Parts	EXT. TONGUE GEAR CLAMP,5/8"	2.00000	\$2.63	\$5.26
Parts	.946L AUTO TRANS FLUID	1.00000	\$10.08	\$10.08
			<b>Subtotal</b>	<b>\$245.96</b>

**Complaint:** STEADY BEARING**Cause:** Customer request

Labor	<b>Correction:</b> Chassis / Chassis / REMOVE DRIVELINE, CUT THE STEADY BEARING TILL IT WAS ALMOST THROUGH AND HIT IT WITH A PUNCH CRACKING IT FOR EASY REMOVAL, ONCE OFF, I CLEANED AND INSPECT, ALL GOOD, INSTALLED NEW STEADY BEARING AND HAMMERED ON AS IT WAS A TIGHT FIT, PUT YOKE ON AND TIGHTENED DOWN NUT, BOLTED STEADY BEARING UP, INSTALLED DRIVE LINE - Completed: 1/16/2026	2.50000	\$150.00	\$375.00
Parts	CENTER BEARING ASSEMBLY	1.00000	\$149.60	\$149.60
Parts	U-JOINT STRAP KIT SPL 250	1.00000	\$32.93	\$32.93
Parts	SHAFT NUT	1.00000	\$26.27	\$26.27
			<b>Subtotal</b>	<b>\$583.80</b>

**Complaint:** INPUT SEAL LEAKING- AXLE 2**Cause:** Customer request

(Inspection)

Labor	<b>Correction:</b> Chassis / Chassis / REMOVED DRIVE LINE FROM YOKE AND PUT TO SIDE, REMOVED YOKE NUT AND REMOVED YOKE, REMOVED SEAL AND CLEANED AREA, INSTALLED NEW SEAL, PUT YOKE ON AND INSTALLED NEW WASHER AND YOKE NUT, INSTALLED DRIVE LINE, TORQUED TO SPEC - Completed: 1/21/2026	2.50000	\$150.00	\$375.00
Parts	ROCKWELL NUT AND WASHER	1.00000	\$44.89	\$44.89
Parts	SEAL ASSY, OIL BATH, INPUT BEARING CAGE	1.00000	\$112.36	\$112.36
Parts	U-JOINT STRAP KIT SPL 250	1.00000	\$32.93	\$32.93
			<b>Subtotal</b>	<b>\$565.18</b>

**Complaint:** TRANSMISSION OUTPUT SEAL**Cause:** Customer request

Labor	<b>Correction:</b> Chassis / Chassis / REMOVED DRIVELINE, REMOVED YOKE NUT AND PULLED YOKE OFF, PULLED OUT SPEED SENSOR AND REMOVED CASE, CLEANED AND INSPECTED, REMOVED SEAL IN CASE AND INSTALLED NEW, INSTALLED CASE WITH NEW GASKET AND TORQUED BOLTS WITH BLUE LOCKTIGHT, PUT YOKE ON WITH NEW NUT AND TORQUED, INSTALLED DRIVELINE AND TORQUED NEW STRAP KIT TO SPEC, TIGHTENED NUTS AND BOLTS FOR STEADY BEARING, INSTALLED REAR SECTION OF DRIVE LINE AND TORQUED BOLTS TO SPEC - Completed: 1/20/2026	3.00000	\$150.00	\$450.00
Parts	KIT-OIL SEAL	1.00000	\$108.45	\$108.45
Parts	KIT-HEX FLANGE NUT	1.00000	\$79.33	\$79.33

<b>Labor</b>	<b>\$8,062.49</b>
<b>Parts</b>	<b>\$1,599.63</b>
<b>Shop Supplies</b>	<b>\$400.00</b>
<b>Pre-Charge Subtotal</b>	<b>\$10,062.12</b>
<b>GST (5% of \$10,062.12)</b>	<b>\$503.11</b>
<b>Total</b>	<b>\$10,565.23</b>
<b>Payments &amp; Credits</b>	<b>\$0.00</b>
<b>Balance Due</b>	<b>\$10,565.23</b>

Any warranties on the parts and accessories sold hereby are made by the manufacturer. You understand and agree that we make no warranties of any kind unless expressed in writing. You hereby authorize us to perform the repair work herein set forth and to purchase the necessary material and parts to perform such repair work. You agree that we are not responsible for loss or damage to your vehicle or articles left in your vehicle in case of fire, theft, or any other cause beyond our control or for any delays caused by unavailability of parts or delays in part shipments by the supplier or transporter. In addition, you agree that we are not responsible for damages to your vehicle from freezing due to lack of antifreeze. You hereby grant our employees permission to operate your vehicle on streets, highways, or elsewhere for the purpose of testing and/or inspection. You acknowledge and agree that an express mechanic's lien on your vehicle is granted to secure payment of this invoice for the repair work detailed in this invoice.

Customer Signature: \_\_\_\_\_

Printed Name: \_\_\_\_\_ Date: \_\_\_\_\_



# Dawson

## TRUCK CENTRES

DAWSON INTERNATIONAL TRUCK  
CENTRES LTD.  
7156 Meadowlark Rd.  
VERNON, BC V1B 3R6  
P: (250) 545-2381  
F:  
www.dawsontruckcentres.com  
GST: 136913514

**SERVICE INVOICE: R104012444:01**

**CUSTOMER PO#: 3575L**

**Tag Number:**

**License Plate Number:**

**FLEET CHARGE: 6220860611800051**  
**AUTH: 4662**

**BILL TO**  
DAWSON IDEALEASE (FOR TC USE ONLY!!) - 102584

P:  
F:

**DELIVER TO**  
DAWSON IDEALEASE (FOR TC USE ONLY!!) -  
102584

3953 Highway 97 North  
KELOWNA BC V1X 6S4

F:

DATE ARRIVED	DATE INVOICE	SALES TYPE	ADVISOR	TERMS	CUSTOMER PO#
2025-08-28 9:32:06AM	9/12/2025	SRET	S Rutter	FC	3575L

YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT #	ENGINE HOURS	IN SERVICE	Component Serial #	ODOMETER
2019	INTERNATIONAL	LT	3HSDZAPR8KN392213	3575L	15,850		80103144	426541

### Sold Operations

**JOB #1 00      GENERAL REPAIR**  
**COMPLAINT      114 POINT INSPECTION**  
**CAUSE**

INVOICE REPRINT



**Sold Operations (Cont.)**

CORRECTION

topped coolant off as it was low, started checking components in the engine. PUT IN A PARTS ESTIMATE REQUEST FOR: EGR COOLER AND ALL PLUMBING ORINGS/GASKETS, BELLOWS GASKETS, EGR OUTLET PIPE GASKET, BOOT AND CLAMPS, TURBO MOUNT GASKET, TURBO PLUMBING ORINGS/GASKETS, TURBO CAC O RING, AIR BRAKE RELAY VALVE ABOVE REAR DRIVESHAFT, #2 QUICK RELEASE VALVE, EXHAUST FLEX AFTER AFTERTREATMENT WITH CLAMPS, COOLANT TANK AND CAP. THE REST OF THE REPAIRS REQUIRE DIAGNOSIS.

UNIT FAILS FOR:

- EGR OUTLET PIPE LEAKING. THE COOLER HAS COOLANT COMING FROM THE BACK AND IS RUPTURED.
  - WINDSHIELD WASHERS HAVE NO PRESSURE
  - ENGINE LIGHT IS ON
  - AIR LEAK ON INITIAL BRAKE APP, THE RELAY VALVE ABOVE REAR DRIVESHAFT IS LEAKING
  - TRANS AND STEADY BEARING YOKE NUTS HAVE RUST CHECKING, MAY BE LOOSE
  - #3 TIRES 0/32, #2 TIRES 1/32 SIZE IS 11R22.5 #3 OUTER IS FLAT
  - #1 LEFT AND #3 LEFT SHOCKS ARE LEAKING
  - #2 QUICK RELEASE VALVE IS LEAKING
  - #2 BRAKE AIR LINES ARE RUBBING
  - EXHAUST FLEX AFTER TREATMENT IS LEAKING
  - MUD FLAPS ARE LOOSE
  - COOLANT TANK IS CRACKING AND PRESSURE CAP DOES NOT SEAL PROPERLY (NOT A FAIL)
- ALL MEASUREMENTS ARE ON THE BACK OF THE WORK ORDER. NO REGI IN THE TRUCK TO COMPLETE FAIL PAPERWORK.

completed 114 point inspection, changed oil and filter and took oil sample, changed fuel filters, changed air filter as it was pretty bad, changed hvac filter as that was bad as well, checked diff levels, checked transmission level, topped off washer fluid,

EGR OUTLET PIPE LEAKING, COOLER MAYBE RUPTURED.

WINDSHIELD WIPERS HAVE NO PRESSURE AT WIPERS.

ENGINE LIGHT ON.

AIR LEAK ON INITIAL BRAKE APPLICATION, RELAY VALVE ABOVE REAR DRIVESHAFT.

#3 TIRES IS AT 0/32 TREAD.

#2 TIRES IS AT 1/32 TREAD ON RIGHT SIDE.

#1 LEFT HAND SIDE, #3 LEFT HAND SIDE SHOCKS ARE LEAKING.

#2 QUICK RELEASE VALVE IS LEAKING.

#2 BRAKE LINES ARE RUBBING.

EXHAUST FLEX LEAKING AFTER AFTERTREATMENT.

MUD FLAPS ARE LOOSE.

COOLANT TANK IS CRAKING, CAP ISN'T SEALING WELL, NOT FAIL.

TRANS OUTPUT YOKE AND STEADY BEARING YOKE ARE RUST JACKING, MAYBE LOOSE.

NEEDS 4 NEW BATTERIES.

DRAGLINK ISN'T TAKING ANY GREASE ON BOTH ENDS.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
4.30	LABOR 00-10	INSPECT GENERAL INFORMATION		580.50
1	104I/2510993C2	Fuel Filter	77.04	77.04
1	104I/2515573C1	Air Filter Element, Lt/hx	183.27	183.27
1	104I/4070948C1	Air Filter, Cabin	29.17	29.17
1	104I/FF5825NN	Fuel Filter	82.80	82.80
1	104I/LF14000NN	Oil Filter, Nanonet Used On Cu	60.66	60.66
1	104K/320271102	OIL SAMPLE BOTTLE	27.20	27.20
1	104S/FLTNFELC5050GCDT2	COOLANT, FLEETRITE 50/50 JUG	12.99	12.99
42	104S/SH500010047	OIL, ROTELLA T5 10W30 BULK	5.75	241.50
1	104X/KL-HF0480	AW46 COMMERCIAL FORMULA	90.65	90.65
42	EHC005	ENVIRONMENTAL HANDLING CHARGE 0.05	0.08	3.36
1	EHC12	ENVIRONMENTAL HANDLING CHARGE 1.2	1.20	1.20
4	EHC125	ENVIRONMENTAL HANDLING CHARGE 1.25	1.45	5.80



**Sold Operations (Cont.)**

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	EHC3	ENVIRONMENTAL HANDLING CHARGE 3	3.00	3.00
Prepay: \$0.00 Parts: \$805.28 Labor: \$580.50 Misc: \$13.36 Sublet: \$0.00				\$1,399.14

**JOB #2 00 GENERAL REPAIR**

COMPLAINT HEALTH REPORT ONCE THE UNIT HAS BEEN THROUGH THE SHOP, SHOWING CLEAN  
 CAUSE  
 CORRECTION COMPLETED HEALTH REPORT ALONG WITH RECAL CHECK AND CALIBRATION CHECK.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.70	LABOR 00-10	INSPECT GENERAL INFORMATION		94.50
Prepay: \$0.00 Parts: \$0.00 Labor: \$94.50 Misc: \$0.00 Sublet: \$0.00				\$94.50

**JOB #3 00 GENERAL REPAIR**

COMPLAINT NEEDS 4 BATTERIES  
 CAUSE  
 CORRECTION replaced the 4 batteries and cleaned all the cables, truck started up just fine.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.50	LABOR 00-10	INSPECT GENERAL INFORMATION		202.50
4	104S/BSGA31S	BATTERY, GROUP 31	114.82	459.28
-4	104S/BSGA31S-CORE	BATTERY, GROUP 31 CORE	33.75	-135.00
4	104S/BSGA31S-CORE	BATTERY, GROUP 31 CORE	33.75	135.00
Prepay: \$0.00 Parts: \$459.28 Labor: \$202.50 Misc: \$0.00 Sublet: \$0.00				\$661.78

**JOB #4 00 GENERAL REPAIR**

COMPLAINT EGR OUTLET PIPE LEAKING, COOLER MAY BE RUPTURED  
 CAUSE  
 CORRECTION DRAINED COOLANT AND REMOVED INTAKE PIPING AND TURBO. REMOVED ALL LINES INTO EGR COOLER AND PULLED IT OUT. NEW COOLER IS DIFFERENT, INSTALLED NEW UPPER MOUNT THEN PUT IN COOLER AND BOLTED IT UP, INSTALL ALL LINES TO COOLER AND REPLACED SEAL IN REAR COOLANT MANIFOLD WHEN RE-INSTALLING IT. HAD TO REMOVE RH FENDER SO I COULD CONNECT EGR INLET PIPE TO REAR OF COOLER. INSTALL TURBO AND INTAKE PIPING.  
 FOUND LARGE POOL OF COOLANT UNDER TRUCK. BRING BACK IN. PRESSURE UP COOLING SYSTEM. FOUND AFTER CHECKING, SMALL STREAM OF COOLANT FROM HEATER HOSE, METAL PIPE TO RUBBER HOSE CONNECTION, RECOVER COOLANT AND REMOVE HOSE. FOUND HOSE IS HARD AND BRITTLE. REPLACED SECTION OF HOSE AND CLAMPS.  
 REFILL AND CHECK FOR LEAKS. GOOD. WASH OFF ENGINE.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
10.40	LABOR 00-10	INSPECT GENERAL INFORMATION		1,404.00
1	104C/3163075	PAINT	43.99	43.99
2	104C/4944257	WASHER,SEALING	26.45	52.90
1	104C/5693915	KIT,EXH EGR COOLER	4,064.24	4,064.24
2	104S/FLTNFELC5050GCDT2	COOLANT, FLEETRITE 50/50 JUG	12.99	25.98
2	104X/ET-12	CLAMP	1.14	2.28
1	104X/ET-32	CLAMP	1.71	1.71
1	104X/ET-44	CLAMP	1.44	1.44
1	104X/NL4875-075	3/4 SILICONE	5.59	5.59
1	EHC01	ENVIRONMENTAL HANDLING CHARGE 0.1	0.10	0.10
2	EHC12	ENVIRONMENTAL HANDLING CHARGE 1.2	1.20	2.40
Prepay: \$0.00 Parts: \$4,198.13 Labor: \$1,404.00 Misc: \$2.50 Sublet: \$0.00				\$5,604.63



**Sold Operations (Cont.)**

**JOB #5 00 GENERAL REPAIR**

COMPLAINT WIPERS HAVE NO PRESSURE AT WIPERS  
 CAUSE  
 CORRECTION replace pump, sprayers still low pressure found split in line

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.80	LABOR 00-10	INSPECT GENERAL INFORMATION		108.00
2	104I/2504705C91	Nozzle Kit, Windshield Washer	31.42	62.84
1	104I/2511834C1	Pump, Washer, Windshield	52.44	52.44
Prepay: \$0.00 Parts: \$115.28 Labor: \$108.00 Misc: \$0.00 Sublet: \$0.00				\$223.28

**JOB #6 01 ENGINE**

COMPLAINT CHECK ENGINE LIGHT ON  
 CAUSE  
 CORRECTION LOOK THROUGH HEALTH REPORT WITH CURTIS. ORDER PARTS CLEAN UP CHANGE TASKS, UNIT NEEDS TO BE FIXED AND ROAD TESTED THEN RECHECKED FOR CODES

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.30	LABOR 01-10	INSPECT ENGINE		40.50
Prepay: \$0.00 Parts: \$0.00 Labor: \$40.50 Misc: \$0.00 Sublet: \$0.00				\$40.50

**JOB #7 00 GENERAL REPAIR**

COMPLAINT AIR LEAK ON INITIAL BRAKE APPLICATION - RELAY VALVE ABOVE REAR DRIVESHAFT  
 CAUSE  
 CORRECTION COULDN'T DIAGNOSE AIRLEAK, VERNE LOOKED AT IT WITH ME, NO AIR LEAK.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.00	LABOR 00-10	INSPECT GENERAL INFORMATION		0.00
Prepay: \$0.00 Parts: \$0.00 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00				\$0.00

**JOB #8 00 GENERAL REPAIR**

COMPLAINT #3 TIRE IS 0/32 TREAD.  
 CAUSE  
 CORRECTION

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.00	LABOR 00-10	INSPECT GENERAL INFORMATION		0.00
Prepay: \$0.00 Parts: \$0.00 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00				\$0.00

**JOB #9 00 GENERAL REPAIR**

COMPLAINT #2 TIRE 1/32 ON RIGHT SIDE  
 CAUSE  
 CORRECTION

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.00	LABOR 00-10	INSPECT GENERAL INFORMATION		0.00
Prepay: \$0.00 Parts: \$0.00 Labor: \$0.00 Misc: \$0.00 Sublet: \$0.00				\$0.00



Sold Operations (Cont.)

**JOB #10 00 GENERAL REPAIR**

COMPLAINT #1 LEFT AND #3 LEFT SHOCKS ARE LEAKING  
 CAUSE  
 CORRECTION REMOVED #1 LH SHOCK.  
 BOLTS SEIZED.  
 INSTALLED NEW SHOCK WITH NEW BOLTS #1 LH.  
 REMOVED #3 LH SHOCK.  
 INSTALLED NEW SHOCK #3 LH.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.00	LABOR 00-10	INSPECT GENERAL INFORMATION		135.00
1	104I/1669024C1	Bolt, Motor Mount	25.10	25.10
1	104I/438286C1	Bolt, Flange Hex, 5/8-18 X 4-1	12.63	12.63
1	104I/FLTSA55056	Suspension Shock Absorber	56.12	56.12
1	104I/FLTSA55084	Suspension Shock Absorber	56.12	56.12
1	104X/41B	5/8 FED WASHER	0.43	0.43
1	104X/6B	5/8 NF-STOVER-NUT	1.16	1.16
1	104X/SNBF012FL	3/4 NUT	4.53	4.53

Prepay: \$0.00 Parts: \$156.09 Labor: \$135.00 Misc: \$0.00 Sublet: \$0.00 \$291.09

**JOB #11 00 GENERAL REPAIR**

COMPLAINT #2 QUICK RELEASE VALVE LEAKING  
 CAUSE  
 CORRECTION REPLACED QUICK RELEASE VALVE ON #2 AXLE, LEAK STOPPED. ALSO INSTALLED NEW FITTINGS.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.20	LABOR 00-10	INSPECT GENERAL INFORMATION		162.00
1	104I/BX229859N	Valve, Quick Release, Brake, Q	51.03	51.03
2	104X/4134-6C	CONNECTOR	1.65	3.30
2	104X/X124-C	45ELB	3.41	6.82

Prepay: \$0.00 Parts: \$61.15 Labor: \$162.00 Misc: \$0.00 Sublet: \$0.00 \$223.15

**JOB #12 00 GENERAL REPAIR**

COMPLAINT #2 BRAKE LINE RUBBING  
 CAUSE  
 CORRECTION FOUND AND FIXED ALL THE BRAKE LINES RUBBING, 1 FOUND NEXT TO QUICK RELEASE VALVE ON #2 AXLE,  
 2 MORE LINES RUBBING ABOVE 2 DIFF.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.40	LABOR 00-10	INSPECT GENERAL INFORMATION		54.00

Prepay: \$0.00 Parts: \$0.00 Labor: \$54.00 Misc: \$0.00 Sublet: \$0.00 \$54.00

**JOB #13 00 GENERAL REPAIR**

COMPLAINT EXHAUST FLEX LEAKING AFTER AFTERTREATMENT  
 CAUSE  
 CORRECTION TIGHTEN UP CLAMP

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.20	LABOR 00-10	INSPECT GENERAL INFORMATION		27.00

Prepay: \$0.00 Parts: \$0.00 Labor: \$27.00 Misc: \$0.00 Sublet: \$0.00 \$27.00



**Sold Operations (Cont.)**

**JOB #14 00 GENERAL REPAIR**

COMPLAINT MUD FLAPS ARE LOOSE  
CAUSE

CORRECTION removed both mud flaps, right side was broken so it was able to slide around, found two new white idealease mud flaps upstairs in the shop, installed them along with new fasteners.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.60	LABOR 00-10	INSPECT GENERAL INFORMATION		81.00
Prepay: \$0.00 Parts: \$0.00 Labor: \$81.00 Misc: \$0.00 Sublet: \$0.00				\$81.00

**JOB #15 00 GENERAL REPAIR**

COMPLAINT COOLANT TANK CRACKING, CAP DOESN'T SEAL WELL - NOT A FAIL

CAUSE

CORRECTION COOLANT STILL OUT FROM PREVIOUS LINE. DISCONNECT ALL LINES TO SURGE TANK AND REMOVE IT, INSTALL NEW TANK, HOOK UP ALL HOSES. FILLED COOLANT.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.10	LABOR 00-10	INSPECT GENERAL INFORMATION		13.50
2.30	LABOR 00-30	REPAIR GENERAL INFORMATION		310.50
1	104I/3578833C3	Cap, Filler, Radiator, Surge T	46.85	46.85
1	104I/4004254C5	Gauge, Low Coolant Sender	155.75	155.75
1	104I/4062312C1	Tank, Surge, Radiator	1,023.00	1,023.00
2	104S/FLTNFELC5050GCDT2	COOLANT, FLEETRITE 50/50 JUG	12.99	25.98
2	EHC12	ENVIRONMENTAL HANDLING CHARGE 1.2	1.20	2.40
Prepay: \$0.00 Parts: \$1,251.58 Labor: \$324.00 Misc: \$2.40 Sublet: \$0.00				\$1,577.98

**JOB #16 00 GENERAL REPAIR**

COMPLAINT TRANS OUTPUT YOKE AND STEADY BEARING YOKE RUST JACKING, MAYBE LOOSE?

CAUSE

CORRECTION FIXED STEADY BEARING NUT, REMOVED OLD NUT AND WASHER, REPLACED WITH NEW NUT AND WASHER, TIGHTENED DOWN, INSTALLED NEW STRAP KIT. WAITING ON STRAP KIT FOR TRANSMISSION OUTPUT YOKE, MIGHT NEED A NUT AS WELL.  
REMOVED DRIVESHAFT.  
STRAP BOLTS STRIPPED, TOOK EXTRA TIME TO REMOVE.  
REMOVED OLD YOKE NUT.  
CLEANED RUST FROM SURFACE.  
INSTALLED NEW YOKE NUT.  
REINSTALLED DRIVE SHAFT WITH NEW STRAP KIT.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
3.60	LABOR 00-10	INSPECT GENERAL INFORMATION		486.00
1	104I/1662738C1	Washer, Companion Flange Nut	10.37	10.37
1	104I/2500669C1	Locknut, Hex	53.08	53.08
2	104I/DS2507018X	U-joint Strap Kit	24.19	48.38
1	104I/FULK4122	Nut Kit, Hex Flange Crimped	42.77	42.77
Prepay: \$0.00 Parts: \$154.60 Labor: \$486.00 Misc: \$0.00 Sublet: \$0.00				\$640.60

**JOB #17 00 GENERAL REPAIR**

COMPLAINT #3 OUTER TIRE LOW ON AIR PRESSURE

CAUSE

CORRECTION INFLATE TIRE TO CORRECT PRESSURE

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.10	LABOR 00-10	INSPECT GENERAL INFORMATION		13.50
Prepay: \$0.00 Parts: \$0.00 Labor: \$13.50 Misc: \$0.00 Sublet: \$0.00				\$13.50



**Sold Operations (Cont.)**

**JOB #18 00**

**GENERAL REPAIR**

COMPLAINT  
CAUSE

DRAGLINK ISN'T TAKING GREASE ON BOTH ENDS

CORRECTION

was able to get right side of draglink to take grease, other side still isn't taking grease, might need a new draglink  
was able to get right side of draglink to take grease, other side still isn't taking grease, might need a new draglink

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.50	LABOR 00-10	INSPECT GENERAL INFORMATION		67.50
2	104X/56698R1	TERMINAL	1.81	3.62
Prepay: \$0.00    Parts: \$3.62    Labor: \$67.50    Misc: \$0.00    Sublet: \$0.00				\$71.12

<b>Sold Operations Totals</b>	<b>Prepay: \$0.00</b>	<b>Parts: \$7,205.01</b>	<b>Labor: \$3,780.00</b>	<b>Misc: \$18.26</b>	<b>Sublet: \$0.00</b>	<b>\$11,003.27</b>
-------------------------------	-----------------------	--------------------------	--------------------------	----------------------	-----------------------	--------------------

# INVOICE REPRINT

I AM THE PERSON OR AGENT ACTING ON BEHALF OF THE PERSON WHO IS OBLIGATED TO PAY FOR THE REPAIR OF THE MOTOR VEHICLE SUBJECT TO THE REPAIR AGREEMENT. I UNDERSTAND THAT THE VEHICLE IS SUBJECT TO REPOSSESSION IN ACCORDANCE WITH THE BC REPAIRERS LIEN ACT, IF PAYMENT FOR THE REPAIR OF THE MOTOR VEHICLE IS NOT MADE IN ACCORDANCE WITH THE TERMS OF THE CREDIT ACCOUNT OR DISHONORED FOR ANY REASON.

**Statement of Disclaimer**

The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

CUSTOMER SIGNATURE

	ESTIMATED	BILLED
LABOR		\$3,780.00
PARTS		\$7,205.01
MISC		\$18.26
SUBLET		\$0.00
Prepay		\$0.00
<b>SUBTOTAL</b>		<b>\$11,003.27</b>
SHOP SUPPLIES		\$378.00
MISC SUPPLIES		\$0.00
PST		\$0.00
GST		\$569.06
<b>TOTAL</b>		<b>\$11,950.33</b>

Please Remit Payment to:  
DAWSON INTERNATIONAL TRUCK CENTRES LTD.  
1495 Iron Mask Rd  
Kamloops, BC V1S 1C8

X  
SIGNATURE OF PERSON RESPONSIBLE OR AGENT FOR PERSON RESPONSIBLE FOR PAYMENT.



# Dawson

## TRUCK CENTRES

DAWSON INTERNATIONAL TRUCK  
CENTRES LTD.  
7156 Meadowlark Rd.  
VERNON, BC V1B 3R6  
P: (250) 545-2381  
F:  
www.dawsontruckcentres.com  
GST: 136913514

**SERVICE INVOICE: R104012752:01**

**CUSTOMER PO#: CF-13839491**

**ESTIMATE: R104012751:01**

**Tag Number:**

**License Plate Number:**

**BILL TO**  
WARRANTY NAVISTAR - &WNAV

P: (250) 763-2327  
F:

**DELIVER TO**  
DAWSON IDEALEASE (FOR TC USE ONLY!!) -  
102584  
3953 Highway 97 North  
KELOWNA BC V1X 6S4  
P: (250) 763-2327  
F:

DATE ARRIVED	DATE INVOICE	SALES TYPE	ADVISOR	TERMS	CUSTOMER PO#
2025-10-09 1:28:21PM	10/9/2025	SWN	S Rutter	INT	CF-13839491

YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT #	ENGINE HOURS	IN SERVICE	Component Serial #	ODOMETER
2019	INTERNATIONAL	LT	3HSDZAPR8KN392213	3575L	0		80103144	426541

### Sold Operations

#### JOB #4 00 GENERAL REPAIR

**COMPLAINT CAUSE** EGR OUTLET PIPE LEAKING, COOLER MAY BE RUPTURED

**CORRECTION** DRAINED COOLANT AND REMOVED INTAKE PIPING AND TURBO. REMOVED ALL LINES INTO EGR COOLER AND PULLED IT OUT. NEW COOLER IS DIFFERENT, INSTALLED NEW UPPER MOUNT THEN PUT IN COOLER AND BOLTED IT UP, INSTALL ALL LINES TO COOLER AND REPLACED SEAL IN REAR COOLANT MANIFOLD WHEN RE-INSTALLING IT. HAD TO REMOVE RH FENDER SO I COULD CONNECT EGR INLET PIPE TO REAR OF COOLER. INSTALL TURBO AND INTAKE PIPING.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
9.00	LABOR 00-10	INSPECT GENERAL INFORMATION		1,530.00
1	104C/3163075	PAINT	48.81	48.81
2	104C/4944257	WASHER,SEALING	28.95	57.90
1	104C/5693915	KIT,EXH EGR COOLER	4,447.28	4,447.28
1	EHC01	ENVIRONMENTAL HANDLING CHARGE 0.1	0.10	0.10
2	EHC12	ENVIRONMENTAL HANDLING CHARGE 1.2	1.20	2.40
Prepay: \$0.00 Parts: \$4,553.99 Labor: \$1,530.00 Misc: \$2.50 Sublet: \$0.00				\$6,086.49

<b>Sold Operations Totals</b>	<b>Prepay: \$0.00</b>	<b>Parts: \$4,553.99</b>	<b>Labor: \$1,530.00</b>	<b>Misc: \$2.50</b>	<b>Sublet: \$0.00</b>	<b>\$6,086.49</b>
-------------------------------	-----------------------	--------------------------	--------------------------	---------------------	-----------------------	-------------------



# INVOICE REPRINT

I AM THE PERSON OR AGENT ACTING ON BEHALF OF THE PERSON WHO IS OBLIGATED TO PAY FOR THE REPAIR OF THE MOTOR VEHICLE SUBJECT TO THE REPAIR AGREEMENT. I UNDERSTAND THAT THE VEHICLE IS SUBJECT TO REPOSSESSION IN ACCORDANCE WITH THE BC REPAIRERS LIEN ACT, IF PAYMENT FOR THE REPAIR OF THE MOTOR VEHICLE IS NOT MADE IN ACCORDANCE WITH THE TERMS OF THE CREDIT ACCOUNT OR DISHONORED FOR ANY REASON.

**Statement of Disclaimer**

The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

CUSTOMER SIGNATURE

	ESTIMATED	BILLED
LABOR		\$1,530.00
PARTS		\$4,553.99
MISC		\$2.50
SUBLET		\$0.00
Prepay		\$0.00
<b>SUBTOTAL</b>		<b>\$6,086.49</b>
SHOP SUPPLIES		\$0.00
MISC SUPPLIES		\$0.00
PST		\$0.00
GST		\$304.32
<b>TOTAL</b>		<b>\$6,390.81</b>

Please Remit Payment to:

DAWSON INTERNATIONAL TRUCK CENTRES LTD.  
1495 Iron Mask Rd  
Kamloops, BC V1S 1C8

X  
SIGNATURE OF PERSON RESPONSIBLE OR AGENT FOR PERSON RESPONSIBLE FOR PAYMENT.