

X24-2
BLUE-MAR



Bobcat of EDMONTON

www.calmont.ca

14566 Yellowhead Trail
Edmonton, AB, T5L 3C5
Phone: (780) 448-4522

CUSTOMER #: _____

31003367S

INVOICE

PAGE 1

T-BAR CONTRACTING LTD
11324-163 STREET NW
EDMONTON, AB T5M 1Y
HOME:780-496-9411 CONT:780-496-9411
BUS: _____ CELL: _____

SERVICE ADVISOR: 15357 TANYA LADOUCEUR

COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	ODOMETER IN/ OUT	TAG	
	00	BOBCAT S630	A3NT11174		3879/3879	T1174	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN00 DD			17:00 20FEB26		0.00	CASH	23FEB26

R.O. OPENED	READY	OPTIONS:
08:17 27JAN26	13:34 23FEB26	STK:1474 10)GROUP-SSL

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A TRAVEL TO AND FROM SITE
 99-000-0001 TRAVEL TO AND FROM SITE
 15264 CTT 99.00 99.00
 PARTS: 0.00 LABOR: 99.00 OTHER: 0.00 TOTAL LINE A: 99.00
 3879

B DIAG - HYDRAULIC LEAK FROM LH SIDE OF MACHINE
 99-000-0001 DIAG - HYDRAULIC LEAK FROM LH SIDE OF MACHINE
 15264 CFW 198.00 198.00
 PARTS: 0.00 LABOR: 198.00 OTHER: 0.00 TOTAL LINE B: 198.00
 3879 2026-02-05 18:44:32 UTC Brad Dancause 15264 customer complaint

of oil leak on left side under the cab. inspected and found the left side pintle seal is leaking. started quote to repair. customer needs repair done quickly before other issues are looked at. job not done

C** PINTLE SEALS LEAKING
 99-000-0001 PINTLE SEALS LEAKING
 15263 CBOB 1080.00 1080.00
 2 6678226 SEAL, OIL 39.25 39.25 78.50
 2 6660814 RING QUAD 17.26 17.26 34.52
 1 17C680 BOLT 20.04 20.04 20.04
 3 6715163 BUSHING FLANGED 9.80 9.80 29.40
 1 6701535 SPRING CENTERING 12.27 12.27 12.27
 2 6715163 BUSHING FLANGED 9.80 9.80 19.60
 2 6702716 BLOCK WEAR 50.54 50.54 101.08
 2 6706098 BUSHING CENTERING 12.20 12.20 24.40
 2 6577058 PIN HAND CONTROL 21.66 21.66 43.32
 2 6687913 SEAL 5.91 5.91 11.82
 2 7103708 BRACKET 58.64 58.64 117.28
 2 99101 SPEEDY SLEEVE 49.54 49.54 99.08
 PARTS: 591.31 LABOR: 1080.00 OTHER: 0.00 TOTAL LINE C: 1671.31
 3879 Confirmed complaint. Both pintle seal are leaking. Remove steering linkage mounting hardware. Remove centering spring. Remove

Terms: Net 10th of month following.
Interest of 2% (26.4% per annum) if overdue.

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
G.S.T	
PLEASE PAY THIS AMOUNT	

CUSTOMER SIGNATURE _____

GST No. 78180 7482 RT0001

CUSTOMER #:

31003367S



Bobcat
of EDMONTON

INVOICE

T-BAR CONTRACTING LTD
11324-163 STREET NW
EDMONTON, AB T5M 1Y
HOME:780-496-9411 CONT:780-496-9411
BUS: CELL:

PAGE 2

www.calmont.ca
14566 Yellowhead Trail
Edmonton, AB, T5L 3C5
Phone: (780) 448-4522

SERVICE ADVISOR: 15357 TANYA LADOUCEUR

COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	ODOMETER IN/ OUT	TAG
	00	BOBCAT S630	A3NT11174		3879/3879	T1174

DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN00 DD			17:00 20FEB26		0.00	CASH	23FEB26

R.O. OPENED	READY	OPTIONS: STK:1474 10)GROUP-SSL
08:17 27JAN26	13:34 23FEB26	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

centering plate. Remove pintle arms. Remove centering plate brackets and pintle seal covers. Clean pintle seal covers and centering plate mounting brackets. Replace pintle seals. Replace quad rings. Re-install pintle covers and centering plate mounting brackets. Re-install pintle arms. Re-install centering plate. Re-install centering spring. Re-install steering linkage mounting hardware. Lift unit onto jack stands. Top up hydraulic reservoir. Check for any creep/steering drift. Unit slightly creeping forwards. Adjust steering linkages and re-check. Unit no longer creeps. Both sets of wheels turn at ~450RPM when fully stroked in the forwards direction. Set unit down. Run unit on flow cart. Drive unit around yard for ~15min. Check for any further leaks from hydrostat. No further leaks found. Wash area under cab

D** SPOOL SEALS STARTING TO LEAK

99-000-0001 SPOOL SEALS STARTING TO LEAK

15263 CBOB

540.00 540.00

2 7418836 O-RING

3.46 3.46 6.92

2 82K019 O-RING

4.07 4.07 8.14

2 6683274 SEAL, SPOOL 10

7.30 7.30 14.60

PARTS: 29.66 LABOR: 540.00 OTHER: 0.00 TOTAL LINE D: 569.66

3879 Verify complaint. Found tilt and lift spools to be leaking. Remove emergency lift arm bypass knob. Remove upper half of foot well plastics. Remove tilt and lift actuator mounting hardware. Remove actuator pins. Move actuators out of the way. Remove aux spool cover mounting hardware. Remove spool end cover. Replace leaking spool seals. Replace end cap o-rings. Replace centering o-rings on ends of tilt and lift spools. Re-install spool end cover. Re-install aux spool cover mounting hardware. Re-install actuators onto spools. Install actuator mounting pins. Re-install actuator mounting hardware. Re-install removed foot well plastics. Re-install lift arm bypass knob. Top up hydraulic reservoir. Perform actuator calibration. Lift actuator failed calibration multiple times. Swap lift and tilt actuator connectors. Issue moves to tilt. Lift actuator is weak and unable to fully return actuator to center. Unit requires a new lift actuator. Quote repair

Terms: Net 10th of month following.
Interest of 2% (26.4% per annum) if overdue.

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
G.S.T	
PLEASE PAY THIS AMOUNT	

CUSTOMER SIGNATURE

GST No. 78180 7482 RT0001

CUSTOMER #:

31003367S



Bobcat.
of EDMONTON

www.calmont.ca

14566 Yellowhead Trail
Edmonton, AB, T5L 3C5
Phone: (780) 448-4522

INVOICE

PAGE 3

T-BAR CONTRACTING LTD
11324-163 STREET NW
EDMONTON, AB T5M 1Y
HOME:780-496-9411 CONT:780-496-9411
BUS: CELL:

SERVICE ADVISOR: 15357 TANYA LADOUCEUR

COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	ODOMETER IN/ OUT	TAG	
	00	BOBCAT S630	A3NT11174		3879/3879	T1174	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN00 DD			17:00 20FEB26		0.00	CASH	23FEB26

R.O. OPENED	READY	OPTIONS:	STK:1474 10)GROUP-SSL
08:17 27JAN26	13:34 23FEB26		

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

E** COOLANT RESERVOIR FALLS OUT OF MOUNTING PLATE
 99-000-0001 COOLANT RESERVOIR FALLS OUT OF MOUNTING PLATE

15263 CBOB 90.00 90.00
 PARTS: 0.00 LABOR: 90.00 OTHER: 0.00 TOTAL LINE E: 90.00
 3879 Verify complaint. Coolant reservoir loose within mounting bracket. Bend coolant reservoir mounting bracket to more tightly hold reservoir. Verify repair. Coolant reservoir now tightly secure within mounting bracket

F** DIAG - RH THUMB PADDLE SWITCH FAULT ACTIVE
 99-000-0001 DIAG - RH THUMB PADDLE SWITCH FAULT ACTIVE

15263 CBOB 360.00 360.00
 PARTS: 0.00 LABOR: 360.00 OTHER: 0.00 TOTAL LINE F: 360.00
 3879 Verify complaint. Unit has active RS thumb switch not in neutral code and intermittent RS joystick thumb switch out of range high code. Check condition of wiring. All wiring in good condition. Unit requires new RS joystick grip. Quote repair. Customer declined repair

G** SUPPLY ONLY - WINDOW WIPER NOT WORKING
 99-000-0001 SUPPLY ONLY - WINDOW WIPER NOT WORKING

15263 CBOB 0.00 0.00
 1 7155024 HARNESS DOOR 154.68 154.68 154.68
 PARTS: 154.68 LABOR: 0.00 OTHER: 0.00 TOTAL LINE G: 154.68
 3879

H** REPLACE LIFT ACTUATOR
 99-000-0001 REPLACE LIFT ACTUATOR

15263 CBOB 360.00 360.00
 1 7101672 ACTUATOR 1289.31 1289.31 1289.31
 1 7108236 PIN 18.47 18.47 18.47

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
G.S.T	
PLEASE PAY THIS AMOUNT	

Terms: Net 10th of month following.
Interest of 2% (26.4% per annum) if overdue.

CUSTOMER SIGNATURE

GST No. 78180 7482 RT0001

CUSTOMER #:

31003367S



Bobcat
of EDMONTON

www.calmont.ca

14566 Yellowhead Trail
Edmonton, AB, T5L 3C5
Phone: (780) 448-4522

INVOICE

T-BAR CONTRACTING LTD
11324-163 STREET NW
EDMONTON, AB T5M 1Y
HOME:780-496-9411 CONT:780-496-9411
BUS: CELL:

PAGE 4

SERVICE ADVISOR: 15357 TANYA LADOUCEUR

COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	ODOMETER IN/ OUT	TAG
	00	BOBCAT S630	A3NT11174		3879/3879	T1174

DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN00 DD			17:00 20FEB26		0.00	CASH	23FEB26

R.O. OPENED	READY	OPTIONS: STK:1474 10)GROUP-SSL
08:17 27JAN26	13:34 23FEB26	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

PARTS: 1307.78 LABOR: 360.00 OTHER: 0.00 TOTAL LINE H: 1667.78

3879 Lift Actuator Fails Calibration Remove lift actuator mounting hardware. Remove faulty lift actuator. Install new actuator, using new spool pin. Install lift actuator mounting hardware. Make electrical connection. Perform actuator calibration. Unit passes calibration multiple times

ESTIMATE: 1,326.25 20FEB26 15:50 SA: 15357

CONTACT:

ESTIMATE: 0.00 10FEB26 11:17 SA: 15357

CONTACT:

ESTIMATE: 154.68 10FEB26 11:16 SA: 15357

CONTACT:

ESTIMATE: 620.97 09FEB26 12:28 SA: 15357

CONTACT:

Terms: Net 10th of month following.
Interest of 2% (26.4% per annum) if overdue.

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
G.S.T	
PLEASE PAY THIS AMOUNT	

CUSTOMER SIGNATURE

GST No. 78180 7482 RT0001

