

KIPP SCOTT



6841—50th AVENUE | Red Deer, Alberta T4N 4E2

PHONE: 403-343-6633 | FAX: 403-350-2201

www.kippscott.ca | G.S.T. #102848470

M08-1

Promised: 02/18/2020 5:00:00 PM

Printed 02/28/2020 11:51 AM



PO
Fleet # W

Cashiered Date:

Page: 1

Tag *** Service Invoice Customer Copy *** SO #: 1131012

Customer No: OLDS COLLEGE UNIT 1GCEC14C07Z5237 OLDS, AB T4H 1R6	Advisor: Perry Penman	Invoice Date: 02/28/2020	Term: CASH
Home:	Bus: (403) 556-8281	License No BGM9264	Odometer In 114966
Cell:	Today:	Odometer Out 114989	Delivery Date
Email:		Year Make 2012 CHEVROLET	Model EXPRESS COMMERCIAL
		Vehicle ID No 1GB6G5BL6C1108278	Model No
		Selling Dealer	Colour WHITE
		Engine Size	SO Date 02/18/2020
			InServ Date
			Location
			Fleet #

Request/Concern **Type** **CSR** **Amount**

Original				
1 S	check and advise for truck smoking and running rough			
S	check and advise for truck smoking	C	991266	2546.00

Qty	Price	Ext
1	821.39	821.39
1	7.89	7.89
1	1.79	1.79

Name 99132 Angel Calderon

Cause: performed diagnosis for engine smocking badly when start , checked all engine perimeters all are on spec but found EGR opens even is disable so it need delete exhaust pipe and plug EGR ports kit prepared estimate. **Request Total** 3,377.07

Correction: got authorization to install exhaust pipe and EGR plugs as recommended when got to exhaust manifold bolts one is seized need to be extracted requested time to removed used heat and extractor after 2.5 hours got it out , cleaned treads continuo replacing pipe removed EGR and cooler too. plug EGR ports reassembled engine put new coolant let set out side over night tested in morning it better road tested is good now. costumer to try.
diag. 1.0
lab repair 14
remove broken bolt 2.5

Thank you!

Original				
2 S	check and advise if pro heat system is working			
S	check and advise if pro heat system is working	CMED	991266	612.50

Qty	Price	Ext
1	1352.66	1352.66
1	44.70	44.70

Name 99132 Angel Calderon

KIPP SCOTT



6841—50th AVENUE | Red Deer, Alberta T4N 4E2

PHONE: 403-343-6633 | FAX: 403-350-2201

www.kippscott.ca | G.S.T. #102848470

Promised: 10/24/2019 5:00:00 PM

**** In Progress **** Printed: 10/29/2019 07:32 AM



PO
Fleet W
Tag#:

Cashiered Date:

Page: 1

* Service Invoice Customer Copy *

SO #: 1124118

Customer No: OLDS COLLEGE STE 1GCEC14C07Z5237 OLDS, AB T4H 1R6	Advisor: Jackie Moisan	Invoice Date: 10/29/2019	Term: CASH
Home: Cell: Email:	Bus: (403) 556-8281 Today:	License No BGM9264	Odometer In 111341
		Odometer Out 111342	Delivery Date
		Year 2012	Make CHEVROLET
		Model EXPRESS COMMERCIAL	Model No
		Vehicle ID No 1GB6G5BL6C1108278	Colour WHITE
		Selling Dealer	SO Date 10/24/2019
		Engine Size	InServ Date
			Location
			Fleet#

Request/Concern	Type	CSR	Amount
Original			
1 S check and report on there is excessive smoke coming from the vehicle like a fuel injector may be gone			
S check and report on there is excessive smoke coming from the cheicle like a fuel injector may be gone	CFLT	99535	137.00
S check and report on there is excessive smoke coming from the cheicle like a fuel injector may be gone	CFLT	99535	863.10

Name 99132 Angel Caldron
Name 99427 Shawn Winder

Cause: VERIFIED CUSTOMER CONCERN. AFTER LETTING VEHICLE IDLE FOR 15 MINUTES ON COLD START FOUND EXCESSIVE SMOKE COMING FROM TAILPIPE. BROUGHT VEHICLE IN AND CHECKED DATA ON FUEL INJECTORS. ALL BALANCE RATES ARE WITHIN SPECIFICATIONS AND ARE ALL AROUND 1. SPEC IS +4 TO -4. CHECKED AND FOUND AIR EQUIVELANCY RATIO TO BE AT 0.43:1 TO 0.64:1. SPEC IS 0.8-1.2:1. REMOVED AIR INTAKE AND CHECKED ALL CONNECTIONS. ALL CONNECTIONS ARE OKAY. INSPECTED AND FOUND EGR VALVE TO BE STUCK OPEN CAUSING AIR LEAK BEFORE BOOSTED SECTION OF TURBOCHARGER SYSTEM. WILL NEED TO UNHOOK AND PIN EGR SYSTEM SHUT.

Request Total 1,000.10

Correction: DISABLED EGR SYSTEM AND PINNED SHUT. REASSEMBLED ALL REMOVED COMPONENTS. CHECKED OPERATION AND FOUND AIR EQUIVELANCY RATIO TO BE AT 1.03:1 NOW AND NO MORE EXCESSIVE SMOKE IS COMING FROM TAILPIPE. ADVISE CUSTOMER THAT SOME SMOKE AND HAZE IS NORMAL AS THE VEHICLE HAS BEEN DELETED AND ALL EMISSIONS EQUIPMENT DESIGNED TO KEEP SMOKE FROM COMING OUT OF THE TAILPIPE HAS BEEN REMOVED. COMPLETED.

Original	Type	CSR	Amount
2 WL PLEASE ADVISE ON THE LOCATION OF THE WHEEL LOCK.			
WL PLEASE ADVISE ON THE LOCATION OF THE WHEEL LOCK.	C	99535	0.00

KIPP SCOTT



6841—50th AVENUE | Red Deer, Alberta T4N 4E2

PHONE: 403-343-6633 | FAX: 403-350-2201

www.kippscott.ca | G.S.T. #102848470

Promised: 10/24/2019 5:00:00 PM

**** In Progress **** Printed: 10/29/2019 07:32 AM



PO
Fleet W
Tag#:

Cashiered Date:

Page: 2

* Service Invoice Customer Copy *

SO #: 1124118

Customer No: OLDS COLLEGE STE 1GCEC14C07Z5237 OLDS, AB T4H 1R6	Advisor: Jackie Moisan	Invoice Date: 10/29/2019	Term: CASH
Home: Cell: Email:	Bus: (403) 556-8281 Today:	License No BGM9264	Odometer In 111341
		Odometer Out 111342	Delivery Date
		Year Make 2012 CHEVROLET	Model EXPRESS COMMERCIAL
		Vehicle ID No 1GB6G5BL6C1108278	Selling Dealer
		Engine Size	Model No Colour WHITE
			SO Date 10/24/2019
			InServ Date
			Location
			Fleet#

Request/Concern	Name	Type	CSR	Amount
	99132 Angel Caldron			
Cause:			Request Total	0.00
Correction:	no			

IF YOUR TIRES HAVE BEEN ROTATED OR MOUNTED ON THIS WORK ORDER, FOR SAFETY REASONS YOU WILL HAVE TO HAVE THEM RETORQUED WITHIN 150KMS. THANKS

LABOUR	\$1,000.10
PARTS	\$0.00
SUPPLIES	\$49.76
SUB-TOTAL	\$1,049.86
GST	\$52.49
TOTAL INVOICE	\$1,102.35

GENERAL MOTORS
CANADA

KIPP SCOTT GMC CADILLAC
6841 50 AVENUE
RED DEER, AB, T4N 4E2
403-343-6633

SALE

Clerk #: 000012

REF#: 00000002

14:03:15

Batch #: 320

10/29/19

Inv/Tkt #: 1124118

APPR CODE: 055742

Trace: 2

AMOUNT \$1,102.35

APPROVED

AID: A000000031010
TVR: 00 80 00 80 00
TSI: F8 00

THANK YOU / MERCI

CUSTOMER COPY

18 Pass

KIPP SCOTT



6841—50th AVENUE | Red Deer, Alberta T4N 4E2

PHONE: 403-343-6633 | FAX: 403-350-2201

www.kippscott.ca | G.S.T. #102848470

Promised: 03/13/2019 5:00:00 PM

**** In Progress ****



Page: 1

PO
Fleet
Tag#:

Cashiered Date:

*** Service Invoice Customer Copy ***

SO #: 1109836

Customer No: OLDS COLLEGE STE 1GCEC14C07Z5237 OLDS, AB T4H 1R6		Advisor: Jackie Moisan		Invoice Date: 03/15/2019		Term: CASH	
Home:		Bus: (403) 556-8281		License No: BGM9264		Odometer In: 105752	
Cell:		Today:		Odometer Out: 105756		Delivery Date:	
Email:				Year Make Model: 2012 CHEVROLET EXPRESS COMMERCIAL		Stock No:	
				Vehicle ID No: 1GB6G5BL6C1108278		Colour: WHITE	
				Engine Size:		Location: NORTH	
				Selling Dealer:		SO Date: 03/13/2019	
						InServ Date:	
						Fleet#:	

Request/Concern	Type	CSR	Amount
Original			
1 S check and report on the check engine light is on and about to derate :see estimate 2019842 for delete			
S check and report on the check engine light is on and about to derate	CFLT	99535	1370.00
QTY	SL	Price	Ext
1 1200.00 10707 40428	BULLY DOG PROGRAMMER	1200.00	1200.00
1 550.00 204 864	4" EXHAUST	550.00	550.00

Name 99427 Shawn Winder

Cause: CUSTOM DEF DELETE Request Total 3,120.00

Correction: ON ROAD TEST COULD HEAR A HISSING NOISE FROM THE FRONT.INSPECTED AND FOUND TURBOCHARGER BOOT CLAMP HAS COME OFF CAUSING SYSTEM TO FILL EXHAUST FULL OF SOOT AND GO INTO LIMP MODE. TUNED VEHICLE AND INSTALLED CUSTOM EXHAUST.CHECKED OPERATION.ENGINE OPERATING PROPERLY NOW.PLEASE KEEP TUNER IN VEHICLE AT ALL TIMES

A0388
C/T Rans

IF YOUR TIRES HAVE BEEN ROTATED OR MOUNTED ON THIS WORK ORDER, FOR SAFETY REASONS YOU WILL HAVE TO HAVE THEM RETORQUED WITHIN 150KMS. THANKS

Thank you!

LABOUR	\$1,370.00
PARTS	\$1,750.00
SUPPLIES	\$49.76
SUB-TOTAL	\$3,169.76
GST	\$158.49
TOTAL INVOICE	\$3,328.25