

Remit To: Edmonton Kenworth Ltd.
 17335 118 Avenue
 Edmonton, AB
 T5S 2P5
 Tel: 780-453-3431 Fax: 780-454-6124

Purchased From
 Edmonton Kenworth (West)
 17335 - 118 Avenue
 Edmonton, Alberta T5S 2P5
 Phone: 780-453-3431

Invoice: 28M0813194
 Date / Hour: 1/31/2026 10:50:43AM
 Repair Order: 13194
 Customer:
 Branch: M08
 Total Invoice: \$1,826.35
 Charge

D16-12
 MAY

Bill To: BOYD VENTURES INC.

Ship To: BOYD VENTURES INC.

Office Phone:
 Shop Phone:
 Email:

Work: Shop: Fax:
 Customer P/O: Add User: Ltesior
 Open Date: 01/31/2026 Completion Date: 01/30/2026
 Salesperson: Vcouler
 Unit Number: 161 Model Year: 2025 Make/Model: KENWORTH W900B
 Type: Class 8 VIN: 1XKWD40X3SR981317 Meter: 137574 Kilometers

Task: 1 34-020000 LIGHTING SYSTEM - REAR LAMPS - DIAGNOSE Department: ServTruck
 Complaint: Customer complaint of the tail lights not working. Also request the air cleaner lights be hooked up and moved to turn on with the under glow.
 Correction: Inspected unit looked up a wiring diagram trouble shot checked voltages the tail lights were only getting 8 volts. Cut harness loose checked voltage at the next harness connector the connector was full of corrosion. Had to cut everything loose from there to the back of the chassis for slack. Spliced the harnesses together checked operation everything works now tied hoses and harnesses back up wrapped so nothing will rub through. Removed the air cleaner lids hooked the lights back up reassembled. Pulled the dash apart found where the lights were tied in had to pull the whole dash apart they weren't tied into the same place. Rewired to the under glow switch reassembled the dash tested ok.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
G1200	83-3110	BUTT CONN 22-18 GA	EA	18.0	\$0.18	\$3.24
G1200	83-3111	BUTT CONN 16-14 GA	EA	8.0	\$0.18	\$1.08
G1200	83-3112	BUTT CONN 12-10 GA	EA	2.0	\$0.18	\$0.36
G1475	8440013GRC	TUBING HEAT SHRINK BLK 3/8X6" B1G20	EA	1.0	\$1.78	\$1.78
G1475	8440053GRC	TUBING HEAT SHRINK BLK 3/16X6" B1G20	EA	11.0	\$1.13	\$12.43
P0100	CT04311	TIE-CABLE 50LB 11.75" BLK	EA	7.0	\$0.20	\$1.40
P0100	CT05512	TIE-CABLE 120LB 15.25" BLK	EA	32.0	\$0.51	\$16.32
P0100	VT10380	TERMINAL-WIRE RING INSLTD NYL 3/8 1	EA	1.0	\$0.41	\$0.41
	STSSE	ENV/MISC SUPPLIES		1.0	\$126.10	\$126.10

Customer Tax ID: 853752756RT0001

Detail Tax Info:

GST REGISTRATION NUMBER: R101577278
 \$86.97
 Total: \$86.97

Total Parts: \$37.02
 Total Labor: \$1,576.26
 Total Miscellaneous: \$126.10
 Invoice Subtotal: \$1,739.38
 Total Tax: \$86.97
 Total Invoice: \$1,826.35

Payment Method Terms Due Date
 Charge Net 15th of month 2/15/2026

Remit To: Edmonton Kenworth Ltd.
 17335 118 Avenue
 Edmonton, AB
 T5S 2P5
 Tel: 780-453-3431 Fax: 780-454-6124

Purchased From
 Edmonton Kenworth (West)
 17335 - 118 Avenue
 Edmonton, Alberta T5S 2P5
 Phone: 780-453-3431

Invoice: 28M0813141
 Date / Hour: 1/20/2026 1:24:37PM
 Repair Order: 13141
 Customer:
 Branch: M08
 Total Invoice: \$1,282.33
 Charge

Bill To: BOYD VENTURES INC.

Ship To: BOYD VENTURES INC.

Office Phone:
 Shop Phone:
 Email:

Work:	Shop:	Fax:
Customer PID: Add User: Ulessler	Open Date: 12/23/2025	Completion Date: 12/29/2025
Unit Number: 161	Model Year: 2025	Make/Model: KENWORTH W900B
Type: Class B	VIN: 1XKWD40X3SR981317	Meter: 125951 Kilometers

Task: 1 45-000008 ENGINE PERFORMANCE - DIAGNOSE Department: ServTruck

Complaint: Customer complaint of the high idle not working properly. Unit revs up to 1300 and won't come back down.
 Correction: Hooked up to the ECM checked faults there wasn't any. Inspected the cruise switches and monitored was able to duplicate the problem. Pulled the dash apart checked the switches found the set resume switch not working correctly. Didn't have a new switch went to customers other shop and got a switch out of another unit. Returned installed in this unit tested now it works, reassembled. Got a new switch from the shop returned on another trip installed the switch reassembled and tested.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
P0100	P27-104Q-15	SWITCH-ROCKER CRUISE CONTROL	EA	1.0	\$150.08	\$150.08
	STSSSE	ENV/MISC SUPPLIES		1.0	\$35.70	\$35.70
Task 1 Subtotals				Parts:		\$150.08
				Labor:		\$448.21
				Miscellaneous:		\$35.70
Task 1 Subtotals						\$631.99

Task: 2 34-020000 LIGHTING SYSTEM - REAR LAMPS - DIAGNOSE Department: ServTruck

Complaint: Customer complaint of the light staying lit on the headache rack.
 Correction: Inspected unit looked up a wiring diagram trouble shot. Pulled the junction box apart the rig up installed tested had 8 volts going to the headache rack lights. Traced wiring checking plugs found moisture and corrosion in the trailer plug connection cleaned connections. Reassembled cleaned the junction box back up.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	STSSSE	ENV/MISC SUPPLIES		1.0	\$43.65	\$43.65
Task 2 Subtotals				Parts:		\$0.00
				Labor:		\$545.88
				Miscellaneous:		\$43.65
Task 2 Subtotals						\$589.28

Customer Tax ID: 853752756RT0001

Detail Tax Info:

GST REGISTRATION NUMBER: R101577278 \$81.08
 Total: \$81.08

Total Parts:	\$150.08
Total Labor:	\$991.84
Total Miscellaneous:	\$79.35
Invoice Subtotal:	\$1,221.27
Total Tax:	\$61.06
Total Invoice:	\$1,282.33



25325 117 Ave NW
 Acheson, AB T7X 6C2
 Phone: (780) 447-4488
 WWW.SUMMITTRAILER.CA

SERVICE INVOICE: RA231000214:01
 ESTIMATE:

BILL TO
BOYD VENTURES INC. - 100350

DELIVER TO
BOYD VENTURES INC. - 100350

P:
 F:

P:
 F:

161 -

DATE ARRIVED	DATE INVOICE	SALES TYPE	ADVISOR	TERMS	CUSTOMER PO#	
1/13/2026 11:48:34AM	1/15/2026	SRET	T.KOWALCHUK	AR30		
YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT #	IN SERVICE	ODOMETER
2025	KENWORTH	TANDEM	1XKWD40X3SR981317			1

Operations

JOB# 1 POWER TRAIN REPAIR AS FOLLOWS:

CUSTOMER PAY

CLAIM NUMBER#

COMPLAINT: REPLACE PUMP AIR SHIFTER - SEE STEVE

CAUSE:

CORRECTION: Tested pump air shifter using existing AV295 in cab - no movement of spool
 Removed air lines to air shifter and tried to operate - no air to the synflex (air full in both tanks)
 Traced synflex lines from console and found PTO needed to be engaged for there to be air supply at feather valve
 (intentionally plumbed like this)

With operating of air shifter - found that air shifter was functioning properly but the plastic end cap for spool was broken
 and impeding the spool from shifting (caught on roll pin)
 Removed roll pin and end cap
 Replaced end cap with new
 Tested air shifter (again with existing AV295), spool operating properly with full range of motion and no air leaks at fittings -
 pump air shifter is good
 Resecured air lines back up

STATUS	QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
SOLD	1	231X/PE1206V	PUMP END CAP T10	20.00	20.00
SOLD		LABOR TRUCK	SERVICE LABOR - TRK		217.50
SOLD	Prepay: 0.00	Parts: 20.00	Labor: 217.50	Misc: 0.00	Sublet: 0.00
				Supplies: 21.75	Subtotal: 259.25

Job # 1 Subtotal: 259.25



SERVICE INVOICE: RA231000214:01

ESTIMATE:

Detail Tax Info:

GST 88925-8103 RT	12.96
PST 1012-1258	0.00
Total Taxes:	\$12.96

Subtotal:	\$237.50
PrePay:	\$0.00
Shop Supplies:	\$21.75
Total Taxes:	\$12.96
Total:	\$272.21

Please Remit Payment to:

25325-117 Ave
Acheson, AB T7X 6C2

Debit/Credit accepted.

Etransfer/EFT/Wires contact us at
payments@summittrailer.ca or
587-881-1046

X

SIGNATURE OF PERSON RESPONSIBLE OR AGENT FOR PERSON RESPONSIBLE FOR PAYMENT