

SERVICING DEALERSHIP

COLORADO MOTOR GROUP, L.P./DBA
 MHC KENWORTH - CHEYENNE
 11900 I-80 SERVICE ROAD
 CHEYENNE, WY 82009
 1-307-778-9100

REPAIR ORDER INVOICE

Customer Number: 1	Phone: (403) 998-8755	Invoice Number: R00353700044868
Tax Status: TAX	Terms: CASH	P.O.#: N/A
	Service Date: 7/20/2024	Invoice Date: 7/23/2024



Spruce Hollow Heavy Haul
 2511 Gullford Dr
 Abbotsford BC V2S 5L9

Serial Number	Unit Number	Make / Model	Year	License Number	Mileage
1NKWX4EX6RR983860	708	KENWORTH/W800B	2024		36095

OPERATION 1

COMPLAINT: VEHICLE INSPECTION
 VMRS CODE: 05-999-999-999-06-00
 CORRECTION: INSPECT-TOTAL VEHICLE-TOTAL VEHICLE-NO FAILURE
 INSPECTED UNIT, NO ISSUES FOUND

Labor Total -- .00
 Total Operation 1 -- .00

OPERATION 2

 
COMPLAINT: AMBIENT TEMP SENSOR READING IMPROPERLY. UNIT DERATED
 VMRS CODE: 01-002-010-056-03-08
 CORRECTION: REPLACE WITH NEW-WIRING HARNESS - POWER MIRROR-MIRRORS-
 IMPROPER ELECTRICAL VALUE
 PULLED UNIT INTO SHOP AND STARTED EDS FOR AMBIENT AIR TEMP
 FAULT. FIRST STEP WAS CHECKING FOR PRIMARY FAULTS AND UNIT
 HAD NONE. NEXT WAS TO MONITOR THE INTAKE TEMP SENSOR AND IT
 IS READING 132 DEGREES SO OUT OF SPEC. PUT IN FOR A NEW
 INTAKE TEMP SENSOR. GOT NEW INTAKE MANIFOLD TEMP SENSOR.
 REMOVED OLD SENSOR AND INSTALLED NEW. LOCKED UP REPAIR
 VERIFICATION FOR FAULT AND IT WAS TO IDLE UNIT FOR 1 MIN AND
 PERFORM KEY CYCLE. FAULT WENT INACTIVE. WENT TO PARK UNIT
 FAULT CAME BACK. NEED TO PERFORM FURTHER DIAG FOR FAULT EDS
 CASE DSCDL0200. CONNECTED BACK TO UNIT AND LOOKED UP CODE.
 LOOKED UP LOCATION FOR THE OAT SENSOR AND FOUND THAT IT IS
 BUILT INTO THE DRIVER SIDE MIRROR. FOLLOWED AND INSPECTED
 WIRING WITH NO ISSUES FOUND. DISCONNECTED OAT SENSOR FROM
 THE IP HARNESS AND FOUND A NEW CODE APPEARED FOR THE SENSOR.
 DISCONNECTED OEM HARNESS FROM THE ECM AND TESTED THE
 RESISTANCE OF THE SUPPLY AND RETURN CIRCUITS FOR THE SENSOR.
 FOUND BOTH IN SPEC AT 0.1 OHMS. UNIT NEEDS THE MIRROR W/ OAT
 SENSOR REPLACED. REMOVED AND REPLACED HARNESS/SENSOR, TEMP
 IS READING CORRECTLY, FAULT WENT INACTIVE AND CLEARED, PUT
 DASH BACK TOGETHER AND PARKED

5.8 Hours
 Labor -- 1,467.40
 100% Warranty -- 1,467.40
 Labor Total -- .00

Customer Copy

CONTINUED

TERMS AND CONDITIONS OF THIS SALE ARE SET FORTH BELOW AND THOSE CONTAINED AT THIS WEBSITE, TERMS AND CONDITIONS WHICH ARE INCORPORATED HEREIN BY THIS REFERENCE
 1. PAYMENT: Customer shall pay Dealer the full amount of the Order, which may be due in cash, upon the tender by Dealer to Customer of the Parts, access and repair terms for Customer are approved in writing
 2. WARRANTY: Dealer warrants that the goods are as described in the Order. For Customers whose goods have been only approved in writing by Dealer it is a written contract by a corporate officer or authorized manager of Dealer. This warranty
 3. ASSIGNMENT: Any assignment or transfer of the Order shall be subject to the approval of the American Arbitration Association in accordance with its Commercial Arbitration Rules, subject
 to the applicable law and conditions set forth in the Terms and Conditions contained at this website.



SERVICING DEALERSHIP

COLORADO KENWORTH, LLC, DBA
 MHC KENWORTH - CHEYENNE
 11900 I-80 SERVICE ROAD
 CHEYENNE, WY 82009
 1-307-778-9100

REPAIR ORDER INVOICE

Customer Number: 1		Phone: (403) 998-8755		Invoice Number: R00353700044888	
Tax Status	Terms	P.O.#	Service Date	Invoice Date	
TAX	CASH	N/A	7/20/2024	7/23/2024	

OPERATION 2

RX2897334NXCUM	SENSOR, PRS TEMPERATUR	1	100.05	100.05
CX2897334NXCUM	SENSOR, PRS TEMPERATUR	1	19.83	19.83
CR2897334NXCUM	SENSOR, PRS TEMPERATUR	1	19.83	19.83
P92-4022-11122170	HARNASS-M&H F/OAT SENS	1	800.76	800.76
			Parts --	900.81
			100% Warranty --	900.81
			Parts Total --	.00
			Total Operation 2 --	.00

OPERATION 3

COMPLAINT: PM SERVICE
 VMRS CODE: 01-044-002-001-03-44
 CORRECTION: REPLACE WITH NEW-FILTER ASSEMBLY - FUEL, PRIMARY-FILTERS-
 WORN
 GREASED CHASSIS. REMOVED AND REPLACED FUEL FILTERS, OIL
 FILTER, OIL. FILLED WITH OIL, PRIMED ENGINE. CHECKED OVER
 CHASSIS, NO ISSUES FOUND AT THIS TIME.

K37-1029	FILTER-ELEMENT FUEL 10	1	78.29	78.29
PF5971NNFLG	FILTER-FUEL, SPIN-ON	1	52.33	52.33
LF14000NNFLG	FILTER	1	31.55	31.55
MAJ10W30TG	SYNTHETIC BLEND 10W30	11	19.95	219.45
MAJHD1120LB	120 LB HI-TEMP RED GRE	2	5.50	11.00
			Parts Total --	392.61
			Labor Total --	157.38
			Total Operation 3 --	550.00

OPERATION 4

COMPLAINT: PARTS OVER THE COUNTER
 VMRS CODE: 01-018-001-026-03-00
 CORRECTION: REPLACE WITH NEW-HUBCAP - FRONT STEER WHEEL-FRONT AXLE
 HUBS & BEARINGS-NO FAILURE
 PARTS PURCHASED OVER THE COUNTER

343-4009	HUBCAP-W/PIPE PLUG	6	24.78	148.68
10088LUC	OIL-HUB 32 OZ BOTTLE (2	10.77	21.54
330-3009	GASKET HUBCAP	6	5.97	35.82
RF417-491MP	LED PLG 3-WIRE AMP H/S	1	14.16	14.16
RF817SA-9	LED STROBING AUX. HAZA	1	34.78	34.78
359-5990	PLUGS OIL PKG QTY.25	6	11.38	68.28
FREIGHT	PARTS CHARGE - minor	1	140.00	140.00
			Parts Total --	463.26
			Labor Total --	.00
			Total Operation 4 --	463.26

Customer Copy

CONTINUED

TERMS AND CONDITIONS OF THIS SALE ARE SET FORTH BELOW AND THOSE CONTAINED AT THIS LINKS CONFORMS AND CONDITIONS WHICH ARE INCORPORATED HEREIN BY THIS REFERENCE.
 1. PAYMENT: Customer shall pay Dealer the total amount due on the order, which shall be due in each invoice tendered by Dealer to Customer of the Parts, unless and until credit terms for Customer are approved in writing, signed by a manager or authorized manager of Dealer.
 2. CREDIT: Dealer may, at its discretion, extend credit to Customer on a credit agreement approved by Dealer in a writing signed by a manager or authorized manager of Dealer, the amount, terms and conditions of which shall be set forth in the credit agreement.
 3. DEFERRED: Any delay in payment or failure to pay on the order shall be deemed to be a breach of the credit agreement and shall be subject to the provisions of the credit agreement.
 4. ARBITRATION: Any controversy arising out of or relating to this Order shall be decided by arbitration administered by the American Arbitration Association in accordance with its Commercial Arbitration Rules, subject to the provisions of the credit agreement or set forth in the Terms and Conditions contained at this link.