


A22-1
JUN

1959 Ford Fairlane Convertible
VIN : B9RW110359

| | | | |
|-----------|---------------------|--|--------------|
| 01-Sep-22 | Integra Tire | Service retractable top, clean fuel system Service & repair electrical, Rebuild transmission Replace master cylinder & brake lines Tune up engine, new spark plugs, condenser, cap, rotor, ignition wire set New carburator, new push rod & valve cover gaskets Replace ignition starter switch. | \$ 7,942.85 |
| 30-Apr-22 | Carriage Upholstery | New seats, door side panels, carpet interior Headliner, trunk matting & side panels | \$ 8,027.25 |
| 06-Jun-24 | Integra Tire | New starter motor, new thermostat, Service hard top convertible, new battery | \$ 2,019.79 |
| Total : | | | \$ 17,989.89 |

Integra Tire Red Deer
 Bay 3, 7450 49 Avenue Crescent
 Red Deer, AB. T4P 1X8
 Phone: (403) 356-1178 ~ Fax: 1-888-754-6408
 integratire@gmail.com
 GST # 842182305RT0001

Invoice

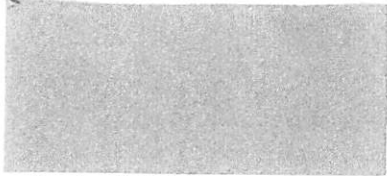

Invoice # 28113
 Work Order # 35274
 Service Advisor Deidra Bennett
 Technician Tim Wiebe

Plate AB ZAPS500
 Description White 1959 Ford Fairlane Base V8 5.4L 5441CC
 332CID VIN G
 VIN B9RW110359
 Odometer 22,699

Invoice Date 9/1/2022 9:10 AM
 Appointment 7/12/2022 10:25 AM
 Promised 9/30/2022 5:00 PM

Concern

Transmission - STUCK IN DRIVE --

Bring in and inspect linkage, ok. Found vehicle is moving forward in neutral. Transmission has an internal failure (forward clutch is stuck on) and need to be replaced.
 Removed transmission to be rebuilt. Found that the flexplate and starter teeth are quite chewed up. Recommend replacement of the flexplate and starter while the trans is out.

Accessories Concern - Retractable Top not working

Verify customers concern and found top is inoperative. Inspect and found no Voltage to top control switch. Trace circuit and found neutral switch is out of adjustment. Adjust switch and found voltage in neutral as designed. Continue to diagnose and found trunk lid unlock but will not raise. Unbolt lift jacks to open manually to diagnose. Found trunk lid lift motor is running but not moving lid. Remove lid jacks and inspect. Found drivers side jack is seized. Disassemble and un- bearings and shafts. Free up bearings, shafts and gears. Grease all moving components and assemble. Reinstall side jacks and lid connections. Lubricate all hinges and screw locks. Clean and lubricate all accessible electrical switches. Found voltage is cutting out when operating top. Diagnose and found voltage supply relay to the relay block is defective. Replace circuit breaker and confirm system operation.

| | | | |
|-----------------------|--------|-----------------|-------------|
| 40amp Circuit breaker | 1 Unit | \$7.05 / Unit | \$7.05 G |
| 50Amp Circuit Breaker | 1 Unit | \$7.05 / Unit | \$7.05 G |
| MOM Starter Switch | 1 Unit | \$12.38 / Unit | \$12.38 G |
| Labor | 6 Hour | \$136.00 / Hour | \$816.00 *G |

Service Advisor: Deidra Bennett

Sub \$842.48

Accessories Concern - Fuel sediment Bowl/Inline Filter

Inspect fuel system and found fuel supply to fuel pump kinked off and filter has lots of sediment in it. Drain fuel tank (vehicle is equip with drain plugs) and all lines. Replace fuel pump with built in filter and proper output to fuel line. Install new line and fuel.

| | | | |
|----------------------|----------|-----------------|-------------|
| Fuel | 1 Unit | \$107.31 / Unit | \$107.31 G |
| Fuel Line | 1 Unit | \$1.90 / Unit | \$1.90 G |
| Mechanical Fuel Pump | 1 Unit | \$110.90 / Unit | \$110.90 G |
| Labor | 1.5 Hour | \$136.00 / Hour | \$204.00 *G |

Service Advisor: Deidra Bennett

Sub \$424.11

Diagnose Electrical Concern - Front turn signal cover in glove box

Inspect all lights and found many repairs are required. Replace LH and RH rear turn/park bulbs and repair socket contacts. Inspect front turn/park lights and found broken wires and bad sockets. Remove both front sockets and modify to install new ones. Wire in both lights and repair ground circuit. Replace LH inner headlight bulb. Inspect revers light and found both unplugged and no voltage getting to the connector. Inspect and adjust revers switch on column. All lights are properly functioning now however the transmission is not functioning properly. Will need to readjust.

| | | | |
|--------------------|---------|-----------------|-------------|
| Contact Socket | 2 Unit | \$6.73 / Unit | \$13.46 G |
| Bulbs | 10 Unit | \$0.67 / Unit | \$6.70 G |
| Headlamp High Beam | 1 Unit | \$27.17 / Unit | \$27.17 G |
| Labor | 5 Hour | \$136.00 / Hour | \$680.00 *G |

Service Advisor: Deidra Bennett

Sub \$727.33

Inspection

Mechanical Inspection 1 hour
See inspection form.

Service

Automatic Transmission Assembly, Remove & Install - Sublet Transmission Rebuild

| | | | |
|----------------------------------|---------|------------------|------------------------------|
| Master O/H Kit w/Steels | 1 Unit | \$441.88 / Unit | \$441.88 G |
| Front Band 2" Offset, Thick Wall | 1 Unit | \$237.50 / Unit | \$237.50 G |
| Bushings-Pump, Extension | 1 Unit | \$21.04 / Unit | \$21.04 G |
| Torque Converter-Custom Build | 1 Unit | \$571.88 / Unit | \$571.88 G |
| Modulator Valve, Blue | 1 Unit | \$51.74 / Unit | \$51.74 G |
| In-Line Filter | 1 Unit | \$26.75 / Unit | \$26.75 G |
| Pump, Lug Style Gear | 1 Unit | \$250.00 / Unit | \$250.00 G |
| Freight | 1 Unit | \$119.64 / Unit | \$119.64 G |
| Labor - Rebuild | 1 Unit | \$703.12 / Unit | \$703.12 G |
| Transmission Flush | 2 Unit | \$35.02 / Unit | \$70.04 G |
| Labor - Remove & Install | 5 Hours | \$136.00 / Hours | \$680.00 *G |
| Service Advisor: Deidra Bennett | | | |
| | | | Sub <u>\$3,173.59</u> |

Brake Hydraulic Line(s) - Front drivers side - parts in cab - CHECK BRAKE SYSTEM

Inspect brake hoses and found all hoses to be in good condition. Brake pedal feels soft. Recommend replacing master cylinder. Replaced brake master cylinder, and flushed brake system and bled brakes. Problem corrected.

| | | | |
|---------------------------------|--------|-----------------|----------------------------|
| Master Cylinder | 1 Unit | \$85.33 / Unit | \$85.33 G |
| Master Cylinder Adapter | 1 Unit | \$5.92 / Unit | \$5.92 G |
| Brake Fluid - Dot 3 | 2 Unit | \$13.95 / Unit | \$27.90 G |
| Brake Line | 1 Unit | \$3.80 / Unit | \$3.80 G |
| Labor | 2 Hour | \$136.00 / Hour | \$272.00 *G |
| Service Advisor: Deidra Bennett | | | |
| | | | Sub <u>\$394.95</u> |

Lube, Oil & Filter Service - Regular Oil

Drain and refill engine oil, change engine oil filter and lubricate chassis grease fittings and friction points as required. Check and top off fluid levels, additional charges may apply where fluids are required. Complete a complementary visual vehicle inspection.

| | | | |
|---------------------------------|--------|----------------|----------------------------|
| 10W-30 Engine Oil 5L | 1 Unit | \$70.77 / Unit | \$70.77 FG |
| Oil Filter | 1 Unit | \$9.95 / Unit | \$9.95 EG |
| Drain Plug Gaskets | 1 Unit | \$0.65 / Unit | \$0.65 G |
| Power Steering Fluid | 1 Unit | \$15.92 / Unit | \$15.92 G |
| Brake Cleaner | 1 Unit | \$4.95 / Unit | \$4.95 G |
| Labor | | | \$40.00 *G |
| Service Advisor: Deidra Bennett | | | |
| | | | Sub <u>\$142.24</u> |

Windshield Wiper General Service - Check wipers/motor etc

Install customer supplied washer reservoir. Install and wire washer pump. Run all needed washer lines. Mount switch in dash and wire. Found washers are spraying over roof. Remove both washer nozzles and adjust bend to properly hit the windshield. Run wire into cab and install washer fluid switch.

Inspect why wiper motor inoperative. Inspect and found no voltage to supply circuit at wiper motor. Trace circuit and found circuit breaker for wiper motor is not connected to voltage. Supply ignition voltage to circuit breaker and reinstall breaker and wiper arms.

| | | | |
|---------------------------------|--------|-----------------|----------------------------|
| Washer Pump | 1 Unit | \$42.65 / Unit | \$42.65 G |
| Washer Hose | 4 Unit | \$0.88 / Unit | \$3.52 G |
| Vacuum Hose | 4 Unit | \$0.67 / Unit | \$2.68 G |
| Labor | 3 Hour | \$136.00 / Hour | \$408.00 *G |
| Service Advisor: Deidra Bennett | | | |
| | | | Sub <u>\$456.85</u> |

Maintenance Tune Up, 8 Cylinder Engines

Inspect and found engine is in need of a tune-up. Replace all spark plugs, points, condenser, cap, rotor and custom cut to length ignition wire set. Found vacuum leaking at rear of the carburetor, replace gasket and adjust carburetor. Still leaking at the rear of the carburetor. Remove valve covers to inspect for cause on engine noise. Found cylinder #2 intake push rod is bent and fallen off. Install new push rod and new valve cover gaskets. Replace and adjust carburetor.

| | | | |
|------------|--------|---------------|-----------|
| Spark Plug | 8 Unit | \$4.98 / Unit | \$39.84 G |
|------------|--------|---------------|-----------|

| | | | |
|---------------------------------|----------|-----------------|-----------------------|
| Air Filter | 1 Unit | \$26.13 / Unit | \$26.13 G |
| Distributor Cap | 1 Unit | \$47.77 / Unit | \$47.77 G |
| Rotor ASY | 1 Unit | \$8.25 / Unit | \$8.25 G |
| Contact Set | 1 Unit | \$33.20 / Unit | \$33.20 G |
| Vacuumtee | 1 Unit | \$4.38 / Unit | \$4.38 G |
| Wire Set | 1 Unit | \$61.02 / Unit | \$61.02 G |
| Condenser ASY | 1 Unit | \$21.72 / Unit | \$21.72 G |
| Gasket | 1 Unit | \$16.68 / Unit | \$16.68 G |
| Clip | 1 Unit | \$6.15 / Unit | \$6.15 G |
| Hose Clamp | 2 Unit | \$1.70 / Unit | \$3.40 G |
| Carburator | 1 Unit | \$483.28 / Unit | \$483.28 G |
| Push Rod | 1 Unit | \$45.00 / Unit | \$45.00 G |
| Labor | 3.5 Hour | \$136.00 / Hour | \$476.00 *G |
| Service Advisor: Deidra Bennett | | | |
| | | | Sub <u>\$1,272.82</u> |

Replace Ignition Switch

Remove and Replace components as required to access and install materials, and/or perform needed service, adjustments as required. Retest and verify repair as required. Perform final road test where applicable.

| | | | |
|-------------------------|--------|----------------|--------------------|
| Ignition Starter Switch | 1 Unit | \$93.00 / Unit | \$93.00 G |
| | | | Sub <u>\$93.00</u> |

| | | | |
|--|--|-------------|--------------------------|
| Total Parts | | | \$3,951.37 |
| Total Labor | | | \$3,576.00 |
| Total Before Taxes & Miscellaneous Charges | | | <u>\$7,527.37</u> |
| (*) Shop Supplies | | | \$35.95 G |
| (E) Environmental Disposal Charge | | | \$1.20 G |
| (F) Fluid Disposal | | \$0.10 Each | \$0.10 G |
| (G) Canadian Goods and Services Tax (GST) | | 5 % | <u>\$378.23</u> |
| Grand Total | | | <u>\$7,942.85</u> |

paid \$7,942.85 by Master Card

Integra Tire Red Deer would like to thank you for your patronage and we look forward to serving you in your future automotive needs.

Carriage Upholstery Ltd.

Mailing Address: 34 Livingston

Close, Lacombe AB, T4L 2J3.

Shop: 27017 TWP RD 405.5

Lacombe County AB

+1 4033468985

service@carriageupholstery.com

GST/HST Registration No.:

731898474RT0001



Invoice

| BILL TO |
|---------|
| |

| INVOICE # | DATE | TOTAL DUE | DUE DATE | TERMS | ENCLOSED |
|-----------|------------|------------|------------|----------------|----------|
| 4117 | 31/05/2024 | \$8,027.25 | 31/05/2024 | Due on receipt | |

| DATE | ACTIVITY | DESCRIPTION | TAX | QTY | RATE | AMOUNT |
|------------|-------------------------------|--|-----|-----|----------|----------|
| 31/05/2024 | Labour & Materials | 1959 Ford Fairlane convertible hard top. Bench seats: front split bench and rear. Gold and black with silver piping. Door panels, add gold on the top and re-install. order correct sill plates and install Order headliner material and install Order carpet and install Order trunk matting and install panels | GST | 1 | 7,645.00 | 7,645.00 |

We appreciate your business. Payment is due as per due date above.

Please be aware that we will charge 2.0% interest per month on late invoices.

We accept all major credit cards, cheques, cash and e-transfers
(Service@carriageupholstery.com)

| | |
|--------------------|-------------------|
| SUBTOTAL | 7,645.00 |
| GST @ 5% | 382.25 |
| TOTAL | 8,027.25 |
| BALANCE DUE | \$8,027.25 |

TAX SUMMARY

| RATE | TAX | NET |
|----------|--------|----------|
| GST @ 5% | 382.25 | 7,645.00 |

Integra Tire Red Deer

Bay 3, 7450 49 Avenue Crescent

Red Deer, AB. T4P 1X8

Phone: (403) 356-1178 ~ Fax: 1-888-754-6408

integratire@gmail.com

GST # 842182305RT0001

Invoice

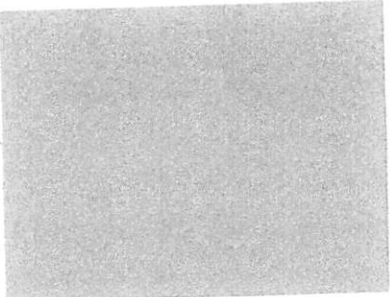


Plate AB ZAPS500
Description White 1959 Ford Fairlane 500 V8 5.8L 5769CC
352CID
VIN B9RW110359
Odometer 23,640

Invoice # 41415
Work Order # 53017
Service Advisor Deidra Bennett
Technician Tim Wiebe

Invoice Date 6/14/2024 9:31 AM
Appointment 6/6/2024 10:22 AM
Promised 6/6/2024 5:00 PM

Service

Starter Motor

Technician Notes: Replace starter motor and starter solenoid.

| | | | |
|------------------|--------|-----------------|-------------|
| Starter Motor | 1 Unit | \$284.75 / Unit | \$284.75 G |
| Starter Solenoid | 1 Unit | \$76.10 / Unit | \$76.10 G |
| Labor | 2 Hour | \$152.00 / Hour | \$304.00 *G |

Service Advisor: Deidra Bennett

Sub \$664.85

Diagnose Heating System Concern - Diagnose Heat - seems to be running a little hot

Technician Notes: Inspect and found engine has a 180 Deg thermostat. Install a new thermostat that opens at 160 Deg, fill with coolant and instal a new radiator cap.

| | | | |
|----------------------------------|----------|-----------------|-------------|
| Coolant Thermostat | 1 Unit | \$10.05 / Unit | \$10.05 G |
| Coolant Thermostat Gasket | 1 Unit | \$1.63 / Unit | \$1.63 G |
| Radiator Cap | 1 Unit | \$9.32 / Unit | \$9.32 G |
| Engine Coolant Thermostat Gasket | 1 Unit | \$1.63 / Unit | \$1.63 G |
| Antifreeze (Concentrate) | 4 Unit | \$10.95 / Unit | \$43.80 G |
| Labor | 2.5 Hour | \$152.00 / Hour | \$380.00 *G |

Service Advisor: Deidra Bennett

Sub \$446.43

Accessories - Service screws on hard top convertible

Technician Notes: Lubricate and adjust screw locks and hinges. Try adjusting RH rear hinge switch and found unable to get switch to contact and rear hid to lift to the proper height. Inspect further and found hinges are worn. Inspect ways to create more spring pressure, but this will not be a good repair. Modify and adjust rear switch to allow rear lid to open higher and function test system. Top is working properly now.

| | | | |
|-------|--------|-----------------|-------------|
| Labor | 3 Hour | \$152.00 / Hour | \$456.00 *G |
|-------|--------|-----------------|-------------|

Service Advisor: Deidra Bennett

Sub \$456.00

Diagnose Power Accessories Concern - Level hardtop

Technician Notes: Try adjusting top, hinge and other components but unable to get top gap at RH front to lower down. This is a body fitment issue.

Test Battery

Technician Notes: Charge battery and test. Battery is defective and will need to be replaced. Replace battery with proper size and most CCA available.

| | | | |
|---------|----------|-----------------|------------|
| Battery | 1 Unit | \$244.38 / Unit | \$244.38 G |
| Labor | 0.5 Hour | \$152.00 / Hour | \$76.00 *G |

Service Advisor: Deidra Bennett

Sub \$320.38

| | | |
|--|-----|-------------------|
| Total Parts | | \$671.66 |
| Total Labor | | \$1,216.00 |
| Total Before Taxes & Miscellaneous Charges | | <u>\$1,887.66</u> |
| (*) Shop Supplies | | \$35.95 G |
| (G) Canadian Goods and Services Tax (GST) | 5 % | <u>\$96.18</u> |
| Grand Total | | \$2,019.79 |

..... paid \$2,019.79 by MasterCard
 6/14/2024 Card #: XXXXXXXXXXXXX Entry Method: Chip Type: Sale Amount: 2019.79
 Terminal: 75503 Transaction: 3b0eb621-f7f7-4b1b-8dd5-812b2965ef96 Authorization: 01493J Result: Approved
 AID: A0000000041010 TC: ARQC: 3BAB91C8176B4A63 TVR: 0000008000 TSI: E800

Buyer agrees to pay total amount above according to cardholder's agreement with issuer.

Integra Tire Red Deer would like to thank you for your patronage and we look forward to serving you in your future automotive needs.