

Ship to:

IN STORE PICKUP

Invoice to:

 INTERNAL CUSTOMER
 INTERNAL CUSTOMER
 INTERNAL W/O AB T5S 2L7

Branch		WETASKIWIN		*REPRINT*	
Date	08/26/25	Time	23:03:11 (B)	Page	01
Account No.	INTER01	Phone No.		Invoice No.	W37635
Ship Via		Purchase Order			
				Salesperson	EDB

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
153002A	JOHN DEERE X9 1100	537	1H0X911XVP0825456		
	X9 1100	379			

Have you heard about MyDealer yet? We have a great new way to help you stay connected to your equipment. Either mobile or laptop - look up parts, order them online, view past purchases, or book a service appointment, you are in control. Ask a parts or service member about MyDealer today!

SEGMENT# 1 C 6007 10-000-200 07/15/25 07/15/25
 GREENLIGHT INSPECTION == INSPECT X9 COMBINE AS PER 27.00 HRS
 CHECKLIST NOTING REPAIRS AND WEAR ITEMS AS FOUND.
 PLEASE NOTE PRESSURES TAKEN. CONSULT WITH OWNER OF MACHINE
 TO WHICH REPAIRS WE RECOMMEND AND WHICH THEY WISH US TO DO.
 HAVE SEGMENTED WORKORDER CREATED, FOR WORK TO BE DONE.
 THIS DOES NOT INCLUDE ANY MAJOR CLEANING OR BLOWING OF THE
 DUST CHAFF OFF.
 -ADD ARROWS TO FEEDERHOUSE AND PLATFORM FOR EASE OF
 ALIGNMENT AND HOOKING UP
 *TECHNICIAN COMMENTS*****
 *
 *PERFORMED GREENLIGHT CHECKLIST-WENT THROUGH WITH CUSTOMER *

10400001	16001001	LABOR	3499.00
		SEGMENT TOTAL==>	3499.00

SEGMENT# 2 C 6007 NA 07/23/25 07/23/25
 REPLACE MISSING SEALS IN FEEDER HOUSE ABOVE FRONT DRUM 5.00 HRS
CORRECTION:
 Removed front shields from feeder house
 Mounts are bent and needed to be straightened
 Riveted new seals on to mounts
 Installed seals

CONTINUED ON PAGE 02

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
 (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



Wetaskiwin
3820 - 47 Street, Wetaskiwin, AB, T9A 2J1
Tel: 780.352.3368 Fax: 780.352.7225
www.horizonagturf.com

Ship to:

IN STORE PICKUP

Invoice to:

INTERNAL CUSTOMER
INTERNAL CUSTOMER
INTERNAL W/O AB T5S 2L7

Branch		
WETASKIWIN		
Date	Time	Page
08/26/25	23:03:11 (B)	02
Account No.	Phone No.	Invoice No.
INTER01		W37635
Ship Via		Purchase Order
		Salesperson
		EDB

SERVICE INVOICE


STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
153002A	JOHN DEERE X9 1100	537	1H0X911XVP0825456		
	X9 1100	379			
Installed front shields back on feeder house					
<u>ADDITIONAL DESCRIPTION:</u>					
(A)					
AXE88178	Cover	1	N	211.51	211.51
AXE88180	Cover	1	N	213.57	213.57
HXE138024	Seal	2		47.28	94.56
HXE160641	Seal	2	N	29.84	59.68
HXE169446	Seal	2	N	42.80	85.60
HXE175200	Seal	1	N	147.70	147.70
M64720	RIVET		RETAIL	1.10	
		14		.93	13.02
			PARTS		825.64
			LABOR		925.00
10400001	16001001		SEGMENT TOTAL==>		1750.64

SEGMENT# 3 C 6007 NA	07/23/25 07/23/25		
REMOVE 1/2 LINKS FROM FEEDER CHAIN		1.50	HRS
<u>CORRECTION:</u>			
Replaced bent feeder chain slat			
Untensioned feeder chain			
Removed 1/2 link from feeder chain			
Connected chain and tensioned			
<u>ADDITIONAL DESCRIPTION:</u>			
REPLACE 1 BENT FEEDER SLAT			
(A)			
HXE113327	Slat	1	60.54 60.54
			PARTS 60.54
			LABOR 277.50
10400001	16001001		SEGMENT TOTAL==> 338.04

CONTINUED ON PAGE 03

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing. Items left for 30 days after completion date will be subject to storage fees,

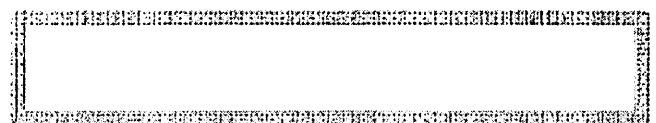

SIGNATURE
RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO

SIGNATURE
RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



Wetaskiwin
3820 - 47 Street, Wetaskiwin, AB, T9A 2J1
Tel: 780.352.3368 Fax: 780.352.7225
www.horizonagturf.com

Ship to:

IN STORE PICKUP

Invoice to:

INTERNAL CUSTOMER
INTERNAL CUSTOMER
INTERNAL W/O AB T5S 2L7

Branch			
WETASKIWIN			
Date	Time	Page	
08/26/25	23:03:11 (B)	04	
Account No.	Phone No.	Invoice No.	
INTER01		W37635	
Ship Via		Purchase Order	
		Salesperson	
		EDB	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
153002A	JOHN DEERE X9 1100	537	1H0X911XVP0825456		
	X9 1100	379			
Installed concaves					
Damaged ones where replaced with new ones					
Level concaves					
Installed separator grates					
<u>ADDITIONAL DESCRIPTION:</u>					
(A) WILL BE USING CONCAVES OUT OF NEW COMBINES					
AXE108905	Concave	1	N	732.72	732.72
AXE108906	Concave	3	N	656.15	1968.45
03M7199	BOLT	1		2.41	2.41
14M7299	NUT	1		2.78	2.78
19M7789	SCREW	1		2.54	2.54
				PARTS	2708.90
				LABOR	740.00
10400001	16001001			SEGMENT TOTAL==>	3448.90

SEGMENT# 7 C 6007 NA 07/23/25 07/23/25
REPLACE BROKE THERSHING ELEMENTS ON LH ROTOR 1.50 HRS

CORRECTION:

Removed damaged threshing elements from 4th row of LH rotor
Cleaned dirt out from behind mounting ears
Torqued new elements to 64 ft/lbs
Found damage to ears on 5th row
Replaced elements on 5th row

ADDITIONAL DESCRIPTION:

(A)

KXE10755	Threshing Eleme	RETAIL	1243.38	
		2	1056.87	2113.74
	Threshing Element			
		PARTS	2113.74	
		LABOR	277.50	

CONTINUED ON PAGE 05

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, it is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



Wetaskiwin
3820 - 47 Street, Wetaskiwin, AB, T9A 2J1
Tel: 780.352.3368 Fax: 780.352.7225
www.horizonaglturf.com

Ship to:

IN STORE PICKUP

Invoice to:

INTERNAL CUSTOMER
INTERNAL CUSTOMER
INTERNAL W/O AB T5S 2L7

Branch		
WETASKIWIN		
Date	Time	Page
08/26/25	23:03:11 (B)	05
Account No.	Phone No.	Invoice No.
INTER01		W37635
Ship Via	Purchase Order	
		Salesperson
		EDB

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
153002A	JOHN DEERE X9 1100	537	1H0X911XVP0825456		
	X9 1100	379			
10400001	16001001			SEGMENT TOTAL==>	2391.24

SEGMENT# 8 C 6007 NA 07/23/25 07/23/25
REPLACE BROKE DISCHARGE BEATER GRATE 2.00 HRS

CORRECTION:

Removed broke discharge beater grate from frame and down
grain pan to remove
Slid new grate up grain pan
Installed new grate

ADDITIONAL DESCRIPTION:

(A)

H164785	FINGER	1	337.11	337.11
			PARTS	337.11
			LABOR	370.00
10400001	16001001		SEGMENT TOTAL==>	707.11

SEGMENT# 9 C 6007 NA 07/23/25 07/23/25
REPLACE RETHERSHER DOOR SEALS AND ADJUST 2.00 HRS

CORRECTION:

Removed rethersher door
Replaced damaged side and lower seals
Reinstalled door and adjusted

ADDITIONAL DESCRIPTION:


(A)

HXE23491	Flap	1 N	29.99	29.99
HXE23617	Isolator	2	53.53	107.06
			PARTS	137.05
			LABOR	370.00
10400001	16001001		SEGMENT TOTAL==>	507.05

CONTINUED ON PAGE 06

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees.

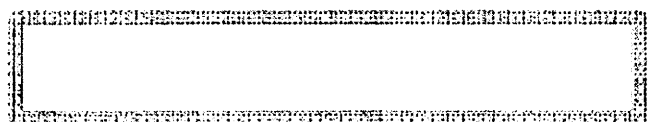

SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO

SIGNATURE
RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



Wetaskiwin
3820 - 47 Street, Wetaskiwin, AB, T9A 2J1
Tel: 780.352.3368 Fax: 780.352.7225
www.horizonagturf.com

Ship to:

IN STORE PICKUP

Invoice to:

INTERNAL CUSTOMER
INTERNAL CUSTOMER
INTERNAL W/O AB T5S 2L7

Branch			
WETASKIWIN			
Date	Time	Page	
08/26/25	23:03:11 (B)	07	
Account No.	Phone No.	Invoice No.	
INTER01		W37635	
Ship Via		Purchase Order	
		Salesperson	
		EDB	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
153002A	JOHN DEERE X9 1100	537	1H0X911XVP0825456		
	X9 1100	379			
				LABOR	185.00
10400001	16001001			SEGMENT TOTAL==>	185.00

SEGMENT#13 C 6007 NA 07/23/25 07/24/25
UPDATE SOFTWARE 2.00 HRS

CORRECTION:

Update software for controllers with new available

ADDITIONAL DESCRIPTION:

(B)

				LABOR	370.00
10400001	16001001			SEGMENT TOTAL==>	370.00

SEGMENT#14 C 6007 NA 07/23/25
REPLACE DENTED FRONT DRUM
(B) (DECLINED)

SEGMENT#15 C 6007 NA 07/23/25
REPLACE LEAKING CHOPPER UNION FITTING
(B) (DECLINED)

SEGMENT#16 C 6007 NA 07/23/25 07/23/25
REPLACE ENGINE ACCESS LADDER LATCH 1.00 HRS

CORRECTION:

Removed latch from engine access ladder

Installed new latch

Panel now opens and close without issue

ADDITIONAL DESCRIPTION:


(B)

AXE93048	Latch	1 N	50.52	50.52
		PARTS		50.52

CONTINUED ON PAGE 08

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,

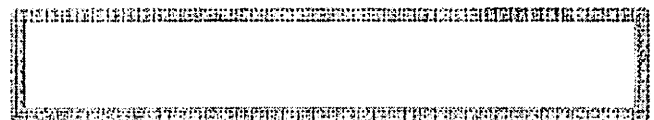

SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



Wetaskiwin
3820 - 47 Street, Wetaskiwin, AB, T9A 2J1
Tel: 780.352.3368 Fax: 780.352.7225
www.horizonagturf.com

Ship to:

IN STORE PICKUP

Invoice to:

INTERNAL CUSTOMER
INTERNAL CUSTOMER
INTERNAL W/O AB T5S 2L7

Branch			
WETASKIWIN			
Date	Time	Page	
08/26/25	23:03:11 (B)	08	
Account No.	Phone No.	Invoice No.	
INTER01		W37635	
Ship Via		Purchase Order	
		Salesperson	
		EDB	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
153002A	JOHN DEERE X9 1100	537	1H0X911XVP0825456		
	X9 1100	379			
				LABOR	185.00
10400001	16001001			SEGMENT TOTAL==>	235.52

SEGMENT#17 C 6007 NA 07/23/25 07/23/25
ADJUST CLEANING FAN SHEAVE GAP 1.00 HRS

CORRECTION:

Adjust cleaning fan sheave gap to 10 mm

ADDITIONAL DESCRIPTION:

(B)

				LABOR	185.00
10400001	16001001			SEGMENT TOTAL==>	185.00

SEGMENT#18 C 6007 NA 07/23/25 07/23/25
REPLACE MISSING RH CHOPPER HOOP PIN .25 HRS

CORRECTION:

Pin securing RH chopper safety hoop was missing
Replaced missing pin

ADDITIONAL DESCRIPTION:

(C)

B2290R	PIN *	1 N	13.96	13.96	
TCU33336	Pin	RETAIL	.82		
		1	.70	.70	
24M7055	WASHER	1	.50	.50	
		PARTS	15.16		
		LABOR	46.25		
10400001	16001001			SEGMENT TOTAL==>	61.41

SEGMENT#19 C 6007 NA 07/23/25
PEFORM FACTORY CALIBRATION ON CHAFFER AND SIEVE
(C)MOVED TO SEGMENT 11

CONTINUED ON PAGE 09

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



Wetaskiwin
3820 - 47 Street, Wetaskiwin, AB, T9A 2J1
Tel: 780.352.3368 Fax: 780.352.7225
www.horizonagturf.com

Ship to:

IN STORE PICKUP

Invoice to:

INTERNAL CUSTOMER
INTERNAL CUSTOMER
INTERNAL W/O AB T5S 2L7

Branch			
WETASKIWIN			
Date	Time	Page	
08/26/25	23:03:11 (B)	09	
Account No.	Phone No.	Invoice No.	
INTER01		W37635	
Ship Via		Purchase Order	
		Salesperson	
		EDB	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
153002A	JOHN DEERE X9 1100	537	1H0X911XVP0825456		
	X9 1100	379			

SEGMENT#20 C 6007 NA 07/23/25 07/24/25
REPLACE IMPACT PLATE BELOW MASS FLOW SENSOR
(C) (DECLINED)

SEGMENT#21 C 6007 NA 07/23/25
ADJUST AUGER STRIPPER GAP ON PICKUP HEADER
(C) (DECLINED)

SEGMENT#22 C 6007 NA 07/23/25 07/23/25
SERVICE 3.00 HRS

CORRECTION:

Changed engine oil and filter
Changed fuel filters
Replaced outer air filter and cab air filters
Topped up coolant
Greased unit

ADDITIONAL DESCRIPTION:

CHANGE ENGINE OIL AND FILTER, CHANGE FUEL FILTERS, REPLACE
OUTER AIR FILTER, REPLACE CABIN FILTERS, TOP UP COOLANT,
GREASE UNIT


(M)

AXE70605	Air Filter	1	37.05	37.05
DZ124761	Filter Element	1	156.09	156.09
DZ124786	FILTER	1	149.94	149.94
ENVO114	OIL ENVIRO FEE	3	1.14	3.42
ENV100	ENVIRO CHARGE	2	1.25	2.50
ENV227	CONTAIN ENV FEE	3	2.27	6.81
ENV50	ENVIRO CHARGE	1	.55	.55
HXE11090	Filter	1	420.44	420.44

CONTINUED ON PAGE 10

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2% PER MONTH
(24% PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing. Items left for 30 days after completion date will be subject to storage fees.

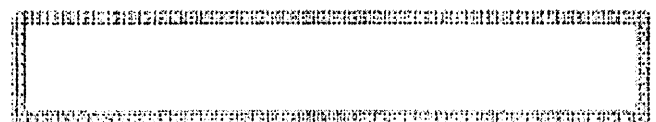

SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



Wetaskiwin
 3820 - 47 Street, Wetaskiwin, AB, T9A 2J1
 Tel: 780.352.3368 Fax: 780.352.7225
 www.horizonagturf.com

Ship to:

IN STORE PICKUP

Invoice to:

INTERNAL CUSTOMER
 INTERNAL CUSTOMER
 INTERNAL W/O AB T5S 2L7

Branch		
WETASKIWIN		
Date	Time	Page
08/26/25	23:03:11 (B)	10
Account No.	Phone No.	Invoice No.
INTER01		W37635
Ship Via		Purchase Order
		Salesperson
		EDB

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
153002A	JOHN DEERE X9 1100	537	1H0X911XVP0825456		
	X9 1100	379			
RE572785	Oil Filter	1		137.88	137.88
TA32591	Air Filter	1		110.84	110.84
TY26576	COOL-GARD II	1		60.11	60.11
TY26679	15W40 P50 18.9L	3		154.45	463.35
TY6341	GREASE	1		10.50	10.50
				PARTS	1559.48
				LABOR	555.00
10400001	16001001			SEGMENT TOTAL==>	2114.48


SEGMENT#23 C 6811 COMBINE WASH 07/23/25
 WASH FOR A COMBINE
 UNIT WENT TO WARBURG

***** WORK ORDER TOTALS *****

	INTERNAL	CUSTOMER
PARTS	9059.35	
LABOR	9141.50	
Shop Supplies	250.00	
INTERNAL TOTAL	18450.85	

**A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
 (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.**

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,

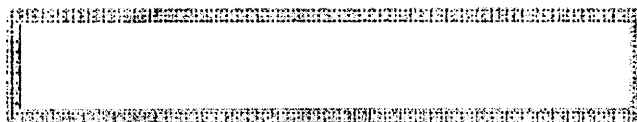

SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO