



Torque & Throttle 44 Mechanics Ltd.
PO Box 1181
Warman SK S0K 4S0
tnt44@sasktel.net
GST/HST Registration No.:
760794545RC0001

FO2-1
SEP
Invoice 0811

BILL TO

TKC Trucking & Picker Service
1019 9 Ave W, Kindersley, SK
S0L 1S0

DATE
06/02/2024

PLEASE PAY
\$23,410.56

DUE DATE
07/03/2024

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
15/12/2023	Labour	Condition 1: Check & Repair diesel fuel in engine oil (customer performed service and monitored level, level is growing again). Correction: R&I valve covers. R&I jake heads & rockers. Removed injectors, cleaned, and inspected. Found faulty injector on #1 cylinder. R&R injector. R&R o-ring seal kits on all injectors. Installed and torqued. Performed top set & programmed injector. R&R engine oil and filter due to diesel contamination. Ran unit and monitored oil level.	10	130.00	1,300.00
	Parts	10r8501 - INJ GP Fuel	1	1,447.69	1,447.69
	Parts	2481394 - Gasket Kit	5	50.17	250.85
	Rotella 15W40 Bulk	500010131D	40	5.88	235.20
	Oil Filter - Cat	LF691AFLG	1	31.73	31.73
	DEX III	DEX III	2	8.42	16.84
	Labour	Condition 2: Check & Repair driving lights. Correction: R&I dash panel. Tested switch, find switch to be faulty. R&R switch.	0.50	130.00	65.00
	Parts	K301-198 - Switch-Toggle	1	90.40	90.40

We appreciate your business and look forward to helping you again soon.

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
	Labour	Condition 3: Driver requested hydraulic filters be replaced.	0.50	130.00	65.00
		Correction: R&R hydraulic filters and marked with date.			
	Parts	HF6711FLG - Filter-Hydraulic	2	36.24	72.48
	Labour	Condition 4: Check & repair LRD dust cover missing. Check & Repair RFD brake pot mounted in wrong mounting holes.	2.50	130.00	325.00
		Correction: Removed LRD wheels. Torch required to removed dust cover bolts being siezed. Installed new dust cover & hardware. Removed brake pot nuts and moved brake pot to proper mounting holes and installed.			
	Parts	A1-3236Q2123 - Shield Dust	1	133.52	133.52
	Labour	Condition 5: Check & Repair bearing gone in back roll. Customer supplied bearings for roll.	8	130.00	1,040.00
		Correction: Removed bolts and grind welds as needed to remove back roll. Removed bearings and backing plates due to wear/damage to roll. Sublet repair needed. Reinstalled repaired live roll with new hardware, bearings purchased and billed to TKC. Shipped to TNT44. Welded & repaired the deck beside back roll due to roll failure, grinded and painted. Greased roll and support rollers. R&R lights and grommets in center of deck below live roll.			
	LED Amber 2"	G3003	1	9.40	9.40
	Grommet 2"	92120	1	2.30	2.30
	LED High Count Red 2.5"	G1032	3	9.75	29.25
	Grommet 2 1/2"	91400	3	1.78	5.34
	Parts	CS8SC-075-275 - 3/4 X 2 3/4 Bolt	4	4.50	18.00
	Parts	CS8SC-075-300 - 3/4 X 3 Bolt	8	4.81	38.48
	Gadus S4 Grease	550027663	6	7.45	44.70
	Parts	Sublet - Roller Repair	1	4,830.00	4,830.00
	Labour	Condition 6: Check & Repair passenger windshield fails.	1	130.00	130.00
		Correction: R&R windshield and cleaned glass.			

We appreciate your business and look forward to helping you again soon.

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
	Parts	DL4717-30 - Glass Kenworth	1	45.39	45.39
	Labour	Condition 7: Check & Repair passenger door window operation. Check & Repair door entry light n/w. Correction: Tested window, window does not operate. R&I outer & inner door panels. Found window motor has power, and the gear is stripped. R&R window regulator. Removed door lamp switch, found pins broken. R&R door lamp and switch with new hardware.	3	130.00	390.00
	Parts	R21-1010R - Regulator-Window	1	940.22	940.22
	Parts	BA28600 - Switch-Door Jamb	1	27.44	27.44
	Parts	K333-511KIT - Kit-Connector	1	37.46	37.46
	Parts	K256-767 - Lmap-Assy Door	1	135.93	135.93
	Labour	Condition 8: Check & Repair speedo n/w. Correction: Hooked up diagnostic tool, tested speedo head, not working. Removed dash. R&R speedo, set parameters the same as the old speedo. using diagnostic test speedo works with diagnostic tool. Took unit for test drive unit still not recording speed. Tested speedo sensor, found speed sensor faulty. R&R speed sensor. Operation all good.	2.50	130.00	325.00
	Parts	GSB11105ATK Gauge Speedometer	1	899.65	899.65
	Parts	Q21-6004 - Sensor Dual	1	229.63	229.63
	Labour	Condition 9: Check & Repair drivers door panel falling off. Correction: R&I inner & outer door panels. Found all screws pulled through. Installed 10 #8 nutserts. Lamp switch n/w, found pins broke in connector. R&R door lamp and switch with new hardware.	2.50	130.00	325.00
	Parts	BA28600 - Switch-Door Jamb	1	27.44	27.44
	Parts	K333-511KIT - Kit-Connector	1	37.46	37.46
	Parts	K256-767 - Lmap-Assy Door	1	135.93	135.93

We appreciate your business and look forward to helping you again soon.

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
	Labour	Condition 10: Check & Repair no clutch free pedal.	0.70	130.00	91.00
		Correction: Adjusted clutch internal to spec. Free pedal in spec after internal adjustment. Greased release bearing while unit was running. Lubricated linkage.			
	Labour	Condition 11: Customer requested unit washed and detailed.	1	130.00	130.00
		Correction: Took unit to truck wash. Washed and detailed unit.			
	Parts	Wash	1	90.00	90.00
	Labour	Condition 12: Customer requested a visual inspection, grease, and check levels.	1.50	130.00	195.00
		Correction: R&R steer axle oil hub caps. Topped up washer fluid. Check Transmission and Diff levels. Greased unit. Installed missing battery box cover hardware.			
	Trailer Hub Cap 6 Hole	HA4009	2	18.50	37.00
	Trailer Hub Gasket 6"	3303009	2	2.69	5.38
	Wakefield Synthetic 75W-90	4402459	2	15.55	31.10
	Nut Wing M10X50 DIN	W20-1013	1	3.42	3.42
	Washer Round 11X38X	HWC05782	1	13.96	13.96
	Washer Fluid -45	15-404	1	5.46	5.46
	Labour	Condition 13: Check & Repair hub & nut covers missing. Check & Repair antennas broken. Check & Repair winter front turn buckles missing.	1	130.00	130.00
		Correction: Installed hub and nut covers. R&R antennas. Installed missing turn buckles.			
	Chrome Steer Hub Cap With Hole	10112	2	9.06	18.12
	Chrome Rear Hub Cap	80012C	4	11.25	45.00
	Cover-Wheel (Cone) 33MM	TNUTF2	60	1.47	88.20

We appreciate your business and look forward to helping you again soon.

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
	Antenna (KW)	TSM4B100KW	2	13.65	27.30
	Winter front Turn Buckles	75700AU0	1	4.49	4.49
	Labour	Condition 14: Check & Repair drivers seat worn out.	2	130.00	260.00
		Correction: R&R divers seat with new/used take off.			
	Parts	New/Used Bostrom Wide Base/Low Back Seat	1	700.00	700.00
	Labour	Condition 15: Check & Repair fan hub lining, missing half of the lining.	4	130.00	520.00
		Correction: Removed fan from hub. Removed alternator and fan belts for access. Removed mounting studs from engine. Clean mounting studs and front of engine. Reinstalled mounting studs and painted front of engine. Reinstalled new rebuild fan hub. Reinstalled & tightened alternator and engine belts.			
	Parts	791020RMAN - Clutch, Fan	1	1,522.77	1,522.77
	Labour	Condition 16: Check & Repair air leak at service line on drivers front seer brake pot. Check & Repair air tank rusted out and leaking on drivers side.	4.50	130.00	585.00
		Correction: R&R LFS brake pot air line. Tied and secured in place. R&R furrel on emergency T-Fitting. Spray air tank to locate leak, mark and remove lines. R&R air tank and connect all lines. Tied and secured all lines.			
	Parts	K239-2122 - Tank-Air STL	1	1,171.99	1,171.99
	Parts	HAB818C - 3/8 RGDX3/8 SW	1	10.81	10.81
	Parts	Freight - Tank-Air STL	1	50.00	50.00
	Labour	Condition 17: Check & Repair P/S leak on supply line on reservoir.	2	130.00	260.00
		Correction: Drain reservoir. Removed fittings from reservoir, heat required. R&R o-rings. Reinstalled reservoir with new hardware and connected lines. Installed P/S fluid and topped up level.			

We appreciate your business and look forward to helping you again soon.

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
	ORB 3/4" O-Ring #12	S3631R-12	1	1.60	1.60
	DEX III	DEX III	2	8.42	16.84
	Labour	Condition 18: Check & Repair broken mount on the top of the passenger stack shield.	1	130.00	130.00
		Correction: Removed stack shield and mount. Welded mount. Installed mount on stack. Reinstalled stack shield and tightened hardware.			
	Labour	Condition 19: Check & Repair leak at front diff banjo.	8	130.00	1,040.00
		Correction: Drained diff oil. Removed axles. Removed steady bearing mount bolts. Removed banjo, cleaned flanges, and applied sealant. Reinstalled banjo with new hardware and torqued. Installed axle shafts with new gaskets and hardware. Filled diff with new oil.			
	Ultra Grey 599	82194	1	17.48	17.48
	Axle Gasket 5/8" Hole	3303106	2	4.16	8.32
	5/8" GR 8 NF Nylon LK Nut	NN8SF-062	14	1.20	16.80
	Stud-Double Ended	CM103430	1	11.34	11.34
	Axle Dowel Cone	1246V1166	1	2.39	2.39
	Axle Dowel Washer	1229W1661	1	2.75	2.75
	Wakefield Synthetic 75W-90	4402459	18	15.55	279.90
	Labour	Condition 20: Check & Repair back-up extension lamps dim n/w. Check & Repair drivers beacon lamp n/w.	1.50	130.00	195.00
		Correction: Removed dash, located switch and tested for power. Switch is faulty. R&R switch. Traced wires from drivers beacon light, found ground wire loose. Repaired and secured ground wire. Checked operation, all good.			
	Parts	K301-201 - Switch-Dome & Fan	1	90.40	90.40

We appreciate your business and look forward to helping you again soon.

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
	Labour	Condition 21: Check & Repair mud flap torn and hanger bent on rear of unit.	2	130.00	260.00
		Correction: Removed flaps, heated hanger and straightened brackets. Installed new flaps and painted brackets. R&R reflector taped on sides of deck and painted.			
	Black Gloss Paint 15oz	V2179838	3	18.03	54.09
	Conspicuity Tape 2"X150' Red/Silver	41160	21	1.72	36.12
	TNT Mudflap	RLHD2430TORQUE44	2	0.00	0.00
	Consumables				399.00

PO#:	SUBTOTAL	22,295.76
Unit#: TT033	GST @ 5%	1,114.80
License#: J35146	TOTAL	23,410.56

Vin#: 964895

Year/Make/Model: 2002 Kenworth C500

KMs: 130,627 (New Head Replacement)

Hours: 4,670

Engine: CAT C15

ESN#: 6NZ45979

PST Exempt #: AB7729-1

TOTAL DUE \$23,410.56

THANK YOU.

TAX SUMMARY

RATE	TAX	NET
GST @ 5%	1,114.80	22,295.76

We appreciate your business and look forward to helping you again soon.