



CHEVROLET • BUICK • GMC
"Automotive Excellence is our Guarantee"

11204 Alaska Road, Fort St John, BC V1J 5T5
Phone: 250-785-8005 • Toll Free: 1-800-811-1555 • Fax: 250-785-5122
www.murraygmc.com



Monday - Friday 7:30am - 5:00pm • Saturday 9:00am - 5:00pm

SO # 477104

UNIT
#619

SERVICE INVOICE CUSTOMER COPY

H02-4
SEP



Printed 02/12/2025 9:55:12 AM

User 512 Page 2

Customer No

BROTHERS HDD
PO BOX 10796 RPO 10
LLOYDMINSTER, AB T9V 3A8

Home Bus (780) 875-8845
Cell Today
Email

Term Visa

Advisor TAYLER Promised 02/06/2024 5:00 PM Tag# 8724
Shop S1 Opened 01/11/2024 2:18 PM Location
Priority Cashiered 02/07/2024 11:09 AM PO #

License	Odom In	Odom Out	In Service Date	Stock No
CLH2520	93781	93783	04/26/2022	
Year	Make	Model	Model Number	Colour
2022	CHEVROLET	SILVERADO 3500HD	CK30943	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
1GB4YTEY2NF218606				
Engine	DURAMAX 6.6L TURBO-DIESEL V8			Fleet #

Cause exhaust crossover adpater under turbo leaking

4050150 Exhaust Turbocharger Inlet Pipe Adapter Replacement

Effective Date: Feb 1, 2024

LABOR CODE: 4050150

Coverage Code: Emission E

Coverage Code: Powertrain P

L5P LABOR TIME: 5.6

To Recover and Recharge R-134a A/C System ADD TIME: 0.3

5.9 plus ST --

1.0 justified to perform smoke test to find exhaust leak and continue inspection after sheild removal. luke middleton 02/08/24

Correction inspect for exhaust leak verified concern exhaust fill cab of truck
ST
smoke test for leak
smoke from under turbo
also found left exhaust crossover pipe leaking at bellows
and left manifold leaking between cylinders 6 and 8
ST
remove heat shields from oxidation cat and recheck for leak found
exhaust crossover adpater under turbo leaking
parts ordered

recover a/c system
remove exhaust oxidation cat convertor and turbo assembly
disconnect nessary parts from exhaust crossover pipe adpater
install new adpater replace all nessary seals and gaskts
reinstall turbo and oxidation cat convertor reinstall heat shield
replace exhaust clamps
reinstall all removed parts recharge a/c system
fill cooling system
rd test check for leaks ok

Request	Description	Job	CSR	Status
01TRUVIDEO	Truvideo	2	441	Original
Labour	Description	Type	Amount	

PRINT NAME: _____

CUSTOMER SIGNATURE: _____

☐ DEBIT ☐ CHARGE ☐ CASH ☐ VISA ☐ MC ☐ AMEX INITIALS _____

Thank you for your Business!



IMPORTANT: All wheels must be retorqued within 100-150 kms. Its is our policy that all wheels be torqued to manufacturers specification at all times. We will provide retorquing at no extra charge within the kilometers listed above.

IMPORTANT NOTES: you may receive a questionnaire from General Motors in the next few days. If for any reason you cannot grade us completely satisfied, please contact our Service Manager at 250-785-8005

Due to environmental regulations there is a normal fee for the collection and disposal of hazardous materials. Example: oil filters, engine oil, glycol, transmission fluid, etc.

GST# 898953120RT0001



11204 Alaska Road, Fort St John, BC V1J 5T5
Phone: 250-785-8005 • Toll Free: 1-800-811-1555 • Fax: 250-785-5122
www.murraygmc.com



CHEVROLET • BUICK • GMC
"Automotive Excellence is our Guarantee"

Monday - Friday 7:30am - 5:00pm • Saturday 9:00am - 5:00pm

SO # 477104

SERVICE INVOICE CUSTOMER COPY



Printed 02/12/2025 9:55:12 AM

User 512 Page 3

Customer No

BROTHERS HDD
PO BOX 10796 RPO 10
LLOYDMINSTER, AB T9V 3A8

Home Bus (780) 875-8845
Cell Today
Email

Term Visa

Advisor TAYLER Promised 02/06/2024 5:00 PM Tag# 8724
Shop S1 Opened 01/11/2024 2:18 PM Location
Priority Cashiered 02/07/2024 11:09 AM PO #

License	Odom In	Odom Out	In Service Date	Stock No
CLH2520	93781	93783	04/26/2022	
Year	Make	Model	Model Number	Colour
2022	CHEVROLET	SILVERADO 3500HD	CK30943	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
1GB4YTEY2NF218606				
Engine	DURAMAX 6.6L TURBO-DIESEL V8	Fleet #		

01TRUVIDEO Truvideo

C 0.00

Technician 72 -

Cause

Correction

Request	Description	Job	CSR	Status
58	Customer Satisfaction Program (N212354520): Heated Vented Seats Retrofit Due to Chip Shortage - Front Seats Only - Expires February 28, 2026 (Release Date 2022-12-14)	3	441	Original

Labour	Description	Type	Amount
58	Customer Satisfaction Program (N212354520): Heated Vented Seats Retrofit Due to Chip Shortage - Front Seats Only - Expires February 28, 2026 (Release Date 2022-12-14)	W	

Part	Description	Shp	SL	Bin	Type	Price	Amount
13526069	MODULE	0		01B06	W4		
B Shelf							
Technician	999 -						

Request	Description	Job	CSR	Status
58	Customer Satisfaction Program (N222371151): Heated Steering Wheel Retrofit Steering Wheel Replacement Only - Expires January 31, 2027 (Release Date 2023-5-23)	4	441	Original

Labour	Description	Type	Amount
58	Customer Satisfaction Program (N222371151): Heated Steering Wheel Retrofit Steering Wheel Replacement Only - Expires January 31, 2027 (Release Date 2023-5-23)	W	

Part	Description	Shp	SL	Bin	Type	Price	Amount
84946341	WHEEL	0			W4		
Po1							
Technician	999 -						

Request	Description	Job	CSR	Status
19GMZ	Replace rear brake pads & machine rotors - 4-5mm	5	441	Approved

Labour	Description	Type	Amount
19GMZ	Replace rear brake pads & machine rotors - 4-5mm	CGW	787.28

Part	Description	Shp	SL	Bin	Type	Price	Amount
86792660	PAD KIT	1		04G03	CGOOD	343.49	343.49
84271030	SEAL	1		04A06	CGOOD	85.99	85.99
edm							
84757390	GASKET	1		04AD5	CGOOD	7.25	7.25

PRINT NAME: _____

CUSTOMER SIGNATURE: _____

☐ DEBIT ☐ CHARGE ☐ CASH ☐ VISA ☐ MC ☐ AMEX INITIALS _____

Thank you for your Business!



IMPORTANT: All wheels must be retorqued within 100-150 kms. It is our policy that all wheels be torqued to manufacturers specification at all times. We will provide retorquing at no extra charge within the kilometers listed above.

IMPORTANT NOTES: you may receive a questionnaire from General Motors in the next few days. If for any reason you cannot grade us completely satisfied, please contact our Service Manager at 250-785-8005

Due to environmental regulations there is a normal fee for the collection and disposal of hazardous materials. Example: oil filters, engine oil, glycol, transmission fluid, etc.

GST# 898953120RT0001



11204 Alaska Road, Fort St John, BC V1J 5T5
Phone: 250-785-8005 • Toll Free: 1-800-811-1555 • Fax: 250-785-5122
www.murraygmc.com



CHEVROLET • BUICK • GMC
"Automotive Excellence is our Guarantee"

Monday - Friday 7:30am - 5:00pm • Saturday 9:00am - 5:00pm

SO # 477104

SERVICE INVOICE CUSTOMER COPY



Printed 02/12/2025 9:55:12 AM

User 512 Page 4

Customer No
BROTHERS HDD
PO BOX 10796 RPO 10
LLOYDMINSTER, AB T9V 3A8

Home **Bus** (780) 875-8845
Cell **Today**
Email

Term Visa

Advisor TAYLER **Promised** 02/06/2024 5:00 PM **Tag#** 8724
Shop S1 **Opened** 01/11/2024 2:18 PM **Location**
Priority **Cashiered** 02/07/2024 11:09 AM **PO #**

License CLH2520	Odom In 93781	Odom Out 93783	In Service Date 04/26/2022	Stock No
Year 2022	Make CHEVROLET	Model SILVERADO 3500HD	Model Number CK30943	Colour
Vehicle ID No 1GB4YTEY2NF218606	Selling Dealer	Extended Warranty	Delivery Date	
Engine DURAMAX 6.6L TURBO-DIESEL V8	Fleet #			

edm
Technician 72 -
Cause rear brakes low
Correction re and re dual rear wheels
remove calpers
remove rotor/hub assemblies
machine both rear brake rotors
replace both rear axle seals
reinstall rotor/hub assemblies and replace axle shaft gaskets
replace rear brake pads and service calipers
reinstall wheels and torque to spec
top up fluid levels and rd test ok

Parts Total 436.73
Labour Total 787.28
Request Sub-total 1,224.01

NEED TO RETORQUE WHEELS IN 100 KM

Request	Description	Job	CSR	Status
01GMZZ-AIR	Replace air filter	6	441	Approved
Labour	Description		Type	Amount
01GMZZ-AIR	Replace air filter		CGW	0.00
Part	Description	Shp	SL	Bin
85614334	ELEMENT	1		05B06
				CGMQS
				Price
				64.75
Technician	72 -			Amount
				64.75
Cause	Inspected			Parts Total
				64.75
Correction	replace air filter			Request Sub-total
				64.75

Request	Description	Job	CSR	Status
01GMZZ8	Replace pollen filter	7	441	Approved
Labour	Description		Type	Amount
01GMZZ8	Replace pollen filter		CGW	21.46
Part	Description	Shp	SL	Bin
13508023	FILTER	1		05A03
				CGOOD
				Price
				38.49
Technician	72 -			Amount
				38.49
Cause	Inspected			Parts Total
				38.49
Correction	replace pollen filter			Labour Total
				21.46
				Request Sub-total
				59.95

Request	Description	Job	CSR	Status
01GMFFD17	Fuel Filter Replacement Diesel 2017 and newer - supply and install diesel fuel filter	8	441	Approved

PRINT NAME: _____

CUSTOMER SIGNATURE: _____

☐ DEBIT ☐ CHARGE ☐ CASH ☐ VISA ☐ MC ☐ AMEX INITIALS _____

Thank you for your Business!



IMPORTANT: All wheels must be retorqued within 100-150 kms. Its is our policy that all wheels be torqued to manufacturers specification at all times. We will provide retorquing at no extra charge within the kilometers listed above.

IMPORTANT NOTES: you may receive a questionnaire from General Motors in the next few days. If for any reason you cannot grade us completely satisfied, please contact our Service Manager at 250-785-8005

Due to environmental regulations there is a normal fee for the collection and disposal of hazardous materials. Example: oil filters, engine oil, glycol, transmission fluid, etc.

GST# 898953120RT0001



11204 Alaska Road, Fort St John, BC V1J 5T5
Phone: 250-785-8005 • Toll Free: 1-800-811-1555 • Fax: 250-785-5122
www.murraygmc.com



CHEVROLET • BUICK • GMC
"Automotive Excellence is our Guarantee"

Monday - Friday 7:30am - 5:00pm • Saturday 9:00am - 5:00pm

SO # 477104

SERVICE INVOICE CUSTOMER COPY



Printed 02/12/2025 9:55:13 AM

User 512 Page 5

Customer No BROTHERS HDD PO BOX 10796 RPO 10 LLOYDMINSTER, AB T9V 3A8		Advisor TAYLER Shop S1 Priority	Promised 02/06/2024 5:00 PM Opened 01/11/2024 2:18 PM Cashiered 02/07/2024 11:09 AM	Tag# 8724 Location PO #
Home Cell Email	Bus (780) 875-8845 Today	License CLH2520 Year 2022 Vehicle ID No 1GB4YTEY2NF218606 Engine	Odom In 93781 Make CHEVROLET Selling Dealer DURAMAX 6.6L TURBO-DIESEL V8	Odom Out 93783 Model SILVERADO 3500HD Extended Warranty Fleet #
In Service Date 04/26/2022 Model Number CK30943		Stock No Colour Delivery Date		
Term Visa				

Labour	Description	Type	Amount				
01GMFFD17	Fuel Filter Replacement Diesel 2017 and newer - supply and install diesel fuel filter	CGW	49.95				
Part	Description	Shp	SL	Bin	Type	Price	Amount
13539108	FILTER KI	1		05E02	CGOOD	60.99	60.99
Technician	72 -				Parts Total		60.99
Cause	request				Labour Total		49.95
Correction	Supplied and installed diesel fuel filter				Request Sub-total		110.94

Request	Description	Job	CSR	Status			
01GMZDRV7	4X4 GM Fluid service change on front/rear differentials and transfer case	9	441	Approved			
Labour	Description	Type	Amount				
01GMZDRV7	4X4 GM Fluid service change on front/rear differentials and transfer case	CGW	259.52				
Part	Description	Shp	SL	Bin	Type	Price	Amount
19300458	LUBRICANT	2		BULK	CGOOD	28.99	57.98
19421425	FLUID	2		BULK	CGOOD	11.99	23.98
89021678	GEAR LUBR	3		BULK	CGOOD	29.49	88.47
Technician	72 -			Parts Total			170.43
Cause	request			Labour Total			259.52
Correction	drivetrain service			Request Sub-total			429.95

Request	Description					Job	CSR	Status
01GMZZ2020	10 Speed Diesel transmission service					10	441	Approved
Labour	Description						Type	Amount
01GMZZ2020	10 Speed Diesel transmission service						CGW	278.20
Part	Description	Shp	SL	Bin	Type		Price	Amount
24298004	FILTER KI	1		05E02	CGOOD		94.75	94.75
19352620	FLUID	12		BULK	CGOOD		12.25	147.00
Technician	72 -				Parts Total			241.75
Cause	request				Labour Total			278.20
Correction	perform diesel 10 speed trans service				Request Sub-total			519.95

Request	Description	Job	CSR	Status
31	Replace exhaust turbo inlet pipe on left side.	11	441	Approved
Labour	Description		Type	Amount
31	Replace exhaust turbo inlet pipe on left side.		C	369.90

PRINT NAME: _____

CUSTOMER SIGNATURE: _____

☐ DEBIT ☐ CHARGE ☐ CASH ☐ VISA ☐ MC ☐ AMEX INITIALS _____

Thank you for your Business!



IMPORTANT: All wheels must be retorqued within 100-150 kms. Its is our policy that all wheels be torqued to manufacturers specification at all times. We will provide retorquing at no extra charge within the kilometers listed above.

IMPORTANT NOTES: you may receive a questionnaire from General Motors in the next few days. If for any reason you cannot grade us completely satisfied, please contact our Service Manager at 250-785-8005

Due to environmental regulations there is a normal fee for the collection and disposal of hazardous materials. Example: oil filters, engine oil, glycol, transmission fluid, etc.

GST# 898953120RT0001



11204 Alaska Road, Fort St John, BC V1J 5T5
Phone: 250-785-8005 • Toll Free: 1-800-811-1555 • Fax: 250-785-5122
www.murraygmc.com



CHEVROLET • BUICK • GMC
"Automotive Excellence is our Guarantee"

Monday - Friday 7:30am - 5:00pm • Saturday 9:00am - 5:00pm

SO # 477104

SERVICE INVOICE CUSTOMER COPY



Printed 02/12/2025 9:55:13 AM

User 512 Page 6

Customer No

BROTHERS HDD
PO BOX 10796 RPO 10
LLOYDMINSTER, AB T9V 3A8

Home Cell Email
Bus Today (780) 875-8845

Term Visa

Advisor TAYLER
Shop S1
Priority
Promised 02/06/2024 5:00 PM
Opened 01/11/2024 2:18 PM
Cashiered 02/07/2024 11:09 AM
Tag# 8724
Location
PO #

License	Odom In	Odom Out	In Service Date	Stock No
CLH2520	93781	93783	04/26/2022	
Year	Make	Model	Model Number	Colour
2022	CHEVROLET	SILVERADO 3500HD	CK30943	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
1GB4YTEY2NF218606				
Engine	DURAMAX 6.6L TURBO-DIESEL V8			Fleet #

Part	Description	Shp	SL	Bin	Type	Price	Amount
12688020	PIPE	1			CRO	296.00	296.00
b/o							
Technician	72 -					Parts Total	296.00
Cause	pipe cracked in bellows					Labour Total	369.90
Correction	remove nessary parts to access left turbo inlet pipe					Request Sub-total	665.90
	remove heat shield						
	replace left exhaust turbo inlet pipe						
	reinstall removed parts						
	check for leaks rd test ok						

Request	Description	Job	CSR	Status
4050670	added operation..... line added to replace left manifold gasket as it is leaking, noyiced on other line when checking for exhaust leaks. luke middleton 02/02/24	12	441	Approved

Labour	Description	Type	Amount
4050040	Exhaust Manifold Replacement - Left Side	W	

Part	Description	Shp	SL	Bin	Type	Price	Amount
12705094	GASKET	1		03F07	W4		

Technician 72 -
Cause left exhaust manifold gasket leaking

4050040 Exhaust Manifold Replacement - Left Side
Effective Date: Feb 1, 2024
LABOR CODE: 4050040
Coverage Code: Emission E, E1
Coverage Code: Powertrain P
L5P LABOR TIME: 2.8

Correction remove nessary parts to access left exhaust manifold
remove left manifold and replace manifold gasket
reinstall manifold and torque to spec
reinstall heat shields and removed parts
rd test ok

PRINT NAME: _____

CUSTOMER SIGNATURE: _____

☐ DEBIT ☐ CHARGE ☐ CASH ☐ VISA ☐ MC ☐ AMEX INITIALS _____

Thank you for your Business!



IMPORTANT: All wheels must be retorqued within 100-150 kms. Its is our policy that all wheels be torqued to manufacturers specification at all times. We will provide retorquing at no extra charge within the kilometers listed above.

IMPORTANT NOTES: you may receive a questionnaire from General Motors in the next few days. If for any reason you cannot grade us completely satisfied, please contact our Service Manager at 250-785-8005

Due to environmental regulations there is a normal fee for the collection and disposal of hazardous materials. Example: oil filters, engine oil, glycol, transmission fluid, etc.

GST# 898953120RT0001



11204 Alaska Road, Fort St John, BC V1J 5T5
 Phone: 250-785-8005 • Toll Free: 1-800-811-1555 • Fax: 250-785-5122
 www.murraygmc.com



CHEVROLET • BUICK • GMC
 'Automotive Excellence is our Guarantee'

Monday - Friday 7:30am - 5:00pm • Saturday 9:00am - 5:00pm

SO # 477104

SERVICE INVOICE CUSTOMER COPY



Printed 02/12/2025 9:55:13 AM

User 512 Page 7

Customer No
 BROTHERS HDD
 PO BOX 10796 RPO 10
 LLOYDMINSTER, AB T9V 3A8

Home **Bus** (780) 875-8845
Cell **Today**
Email

Term Visa

Advisor TAYLER	Promised 02/06/2024 5:00 PM	Tag# 8724
Shop S1	Opened 01/11/2024 2:18 PM	Location
Priority	Cashiered 02/07/2024 11:09 AM	PO #

License CLH2520	Odom In 93781	Odom Out 93783	In Service Date 04/26/2022	Stock No
Year 2022	Make CHEVROLET	Model SILVERADO 3500HD	Model Number CK30943	Colour
Vehicle ID No 1GB4YTEY2NF218606	Selling Dealer	Extended Warranty	Delivery Date	
Engine DURAMAX 6.6L TURBO-DIESEL V8	Fleet #			

Labour	1,766.31
Parts	1,309.14
Supplies	122.37
Sub-Total	3,197.82
GST	159.89
PST	223.85
Total Invoice	3,581.56
Visa	3,581.56



Outstanding Deposit	104.43
TOTAL INCLUDING DEPOSIT	3,685.99

PRINT NAME: _____

CUSTOMER SIGNATURE: _____

☐ DEBIT ☐ CHARGE ☐ CASH ☐ VISA ☐ MC ☐ AMEX INITIALS _____

Thank you for your Business!



IMPORTANT: All wheels must be retorqued within 100-150 kms. Its is our policy that all wheels be torqued to manufacturers specification at all times. We will provide retorquing at no extra charge within the kilometers listed above.

IMPORTANT NOTES: you may receive a questionnaire from General Motors in the next few days. If for any reason you cannot grade us completely satisfied, please contact our Service Manager at 250-785-8005

Due to environmental regulations there is a normal fee for the collection and disposal of hazardous materials. Example: oil filters, engine oil, glycol, transmission fluid, etc.

GST# 898953120RT0001