



5351 94 Ave SE
Calgary, AB T2C 4E5

Ph: 403.720.2910

www.artictruckparts.com

229-1
Aug

Invoice: 104W3645
Date / Hour: 3/13/2025 9:30:35AM
Repair Order: 3645
Customer:
Branch: 104
Total Invoice:
Charge - CAD
Page 1

Bill To:

Ship To:

Office Phone:

Shop Phone:

Email:

Work:

Fax:

Customer P/O: K002703

Open Date: 02/06/2025

Completion Date: 02/19/2025

Add User: DRichard

Salesperson: Calgary House Sales

Unit Number: FT1003

Model Year: 2008

Make/Model: KENWORTH

Type: Truck

VIN: 2NKMHN7X28M232459

Meter: 40498 Kilometers

Task: 1 B104 REPAIR GENERAL REPAIR

Department: Service

Complaint: SUBLET REPAIR FOR PUMP SYSTEM AND PTO

Correction: KENWORTH LUBE TRUCK

V.I.N 2NKMWHN7X2BM23245

-Install customer supplied PTO

-Rewire PTO electrical

-Install drive shaft

-Drain, inspect & clean the hydraulic reservoir

-Run projectiles through all hydraulic hoses

-New suction & pressure hoses required to
accommodate new style hydraulic pump

-Remove & inspect 6 Permco Hydraulic motors,
1 Chary-Lynn motor

-Perform rebuilds on 6 motors, parts depending
on condition, two removed so far for inspection

-Remove, clean & reseal all hydraulic valving

-The compressor solenoid valve requires
replacement

-Re-wire the solenoid valve & in-cab switch, add
a relay

-Supply & fill unit with new hydraulic oil

-Supply and install new hydraulic filter element

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
Z5	101-1033-009	MH0028AA01AA00000000AA00J	EA	1.0		
R6	131N2-479	FLANGE YOKE	EA	1.0		
Z5	1388265 ELECTRICAL	ELECTRICAL SUPPLIES AS REQ	EA	1.0		
Z5	1388265 HOSE AND FITTINGS	HOSE AND FITTINGS AS REQUI	EA	1.0		
Z5	1388265 REPAIR 1	LUBE CIRCUIT MOTOR REPAIR	EA	1.0		
Z5	1388265 REPAIR 2	LUBE CIRCUIT MOTOR REPAIR	EA	1.0		
Z5	1388265 REPAIR 3	LUBE CIRCUIT MOTOR REPAIR	EA	1.0		
Z5	1388265 REPAIR 4	LUBE CIRCUIT MOTOR REPAIR	EA	1.0		
Z5	1388265 REPAIR 5	LUBE CIRCUIT MOTOR REPAIR	EA	1.0		
Z5	1388265 REPAIR 6	COMPRESSOR MOTOR REPAIR	EA	1.0		

** See Last Page for Invoice Total **



5351 94 Ave SE
Calgary, AB T2C 4E5

Ph: 403.720.2910

www.artictruckparts.com

Invoice: 104W3645
Date / Hour: 3/13/2025 9:30:35AM
Repair Order: 3645
Customer:
Branch: 104
Total Invoice:
Charge - CAD

Page 2

Bill To:

Ship To:

Office Phone:

Shop Phone:

Email:

Work:

Fax:

Customer P/O: K002703

Open Date: 02/06/2025

Completion Date: 02/19/2025

Add User: DRichard

Salesperson: Calgary House Sales

Z5	1404	FILTER	EA	2.0
Z5	281GSFJP-B5XD	PTO	EA	1.0
Z5	300AA00095A	MCSCJ012DW0B0010	EA	1.0
Z5	9016	120 PSI PRESSURE SWITCH	EA	1.0
Z5	AW32	HYDRAULIC OIL	EA	312.0
Z5	CSG-150-A10A	MPF 8T02300 ELEMENT	EA	1.0
Z5	FAB	FABRICATE PUMP MOUNT	EA	1.0
Z5	HPR105XRIP0XXCCL189	PTO PUMP	EA	1.0
	LabourSub	Labour Sublet		1.0
	Towing	SHUTTLE CHARGE		1.0

Task 1 Subtotals

Parts:

Labor:

Miscellaneous:

Task 1 Subtotals

Task: 2 B104 REPAIR GENERAL REPAIR

Department: Service

Complaint: CVIP REPAIR LIST

- 1-AIR LINE DANGLING NEEDS TIED UP
- 2-SIGNAL STAT NOT WORKING PROPERLY
- 3-FLAT TIRE
- 4-BOTH WIPERS STREAKING
- 5-LICENCE PLATE LIGHT LOOSE AND NOT WORKING
- FYI
- TACHOMETER NOT GETTING UP PAST 1200 RPM

Correction: 2/18/2025 3:36:20 PM 155 - REMOVED AND REPLACED BOTH WINDSHIELD WIPER BLADES

- REMOVED PASSENGER SEAT AND PLACE CHARGER ON BATTERIES
- REMOVED STEERING COLUMN COVERS AND REMOVED SIGNAL STAT
- SECURED BACK UP LAMP NEED TO TEST ONCE BATTERIES ARE RECONNECTED
- SECURED AIRLINE ABOVE REAR AXLE
- INSTALLED NEW SIGNAL STAT AND CHECKED OPERATION
- REPLACED LICENSE PLATE BULB AND REINSTALLED
- REINSTALLED PASSENGER SEAT AND SECURED
- TOPPED UP ENGINE COOLANT

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
REC	26-839-1	PREMIX EXT LIFE COOLANT BULK A/F 50/50	LT	4.0		
		RED				
TRI	37-180	CHILL 18WINTER BLADE	EA	2.0		
SB	89.TP	10PK-34233 STD MINI 89	EA	1.0		

** See Last Page for Invoice Total **



5351 94 Ave SE
Calgary, AB T2C 4E5

Ph: 403.720.2910

www.artictruckparts.com

Invoice: 104W3645
Date / Hour: 3/13/2025 9:30:35AM
Repair Order: 3645
Customer:
Branch: 104
Total Invoice:
Charge - CAD

Page 3

Bill To:

Ship To:

Office Phone:

Shop Phone:

Email:

Work:

Fax:

Customer P/O: K002703

Open Date: 02/06/2025

Completion Date: 02/19/2025

Add User: DRichard

Salesperson: Calgary House Sales

Z5

TL30450

SIGNAL STAT

EA

1.0

Task 2 Subtotals

Parts:

Labor:

Task 2 Subtotals

Task: 3 B104 CVIP Heavy Duty Tandem 104

Department: Service

Complaint: PERFORM CVIP INSPECTION

TORQUE TAG#

YOUR WHEELS MUST BE RE-TORQUED BETWEEN 50KM-100KM

FAILURE TO DO SO COULD RESULT IN DAMAGE TO YOUR VEHICLE

OR INJURY.

.....

Cause: NO CHARGE

Task 3 Subtotals

Parts:

Labor:

Task 3 Subtotals

Customer Tax ID: 818327603T0001

GST/HST Number: 101190221

Detail Tax Info:

Sales Tax

Total:

Total Parts:
Total Labor:
Total Miscellaneous:
Total Shop Supplies:
Invoice Subtotal:
Total Tax:
Total Invoice:

Payment Method

Terms

Due Date

Charge - CAD

Net 30 Days From Statement

4/30/2025

Remit To

Artic Truck Parts & Service (Calgary)

11523 - 186ST NW

Edmonton, AB T5S 2W6



5351 94 Ave SE
Calgary, AB T2C 4E5

Ph: 403.720.2910

www.artictruckparts.com

Invoice: 104W2791
Date / Hour: 2/6/2025 10:47:23AM
Repair Order: 2791
Customer:
Branch: 104
Total Invoice:
Charge - CAD
Page 1

Bill To:

Ship To:

Office Phone:
Shop Phone:
403-585-5388
Email:

Work:

Fax:

Customer P/O: K002556

Open Date: 05/01/2024

Completion Date: 06/07/2024

Add User: DRichard

Salesperson: Calgary House Sales

Unit Number: FT1003

Model Year: 2008

Make/Model: KENWORTH

Type: Truck

VIN: 2NKMHN7X28M232459

Meter: 40498 Kilometers

Task: 1 B104 CVIP Heavy Duty Tandem 104

Department: Service

Complaint: PERFORM CVIP INSPECTION

TORQUE TAG#

YOUR WHEELS MUST BE RE-TORQUED BETWEEN 50KM-100KM

FAILURE TO DO SO COULD RESULT IN DAMAGE TO YOUR VEHICLE

OR INJURY.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
				Task 1 Subtotals	Parts:	
					Labor:	\$
				Task 1 Subtotals		\$

Task: 2 B104 REPAIR GENERAL REPAIR

Department: Service

** See Last Page for Invoice Total **



5351 94 Ave SE
Calgary, AB T2C 4E5

Ph: 403.720.2910

www.artictruckparts.com

Invoice: 104W2791
Date / Hour: 2/6/2025 10:47:23AM
Repair Order: 2791
Customer:
Branch: 104
Total Invoice:

Charge - CAD

Page 2

Bill To:

Ship To:

Office Phone:

Shop Phone:

Email:

Work:

Fax:

Customer P/O: K002556

Open Date: 05/01/2024

Completion Date: 06/07/2024

Add User: DRichard

Salesperson: Calgary House Sales

Complaint: CVIP REPAIR LIST

- 1-DO THOROUGH LOOK OVER TRUCK COMPONENTS/EQUIPMENT
- 2-PASSENGER SIDE STORAGE DOOR LOOSE
- 3-PASSENGER SIDE EXHAUST HEALD SHIELD LOOSE
- 4-BACK STORAGE DOOR DOESNT HAVE LOCK
- 5-DRIVER SIDE STORAGE DOOR LOOSE
- 6-SIGNAL SWITCH DOESNT WORK FOR RHS TURN
- 7-FRONT RHS MARKER LIGHT DIM
- 8-PASSENGER SIDE HEADLIGHT MISSING COVER
- 9-PASSENGER SIDE HEAD LIGHT MARKER LIGHT/SIGNAL MISSING
- 10-DRIVER SIDE REAR MARKER LIGHT OUT
- 11-BACK OF CAB WIRING LOOSE
- 12-DRIVER SIDE SIGNAL LIGHT COVER DAMAGED
- 13-PASSENGER SIDE TAIL LIGHT NOT WORKING
- 14-DRIVER SIDE REVERSE LIGHT NOT WORKING
- 15-DRIVER SIDE TAIL LIGHT RUBBER DAMAGED
- 16-WINDSHIELD HAS BAD SCRATCH FROM A PREVIOUS WIPER BLADE RIGHT IN MIDDLE OF DRIVERS VIEW
- 17-LOW COOLANT
- 18-STEER SHAFT BOTH U JOINTS HAVE PLAY
- 19-PTO SHAFT U JOINTS HAVE PLAY
- 20-HVAC CONTROL DOESNT WORK
- 21-HYDRAULIC PUMP INPUT SHAFT LEAKING
- 22-HANGER BEARING DAMAGED
- 23-CAB INTERIOR LIGHTS NOT WORKING
- 24-LHS #2 OUTER TIRE OVER INFLATED BY 50 PSI
- 25-#1 RHS TIRE NEEDS TIRE PRESSURES ADJUSTED
- 26-ADJUST BRAKES, TORQUE WHEELS
- 27-GREASE UNIT
- CUSTOMERS LIST-----
- 1-PTO INPUT SHAFT LEAKING
- 2-FUEL TANK PUMP SYSTEM NOT WORKING
- 3-SWITCHES IN BACK FOR FUEL AND COMPRESSOR NOT WORKING
- 4-FAR DRIVER SIDE HYDRAULIC PUMP NOT WORKING
- 5-AIR COMPRESSOR DOESNT WORK
- 6-NO DIFF LOCK WORKING
- 7-AIR TANK ON TOP OF PUMPS DOESNT HAVE A BLEED OFF VALVE
- 8-RADIO NOT WORKING,

** See Last Page for Invoice Total **



5351 94 Ave SE
Calgary, AB T2C 4E5

Ph: 403.720.2910

www.artictruckparts.com

Invoice: 104W2791
Date / Hour: 2/6/2025 10:47:23AM
Repair Order: 2791
Customer:
Branch: 104
Total Invoice:
Charge - CAD

Page 3

Bill To:

Ship To:

Office Phone:

Shop Phone:

Email:

Work:

Fax: 2024

Customer P/O: K002556

Open Date: 05/01/2024

Completion Date: 06/07/2024

Add User: DRichard

Salesperson: Calgary House Sales

Correction: 5/28/2024 9:43:33 AM 98 -ADJUSTED DRIVERS SIDE STORAGE CABINET

- ADJUSTED PASSENGERS SIDE STORAGE CABINET
- REMOVED HEAT SHIELD, REMOVED OLD MOUNTING CLAMPS, INSTALLED NEW CLAMPS, INSTALLED HEAT SHIELD WITH NEW HARDWARE
- INSTALLED NEW RHS SIGNAL LIGHT HOUSING, SPliced IN NEW ELECTRICAL CONNECTION TO SIGNAL LIGHT, INSTALLED NEW BULB
- INSTALLED RHS HEADLIGHT BEZEL
- REMOVED FRONT DRIVE SHAFT AND HANGER BEARING
- REMOVED PTO SHAFT
- REMOVED STEERING SHAFT, REMOVED UJOINTS, INSTALLED NEW UJOINTS, REINSTALLED STEERING SHAFT IN UNIT
- REWired LHS REVERS LIGHT, INSTALLED NEW LIGHT
- REWired LHS TAIL LIGHT, INSTALLED LIGHT WITH NEW GROMET
- REMOVED REVERSE ALARM AND GROMET, REINSTALLED REVERSE ALARM WITH NEW GROMET
- SPliced IN NEW PIGTAIL FOR LHS REAR OUTER MARKER, REINSTALLED MARKER LIGHT
- SPliced IN NEW PIGTAIL FOR RHS FRONT MARKER LIGHT, INSTALLED NEW MARKER LIGHT
- SECURED WIRING BEHIND CAB AND AROUND AIR DRYER
- ADJUSTED TIRE PRESSURES TO 100PSI
- SWAPPED INTERIOR LIGHT BULBS
- REINSTALLED DRIVESHAFT AND HANGER BEARING, USING NEW STRAP KITS
- GREASED UNIT
- CAPPED ALL HYDRAULIC LINES TO HYDRAULIC PUMP, UNBOLTED PUMP FROM MOUNT, REMOVED PUMP FROM UNIT
- CONFIRMED HVAC IS ONLY WORKING ON 1 SPEED IN BLOWER MOTOR, REMOVED RESISTORS, FOUND THAT IT IS OIL BETWEEN DIODES, REPLACED RESISTORS, NO CHANGE IN OPERATION, PULLED HVAC CONTROLLER OUT, FOUND THAT BLOWER MOTOR SPEED SELECTOR SWITCH IS BURNT.
- REPLACED SPEED SWITCH, TESTED SYSTEM, SYSTEM WORKING NORMALLY
- INSTALLED NEW PTO SHAFT
- REINSTALLED PUMP MOUNT, REMOUNTED HYD PUMP
- SECURED BOTH ENDS OF PTO SHAFT WITH SET SCREWS AND BAILING WIRE
- RECONNECTED ALL HYDRAULIC LINES TO PUMP
- BEGAN TESTING COMPRESSOR AND DEISEL PUMP, FOUND THAT NO POWER WAS AT SWITCHES IN BACK OR AT COMPRESSOR, POWER PRESENT AT RELAY ABOVE JUMPER BOX
- REPLACED RELAY, RECHECKED WIRES, HAD TO PUT NEW ENDS ON COMPRESSOR WIRES, FOUND THAT ACTUATOR FOR HYD PUMP ON COMPRESSOR BROKEN OFF, HAVE FULL POWER AT SWITCHES AND TO COMPRESSOR, SECURED ALL WIRING INSIDE FRAME

- INSPECTED A MIDSHIP SHAFT: U-JOINT, HB & MIDSHIP TUBE STUB
- REMOVED U-JOINT FROM THE WELD YOKE SIDE & CLEANED YOKE EARS
- INSTALLED SHAFT ON THE LEATHE & CENTERED
- CUT THE WELD ON THE TUBE STUB & POUND IT OUT & REMOVED FROM THE LEAhte
- INSTALLED U-JOINT ON THE WELD YOKE
- INSTALLED SHAFT TO THE BALANCER
- INSTALLED TUBE STUB TO THE SHAFT, PHASED & PUSHED INTO THE TUBE -STRAIGHTENED & WELDED THE STUB & COOLED &

** See Last Page for Invoice Total **



5351 94 Ave SE
Calgary, AB T2C 4E5

Ph: 403.720.2910

www.artictruckparts.com

Invoice: 104W2791
Date / Hour: 2/6/2025 10:47:23AM
Repair Order: 2791
Customer:
Branch: 104
Total Invoice:

Charge - CAD

Page 4

Bill To:

Ship To:

Office Phone:

Shop Phone:

Email:

Work:

Fax:

Customer P/O: K002556

Open Date: 05/01/2024

Completion Date: 06/07/2024

Add User: DRichard

Salesperson: Calgary House Sales

STRAIGHTENED FURTHER
-INSTALLED HANGER BEARING, END YOKE, WASHER & NUT
-REMOVED ALL OLD WEIGHTS & WELDED WEIGHT TO BALANCE
-PAINTED & DRIED & TAGGED

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
Z5	1006-15	RAD CAP	EA	1.0		
SB	1156.TP	STD MINI 1156 36521-P10	EA	2.0		
SB	211-2.TP	10PK-34887 STD MINI 211-2	EA	2.0		
BW	228750N	LP-3 PRESS INDICATOR	EA	1.0		
TA	24059-DP	1PK-SOL 12V 17.5OHM CONT 4ST	PK	1.0		
FA	241-B	DRAIN COCK GROUND KEY PLUG TYPE 1/4 MPT	EA	1.0		
Z5	5463-BP	SOCKET	EA	1.0		
Z5	564.59032	HEADLIGHT BEZEL	EA	1.0		
Z5	564.59048	SIGNAL MARKER RH	EA	1.0		
Z5	6352012	COIL-10 12DL	EA	1.0		
Z5	83-6030	STICK ON ZIP TIE BASE	EA	1.0		
GR	91740	GROM RUB/STT	EA	2.0		
FLX	FLX2584-0362	10PK-CT CLAMP 2.50/3.00ID	EA	2.0		
Z5	GW19901	HOOD LATCH	EA	2.0		
Z5	JIM9111	HOOD LATCH	EA	2.0		
Z5	K077-352PKG	HEAT SHIELD CLAMP	EA	1.0		
Z5	K077-352PKG	CLAMP PIPE SHIELD	EA	1.0		
UB	LED2500-13AP	LED 2.5 RD MARKER LAMP AMBE	EA	1.0		
UB	LED4000-24RP	4 RND STT 24 DIODE RED	EA	1.0		
UB	LED4100-19WP	PAR36 260L/19D 4.5RD FLOOD	EA	1.0		
Z5	PEM215	GAUGE	EA	1.0		
UB	PT6020	6R/A PIGTAIL/2WIRE/1RING	EA	2.0		
UB	PT9180	9STRT PIGTAIL/3WIRE/1RING	EA	1.0		
Z5	SR2000035	RESISTOR	EA	1.0		
Z5	SR2000041	FAN SPEED SWITCH	EA	1.0		
Z5	SV16-20-0-N-00	SOLENOID VALVE	EA	1.0		
FA	TS17R-24	RUBB CUSH T STRP 1 1/2 T OD	EA	1.0		

** See Last Page for Invoice Total **



5351 94 Ave SE
Calgary, AB T2C 4E5

Ph: 403.720.2910

www.artictruckparts.com

Invoice: 104W2791
Date / Hour: 2/6/2025 10:47:23AM
Repair Order: 2791
Customer:
Branch: 104
Total Invoice: \$

Charge - CAD

Page 5

Bill To:

Ship To:

Office Phone:

Shop Phone:

Email:

Work:

Fax: 2024

Customer P/O: K002556

Open Date: 05/01/2024

Completion Date: 06/07/2024

Add User: DRichard

Salesperson: Calgary House Sales

Z5	Is17r40	p clamp	EA	2.0
	Freight	Freight IN CONTROL FLOW		1.0
	LabourSub	DIAGNOSE PUMP ISSUE		1.0

Task 2 Subtotals

Parts:

Labor:

Miscellaneous:

Task 2 Subtotals

Task: 3 B104 REPAIR GENERAL REPAIR

Department: Service

Complaint: SUPPLY AND INSTALL TOW HOOKS ON FRONT OF TRUCK

Cause: A20-6014

A65-6007

A65-6008

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
Z5	A20-6014	SINGLE TOW HOOK KIT W PINS	EA	2.0		

Task 3 Subtotals

Parts:

Labor:

Task 3 Subtotals

Task: 4 B104 REPAIR GENERAL REPAIR

Department: Service

Complaint: WASH TRUCK, ALL WHEELS AND FRAME ARE FULL OF MUD

Correction: 5/7/2024 9:13:46 AM 6706 - WASH TRUCK

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price

Task 4 Subtotals

Parts:

Labor:

Task 4 Subtotals

Task: 5 7300000 DRIVELINE REPAIR

Department: Service

Complaint: REPLACE HANGER BEARING-FOUND LOOSE ON STUB SHAFT

REPLACE MIDSHIP STUB AND U JOINT

ALL PARTS ON PTO SHAFT OBSOLETE BUILD AS 1310 SHAFT

** See Last Page for Invoice Total **



5351 94 Ave SE
Calgary, AB T2C 4E5

Ph: 403.720.2910

www.artictruckparts.com

Invoice: 104W2791
Date / Hour: 2/6/2025 10:47:23AM
Repair Order: 2791
Customer:
Branch: 104
Total Invoice: \$
Charge - CAD

Page 6

Bill To:

Ship To:

Office Phone:

Shop Phone:

Email:

Work:

Fax: 2024

Customer P/O: K002556

Open Date: 05/01/2024

Completion Date: 06/07/2024

Add User: DRichard

Salesperson: Calgary House Sales

Correction: 5/28/2024 11:43:59 AM 98 -INSPECTED A PTO SHAFT; SLIP/SPLINE, WELD YOKE & 2 U-JOINTS (1000SERIES)

- FABRICATED AT THE SAME LENGTH WITH 2" TUBE & 1310 PARTS
- CUT A 2" TUBE TO 29" LENGTH & CLEANED INSIDE TUBE
- INSTALLED TUBE SHAFT & WELD YOKE AT ONE END, PHASED
- INSTALLED U-JOINT ON THE WELD YOKE & INSTALLED SHAFT TO THE BALANCER & STRAIGHTENED
- WELDED TUBE SHAFT & WELD YOKE & COOLED
- GREASED SLIP YOKE & INSTALLED U-JOINT & INSTALLED TO THE SHAFT & BALANCER
- GREASED U-JOINTS & BALANCED (NO WEIGHT)
- PAINTED, DRIED & TAGGED
- INSTALLED END YOKE ON EACH SIDE

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
S6	10094142	C/B 2.362ID SEMI DURA-TUNE	EA	1.0		
2M	200X083-1	2.00X.083 TUBING PER INCH	EA	36.0		
S6	2-28-357	WELD YOKE	EA	1.0		
S6	2-3-128KX	SLIP YOKE 1.375-16SPL 5.375	EA	1.0		
S6	2-40-1031	STUB SHAFT	EA	1.0		
S6	2-4-533	1280/1310 1.250RD YOKE.312KW	EA	2.0		
S6	25-103X	SEL-1000SG U-J ISR 1.500 LUBE	EA	1.0		
S6	5-103X	1000SG U-J ISR 1.500 LUBE	EA	3.0		
S6	5-1310-1X	1310 U-JOINT LUBE	EA	2.0		
S6	5-675X	1710 U-J HR 6.094 LUBE	EA	1.0		
S6	6.3-53-21	MIDSHIP STUB SHAFT 46SPL	EA	1.0		
S6	6.5-70-18X	1710/1760/1810 H/R STRAP KIT	EA	2.0		

Task 5 Subtotals

Parts:

Labor:

Task 5 Subtotals

Customer Tax ID: 818327603T0001

GST/HST Number: 101190221

Detail Tax Info:

Sales Tax

Total:

Total Parts:
Total Labor:
Total Miscellaneous:
Total Shop Supplies:

** See Last Page for Invoice Total **